




CAPABILITIES AND
FIXED PRICES CATALOGUE

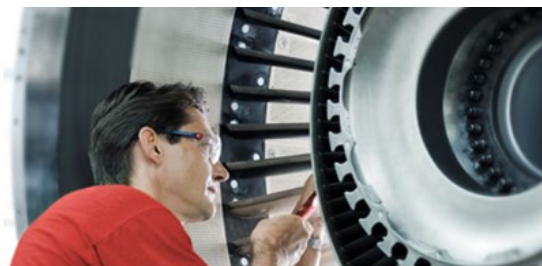

ENGINE PARTS REPAIR SERVICES

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

valid until December 31, 2024

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
1275	51A377-01	EASA,FAA,CAAC,ANAC,CAA UK	32	35	72-53-80	LOW PRESSURE TURBINE (LPT) - FRONT COMPRESSOR DRIVE TURBINE	Package A	CLN/INSP	CLEANING AND INSPECTION		1110.00	SR Technics Switzerland
1275	52A519-01	EASA,FAA,CAAC,ANAC			72-53-80		Package AA	26	NICKEL PLATE REPAIR FOR 7TH STAGE LPT AIRSEAL SHOULDER		3975.00	SR Technics Switzerland
1275					72-53-80		Package AB	27	FLANGE FACE PLASMA SPRAY REPAIR		4200.00	SR Technics Switzerland
1275					72-53-80		Package AC	28	FLANGE SNAP DIAMETER PLASMA SPRAY REPAIR		4200.00	SR Technics Switzerland
1275					72-53-80		Package AF	31	INNER DIAMETER SPACER BORE PLASMA SPRAY REPAIR		4200.00	SR Technics Switzerland
1275					72-53-80		Package AI	34	PLASME COATE 6TH STAGE LPT AIRSEAL FRONT SNAP MATING DIAMETER		4200.00	SR Technics Switzerland
1275					72-53-80		Package AN	41	MARK HIGHPOINT AXIAL RUNOUT		500.00	SR Technics Switzerland
1275					72-53-80		Package E	04	REPAIR NO. 4 BEARING RETAINING PLATE HOLES		885.00	SR Technics Switzerland
1275					72-53-80		Package R	17	SHAFT BALANCE (BY WAX APPLICATION) REPAIR		1300.00	SR Technics Switzerland
1275					72-53-80		Package S	18	SURFACE DAMAGE BLEND REPAIR		1335.00	SR Technics Switzerland
1275					72-53-80		Package S	32	SHOTPEEN AFTER BLEND REPAIR		1335.00	SR Technics Switzerland
1275					72-53-80		Package U	20	REAR COUPLING PILOT DIAMETER PLASMA SPRAY REPAIR		4200.00	SR Technics Switzerland
1275					72-53-80		Package V	21	FRONT COUPLING PILOT DIAMETER PLASMA SPRAY REPAIR		4200.00	SR Technics Switzerland
1275					72-53-80		Package W	22	NICKEL PLATE REPAIR NO. 4 BEARING RETAINING PLATE MATING DIAMETER		3975.00	SR Technics Switzerland
1275					72-53-80		Package X	23	MACHINE REPAIR FRONT SPACER SURFACE		875.00	SR Technics Switzerland
1313	50P460-01	EASA,FAA,CAAC,ANAC	44	35	72-54-01	TURBINE EXHAUST CASE - TURBINE EXHAUST CASE ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		3425.00	SR Technics Switzerland
1313	50P468-01	EASA,FAA,CAAC,ANAC			72-54-01		Package AA	60	STRUT SURFACE DAMAGE AND CRACK WELD REPAIR		1880.00	SR Technics Switzerland
1313	50P468-02	EASA,FAA,CAAC,ANAC			72-54-01		Package AC	28	STRUT DENT AND CRACK REPAIR		7090.00	SR Technics Switzerland
1313					72-54-01		Package AD	ESEE.000961-ED1	CRACK WELDING IN EGT PROBE BOSS OEM WELD JOINT		2280.00	SR Technics Switzerland
1313					72-54-01		Package AE	47	NICKEL PLATE REPAIR THE FIT BETWEEN CARBON SEAL HOUSING AND 1 REWORK OF CARBON SEAL HOUSING NOT INC		11105.00	SR Technics Switzerland
1313					72-54-01		Package AF	52	FRONT OUTER FLANGE INNER LUG WEAR PLASMA COAT REPAIR		3215.00	SR Technics Switzerland
1313					72-54-01		Package AG	55	FRONT OUTER FLANGE WELD JOINT WELD REPAIR		2795.00	SR Technics Switzerland
1313					72-54-01		Package AH	33	PLASMA SPRAY REPAIR THE FRONT OUTER FLANGE FACE		3490.00	SR Technics Switzerland
1313					72-54-01		Package AI	41	EGT PROBE BUSHING REPAIR		920.00	SR Technics Switzerland
1313					72-54-01		Package AJ	38	NO.4 JOURNAL BUSHING REPAIR		6500.00	SR Technics Switzerland
1313					72-54-01		Package AK	45	WELD REPAIR STRUT TO OUTER CASE FILLET RADIUS CRACKS		2920.00	SR Technics Switzerland
1313					72-54-01		Package AL	49	NO. 4 BEARING HOUSING REAR SURFACE CRACKS WELD REPAIR		1615.00	SR Technics Switzerland
1313					72-54-01		Package AM	51	STRUT OUTER STAND-UP TRAILING EDGE CRACK WELD REPAIR		4820.00	SR Technics Switzerland
1313					72-54-01		Package AN	43	STRUT TRAILING EDGE CRACK WELD REPAIR		6020.00	SR Technics Switzerland
1313					72-54-01		Package B	INSP	PREREQUISIT FOR REPAIR ACC.MPG CRACKED		750.00	SR Technics Switzerland
1313					72-54-01		Package C	02	HELICAL COIL INSERT REPAIR THERMOCOUPLE THREADED BOSS HOLES		3350.00	SR Technics Switzerland
1313					72-54-01		Package E	04	HELICAL COIL INSERT REPAIR NO. 3 BEARING OIL VENT TUBE BOSS HOLE		2535.00	SR Technics Switzerland
1313					72-54-01		Package F	05	HELICAL COIL INSERT NO. 4 BEARING COVER. RETAINING HOLES		3620.00	SR Technics Switzerland
1313					72-54-01		Package G	06	REPLACE GROUND HANDLING BUSHINGS		5645.00	SR Technics Switzerland
1313					72-54-01		Package H	07	REPLACE MOUNT BUSHINGS		5645.00	SR Technics Switzerland
1313					72-54-01		Package I	08	REPLACE REAR FLANGE NUT PLATES		3620.00	SR Technics Switzerland
1313					72-54-01		Package M	12	REPLACE NO. 4 BEARING CARBON SEAL HOUSING		9930.00	SR Technics Switzerland
1313					72-54-01		Package N	13	PLASMA SPRAY REPAIR THE REAR OUTER FLANGE SNAP DIAMETER		5075.00	SR Technics Switzerland
1313					72-54-01		Package O	14	NICKEL PLATE REPAIR THE OUTER FRONT FLANGE SNAP DIAMETER		5615.00	SR Technics Switzerland
1313					72-54-01		Package P	15	OUTER FRONT FLANGE BOLTHOLE RADIAL EXTENSION		1325.00	SR Technics Switzerland
1313					72-54-01		Package R	17	WELD REPAIR INNER CASE AND SUPPORT STRUCTURE CRACKS		4815.00	SR Technics Switzerland
1313					72-54-01		Package U	20	CHROMIUM PLATE NO. 4 BEARING SHOULDER		4240.00	SR Technics Switzerland
1313					72-54-01		Package V	21	CHROMIUM PLATE NO. 4 BEARING JOURNAL		6025.00	SR Technics Switzerland
1313					72-54-01		Package X	23	SURFACE DAMAGE BLEND REPAIR		4050.00	SR Technics Switzerland
1313					72-54-01		Package Z	25	DRILL PURGE AND DRAIN HOLES IN EXHAUST CASE OUTER WALL AT STRUT LOCATION		2090.00	SR Technics Switzerland
1456	50L664	EASA,FAA,CAAC,ANAC	18	28	72-52-17	STAGE 1 HPT AIR SEALING RING	Package A	CLN/INSP	CLEANING AND INSPECTION		630.00	SR Technics Switzerland
1456					72-52-17		Package SB01	FAA-2011-25-09	AD FAA-2011-25-09		480.00	SR Technics Switzerland
1456					72-52-17		Package SB02	FAA-2012-18-03	AD FAA-2012-18-03		480.00	SR Technics Switzerland
1711	70R650	EASA,FAA,CAAC,ANAC	10	28	72-61-25	PW4 COUPLING, GEARBOX (STARTER DRIVE)	Package A	CLN/INSP	CLEANING AND INSPECTION		935.00	SR Technics Switzerland
1715	583887	EASA,FAA,CAAC,ANAC	27	28	72-34-34	INTERMEDIATE CASE - NO. 3 TOWER SHAFT BEARING RETAINING NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
1715					72-34-34		Package B	01	SURFACE DAMAGE BLEND REPAIR		1440.00	SR Technics Switzerland
1715					72-34-34		Package C	02	SILVER PLATE REPAIR		1305.00	SR Technics Switzerland
1753	50K035	EASA,FAA,CAAC,ANAC	26	28	72-51-09	TURBINE NOZZLE - COMBUSTION CHAMBER GUIDE ASSEMBLY (LOWER	Package A	CLN/INSP	CLEANING AND INSPECTION		410.00	SR Technics Switzerland
1753	50K192-01	EASA,FAA,CAAC,ANAC			72-51-09		Package B	01	HARDFACE COAT REPAIR		1975.00	SR Technics Switzerland
1753	50K364-01	EASA,FAA,CAAC,ANAC			72-51-09		Package E	04	REPLACE COMBUSTION CHAMBER GUIDE (END TAB) SEAL		1370.00	SR Technics Switzerland
1753					72-51-09		Package F	05	AXIAL AND RADIAL CRACK WELD REPAIR		2740.00	SR Technics Switzerland
1753					72-51-09		Package G	06	COMBUSTION CHAMBER GUIDE TAB WELD REPAIR		2955.00	SR Technics Switzerland
1753					72-51-09		Package H	07	GUIDE SEAL REPLACEMENT REPAIR		3035.00	SR Technics Switzerland
1880	50N587	EASA,FAA,CAAC,ANAC,CAA UK	28	28	72-53-61	LOW PRESSURE TURBINE (LPT) - STAGE 7 LPT DISK - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		1210.00	SR Technics Switzerland
1880					72-53-61		Package B	01	SURFACE DAMAGE BLEND REPAIR		865.00	SR Technics Switzerland
1880					72-53-61		Package C	02	MATING FACE PLASMA SPRAY REPAIR		4185.00	SR Technics Switzerland
1880					72-53-61		Package D	03	MATING DIAMETER PLASMA SPRAY REPAIR		3950.00	SR Technics Switzerland
1880					72-53-61		Package E	04	SHOTPEEN REPAIR		650.00	SR Technics Switzerland
1880					72-53-61		Package SB00	AD 2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	715.00	SR Technics Switzerland
2120	70R147	EASA,FAA,CAAC,ANAC	25	28	72-61-68	MAIN GEARBOX - GEARBOX LUG	Package A	CLN/INSP	CLEANING AND INSPECTION		390.00	SR Technics Switzerland
2120	70R591	EASA,FAA,CAAC,ANAC			72-61-68		Package B	01	CHROMIUM PLATE LUG		1125.00	SR Technics Switzerland
2120	70R986	EASA,FAA,CAAC,ANAC			72-61-68		Package C	02	NICKEL-CADMIUM PLATE REPAIR		1220.00	SR Technics Switzerland
2120	71R018	EASA,FAA,CAAC,ANAC			72-61-68		Package D	01	NICKEL / CHROMIUM PLATE LUG		1400.00	SR Technics Switzerland
2120	71R136	EASA,FAA,CAAC,ANAC			72-61-68		Package SB00	PW4ENG 72-538	MGB-INCORPORATE OF LUG WITH THREADED HOLE		325.00	SR Technics Switzerland
2382	50A077	EASA,FAA,CAAC,ANAC,CAA UK	47	35	72-53-80	LOW PRESSURE TURBINE (LPT) - FRONT COMPRESSOR DRIVE TURBINE	Package A	CLN/INSP	CLEANING AND INSPECTION		1450.00	SR Technics Switzerland
2382					72-53-80		Package A	INSP-04	CLEANING AND INSPECTION		1450.00	SR Technics Switzerland
2382					72-53-80		Package AD	29	CORROSION SURFACE DAMAGE REPAIR (STEEL SHAFT)		1095.00	SR Technics Switzerland
2382					72-53-80		Package AD	29	CORROSION SURFACE DAMAGE REPAIR (FLANGE)		1095.00	SR Technics Switzerland
2382					72-53-80		Package AF	31	INNER DIAMETER SPACER BORE PLASMA SPRAY REPAIR		4075.00	SR Technics Switzerland
2382					72-53-80		Package AH	33	REAR COUPLING PILOT DIAMETER PLASMA COAT REPAIR		3750.00	SR Technics Switzerland
2382					72-53-80		Package AI	36	PLASMA COAT REPAIR THE 6TH STAGE AIRSEAL LAND SNAP DIAMETER		3855.00	SR Technics Switzerland
2382					72-53-80		Package AJ	55	COOLING HOLES MACHINING		6405.00	SR Technics Switzerland
2382					72-53-80		Package AK	58	SPACER OUTER DIAMETER MACHINING		5985.00	SR Technics Switzerland
2382					72-53-80		Package AL	37	FRONT COUPLING PILOT DIAMETER PLASMA COAT REPAIR		3750.00	SR Technics Switzerland
2382					72-53-80		Package AN	41	MARK HIGHPOINT AXIAL RUNOUT		480.00	SR Technics Switzerland
2382					72-53-80		Package C	02	SURFACE DAMAGE BLEND REPAIR		1300.00	SR Technics Switzerland
2382					72-53-80		Package D	03	RESTORE CORROSION PROTECTIVE COATING (STEEL SHAFT)		3250.00	SR Technics Switzerland
2382					72-53-80		Package E	04	REPAIR NO. 4 BEARING RETAINING PLATE HOLES		855.00	SR Technics Switzerland
2382					72-53-80		Package F	05	NICKEL PLATE REPAIR NO. 4 BEARING RETAINING PLATE SEAL LAND		3855.00	SR Technics Switzerland
2382					72-53-80		Package G	06	NICKEL PLATE REPAIR REAR COUPLING PILOT DIAMETER		3855.00	SR Technics Switzerland
2382					72-53-80		Package H	07	NICKEL PLATE REPAIR FRONT COUPLING PILOT DIAMETER		3855.00	SR Technics Switzerland
2382					72-53-80		Package I	08	NICKEL PLATE REPAIR NO. 4 BEARING RETAINING PLATE MATING DIAMETER		3855.00	SR Technics Switzerland
2382					72-53-80		Package J	09	FRONT SPACER SURFACE MACHINE REPAIR		845.00	SR Technics Switzerland
2382					72-53-80		Package K	10	CHROME PLATE REPAIR FOR NO. 4 BEARING JOURNAL		4575.00	SR Technics Switzerland
2382					72-53-80		Package L	11	TIEBOLD HOLES BUSHING REPAIR		8545.00	SR Technics Switzerland
2382					72-53-80		Package M	12	CHROME PLATE REPAIR FOR 6TH STAGE LPT AIRSEAL SHOULDER		4575.00	SR Technics Switzerland
2382					72-53-80		Package N	13	FLANGE FACE PLASMA SPRAY REPAIR		4075.00	SR Technics Switzerland
2382					72-53-80		Package O	14	FLANGE SNAP DIAMETER PLASMA SPRAY REPAIR		4075.00	SR Technics Switzerland
2382					72-53-80		Package P	15	LOCAL TOUCH- UP REPAIR PROTECTIVE COATING (STEEL SHAFT)		2330.00	SR Technics Switzerland
2382					72-53-80		Package Q	16	SHAFT BALANCE (BY WAX APPLICATION) REPAIR		1505.00	SR Technics Switzerland
2382					72-53-80		Package SB00	A72-328	EDDY CURRENT INSPECTION		280.00	SR Technics Switzerland
2553	50P027	EASA,FAA,CAAC,ANAC	52	35	72-54-01	TURBINE EXHAUST CASE - TURBINE EXHAUST CASE ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		3255.00	SR Technics Switzerland
2553	50P174-01	EASA,FAA,CAAC,ANAC			72-54-01		Package AA	26	WELD REPAIR THE NO. 4 BEARING HEAT SHIELD BRACKET CRACKS		5005.00	SR Technics Switzerland
2553	50P200-01	EASA,FAA,CAAC,ANAC			72-54-01		Package AB	27	WELD REPAIR RIVET HOLE DAMAGE NO. 4 BEARING HEATSHIELD		990.00	SR Technics Switzerland
2553	50P416-001	EASA,FAA,CAAC,ANAC			72-54-01		Package AC	57	CRACKS IN STRUT TO CASE ORIGINAL EQUIPMENT MANUFACTURER WELD BEAD WELD REPAIR		3425.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
2553	50P417-001	EASA,FAA,CAAC,ANAC			72-54-01		Package AD	45	WELD REPAIR STRUT TO OUTER CASE FILLET RADIUS CRACKS		7090.00	SR Technics Switzerland
2553	50P418-001	EASA,FAA,CAAC,ANAC			72-54-01		Package AE	30	PLASMA SPRAY REPAIR THE FRONT OUTER FLANGE FACE		5005.00	SR Technics Switzerland
2553	50P418-01	EASA,FAA,CAAC,ANAC			72-54-01		Package AF	38	NO.4 JOURNAL BUSHING REPAIR		6500.00	SR Technics Switzerland
2553					72-54-01		Package AG	36	CLEVIS BOSS (PIN HOLE) BUSHING (STANDARD) REPLACEMENT REPAIR		2850.00	SR Technics Switzerland
2553					72-54-01		Package AH	37	EGT PROBE BUSHING REPAIR		2270.00	SR Technics Switzerland
2553					72-54-01		Package AI	39	STRUT INNER STAND-UP TRAILING EDGE CRACK REPAIR		5005.00	SR Technics Switzerland
2553					72-54-01		Package AJ	42	RIVERT HOLE WELD REPAIR ON NO. 4 BEARING HOUSING HEAT SHIELD MOUNTING FALNGE		4190.00	SR Technics Switzerland
2553					72-54-01		Package AK	43	STRUT INNER STAND-UP TRAILING EDGE CRACK REPAIR		6265.00	SR Technics Switzerland
2553					72-54-01		Package AL	49	NO. 4 BEARING HOUSING REAR SURFACE CRACKS WELD REPAIR		1690.00	SR Technics Switzerland
2553					72-54-01		Package AM	50	NO. 4 BEARING HEAT SHIELD BRACKET WORN AND/OR ELONGATED RIVET HOLES WELD REPAIR		2520.00	SR Technics Switzerland
2553					72-54-01		Package AN	51	STRUT OUTER STAND-UP TRAILING EDGE CRACK WELD REPAIR		5005.00	SR Technics Switzerland
2553					72-54-01		Package AP	61	TOP LIGHTENING SLOT CRACK FLANGE R AND S		3095.00	SR Technics Switzerland
2553					72-54-01		Package B	01	STRUT DENT AND CRACK REPAIR		5005.00	SR Technics Switzerland
2553					72-54-01		Package C	02	HELICAL COIL INSERT REPAIR THERMOCOUPLE THREADED BOSS HOLES		3485.00	SR Technics Switzerland
2553					72-54-01		Package D	03	HELICAL COIL INSERT REPAIR INTERNAL NO. 4 BEARING OIL TUBE BOSS THREADED HOLES		3240.00	SR Technics Switzerland
2553					72-54-01		Package E	04	HELICAL COIL INSERT REPAIR NO. 3 BEARING OIL VENT TUBE BOSS HOLE		2640.00	SR Technics Switzerland
2553					72-54-01		Package F	05	REPLACE THE HELICAL COIL INSERTS ON THE NO. 4 BEARING COVER RETAINING HOLES		3765.00	SR Technics Switzerland
2553					72-54-01		Package G	06	REPLACE GROUND HANDLING BUSHINGS		5865.00	SR Technics Switzerland
2553					72-54-01		Package H	07	REPLACE MOUNT BUSHINGS		5865.00	SR Technics Switzerland
2553					72-54-01		Package I	08	REPLACE REAR FLANGE NUT PLATES		3775.00	SR Technics Switzerland
2553					72-54-01		Package J	09	REPLACE TURBINE EXHAUST CASE BOSS (NO. 4 BEARING OIL PRESSURE AND/OR SCAVENGE TUBE)		915.00	SR Technics Switzerland
2553					72-54-01		Package K	10	REPLACE OIL PRESSURE AND/OR OIL SCAVENGE TUBE BOSS BUSHING		685.00	SR Technics Switzerland
2553					72-54-01		Package L	57	CRACKS IN STRUT TO CASE ORIGINAL EQUIPMENT MANUFACTURER WE IN ASSEMBLED CONDITION		11160.00	SR Technics Switzerland
2553					72-54-01		Package M	12	REPLACE NO. 4 BEARING CARBON SEAL HOUSING		10090.00	SR Technics Switzerland
2553					72-54-01		Package N	13	PLASMA SPRAY REPAIR THE REAR OUTER FLANGE SNAP DIAMETER		5560.00	SR Technics Switzerland
2553					72-54-01		Package O	14	NICKEL PLATE REPAIR THE OUTER FRONT FLANGE SNAP DIAMETER		5560.00	SR Technics Switzerland
2553					72-54-01		Package P	15	OUTER FRONT FLANGE BOLTHOLE RADIAL EXTENTION		1520.00	SR Technics Switzerland
2553					72-54-01		Package Q	16	PLASMA SPRAY REPAIR REAR INTERMEDIATE FLANGE SNAP DIAMETER		5265.00	SR Technics Switzerland
2553					72-54-01		Package R	17	WELD REPAIR INNER CASE AND SUPPORT STRUCTURE CRACKS		5005.00	SR Technics Switzerland
2553					72-54-01		Package S	18	PATCH REPAIR INNER CASE AND SUPPORT STRUCTURE		5865.00	SR Technics Switzerland
2553					72-54-01		Package SB00	PW4MENG 79-76	REROUTING OF THE BEARING NO. 4 OIL TUBES		6840.00	SR Technics Switzerland
2553					72-54-01		Package SB01	24	REPLACE STRUTS		1950.00	SR Technics Switzerland
2553					72-54-01		Package SB02	11	REPLACE NO. 4 BEARING SHIELD AND HEAT SHIELD ASSEMBLY		1690.00	SR Technics Switzerland
2553					72-54-01		Package SB03	47	WELD REPAIR STRUT TO OUTER CASE FILLET RADIUS CRACKS	REWORK OF CARBON SEAL HOUSING NOT INC	10960.00	SR Technics Switzerland
2553					72-54-01		Package T	19	WELD REPAIR, LIGHTENING SLOT CRACKS (FLANGES R AND S)		7360.00	SR Technics Switzerland
2553					72-54-01		Package U	20	CHROMIUM PLATE NO. 4 BEARING SHOULDER		4880.00	SR Technics Switzerland
2553					72-54-01		Package V	21	BEARING SHOULDER CHROMIUM PLATE REPAIR		6260.00	SR Technics Switzerland
2553					72-54-01		Package W	58	OUTER CASE WALL INNER CENTER BODY, STRUT BODY STRUT INNER AND OUTER STAND-UPS WELD REPAIR		1895.00	SR Technics Switzerland
2553					72-54-01		Package X	23	SURFACE DAMAGE BLEND REPAIR		4200.00	SR Technics Switzerland
2553					72-54-01		Package Y	53	STRUT OUTER STAND-UP TRAILING EDGE CRACK WELD REPAIR		4200.00	SR Technics Switzerland
2553					72-54-01		Package Z	25	DRILL PURGE AND DRAIN HOLES IN EXHAUST CASE OUTER WALL AT STRUT LOCATIONS		2205.00	SR Technics Switzerland
2730	221-0262-501	EASA,FAA,CAAC,ANAC	22	21	71-20-05	AFT ENGINE MOUNT - LINK ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1030.00	SR Technics Switzerland
2730	221-0262-503	EASA,FAA,CAAC,ANAC			71-20-05		Package C	02	BEARING REPLACEMENT	ITEM 320	1610.00	SR Technics Switzerland
2730					71-20-05		Package D	02	BEARING REPLACEMENT	ITEM 330	1610.00	SR Technics Switzerland
2730					71-20-05		Package E	03	BLEND REPAIR FOR MINOR DAMAGES		1225.00	SR Technics Switzerland
2730					71-20-05		Package SB01	APW4MD11 A71-86	AFT ENGINE MOUNT LINK - INSP/REPL	AD 94-13-07	925.00	SR Technics Switzerland
2730					71-20-05		Package SB01	APW4NAC 71-138	AFT ENGINE MOUNT LINK - INSP/REPL		925.00	SR Technics Switzerland
2869	801000-1	EASA,FAA,CAAC,ANAC,CAA UK	28	21	73-21-64	FUEL METRING UNIT - JFC131-2	Package B	TEST	BENCH TEST	READJUSTMENT AND TESTING	2510.00	SR Technics Switzerland
2869	801000-2	EASA,FAA,CAAC,ANAC,CAA UK			73-21-64		Package C	TEST	PRE TEST AND TROUBLE SHOOTING	IN CONJUNCTION WITH PACKAGE MEDIUM	1265.00	SR Technics Switzerland
2869	801000-3	EASA,FAA,CAAC,ANAC,CAA UK			73-21-64		Package E	MEDIUM	DISASSEMBLY,CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXC EXAMPLE: GEAR SEGMENT OR RESOLVER REPI		6230.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
2869	801000-4	EASA,FAA,CAAC,ANAC,CAA UK			73-21-64		Package G		OVERHAUL	DISASSEMBLY,CLEANING, INSPECTION, ASSEM	8985.00	SR Technics Switzerland
2869					73-21-64		Package H	1-1	REPLACE STUDS	ASSEMBLED	2510.00	SR Technics Switzerland
2869					73-21-64		Package SB00	JFC131-2-73-8	INCORPORATION OF IMPROVED PRESSURE SWITCH	IN CONJUNCTION WITH PACKAGE MEDIUM O	1725.00	SR Technics Switzerland
2869					73-21-64		Package SB02	JFC131-2-73-16	REPLACE PREFORMED PACKINGS BLACK TO BROWN	IN CONJUNCTION WITH PACKAGE MEDIUM O	1725.00	SR Technics Switzerland
2869					73-21-64		Package SB03	JFC131-2-73-17	REPLACEMENT OF ALL INCORRECT MATERIAL PACKINGS	IN CONJUNCTION WITH PACKAGE MEDIUM O	1725.00	SR Technics Switzerland
2869					73-21-64		Package SB04	JFC131-2-73-18	ADD EPOXY TO RESOLVER COVER SCREWS	IN CONJUNCTION WITH PACKAGE MEDIUM O	1725.00	SR Technics Switzerland
2869					73-21-64		Package SB05	JFC131-2-73-20	REPLACEMENT OF THE SEGMENT GEAR	IN CONJUNCTION WITH PACKAGE MEDIUM O	1725.00	SR Technics Switzerland
2869					73-21-64		Package SB06	JFC131-2-73-21	RESOLVER PROCUREMENT OF RESOLVER WITH ADHESIVE PREAPPLIED 1	IN CONJUNCTION WITH PACKAGE MEDIUM O	1725.00	SR Technics Switzerland
2869					73-21-64		Package SB07	JFC131-2-73-22	TORQUE MOTOR NOZZLE INSPECTION	IN CONJUNCTION WITH PACKAGE MEDIUM O	180.00	SR Technics Switzerland
2869					73-21-64		Package SB08	JFC131-2-73-5	INCORPORATION OF NEW METERING VALVE, SLEEVE AND PISTON	IN CONJUNCTION WITH PACKAGE MEDIUM O	150.00	SR Technics Switzerland
2869					73-21-64		Package SB09	JFC131-2-73-11	REPLACEMENT OF THE SPUR GEAR AND SEGMENT GEAR	IN CONJUNCTION WITH PACKAGE MEDIUM O	280.00	SR Technics Switzerland
2869					73-21-64		Package SB10	JFC131-2-73-A24	ADD SPRING TO METERING VALVE(MV) AND MODIFY CONTROL ORIFICE	IN CONJUNCTION WITH PACKAGE MEDIUM O	600.00	SR Technics Switzerland
2869					73-21-64		Package SB11	JFC131-2-73-10	ADDS A WASHERLESS GUIDE SHAFT FOR THE PRESSURE REGULATING V.	IN CONJUNCTION WITH PACKAGE MEDIUM O	600.00	SR Technics Switzerland
2869					73-21-64		Package SB12	JFC131-2-73-2	REPLACEMENT OF THE SEGMENT GEAR	IN CONJUNCTION WITH PACKAGE MEDIUM O	150.00	SR Technics Switzerland
2869					73-21-64		Package SB13	JFC131-2-73-3	ELIMINATION OF ADJUSTMENT SCREW SHIMS AND PIN		150.00	SR Technics Switzerland
2869					73-21-64		Package SB14	JFC131-2-73-4	ADDITIONAL CABLE STRAPS AND ADDED INSULATION SLEEVING FOR ELECTRICAL WIRING		150.00	SR Technics Switzerland
2869					73-21-64		Package SB15	JFC131-2-73-12	INCORPORATE NEW START-RUN SOLENOID	IN CONJUNCTION WITH PACKAGE MEDIUM O	150.00	SR Technics Switzerland
2869					73-21-64		Package SB18	JFC131-2-12/H	NEW START/RUN SOLENOID	IN CONJUNCTION WITH PACKAGE MEDIUM O	150.00	SR Technics Switzerland
2869					73-21-64		Package SB19	SIR JFC131-2-00	FMU - ORIFICE SELECTION INFORMATION	IN CONJUNCTION WITH PACKAGE MEDIUM O	150.00	SR Technics Switzerland
3200	50K120	EASA,FAA,CAAC,ANAC	15	28	72-51-03	TURBINE NOZZLE - STAGE 1 HPT (BLADE) COOLING DUCT ASSEMBLY-94	Package A	CLN/INSP	CLEANING AND INSPECTION		720.00	SR Technics Switzerland
3200	50K136-001	EASA,FAA,CAAC,ANAC			72-51-03		Package B	01	FRONT FLANGE FACE PLASMA SPRAY REPAIR		5780.00	SR Technics Switzerland
3200	50K136-01	EASA,FAA,CAAC,ANAC			72-51-03		Package D	03	PLASMA SPRAY INNER COMBUSTION CHAMBER DIAMETER		5780.00	SR Technics Switzerland
3200	50K137-001	EASA,FAA,CAAC,ANAC			72-51-03		Package E	04	FRONT DIAMETER PLASMA SPRAY REPAIR		5780.00	SR Technics Switzerland
3200	50K137-01	EASA,FAA,CAAC,ANAC			72-51-03		Package F	05	LOCATING PIN REPLACEMENT		820.00	SR Technics Switzerland
3200	50K178-001	EASA,FAA,CAAC,ANAC			72-51-03		Package G	06	WELD REPAIR THE PS4 TUBE HOLE		4775.00	SR Technics Switzerland
3200	50K178-01	EASA,FAA,CAAC,ANAC			72-51-03		Package H	07	OUTER FLANGE BOLTHOLE CRACKS WELD REPAIR		4820.00	SR Technics Switzerland
3200	50K362-001	EASA,FAA,CAAC,ANAC			72-51-03		Package I	08	OUTER FLANGE FRONT FACE WELD REPAIR		4775.00	SR Technics Switzerland
3200	50K362-002	EASA,FAA,CAAC,ANAC			72-51-03		Package J	09	FUNCTIONAL AIRFLOW (CHECK) REPAIR		1465.00	SR Technics Switzerland
3200	50K362-004	EASA,FAA,CAAC,ANAC			72-51-03		Package N	13	REPLACE THE CLINCH NUTS		680.00	SR Technics Switzerland
3200	50K363-001	EASA,FAA,CAAC,ANAC			72-51-03		Package O	14	PLASMA COAT REPAIR THE BRUSH SEAL SUPPORT DIAMETER		2225.00	SR Technics Switzerland
3200	50K363-01	EASA,FAA,CAAC,ANAC			72-51-03		Package P	15	INNER FLANGE BOLT HOLE CRACKS WELD REPAIR		4045.00	SR Technics Switzerland
3200	50K372-01	EASA,FAA,CAAC,ANAC			72-51-03		Package R	17	OUTER FLANGE FRONT FACE PLASMA SPRAY REPAIR		4775.00	SR Technics Switzerland
3200	50K542-001	EASA,FAA,CAAC,ANAC			72-51-03		Package SB00	PW4ENG 72-466	REPLACEMENT OF WITH BLADES THAT HAVE CERAMIC THERMAL BARRI FLOW TEST ONLY		1575.00	SR Technics Switzerland
3200	50K542-01	EASA,FAA,CAAC,ANAC			72-51-03		Package SB01	PW4ENG 72-514	MODIFICATION OF TO IMPROVE COMPRESSOR SURGE MARGIN AND WEAR RESISTANCE		2165.00	SR Technics Switzerland
3200					72-51-03		Package SB02	PW4ENG 72-662	INCRP. OF ADDITIONAL PLATFORM AND AIRFOIL COOLING WHICH REQUIRES A NEW FIRST STAGE HPT COOLING DUC		4910.00	SR Technics Switzerland
3200					72-51-03		Package SB03	PW4ENG 72-730	INSPECTION AND MODIFICATION OF THE VANE CAVITIES		3420.00	SR Technics Switzerland
3200					72-51-03		Package SB04	PW4ENG 72-795	INTRODUCTION OF THE ADVANTAGE PERFORMANCE UPGRADE CONFIGURATION TO IMPROVE HPT PERFORMANCE		1830.00	SR Technics Switzerland
3200					72-51-03		Package SB05	PW4ENG 72-572	CONVERS.OF PW4152-58 TO-3		270.00	SR Technics Switzerland
3200					72-51-03		Package Y	24	OUTER FLANGE REAR FACE PLASMA COAT REPAIR		6025.00	SR Technics Switzerland
3200					72-51-03		Package Z	25	BLEND REPAIR		525.00	SR Technics Switzerland
3463	221-0261-501	EASA,FAA,CAAC,ANAC	21	21	71-20-05	AFT ENGINE MOUNT - BEAM ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1010.00	SR Technics Switzerland
3463	221-0261-503	EASA,FAA,CAAC,ANAC			71-20-05		Package B	01	ORIGINAL BUSHING REPLACEMENT		1860.00	SR Technics Switzerland
3463					71-20-05		Package B	01	BUSHING REPLACEMENT		1860.00	SR Technics Switzerland
3463					71-20-05		Package C	01	INSTALLATION OF OVERSIZE BUSHING		4115.00	SR Technics Switzerland
3463					71-20-05		Package D	01	WORK DISTANCE BUSHING		1015.00	SR Technics Switzerland
3463					71-20-05		Package E	03	BLEND REPAIR		905.00	SR Technics Switzerland
3610	53T732	EASA,FAA,CAAC,ANAC	2	21	73-21-37	S C U PROGRAMMING PLUG	Package A	CLN/INSP	CLEANING & INSPECTION		525.00	SR Technics Switzerland
3610	53T733	EASA,FAA,CAAC,ANAC			73-21-37		Package A	CLN/INSP	BENCH TEST		525.00	SR Technics Switzerland
3610	53T734	EASA,FAA,CAAC,ANAC			73-21-37		Package B	01	MOISTER REMOVAL		45.00	SR Technics Switzerland
3610					73-21-37		Package C	02	CONNECTOR PIN REPAIR		35.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
3610					73-21-37		Package D	03	REPLACEMENT OF DAMAGED OR CORRODED CONTACT ON ELECTRICAL ASSEMBLY		95.00	SR Technics Switzerland
7872	22953-002	EASA,FAA,CAAC,ANAC	4	21	30-21-05	ANTI-ICING THERMOCOUPLE PROBE PW 51U565	Package A	CLN/INSP	CLEANING & INSPECTION		45.00	SR Technics Switzerland
7872					30-21-05		Package B	TESTING	TESTING AND FAULT ISOLATION		245.00	SR Technics Switzerland
7872					30-21-05		Package C	01	STUD THREAD REPAIR		55.00	SR Technics Switzerland
7872					30-21-05		Package D	02	MOISTURE REMOVAL		535.00	SR Technics Switzerland
7934	50L433-01	EASA,FAA,CAAC,ANAC	24	28	72-52-99	HIGH PRESSURE TURBINE (HPT) - HIGH PRESSURE TURBINE (HPT) MISC	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
7934	50L509-01	EASA,FAA,CAAC,ANAC			72-52-99		Package B	01	STRAIGHTEN THE SHAFT - BORESCOPE PLUG		395.00	SR Technics Switzerland
8009	50P258-01	EASA,FAA,CAAC,ANAC	27	28	72-54-86	TURBINE EXHAUST CASE - NO. 4 BEARING (HOUSING) HEAT SHIELD AS	Package A	CLN/INSP	CLEANING AND INSPECTION		210.00	SR Technics Switzerland
8009					72-54-86		Package B	01	PATCH REPAIR ISOLATION		535.00	SR Technics Switzerland
11470	51H778	EASA,FAA,CAAC,ANAC	58	35	72-35-01	HIGH PRESSURE COMPRESSOR (HPC) - DRUM ROTOR STG 5 - 15	Package A	CLN/INSP	CLEANING AND INSPECTION		1605.00	SR Technics Switzerland
11470	51H878	EASA,FAA,CAAC,ANAC			72-35-01		Package AB	27	BLEND REPAIR SPLINE SURFACE DAMAGE		795.00	SR Technics Switzerland
11470	52H578	EASA,FAA,CAAC,ANAC			72-35-01		Package AF	15	72-35-06 / KNIFE EDGE THICK COATING		2825.00	SR Technics Switzerland
11470	53H973-001	EASA,FAA,CAAC,ANAC			72-35-01		Package AH	33	72-35-08 / CHROMIUM PLATE THE PILOT DIAMETER FRONT JOURNAL		4900.00	SR Technics Switzerland
11470	53H973-01	EASA,FAA,CAAC,ANAC			72-35-01		Package AI	34	72-35-08 / REAR HUB TURBINE PILOT DIAMETER REAR JOURNAL CHROMIUM PLATE REPAIR - HPC DRUM ROTOR (REAR)		4900.00	SR Technics Switzerland
11470	54H668	EASA,FAA,CAAC,ANAC			72-35-01		Package AJ	17	72-35-06 / KNIFE-EDGE SEAL THIN PLASMA COAT REPAIR		3495.00	SR Technics Switzerland
11470	57H678-001	EASA,FAA,CAAC,ANAC			72-35-01		Package AN	05	72-35-08 REAR DRUM BLEND SURFACE		1230.00	SR Technics Switzerland
11470	57H678-004	EASA,FAA,CAAC,ANAC			72-35-01		Package B	1	72-35-06 / STRAIGHTEN STAGE 5 HPC DISK KNIFE-EDGE SEAL - STAGE 5 HPC DISK		745.00	SR Technics Switzerland
11470					72-35-01		Package D	03	72-35-07 / SHOTPEEN BLADE SLOTS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		3310.00	SR Technics Switzerland
11470					72-35-01		Package E	04	72-35-06 / SHOTPEEN BLADE SLOTS - STAGE 5 HPC DISK		1415.00	SR Technics Switzerland
11470					72-35-01		Package F	04	72-35-08 / SHOTPEEN BLADE SLOTS - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		1155.00	SR Technics Switzerland
11470					72-35-01		Package G	05	72-35-06 / RESTORE ANTIGALLING COMPOUND IN DISK BLADE SLOTS		1880.00	SR Technics Switzerland
11470					72-35-01		Package H	07	72-35-07 / BLEND REPAIR TANGENTIAL SLOT RIM RAILS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		990.00	SR Technics Switzerland
11470					72-35-01		Package I	08	72-35-08 / RESTORE KNIFE-EDGE SEAL PLASMA COAT - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		7505.00	SR Technics Switzerland
11470					72-35-01		Package J	09	72-35-05 / PLASMA SPRAY REPAIR - HPC FRONT HUB NO. 2 BEARING JOURNAL		3350.00	SR Technics Switzerland
11470					72-35-01		Package K	10	72-35-07 / RESTORE ANTIGALLING COATING TO AXIAL BLADE SLOTS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		2465.00	SR Technics Switzerland
11470					72-35-01		Package L	11	72-35-07 / SURFACE DAMAGE BLEND REPAIR - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		1920.00	SR Technics Switzerland
11470					72-35-01		Package M	12	72-35-07 / REPLACE 9TH STAGE HPC DRUM ROTOR (FRONT) DISK TUBE ASSEMBLY - HPC DRUM ROTOR (FRONT) DISK		2985.00	SR Technics Switzerland
11470					72-35-01		Package N	11	72-35-05 / BLEND REPAIR ANTI-TORQUE LUGS		990.00	SR Technics Switzerland
11470					72-35-01		Package O	14	72-35-08 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING JOURNAL - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		4705.00	SR Technics Switzerland
11470					72-35-01		Package P	15	72-35-08 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING SEAL SPACER JOURNAL - HPC DRUM ROTOR (REAR) DISK		4705.00	SR Technics Switzerland
11470					72-35-01		Package Q	16	72-35-08 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING FRONT SEAL JOURNAL - HPC DRUM ROTOR (REAR) DISK		4705.00	SR Technics Switzerland
11470					72-35-01		Package R	17	72-35-08 / NICKEL PLATE HPC REAR HUB NO. 3 BEARING SEAL SEAT SHOULDER - HPC DRUM ROTOR (REAR) DISK A		4820.00	SR Technics Switzerland
11470					72-35-01		Package S	18	72-35-07 / REPLACE ANTI-VORTEX TUBES		1645.00	SR Technics Switzerland
11470					72-35-01		Package SB01	PW4ENG 72-745 /	6TH STG DOVETAIL LUG FPI (IN COMBINATION WITH PACKAGE A)		1440.00	SR Technics Switzerland
11470					72-35-01		Package SB02	PW4ENG 72-515	5TH STG - MODIFICATION OF TO REMOVE THE BALANCE FLANGE		2135.00	SR Technics Switzerland
11470					72-35-01		Package SB03	PW4ENG 72-796	FPI OF THE 13TH, 14TH, AND 15TH STAGE BLADE LOADING AND LOCKING SLOTS FOR CRACKS		695.00	SR Technics Switzerland
11470					72-35-01		Package SB04	PW4ENG 72-653	MODIFICATION OF THE FRONT KNIFE EDGE SEAL TO IMPROVE DURABILITY		4655.00	SR Technics Switzerland
11470					72-35-01		Package SB05	PW4ENG 72-816	INTRODUCTION OF NEW SHOOT PEEN SPECIFICATION TO IMPROVE RE ADMINISTRATIVE PROCESS ONLY		400.00	SR Technics Switzerland
11470					72-35-01		Package SB06	PW4ENG 72-799	REPETITIVE INSPECTION OF ANTI-VORTEX TUBE (AVT) SHELF SLOTS FOR CRACKS		595.00	SR Technics Switzerland
11470					72-35-01		Package SB07	PW4ENG A72-722	BORESKOPE INSPECTION OF THE 6TH TO 7TH STAGE SPACER AREA FOR CRACKS		550.00	SR Technics Switzerland
11470					72-35-01		Package SB08	PW4ENG A72-833	EDDY CURRENT AND ULTRASONIC INSPECTION OF THE 10TH STAGE DIS PART B, AD 2016-08-09		3750.00	SR Technics Switzerland
11470					72-35-01		Package SB09	PWSENG 72-845	REIDENTIFY DRUM ROTOR ASSEMBLY		600.00	SR Technics Switzerland
11470					72-35-01		Package T	07	72-35-06 / KNIFE-EDGE SEAL THIN PLASMA COAT REPAIR		3495.00	SR Technics Switzerland
11470					72-35-01		Package U	09	72-35-07 / RESTORE KNIFE-EDGE SEAL PLASMA COAT		4250.00	SR Technics Switzerland
11470					72-35-01		Package V	06	72-35-06 / BLEND REPAIR KNIFE-EDGE SEALS - STAGE 5 HPC DISK		810.00	SR Technics Switzerland
11470					72-35-01		Package W	08	72-35-06 / BLEND REPAIR SURFACE DAMAGE - STAGE 5 HPC DISK		1320.00	SR Technics Switzerland
11470					72-35-01		Package X	08	72-35-07 / BLEND REPAIR KNIFE-EDGE SEALS - STAGE 5 HPC DISK		810.00	SR Technics Switzerland
11470					72-35-01		Package Y	24	72-35-08 / STRAIGHTEN KNIFE-EDGE SEAL THAT HAS NO COATING - HPC DRUM ROTOR (REAR)DISK ASSEMBLY		745.00	SR Technics Switzerland
11471	50S192	EASA,FAA,CAAC,ANAC	51	35	72-35-01	HIGH PRESSURE COMPRESSOR (HPC) - DRUM ROTOR STG 5 - 15	Package A	CLN/INSP	CLEANING AND INSPECTION		3255.00	SR Technics Switzerland
11471	52A520	EASA,FAA,CAAC,ANAC			72-35-01		Package AA	26	72-35-09 / REAR HUB TURBINE PILOT DIAMETER FRONT JOURNAL CHROMIUM PLATE REPAIR		4905.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
11471	55H878	EASA,FAA,CAAC,ANAC			72-35-01		Package AB	27	72-35-09 / REAR HUB TURBINE PILOT DIAMETER REAR JOURNAL CHROMIUM PLATE OR COAT REPAIR		4905.00	SR Technics Switzerland
11471	58H678	EASA,FAA,CAAC,ANAC			72-35-01		Package AC	14	72-35-10 / BLEND REPAIR SURFACE DAMAGE - DRUM ROTOR (REAR) DISK ASSEMBLY		1380.00	SR Technics Switzerland
11471	59H078	EASA,FAA,CAAC,ANAC			72-35-01		Package AD	15	72-35-09 / BLEND REPAIR KNIFE-EDGE SEALS - TURBINE DRIVE SHAFT		810.00	SR Technics Switzerland
11471					72-35-01		Package AE	15	72-35-10 / BLEND REPAIR DAMAGED KNIFE-EDGE SEALS - DRUM ROTOR (REAR) DISK ASSEMBLY		810.00	SR Technics Switzerland
11471					72-35-01		Package AF	17	72-35-09 / BLEND REPAIR SPLINE SURFACE DAMAGE		795.00	SR Technics Switzerland
11471					72-35-01		Package AG	15	72-35-06 / KNIFE EDGE THICK COATING		2825.00	SR Technics Switzerland
11471					72-35-01		Package B	03	72-35-07 / SHOTPEEN BLADE SLOTS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		3310.00	SR Technics Switzerland
11471					72-35-01		Package C	04	72-35-06 / SHOTPEEN BLADE SLOTS - STAGE 5 HPC DISK		1415.00	SR Technics Switzerland
11471					72-35-01		Package D	04	72-35-10 / SHOTPEEN BLADE SLOTS - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		1145.00	SR Technics Switzerland
11471					72-35-01		Package E	05	72-35-06 / RESTORE ANTIGALLING COMPOUND IN DISK BLADE SLOTS		1880.00	SR Technics Switzerland
11471					72-35-01		Package F	05	72-35-09 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING JOURNAL		4705.00	SR Technics Switzerland
11471					72-35-01		Package G	06	72-35-09 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING SEAL SPACER JOURNAL		4705.00	SR Technics Switzerland
11471					72-35-01		Package H	06	72-35-10 / RESTORE KNIFE-EDGE SEAL PLASMA COAT (VENDOR APPLICATION)		7515.00	SR Technics Switzerland
11471					72-35-01		Package I	07	72-35-06 / KNIFE-EDGE SEAL THIN PLASMA COAT REPAIR STAGE 5 HPC DISK		3495.00	SR Technics Switzerland
11471					72-35-01		Package J	08	72-35-06 / BLEND REPAIR SURFACE DAMAGE - STAGE 5 HPC DISK		1320.00	SR Technics Switzerland
11471					72-35-01		Package K	09	72-35-05 / PLASMA SPRAY REPAIR - HPC FRONT HUB NO. 2 BEARING JOURNAL		3350.00	SR Technics Switzerland
11471					72-35-01		Package L	09	72-35-07 / RESTORE KNIFE-EDGE SEAL PLASMA COAT (VENDOR APPLICATION)		4250.00	SR Technics Switzerland
11471					72-35-01		Package M	10	72-35-07 / RESTORE ANTIGALLING COATING TO AXIAL BLADE SLOTS (STAGE 6, 7 AND 8)		2465.00	SR Technics Switzerland
11471					72-35-01		Package N	11	72-35-07 / SURFACE DAMAGE BLEND REPAIR - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		1920.00	SR Technics Switzerland
11471					72-35-01		Package O	11	72-35-05 / BLEND REPAIR ANTI-TORQUE LUGS		990.00	SR Technics Switzerland
11471					72-35-01		Package P	01	72-35-06 / STRAIGHTEN STAGE 5 HPC DISK KNIFE-EDGE SEAL - STAGE 5 HPC DISK		745.00	SR Technics Switzerland
11471					72-35-01		Package Q	05	72-35-10 / BLEND REPAIR TANGENTIAL SLOT RIM RAILS - DRUM ROTOR (REAR) DISK ASSEMBLY		790.00	SR Technics Switzerland
11471					72-35-01		Package R	06	72-35-06 / BLEND REPAIR KNIFE-EDGE SEALS - STAGE 5 HPC DISK		810.00	SR Technics Switzerland
11471					72-35-01		Package S	18	72-35-07 / REPLACE ANTI-VORTEX TUBES - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		1645.00	SR Technics Switzerland
11471					72-35-01		Package SB02	PW4G-100-72-186	72-35-10 / FPI HPC REAR DRUM BLADE LOCKING SLOTS	AD FAA-2012-18-17	520.00	SR Technics Switzerland
11471					72-35-01		Package SB05	PW4G-100-72-240	REPLACEMENT OF, AND INTRODUCTION OF A NEW SHOT PEEN SPECIFICATION		340.00	SR Technics Switzerland
11471					72-35-01		Package SB06	PW4G-100-72-226	REPETITIVE INSPECTION OF ANTI-VORTEX TUBE (AVT) SHELF SLOTS FOR AD FAA-2010-24-14		595.00	SR Technics Switzerland
11471					72-35-01		Package SB07	PW4G-100-72-255	EDDY CURRENT AND ULTRASONIC INSPECTION OF THE 10TH STAGE DIS PART B, AD FAA 2016-08-09		3750.00	SR Technics Switzerland
11471					72-35-01		Package SB08	PW4G-100-72-232	BSI OF ANTI VOTEX TUBE SHELF SLOTS		435.00	SR Technics Switzerland
11471					72-35-01		Package SB10	PW4G-100-72-239	INTRODUCTION OF, TO IMPROVE FRONT COMPRESSOR DURABILITY		1355.00	SR Technics Switzerland
11471					72-35-01		Package SB15	PW4G-100-72-260	HPC, NEW DRUM ROTOR DISK ASSY		425.00	SR Technics Switzerland
11471					72-35-01		Package T	07	72-35-07 / BLEND REPAIR TANGENTIAL SLOT RIM RAILS - DRUM ROTOR (FRONT) DISK ASSEMBLY		990.00	SR Technics Switzerland
11471					72-35-01		Package U	07	72-35-09 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING FRONT SEAL JOURNAL - TURBINE DRIVE SHAFT		4705.00	SR Technics Switzerland
11471					72-35-01		Package V	08	72-35-07 / BLEND REPAIR KNIFE-EDGE SEALS - DRUM ROTOR (FRONT) DISK ASSEMBLY		810.00	SR Technics Switzerland
11471					72-35-01		Package W	12	72-35-10 / PLASMA SPRAY BRUSH SEAL LAND - DRUM ROTOR (REAR) DISK ASSEMBLY		4220.00	SR Technics Switzerland
11471					72-35-01		Package X	13	72-35-10 / BLEND LOCK SCREW DAMAGE IN BLADE SLOTS - DRUM ROTOR (REAR) DISK ASSEMBLY		2650.00	SR Technics Switzerland
11471					72-35-01		Package Z	14	72-35-09 / BLEND REPAIR SURFACE DAMAGE - TURBINE DRIVE SHAFT		1020.00	SR Technics Switzerland
11474	55H778	EASA,FAA,CAAC,ANAC	54	35	72-35-01	HIGH PRESSURE COMPRESSOR (HPC) - DRUM DISK ASSY STG 13	Package A	CLN/INSP	CLEANING AND INSPECTION		1605.00	SR Technics Switzerland
11474	56H378	EASA,FAA,CAAC,ANAC			72-35-01		Package AA	14	72-35-10 / SURFACE DAMAGE BLEND REPAIR - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		1380.00	SR Technics Switzerland
11474	56H378-002	EASA,FAA,CAAC,ANAC			72-35-01		Package AB	15	72-35-09 / BLEND REPAIR KNIFE-EDGE SEALS - HPC TURBINE DRIVE SHAFT		810.00	SR Technics Switzerland
11474	57H478	EASA,FAA,CAAC,ANAC			72-35-01		Package AC	15	72-35-10 / BLEND REPAIR DAMAGED KNIFE EDGE SEALS - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		810.00	SR Technics Switzerland
11474	57H478-002	EASA,FAA,CAAC,ANAC			72-35-01		Package AD	18	72-35-07 / REPLACE ANTI-VORTEX TUBES - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		1645.00	SR Technics Switzerland
11474	58H575	EASA,FAA,CAAC,ANAC			72-35-01		Package AE	26	72-35-09 / REAR HUB TURBINE PILOT DIAMETER REAR JOURNAL CHROMIUM PLATE REPAIR		4900.00	SR Technics Switzerland
11474	58H578	EASA,FAA,CAAC,ANAC			72-35-01		Package AF	27	72-35-09 / REAR HUB TURBINE PILOT DIAMETER REAR JOURNAL CHROMIUM PLATE - SHAFT, HPC DRIVE, TURBINE		4905.00	SR Technics Switzerland
11474					72-35-01		Package AG	11	72-35-05 / BLEND REPAIR ANTI - TORQUE LUGS - HPC FRONT HUB		990.00	SR Technics Switzerland
11474					72-35-01		Package AH	15	72-35-06 / KNIFE EDGE THICK COATING		2825.00	SR Technics Switzerland
11474					72-35-01		Package AI	INSP/CHK-03	FLUORESCENT PENETRANT TEST AND ELECTROSTATIC APPLICATION STG. 13-15		375.00	SR Technics Switzerland
11474					72-35-01		Package AK	17	72-35-09 / BLEND REPAIR SPLINE SURFACE DAMAGE		795.00	SR Technics Switzerland
11474					72-35-01		Package AL	17	72-35-06 / KNIFE-EDGE SEAL THIN PLASMA COAT REPAIR		3495.00	SR Technics Switzerland
11474					72-35-01		Package B	01	72-35-06 / STRAIGHTEN STAGE 5 HPC DISK KNIFE-EDGE SEAL		745.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
11474					72-35-01		Package D	03	72-35-07 / SHOTPEEN BLADE SLOTS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		3310.00	SR Technics Switzerland
11474					72-35-01		Package E	04	72-35-06 / SHOTPEEN BLADE SLOTS - STAGE 5 HPC DISK		1415.00	SR Technics Switzerland
11474					72-35-01		Package F	04	72-35-10 / SHOTPEEN BLADE SLOTS - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		1145.00	SR Technics Switzerland
11474					72-35-01		Package G	05	72-35-06 / RESTORE ANTIGALLING COMPOUND IN DISK BLADE SLOTS		1880.00	SR Technics Switzerland
11474					72-35-01		Package H	05	72-35-09 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING JOURNAL - HPC TURBINE DRIVE SHAFT		4705.00	SR Technics Switzerland
11474					72-35-01		Package I	05	72-35-10 / BLEND REPAIR TANGENTIAL SLOT RIM RAILS - HPC DRUM ROTOR DISK (REAR HUB) ASSEMBLY		790.00	SR Technics Switzerland
11474					72-35-01		Package J	06	72-35-06 / BLEND REPAIR KNIFE-EDGE SEALS - STAGE 5 HPC DISK		810.00	SR Technics Switzerland
11474					72-35-01		Package K	06	72-35-09 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING SEAL SPACER JOURNAL - HPC TURBINE DRIVE SHAFT		4705.00	SR Technics Switzerland
11474					72-35-01		Package L	06	72-35-10 / RESTORE KNIFE-EDGE SEAL PLASMA COAT - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		7515.00	SR Technics Switzerland
11474					72-35-01		Package M	07	72-35-06 / KNIFE-EDGE SEAL THIN PLASMA COAT REPAIR- STAGE 5 HPC DISK		3495.00	SR Technics Switzerland
11474					72-35-01		Package N	07	72-35-07 / BLEND REPAIR TANGENTIAL SLOT RIM RAILS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		990.00	SR Technics Switzerland
11474					72-35-01		Package O	07	72-35-09 / CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING FRONT SEAL JOURNAL - HPC TURBINE DRIVE SHAFT		4705.00	SR Technics Switzerland
11474					72-35-01		Package P	08	72-35-07 / BLEND REPAIR KNIFE-EDGE SEALS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		810.00	SR Technics Switzerland
11474					72-35-01		Package R	08	72-35-06 / BLEND REPAIR SURFACE DAMAGE - STAGE SHPC		1320.00	SR Technics Switzerland
11474					72-35-01		Package S	09	72-35-07 / RESTORE KNIFE-EDGE SEAL PLASMA COAT - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		4250.00	SR Technics Switzerland
11474					72-35-01		Package SB01	PW4ENG 72-745	6TH STG DOVETAIL LUG FPI (IN COMBINATION WITH PACKAGE A)	PART 001	845.00	SR Technics Switzerland
11474					72-35-01		Package SB03	PW4ENG 72-515	5TH STG - MODIFICATION OF TO REMOVE THE BALANCE FLANGE		2350.00	SR Technics Switzerland
11474					72-35-01		Package SB04	PW4ENG 72-796	FPI OF THE 13TH, 14TH, AND 15TH STAGE BLADE LOADING AND LOCKIN AD FAA-2012-18-17		910.00	SR Technics Switzerland
11474					72-35-01		Package SB05	PW4ENG 72-816	INTRODUCTION OF NEW SHOOT PEEN SPECIFICATION TO IMPROVE RE/ ADMINISTRATIVE PROCESS ONLY		75.00	SR Technics Switzerland
11474					72-35-01		Package SB06	PW4ENG 72-799	REPETITIVE INSPECTION OF ANTI-VORTEX TUBE (AVT) SHELF SLOTS FOR AD FAA-2010-24-14		595.00	SR Technics Switzerland
11474					72-35-01		Package SB07	PW4ENG A72-722	BORESKOPE INSPECTION OF THE 6TH TO 7TH STAGE SPACER AREA FOR AD FAA-2002-12-15		550.00	SR Technics Switzerland
11474					72-35-01		Package SB08	PW4ENG A72-833	EDDY CURRENT AND ULTRASONIC INSPECTION OF THE 10TH STAGE DIS PART B, AD FAA-2016-08-09		3750.00	SR Technics Switzerland
11474					72-35-01		Package SB09	PW4ENG 72-845	REIDENTIFY DRUM ROTOR ASSEMBLY		600.00	SR Technics Switzerland
11474					72-35-01		Package T	09	72-35-05 / PLASMA SPRAY REPAIR - HPC FRONT HUB NO. 2 BEARING JOURNAL		3350.00	SR Technics Switzerland
11474					72-35-01		Package U	10	72-35-07 / RESTORE ANTIGALLING COATING TO AXIAL BLADE SLOTS - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		2465.00	SR Technics Switzerland
11474					72-35-01		Package V	11	72-35-07 / SURFACE DAMAGE BLEND REPAIR - HPC DRUM ROTOR (FRONT) DISK ASSEMBLY		1920.00	SR Technics Switzerland
11474					72-35-01		Package W	12	72-35-07 / REPLACE 9TH STAGE HPC DRUM ROTOR (FRONT) DISK TUBE ASSEMBLY - HPC DRUM ROTOR (FRONT) DISK		2985.00	SR Technics Switzerland
11474					72-35-01		Package X	12	72-35-10 / PLASMA SPRAY BRUSH SEAL LAND - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		4220.00	SR Technics Switzerland
11474					72-35-01		Package Y	13	72-35-10 / BLEND LOCK SCREW DAMAGE IN BLADE SLOTS - HPC DRUM ROTOR (REAR) DISK ASSEMBLY		2650.00	SR Technics Switzerland
11474					72-35-01		Package Z	14	72-35-09 / BLEND REPAIR SURFACE DAMAGE - HPC TURBINE DRIVE SHAFT		1020.00	SR Technics Switzerland
14014 505749	EASA,FAA,CAAC,ANAC		21	28	72-35-69	HIGH PRESSURE COMPRESSOR (HPC) - STAGES 5 THROUGH 15 HPC O/U	Package B	ASSEMBLY02	MACHINE STAGE 5 - 15 OUTER AIR SEAL SET		11990.00	SR Technics Switzerland
14014 58H596	EASA,FAA,CAAC,ANAC				72-35-69		Package SB00	PW4ENG 72-755	MODIFICATION OF TO INCORPORATE A RING CASE CONFIGURATION RE BOEING		11990.00	SR Technics Switzerland
14014					72-35-69		Package SB00	PW4ENG 72-756	MODIFICATION OF TO INCORPORATE A RING CASE CONFIGURATION RE AIRBUS		11990.00	SR Technics Switzerland
14014					72-35-69		Package SB00	PW4ENG 72-757	MODIFICATION OF TO INCORPORATE A RING CASE CONFIGURATION RE MD11		11990.00	SR Technics Switzerland
14014					72-35-69		Package SB01	PW4ENG 72-845	INTRO OF NEW HPC FRONT DRUM		11675.00	SR Technics Switzerland
14082 54T661	EASA,FAA,CAAC,ANAC		24	21	71-21-11	FWD ENGINE MOUNT - BEARING - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		310.00	SR Technics Switzerland
14082 55T409	EASA,FAA,CAAC,ANAC				71-21-11		Package B	01	PWA 474 ANTIGALLING COMPOUND REPLACEMENT REPAIR		355.00	SR Technics Switzerland
14160 50N248	EASA,FAA,CAAC,ANAC		34	35	72-53-17	LOW PRESSURE TURBINE (LPT) - LOW PRESSURE TURBINE - REAR TURB	Package A	CLN/INSP	CLEANING AND INSPECTION	INCLUDE AD FAA-2012-14-09	4175.00	SR Technics Switzerland
14160 50N248-001	EASA,FAA,CAAC,ANAC				72-53-17		Package AA	26	REPLACE RIVETED- ON ANGLED BRACKET		595.00	SR Technics Switzerland
14160 50N248-002	EASA,FAA,CAAC,ANAC				72-53-17		Package AB	27	REPLACE FRONT FLANGE BRACKET		1500.00	SR Technics Switzerland
14160 50N248-003	EASA,FAA,CAAC,ANAC				72-53-17		Package AC	28	MACHINE REPAIR VANE ANTI- ROTATION SLOTS TO REMOVE CRACKS		5790.00	SR Technics Switzerland
14160 50N248-004	EASA,FAA,CAAC,ANAC				72-53-17		Package AD	29	STAGE 3 VANE REAR SUPPORT LIP MATING SURFACE PLASMA COAT REPAIR		18645.00	SR Technics Switzerland
14160 50N248-005	EASA,FAA,CAAC,ANAC				72-53-17		Package AD	30	STAGE 4 VANE REAR SUPPORT LIP MATING SURFACE PLASMA COAT REPAIR		18645.00	SR Technics Switzerland
14160 50N248-006	EASA,FAA,CAAC,ANAC				72-53-17		Package AD	31	STAGE 5 VANE REAR SUPPORT LIP MATING SURFACE PLASMA COAT REPAIR		18645.00	SR Technics Switzerland
14160 50N248-007	EASA,FAA,CAAC,ANAC				72-53-17		Package AD	32	STAGE 6 VANE REAR SUPPORT LIP MATING SURFACE PLASMA COAT REPAIR		18645.00	SR Technics Switzerland
14160 50N348-001	EASA,FAA,CAAC,ANAC				72-53-17		Package AH	33	STAGE 3 VANE HOOK INNER DIAMETER PLASMA COAT REPAIR		12600.00	SR Technics Switzerland
14160 50N348-002	EASA,FAA,CAAC,ANAC				72-53-17		Package AJ	38	REAR FLANGE BRACKET REPLACEMENT REPAIR		445.00	SR Technics Switzerland
14160 50N348-003	EASA,FAA,CAAC,ANAC				72-53-17		Package AK	47	STG.3 VANE HOOK CRACK WELD REPAIR		5025.00	SR Technics Switzerland
14160 50N348-004	EASA,FAA,CAAC,ANAC				72-53-17		Package AL	56	WELD REPAIR AFT RETENTION LIP WEAR (STAGES 3 - 6)		11105.00	SR Technics Switzerland
14160 50N348-005	EASA,FAA,CAAC,ANAC				72-53-17		Package AM	60	WELD REPAIR FRONT VANE HOOK GROOVE WEAR (STAGES 3 - 6)		6210.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
14160	50N348-006	EASA,FAA,CAAC,ANAC			72-53-17		Package AN	62	WORN TRANSITION DUCT RETENTION GROOVE WELD BUILD- UP REPAIR		6330.00	SR Technics Switzerland
14160	50N348-007	EASA,FAA,CAAC,ANAC			72-53-17		Package B	01	REPLACE FRONT FLANGE LOCATING PIN		850.00	SR Technics Switzerland
14160	50N348-01	EASA,FAA,CAAC,ANAC			72-53-17		Package C	02	REPLACE REAR FLANGE LOCATING PIN		1100.00	SR Technics Switzerland
14160	50N448-001	EASA,FAA,CAAC,ANAC			72-53-17		Package D	03	REPAIR FRONT FLANGE THREADS WITH HELICAL COIL INSERTS		590.00	SR Technics Switzerland
14160	50N448-002	EASA,FAA,CAAC,ANAC			72-53-17		Package D	70	REPAIR REAR FLANGE THREADS WITH HELICAL COIL INSERTS		590.00	SR Technics Switzerland
14160	50N448-003	EASA,FAA,CAAC,ANAC			72-53-17		Package E	04	REPAIR THREADED BOSS HOLES WITH HELICAL COIL INSERTS		1185.00	SR Technics Switzerland
14160	50N448-004	EASA,FAA,CAAC,ANAC			72-53-17		Package F	05	SURFACE DAMAGE BLEND REPAIR		1695.00	SR Technics Switzerland
14160	50N448-005	EASA,FAA,CAAC,ANAC			72-53-17		Package G	06	STAGE 2 HPT SEAL MATING SURFACE PLASMA COAT REPAIR		3880.00	SR Technics Switzerland
14160	50N448-006	EASA,FAA,CAAC,ANAC			72-53-17		Package H	07	PLASMA SPRAY REPAIR FRONT FLANGE FACE (WITH FLANGE BRACKET)		3340.00	SR Technics Switzerland
14160	50N448-007	EASA,FAA,CAAC,ANAC			72-53-17		Package H	36	PLASMA SPRAY REPAIR FRONT FLANGE FACE (WITH FLANGE BRACKET)		3340.00	SR Technics Switzerland
14160	50N448-01	EASA,FAA,CAAC,ANAC			72-53-17		Package I	08	PLASMA SPRAY REPAIR FRONT FLANGE SNAP DIAMETER		3395.00	SR Technics Switzerland
14160	50N648-01	EASA,FAA,CAAC,ANAC			72-53-17		Package J	09	PLASMA SPRAY REPAIR REAR FLANGE SNAP DIAMETER		3155.00	SR Technics Switzerland
14160	51N448-01	EASA,FAA,CAAC,ANAC			72-53-17		Package K	10	REAR FLANGE FACE (WITHOUT BRACKET) PLASMA SPRAY REPAIR		3315.00	SR Technics Switzerland
14160					72-53-17		Package P	15	WELD REPAIR VANE ANTI- ROTATION SLOTS (STAGE 3)		3310.00	SR Technics Switzerland
14160					72-53-17		Package Q	16	WELD REPAIR VANE ANTI- ROTATION SLOTS (STAGE 4)		3310.00	SR Technics Switzerland
14160					72-53-17		Package R	17	WELD REPAIR VANE ANTI- ROTATION SLOTS (STAGE 5)		3310.00	SR Technics Switzerland
14160					72-53-17		Package S	18	WELD REPAIR VANE ANTI- ROTATION SLOTS (STAGE 6)		4800.00	SR Technics Switzerland
14160					72-53-17		Package SB00	PW4ENG 72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152(-3), PW4156A(-3), OR PW4158(-3) ENGINE		5790.00	SR Technics Switzerland
14160					72-53-17		Package SB01	PW4ENG 72-578	MODIFY THE FRONT ID RAIL ANTI- ROTATION SLOTS		2415.00	SR Technics Switzerland
14160					72-53-17		Package SB02	PW4ENG 72-579	MODIFY THE LPT VANE CLUSTER ASSEMBLY ANTI- ROTATION SLOTS AND ADD STRESS RELIEF SLOTS (STAGES 3 - 6)		17955.00	SR Technics Switzerland
14160					72-53-17		Package SB03	SI 20F-09	DIMENSIONAL INSPECTION		630.00	SR Technics Switzerland
14160					72-53-17		Package SB04	72-069925	PHIII - LOW PRESS TURBINE MODIFICATION		2095.00	SR Technics Switzerland
14160					72-53-17		Package SB05	72-216055	PHIII- LOW PRESS TURBINE MODIFICATION	4 STG MODIFICATION	2095.00	SR Technics Switzerland
14160					72-53-17		Package SB06	72-216055	PHIII- LOW PRESS TURBINE MODIFICATION	COMPLETE MODIFICATION	5695.00	SR Technics Switzerland
14160					72-53-17		Package T	19	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 3)		12435.00	SR Technics Switzerland
14160					72-53-17		Package T	20	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 4)		12435.00	SR Technics Switzerland
14160					72-53-17		Package T	21	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 5)		12435.00	SR Technics Switzerland
14160					72-53-17		Package T	22	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 6)		12435.00	SR Technics Switzerland
14160					72-53-17		Package U	75	CRACK BLEND REPAIR STG 3-6 ANTIROT. SLOTS		570.00	SR Technics Switzerland
14160					72-53-17		Package V	76	CRACK BLEND REPAIR STG 3-6 STRESS RELIEF. SLOTS		570.00	SR Technics Switzerland
14160					72-53-17		Package X	23	REPAIR FRONT INNER RAIL CRACKS BY STOP DRILLING		7165.00	SR Technics Switzerland
14160					72-53-17		Package Y	54	WELD BUILD-UP THE WORN OUTER AIRSEAL RETENTION SLOT (STAGES 3THROUGH 6) REPAIR		5500.00	SR Technics Switzerland
14160					72-53-17		Package Z	25	REPLACE LPT BORESCOPE BOSS		785.00	SR Technics Switzerland
15023	50N024	EASA,FAA,CAAC,ANAC,CAA UK	35	28	72-53-14	LOW PRESSURE TURBINE (LPT) - STAGE 4 LPT DISK ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1360.00	SR Technics Switzerland
15023	50N724	EASA,FAA,CAAC,ANAC			72-53-14		Package B	01	SURFACE DAMAGE BLEND REPAIR		1135.00	SR Technics Switzerland
15023	50N924	EASA,FAA,CAAC,ANAC			72-53-14		Package C	02	MACHINE REPAIR FRONT FACE		845.00	SR Technics Switzerland
15023	51N304	EASA,FAA,CAAC,ANAC			72-53-14		Package D	03	REAR FLANGE FACE PLASMA SPRAY REPAIR		2950.00	SR Technics Switzerland
15023	51N404	EASA,FAA,CAAC,ANAC,CAA UK			72-53-14		Package E	04	FRONT FLANGE FACE PLASMA SPRAY REPAIR		4920.00	SR Technics Switzerland
15023	51M404-001	EASA,FAA,ANAC			72-53-14		Package F	05	PLASMA SPRAY REPAIR REAR SNAP DIAMETER		3520.00	SR Technics Switzerland
15023	51N604	EASA,FAA,ANAC,CAA UK			72-53-14		Package G	06	PLASMA SPRAY REPAIR FRONT SNAP DIAMETER		3520.00	SR Technics Switzerland
15023					72-53-14		Package I	08	REAR SNAP DIAMETER PLASMA SPRAY REPAIR		3660.00	SR Technics Switzerland
15023					72-53-14		Package J	09	FRONT SNAP DIAMETER PLASMA SPRAY REPAIR		3660.00	SR Technics Switzerland
15023					72-53-14		Package K	10	REAR FLANGE FACE PLASMA SPRAY REPAIR		4180.00	SR Technics Switzerland
15023					72-53-14		Package L	11	SHOTPEEN REPAIR		900.00	SR Technics Switzerland
15023					72-53-14		Package N	12	MACHINE REPAIR UNDERSIZED REAR SNAP INNER DIAMETER		720.00	SR Technics Switzerland
15023					72-53-14		Package SB00	PW4G-100-72-105	MODIFICATION OF, ENLARGING THE COOLING AIR HOLE AREA		1730.00	SR Technics Switzerland
15023					72-53-14		Package SB01	AD 2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	1015.00	SR Technics Switzerland
15023					72-53-14		Package SB02	PW4ENG 72-657	ENLARGING OF THE COOLING AIR HOLE AREA		1500.00	SR Technics Switzerland
15023					72-53-14		Package SB03	PW4G-100-72-264	LPT: REPL. AND/OR MOD. OF DISK & SEALS		2000.00	SR Technics Switzerland
15023					72-53-14		Package SB04	PW4ENG 72-658	INTRODUCTION OF A NEW SPARE PART DISK FOR ENGINES PRIOR TO SB PW4ENG 72-634		235.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
19044	508221	EASA,FAA,CAAC,ANAC	42	28	72-31-07	LOW PRESSURE COMPRESSOR (LPC) - FRONT COMPRESSOR HUB ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		3725.00	SR Technics Switzerland
19044	508321	EASA,FAA,CAAC,ANAC			72-31-07		Package AA	26	BEARING SEAL SEAT FACE PLASMA SPRAY REPAIR		3585.00	SR Technics Switzerland
19044	518321	EASA,FAA,CAAC,ANAC			72-31-07		Package B	01	BLEND REPAIR FRONT COMPRESSOR HUB ASSEMBLY		2055.00	SR Technics Switzerland
19044	528021	EASA,FAA,CAAC,ANAC,CAA UK			72-31-07		Package C	02	HUB BLADE SLOT ANTIGALLANT AND SHOTPEEN TREATMENT		3330.00	SR Technics Switzerland
19044	538021	EASA,FAA,CAAC,ANAC,CAA UK			72-31-07		Package D	03	REPLACE LOOSE OR DAMAGED NUTS		1420.00	SR Technics Switzerland
19044					72-31-07		Package E	04	SEATING SHOULDER PLASMA SPRAY REPAIR		2225.00	SR Technics Switzerland
19044					72-31-07		Package F	05	COUPLING PILOT DIAMETER PLASMA SPRAY REPAIR		5000.00	SR Technics Switzerland
19044					72-31-07		Package G	06	REAR COUPLING SNAP DIAMETER REPAIR		3945.00	SR Technics Switzerland
19044					72-31-07		Package H	07	NO. 1 BEARING JOURNAL PLASMA SPRAY REPAIR		2405.00	SR Technics Switzerland
19044					72-31-07		Package I	08	NO. 1 SEAL PLATE DIAMETER PLASMA SPRAY REPAIR		2505.00	SR Technics Switzerland
19044					72-31-07		Package J	09	REAR OUTER SNAP DIAMETER PLASMA SPRAY REPAIR		2580.00	SR Technics Switzerland
19044					72-31-07		Package K	10	OUTER FRONT SNAP DIAMETER PLASMA SPRAY REPAIR		2665.00	SR Technics Switzerland
19044					72-31-07		Package P	15	ANTI-TORQUE SLOT REPAIR		1950.00	SR Technics Switzerland
19044					72-31-07		Package QI	16	MACHINE OFF DAMAGED COUNTERWEIGHT BALANCE FLANGE TANG REPAIR		2980.00	SR Technics Switzerland
19044					72-31-07		Package SB00	AD 2005-25-09	FPI AND ECI LIFE-LIMITED PART, LPC FRONT HUB	IN CONJUNCTION WITH PACKAGE A	535.00	SR Technics Switzerland
20953	53T848-01	EASA,FAA,CAAC,ANAC	2	28	7X-XX_XX	PW4TRAP TO EEC	Package A	CLN/INSP	CLEANING & INSPECTION		75.00	SR Technics Switzerland
20953					7X-XX_XX		Package SB00	MAN-PW4G-100-2-	INSPECT & CLEANING OF CONDENSATION TRAP	MAN-PW4G-100-2-00	420.00	SR Technics Switzerland
21176	50N265	EASA,FAA,CAAC,ANAC	20	28	72-53-20	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT (INNER) SEALING RING SL	Package A	CLN/INSP	CLEANING AND INSPECTION		490.00	SR Technics Switzerland
21176	50N537	EASA,FAA,CAAC,ANAC			72-53-20		Package B	01	REPLACE NUT PLATES		505.00	SR Technics Switzerland
21176					72-53-20		Package C	02	REPLACE DUCT		805.00	SR Technics Switzerland
21176					72-53-20		Package D	03	PLASMA SPRAY REAR OUTER SURFACE		2055.00	SR Technics Switzerland
21176					72-53-20		Package H	07	SUPPORT FLANGE AND SLOT WELD BUILD-UP REPAIR		4760.00	SR Technics Switzerland
21176					72-53-20		Package I	08	SUPPORT FLANGE (FRONT FACE) WEAR AREA PLASMA SPRAY REPAIR		3300.00	SR Technics Switzerland
21176					72-53-20		Package K	10	RIVET HOLE PLUG WELD REPAIR		1880.00	SR Technics Switzerland
21176					72-53-20		Package L	11	RIVET HOLES WELD ATTACHMENT REPAIR		2960.00	SR Technics Switzerland
21176					72-53-20		Package N	13	SUPPORT FLANGE PATCH WELD REPAIR		1670.00	SR Technics Switzerland
21176					72-53-20		Package O	14	CRACK WELD REPAIR		4995.00	SR Technics Switzerland
21176					72-53-20		Package SB00	PW4ENG 72-513	REPL. OF WITH A DUCT ASSEMBLY THAT HAS NEW DUCT SEGMENTS AND LPT SEALING RING WITH HARDCOATING		1295.00	SR Technics Switzerland
21176					72-53-20		Package SB01	PW4G-100-72-41	MODIFICATION OF THE DUCT ASSEMBLY THAT WILL ADD HARD COAT TO THE NEW DETAIL PARTS		1295.00	SR Technics Switzerland
22404	794629	EASA,FAA,CAAC,ANAC	22	28	72-31-80	LOW PRESSURE COMPRESSOR (LPC) - COMPRESSOR INLET CONE FRONT	Package A	CLN/INSP	CLEANING AND INSPECTION		355.00	SR Technics Switzerland
22404					72-31-80		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	180.00	SR Technics Switzerland
22404					72-31-80		Package B	01	REPLACE COMPRESSOR INLET CONE FRONT SEGMENT PROTECTIVE FINISH		2135.00	SR Technics Switzerland
22404					72-31-80		Package C	02	REPAIR COMPRESSOR INLET CONE FRONT SEGMENT SURFACE DAMAGE		1865.00	SR Technics Switzerland
22404					72-31-80		Package SB00	PW4ENG 72-619	INLET COMP. FRONT CONE SEGMENT REPL.		480.00	SR Technics Switzerland
22404					72-31-80		Package SB01	PW4G-100-72-70	INLET CONE SEGMENT: P/N 794629 TO 51A760		480.00	SR Technics Switzerland
22465	51A043-001	EASA,FAA,CAAC,ANAC	36	28	72-31-81	LOW PRESSURE COMPRESSOR (LPC) - COMPRESSOR INLET CONE (REAR	Package A	CLN/INSP	CLEANING AND INSPECTION		1385.00	SR Technics Switzerland
22465	51A045	EASA,FAA,CAAC,ANAC			72-31-81		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	80.00	SR Technics Switzerland
22465	51A045-002	EASA,FAA,CAAC,ANAC			72-31-81		Package B	01	REPLACE INLET CONE SEAL REPAIR		2980.00	SR Technics Switzerland
22465	51A112-01	EASA,FAA,CAAC,ANAC			72-31-81		Package B	01A	REAR SEAL REPLACEMENT REPAIR		2980.00	SR Technics Switzerland
22465	51A609-01	EASA,FAA,CAAC,ANAC			72-31-81		Package B	01B	REAR SEAL REPLACEMENT REPAIR		2980.00	SR Technics Switzerland
22465	51A709-01	EASA,FAA,CAAC,ANAC			72-31-81		Package B	01C	REAR SEAL REPLACEMENT REPAIR		2980.00	SR Technics Switzerland
22465	52A112-01	EASA,FAA,CAAC,ANAC			72-31-81		Package C	02	REPLACE PROTECTIVE FINISH (COMPLETE REPLACEMENT)		3880.00	SR Technics Switzerland
22465	52A517-01	EASA,FAA,CAAC,ANAC			72-31-81		Package C	04	REPAIR SURFACE DAMAGE		3880.00	SR Technics Switzerland
22465	52A523-01	EASA,FAA,CAAC,ANAC			72-31-81		Package D	03	REPLACE NUT PLATE		835.00	SR Technics Switzerland
22465					72-31-81		Package F	05	REPAIR TRAILING EDGE DELAMINATION		3880.00	SR Technics Switzerland
22465					72-31-81		Package H	07	AXIAL CRACK REPAIR		5165.00	SR Technics Switzerland
22465					72-31-81		Package I	08	HEAT INLET CONE TO REMOVE MOISTURE		1050.00	SR Technics Switzerland
22465					72-31-81		Package K	10	DELAMINATION REPAIR		3200.00	SR Technics Switzerland
22465					72-31-81		Package L	ASSEMBLY-01	BALANCE CONE SEGMENT ACC. EM 72-31-81 ASSEMBLY 01		1175.00	SR Technics Switzerland
22465					72-31-81		Package N	13	PROTECTIVE COATING - TOUCH UP REP		2720.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
22465					72-31-81		Package SB00	PW4G-100-72-217	MODIFICATION OF TO INCORPORATE A NEW SEAL TO MINIMIZE LEAKAGE FOR INCREASED ENGINE PERFORMANCE		1175.00	SR Technics Switzerland
22465					72-31-81		Package SB01	PW4ENG 72-792	MODIFICATION OF TO INCORPORATE A NEW SEAL WITH IMPROVED RETENTION FOR INCREASED DURABILITY		1140.00	SR Technics Switzerland
22465					72-31-81		Package SB02	PW4ENG 72-629	MODIFICATION OF TO PROVIDE A CONE ASSY		165.00	SR Technics Switzerland
22667	51H005	EASA,FAA,CAAC,ANAC	36	28	72-35-06	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 5 HPC DISK	Package A	CLN/INSP	CLEANING AND INSPECTION		1705.00	SR Technics Switzerland
22667	51H905	EASA,FAA,CAAC,ANAC			72-35-06		Package AH	15	KNIFE EDGE SEAL THICK COATING		5000.00	SR Technics Switzerland
22667	54H405	EASA,FAA,CAAC,ANAC,CAA UK			72-35-06		Package AJ	17	KNIFE EDGE SEAL THIN PLASMA COATING		3870.00	SR Technics Switzerland
22667	54H705	EASA,FAA,CAAC,ANAC			72-35-06		Package B	01	STRAIGHTEN STAGE 5 HPC DISK KNIFE-EDGE SEAL		3275.00	SR Technics Switzerland
22667	54H705-001	EASA,FAA,CAAC,ANAC			72-35-06		Package E	04	SHOTPEEN BLADE SLOTS		2765.00	SR Technics Switzerland
22667	56H605	EASA,FAA,CAAC,ANAC			72-35-06		Package F	05	RESTORE ANTIGALLING COMPOUND IN DISK BLADE SLOTS		2765.00	SR Technics Switzerland
22667	56H705	EASA,FAA,CAAC,ANAC			72-35-06		Package G	06	BLEND REPAIR KNIFE-EDGE SEALS		525.00	SR Technics Switzerland
22667	57H105	EASA,FAA,CAAC,ANAC			72-35-06		Package H	07	KNIFE-EDGE SEAL THIN PLASMA COAT REPAIR		3870.00	SR Technics Switzerland
22667					72-35-06		Package I	08	BLEND REPAIR SURFACE DAMAGE		2520.00	SR Technics Switzerland
22667					72-35-06		Package J	09	PLASMA SPRAY REPAIR THE REAR SNAP DIAMETER		2520.00	SR Technics Switzerland
22667					72-35-06		Package K	10	PLASMA SPRAY REPAIR THE FRONT SNAP DIAMETER		2520.00	SR Technics Switzerland
22667					72-35-06		Package O	14	MACHINE REPAIR THE REAR SNAP DIAMETER		1890.00	SR Technics Switzerland
22667					72-35-06		Package SB00	PW4ENG 72-515	HPC 5TH STG DISK - REMOVAL OF BALANCE FLANGE		2520.00	SR Technics Switzerland
22667					72-35-06		Package SB01	PW4ENG 72-653	HPC 5TH STG DISK - REMOVAL OF FRONT KNIFE-EDGE SEAL		2765.00	SR Technics Switzerland
22667					72-35-06		Package SB02	AD 2005-25-09	FPI LIFE-LIMITED PART, HPC 5TH STG DISK	IN CONJUNCTION WITH PACKAGE A	380.00	SR Technics Switzerland
22667					72-35-06		Package SB03	PW4ENG 72-772	HPC 5TH STG VISUAL INSPECTION ON BLADE ROOT & DISK LUG	PART 001	165.00	SR Technics Switzerland
22815	50H936	EASA,FAA,CAAC,ANAC	40	28	72-35-08	HIGH PRESSURE COMPRESSOR (HPC) - DRUM ROTOR (REAR) DISK ASSE	Package A	CLN/INSP	CLEANING AND INSPECTION		1970.00	SR Technics Switzerland
22815	50H936-002	EASA,FAA,CAAC,ANAC			72-35-08		Package AA	26	PLASMA REPAIR BRUSH SEAL LAND		3300.00	SR Technics Switzerland
22815	50S425-01	EASA,FAA,CAAC,CAA UK			72-35-08		Package AB	27	BLEND REPAIR SPLINE SURFACE DAMAGE		85.00	SR Technics Switzerland
22815	53H923-001	EASA,FAA,CAAC,ANAC			72-35-08		Package AE	30	REPAIR THE HEAT SHIELD ANTI-ROTATION SLOT SURFACE DAMAGE		1620.00	SR Technics Switzerland
22815	53H923-01	EASA,FAA,CAAC,ANAC			72-35-08		Package AH	33	CHROMIUM PLATE THE PILOT DIAMETER FRONT JOURNAL		4295.00	SR Technics Switzerland
22815					72-35-08		Package AI	34	CHROMIUM PLATE THE PILOT DIAMETER REAR JOURNAL		4295.00	SR Technics Switzerland
22815					72-35-08		Package AJ	35	NO. 3 BEARING SEAL SEAT SHOULDER PLASMA COAT REPAIR		2590.00	SR Technics Switzerland
22815					72-35-08		Package B	01	STRAIGHTEN KNIFE-EDGE SEAL		4700.00	SR Technics Switzerland
22815					72-35-08		Package B	08	RESTORE KNIFE-EDGE SEAL PLASMA COAT		4700.00	SR Technics Switzerland
22815					72-35-08		Package D	03	MACHINE MISALIGNED TIEBOLT HOLES OVERSIZE		3230.00	SR Technics Switzerland
22815					72-35-08		Package E	04	SHOTPEEN BLADE SLOTS		1305.00	SR Technics Switzerland
22815					72-35-08		Package F	05	BLEND REPAIR SURFACE DAMAGE		2075.00	SR Technics Switzerland
22815					72-35-08		Package G	06	BLEND REPAIR TANGENTIAL SLOT RIM RAILS		820.00	SR Technics Switzerland
22815					72-35-08		Package H	07	BLEND REPAIR KNIFE-EDGE SEALS		5165.00	SR Technics Switzerland
22815					72-35-08		Package I		REMARKING ILEGIBLE P/N AND S/N		135.00	SR Technics Switzerland
22815					72-35-08		Package K	10	NICKEL PLATE HPC REAR HUB NO.3 BRG HEAT SHIELD REAR JOURNAL		3880.00	SR Technics Switzerland
22815					72-35-08		Package L	11	NICKEL PLATE HPC REAR HUB NO.3 BRG HEAT SHIELD FRONT JOURNAL		3880.00	SR Technics Switzerland
22815					72-35-08		Package O	14	CHROMIUM PLATE HPC REAR HUB NO.3 BRG JOURNAL		4445.00	SR Technics Switzerland
22815					72-35-08		Package P	15	CHROMIUM PLATE HPC REAR HUB NO.3 BRG SEAL SPACER JOURNAL		4445.00	SR Technics Switzerland
22815					72-35-08		Package Q	16	CHROMIUM PLATE HPC REAR HUB NO.3 BRG FRONT SEAL JOURNAL		4340.00	SR Technics Switzerland
22815					72-35-08		Package R	17	NICKEL PLATE HPC REAR HUB NO.3 BRG SEAL SEAT SHOULDER		4340.00	SR Technics Switzerland
22815					72-35-08		Package SB00	AD 2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	325.00	SR Technics Switzerland
22815					72-35-08		Package SB01	72-490	CONVERSION OF A PW4460 OR PW4462 TO A PW4460 (-3) OR PW4462 REMOVE KNIFE EDGE SEAL		5545.00	SR Technics Switzerland
22815					72-35-08		Package SB01	72-504	CONVERSION OF A PW4052, PW4056, PW4060, TO A PW4052(-3), PW4040 REMOVE KNIFE EDGE SEAL		5545.00	SR Technics Switzerland
22815					72-35-08		Package SB01	72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152 REMOVE KNIFE EDGE SEAL		5545.00	SR Technics Switzerland
22815					72-35-08		Package SB02	PW4ENG 72-816	SEAL 13TH, 14TH AND 15TH STAGE - REPLACEMENT OF AND INTRODUC TO IMPROVE REAR DRUM ROTOR DURABILITY		595.00	SR Technics Switzerland
22815					72-35-08		Package SB03	PW4ENG 72-796	FPI OF THE 13TH, 14TH, AND 15TH STAGE BLADE LOADING AND LOCKING SLOTS FOR CRACKS		730.00	SR Technics Switzerland
22815					72-35-08		Package T	19	PLASMA SPRAY REPAIR REAR DRUM FRONT FLANGE SNAP DIAMETER		3230.00	SR Technics Switzerland
22815					72-35-08		Package U	20	REPAIR REAR HUB TORQUE SLOTS		1560.00	SR Technics Switzerland
22815					72-35-08		Package V	21	BLEND REPAIR TORQUE SLOTS LUGS		330.00	SR Technics Switzerland
22815					72-35-08		Package Y	24	STRAIGHTEN KNIFE-EDGE SEAL THAT HAS NO COATING		715.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
22891			9	21	29-10-01	HYDRAULIC HOSE	Package C		PRE TEST		845.00	SR Technics Switzerland
22891					29-10-01		Package G		OVERHAUL		1380.00	SR Technics Switzerland
24651	50L602	EASA,FAA,CAAC,ANAC	46	28	72-52-06	HIGH PRESSURE TURBINE (HPT) - TURBINE FRONT HUB (STAGE 2)	Package A	CLN/INSP	CLEANING AND INSPECTION		1215.00	SR Technics Switzerland
24651	50L602-001	EASA,FAA,CAAC,ANAC			72-52-06		Package B	01	PLASMA SPRAY OUTER SNAP DIAMETER - STAGE 2 (ROTATING) AIRSEAL CONTACT WEAR		7125.00	SR Technics Switzerland
24651	50L602-021	EASA,FAA,CAAC,ANAC			72-52-06		Package C	02	PLASMA SPRAY INNER SNAP DIAMETER - STAGE 2 (ROTATING) AIRSEAL CONTACT WEAR		7125.00	SR Technics Switzerland
24651	50L602-022	EASA,FAA,CAAC,ANAC			72-52-06		Package D	03	MACHINE NUT COUPLING MATING FACE		1890.00	SR Technics Switzerland
24651	50L602-023	EASA,FAA,CAAC,ANAC			72-52-06		Package E	04	SHOTPEEN HUB		1365.00	SR Technics Switzerland
24651	50L602-024	EASA,FAA,CAAC,ANAC			72-52-06		Package F	05	NICKEL PLATE REPAIR STAGE 2 HPT BLADE RETAINING PLATE AXIAL SNAP TURBINE INTERMEDIATE HUB (STAGE 2)		4080.00	SR Technics Switzerland
24651	50L602-025	EASA,FAA,CAAC,ANAC			72-52-06		Package I	08	SURFACE DAMAGE BLEND REPAIR		2095.00	SR Technics Switzerland
24651	50L602-026	EASA,FAA,CAAC,ANAC			72-52-06		Package J	09	INNER HPC SHAFT PILOT DIAMETER PLASMA COAT/DUAL WIRE ELECTRIC ARC COAT REPAIR		4715.00	SR Technics Switzerland
24651	50L602-027	EASA,FAA,CAAC,ANAC			72-52-06		Package K	10	PLASMA COAT REPAIR FRONT MATING SNAP DIAMETER		5890.00	SR Technics Switzerland
24651	50L902	EASA,FAA,CAAC,ANAC			72-52-06		Package L	11	REAR OUTER DIAMETER MACHINE REPAIR		1760.00	SR Technics Switzerland
24651	50L902-021	EASA,FAA,CAAC,ANAC			72-52-06		Package O	14	REMOVE OR INSTALL THE METERING PLUG REPAIR		470.00	SR Technics Switzerland
24651	50L902-022	EASA,FAA,CAAC,ANAC			72-52-06		Package Q	16	UNBALANCE MARKING		630.00	SR Technics Switzerland
24651	50L902-023	EASA,FAA,CAAC,ANAC			72-52-06		Package SB00	PW4ENG 72-736	FLUORESCENT PENETRANT INSPECTION FOR CRACKS	IN CONJUNCTION WITH PACKAGE A	635.00	SR Technics Switzerland
24651	52L002	EASA,FAA,CAAC,ANAC			72-52-06		Package SB01	PW4ENG 72-435	REPLACEMENT OF, FOR BETTER ENGINE BALANCE		6595.00	SR Technics Switzerland
24651	52L002-021	EASA,FAA,CAAC,ANAC			72-52-06		Package SB02	PW4ENG 72-627	INTRODUCE IMPROVED COOLING TO THE NO. 3 BEARING COMPARTMENT FOR THE LPT		935.00	SR Technics Switzerland
24651	52L402	EASA,FAA,CAAC,ANAC			72-52-06		Package SB03	PW4ENG 72-490	CONVERSION OF A PW4460 OR PW4460 (-3) OR PW4462 (-3)		635.00	SR Technics Switzerland
24651	52L802	EASA,FAA,CAAC,ANAC,CAA UK			72-52-06		Package SB04	PW4ENG 72-504	CONVERSION OF A PW4052, PW4056, PW4060, TO A PW4052(-3), PW4056(-3), OR PW4060(-3)		635.00	SR Technics Switzerland
24651	53L602	EASA,FAA,CAAC,ANAC			72-52-06		Package SB05	PW4ENG 72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152(-3), PW4156A(-3), OR PW4158(-3) ENGINE		635.00	SR Technics Switzerland
24651	55L102	EASA,FAA,CAAC,ANAC			72-52-06		Package SB06	PW4ENG 72-716	REPLACEMENT OF WITH A BLADE WITH PWA 1480 ALLOY AND DIMENSIONAL CHANGES		760.00	SR Technics Switzerland
24651	55L112	EASA,FAA,CAAC,ANAC			72-52-06		Package SB07	PW4G-100-72-165	REPLACEMENT OF WITH A BLADE WITH PWA 1480 ALLOY AND DIMENSIONAL CHANGES		455.00	SR Technics Switzerland
24651					72-52-06		Package SB08	PW4G-100-72-142	REPLACEMENT OR MODIFYING OF TO INCORP. IMPROVED UNDER PLATFORM COATING & INCR. COOLING FLOW		480.00	SR Technics Switzerland
24651					72-52-06		Package SB09	PW4G-100-72-176	FLUORESCENT PENETRANT INSPECTION FOR CRACKS	IN CONJUNCTION WITH PACKAGE A	635.00	SR Technics Switzerland
24651					72-52-06		Package SB10	AD 2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	650.00	SR Technics Switzerland
24651					72-52-06		Package SB11	PW4ENG 72-795	INTRODUCTION OF THE ADVANTAGE PERFORMANCE UPGRADE (APU) C TO IMPROVE HIGH PRESSURE TURBINE (HPT) I		165.00	SR Technics Switzerland
24651					72-52-06		Package SB12	PW4ENG 72-806	HUB ASSEMBLY, 2ND STAGE HPT, INTRODUCTION OF, COMMON TO OTHER PW4 ENGINE MODELS		160.00	SR Technics Switzerland
24651					72-52-06		Package SB13	PW4ENG 72-537	HPT, STG 2 REMOVE METERING PLUG/PLATE		185.00	SR Technics Switzerland
24651					72-52-06		Package SB14	PW4G-100-72-220	CONVERSION TO ADVANTAGE 70 ENGINE MODEL		185.00	SR Technics Switzerland
27515	53D514	EASA,FAA,CAAC,ANAC	21	28	72-33-04	FAN CASE - FAN EXIT INNER CASE ASSEMBLY - 2.5 BLEED DUCT CAM SL	Package B	62	2.5 BLEED DUCT CAM SLOT LINER WEAR PLASMA COAT REPAIR		985.00	SR Technics Switzerland
29279	55T407	EASA,FAA,CAAC,ANAC	20	28	72-34-79	INTERMEDIATE CASE - FWD ENGINE MOUNT ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
29279					72-34-79		Package C		PREINSPECTION OF FORWARD ENGINE MOUNT ASSEMBLY	IN CONJUNCTION WITH PACKAGE LIGHT, MED	340.00	SR Technics Switzerland
29279					72-34-79		Package D	LIGHT	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P/ EXAMPLE: THRUST LINK REPLACEMENT (LEA)		755.00	SR Technics Switzerland
29279					72-34-79		Package E	MEDIUM	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P/ EXAMPLE: BEAM ASSY REPLACEMENT		2205.00	SR Technics Switzerland
29279					72-34-79		Package F	HEAVY	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P/ EXAMPLE: MOUNT SET ASSY REPLACEMENT		4020.00	SR Technics Switzerland
29279					72-34-79		Package G		OVERHAUL	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY	4115.00	SR Technics Switzerland
29279					72-34-79		Package SB00	PW4G-100-71-7	IDENTIFICATION OF THE MOUNT ASSEMBLIES WITH A PART NUMBER A IN CONJUNCTION WITH PACKAGE LIGHT, MED		105.00	SR Technics Switzerland
29279					72-34-79		Package SB01	PW4G-100-71-12	REPLACE STUD WITH A HARDER MATERIAL BOLT	IN CONJUNCTION WITH PACKAGE LIGHT, MED	105.00	SR Technics Switzerland
29279					72-34-79		Package SB02	PW4G-100-71-11	REPLACEMENT OF BOLTS THAT ARE MORE DURABLE	IN CONJUNCTION WITH PACKAGE LIGHT, MED	105.00	SR Technics Switzerland
29279					72-34-79		Package SB03	PW4G-100-71-22	INTRODUCTION OF NEW BEARING HOUSING TO INCREASE DURABILITY	IN CONJUNCTION WITH PACKAGE LIGHT, MED	105.00	SR Technics Switzerland
29279					72-34-79		Package SB04	PW4G-100-71-26	APPLICATION OF ANTI GALLANT COMPOUND TO THE MOUNT MAIN BE IN CONJUNCTION WITH PACKAGE HEAVY OR C		275.00	SR Technics Switzerland
29279					72-34-79		Package SB05	PW4G-100-A71-18	PERIODIC VISUAL INSPECTION OF THE PRIMARY THRUST LOAD PATH	IN CONJUNCTION WITH PACKAGE LIGHT, MED	155.00	SR Technics Switzerland
29279					72-34-79		Package SB06	PW4G-100-71-8	INTRODUCTION OF NEW ENGINE MOUNT HARDWARE WITH ADDITION. IN CONJUNCTION WITH PACKAGE HEAVY OR C		105.00	SR Technics Switzerland
45191	53D227	EASA,FAA,CAAC,ANAC	21	28	72-33-08	FAN CASE - FAN CASE BLEED VALVE DUCT ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		450.00	SR Technics Switzerland
45191					72-33-08		Package B	18	2.5 BLEED DUCT CAM SLOT LINER WEAR PLASMA COAT REPAIR		985.00	SR Technics Switzerland
45219	80R800-1	EASA,FAA,CAAC,ANAC,CAA UK	24	21	73-21-76	FUEL METRING UNIT - JFC131-4	Package B		BENCH-TEST	READJUSTMENT AND TESTING	2480.00	SR Technics Switzerland
45219					73-21-76		Package C		PRE TEST AND TROUBLE SHOOTING	IN CONJUNCTION WITH PACKAGE MEDIUM	175.00	SR Technics Switzerland
45219					73-21-76		Package D	LIGHT	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXCLUDED PIECE PART REPAIRS.		2750.00	SR Technics Switzerland
45219					73-21-76		Package E	MEDIUM	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXC EXAMPLE: GEAR SEGMENT OR RESOLVER REPI		5345.00	SR Technics Switzerland
45219					73-21-76		Package F	HEAVY	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXC EXAMPLE: HOUSING REPLACEMENT		6700.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
45219					73-21-76		Package G		OVERHAUL	DISASSEMBLY,CLEANING, INSPECTION, ASSEM	11900.00	SR Technics Switzerland
45219					73-21-76		Package H	1-1	REPLACE STUDS	ASSEMBLED	2480.00	SR Technics Switzerland
45219					73-21-76		Package SB00	JFC131-4-5	ADDS A WASHERLESS GUIDE SHAR FOR THE PRESSURE REGULATING VA IN CONJUNCTION WITH PACKAGE MEDIUM O		565.00	SR Technics Switzerland
45219					73-21-76		Package SB01	JFC131-4-6	REMOVES THE PRESSURE SWITCH AND CONTACTS	IN CONJUNCTION WITH PACKAGE MEDIUM O	565.00	SR Technics Switzerland
45219					73-21-76		Package SB02	JFC131-4-7	IMPROVED RUBBERBOOT TUBING FOR PROXIMITY WIRE PLANNING INF IN CONJUNCTION WITH PACKAGE MEDIUM O		565.00	SR Technics Switzerland
45219					73-21-76		Package SB03	JFC131-4-8	REPLACE PREFORMED PACKINGS BLACK TO BROWN	IN CONJUNCTION WITH PACKAGE MEDIUM O	565.00	SR Technics Switzerland
45219					73-21-76		Package SB04	JFC131-4-10	REPLACEMENT OF ALL INCORRECT MATERIAL PACKINGS	IN CONJUNCTION WITH PACKAGE MEDIUM O	565.00	SR Technics Switzerland
45219					73-21-76		Package SB05	JFC131-4-12	REMOVAL OF PRESSURE SWITCH PLUG AND ELIMINATION OF HOUSING IN CONJUNCTION WITH PACKAGE MEDIUM O		110.00	SR Technics Switzerland
45219					73-21-76		Package SB06	JFC131-4-13	REMOVAL OF BACKSHELL AND BACKSHELL LINER FROM A/F CONNECTO IN CONJUNCTION WITH PACKAGE MEDIUM O		110.00	SR Technics Switzerland
45219					73-21-76		Package SB07	JFC131-4-11	REPLACEMENT OF INCORRECT PISTON SEAL	IN CONJUNCTION WITH PACKAGE MEDIUM O	300.00	SR Technics Switzerland
45219					73-21-76		Package SB08	JFC131-4-73-16	TORQUE MOTOR NOZZLE INSPECTIO N	IN CONJUNCTION WITH PACKAGE MEDIUM O	300.00	SR Technics Switzerland
45343	50L501	EASA,FAA,CAAC,ANAC	34	28	72-52-05	HIGH PRESSURE TURBINE (HPT) - TURBINE FRONT HUB (STAGE 1)	Package A	CLN/INSP	CLEANING AND INSPECTION		1215.00	SR Technics Switzerland
45343	51L201	EASA,FAA,CAAC,ANAC			72-52-05		Package B	01	AIRSEAL DIAMETER PLASMA SPRAY REPAIR		2515.00	SR Technics Switzerland
45343	51L201-021	EASA,FAA,CAAC,ANAC			72-52-05		Package C	02	INNER FRONT DIAMETER PLASMA COAT REPAIR		4005.00	SR Technics Switzerland
45343	51L901	EASA,FAA,CAAC,ANAC,CAA UK			72-52-05		Package D	03	INNER DIAMETER PLASMA COAT REPAIR		5065.00	SR Technics Switzerland
45343	52L301	EASA,FAA,CAAC,ANAC,CAA UK			72-52-05		Package E	04	SURFACE DAMAGE BLEND REPAIR		1975.00	SR Technics Switzerland
45343	52L401	EASA,FAA,CAAC,ANAC			72-52-05		Package F	05	PLASMA SPRAY REPAIR TURBINE INTERMEDIATE HUB (STAGE 2) MATING SNAP DIAMETER		5305.00	SR Technics Switzerland
45343	52L401-001	EASA,FAA,CAAC,ANAC			72-52-05		Package G	06	FRONT INNER ROTATING AIRSEAL SNAP DIAMETER PLASMA SPRAY REPAIR		3730.00	SR Technics Switzerland
45343	55L061	EASA,FAA,CAAC,ANAC			72-52-05		Package H	07	FRONT BEARING SPACER MATING FACE MACHINE REPAIR		1990.00	SR Technics Switzerland
45343	55L111	EASA,FAA,CAAC,ANAC,CAA UK			72-52-05		Package I	08	FRONT HUB SHOTPEEN REPAIR		860.00	SR Technics Switzerland
45343					72-52-05		Package J	09	LOCK LUGS BLEND REPAIR		780.00	SR Technics Switzerland
45343					72-52-05		Package K	10	CLINCH NUT REPLACEMENT REPAIR		935.00	SR Technics Switzerland
45343					72-52-05		Package L	11	FRONT INNER ROTATING AIRSEAL OUTER SNAP DIAMETER PLASMA SPRAY REPAIR		5240.00	SR Technics Switzerland
45343					72-52-05		Package O	14	FRONT BEARING SPACER MATING FACE PLASMA COAT REPAIR		1225.00	SR Technics Switzerland
45343					72-52-05		Package P	15	MACHINE FRONT OUTER AIRSEAL DIAMETER TO SIZE		2025.00	SR Technics Switzerland
45343					72-52-05		Package Q	16	REAR OUTER SNAP DIAMETER PLASMA COAT REPAIR		1510.00	SR Technics Switzerland
45343					72-52-05		Package R	17	SURFACE DAMAGE REPAIR		685.00	SR Technics Switzerland
45343					72-52-05		Package SB00	AD 2005-25-09	FPI LIFE-LIMITED PART, HUB TURBINE FRONT		520.00	SR Technics Switzerland
45343					72-52-05		Package SB01	PW4ENG 72-736	PW4152(-3), PW4156A(-3), OR PW4158(-3) ENGINE		520.00	SR Technics Switzerland
45343					72-52-05		Package SB01	PW4G-100-72-176	FPI OF HPT HUBS & OUTER AIRSEAL,1ST & 2ND STG		520.00	SR Technics Switzerland
45343					72-52-05		Package SB02	PW4ENG 72-504	CONVERSION OF A PW4052, PW4056, PW4060 TO A PW4052(-3), PW4056(-3) OR PW4060(-3)		5080.00	SR Technics Switzerland
45343					72-52-05		Package SB03	PW4ENG 72-795	INTRODUCTION OF THE ADVANTAGE PERFORMANCE UPGRADE CONFIG (INSPECTION ONLY)		165.00	SR Technics Switzerland
45343					72-52-05		Package SB04	PW4ENG 72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152(-3), PW4156A(-3), OR PW4158(-3) ENGINE		2525.00	SR Technics Switzerland
45343					72-52-05		Package SB05	PW4ENG 72-828	INTRODUCTION OF FOR COMMONALITY AND PROVIDE A PROCEDURE TO IDENTIFY FRONT HUBS THAT HAVE FULL LIFE		455.00	SR Technics Switzerland
45343					72-52-05		Package SB06	PW4ENG 72-490	CONVERSION OF A PW4460 OR PW4462 TO A PW4460 (-3) OR PW4462 (-3)		2525.00	SR Technics Switzerland
45343					72-52-05		Package SB07	PW4G-100-72-250	PROVIDE A PROCEDURE TO IDENTIFY FRONT HUB ASSEMBLIES THAT HAVE FULL LIFE		455.00	SR Technics Switzerland
62426	505013-01	EASA,FAA,CAAC,ANAC	22	28	72-35-84	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 9 HPC CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		570.00	SR Technics Switzerland
62426					72-35-84		Package F	05	PLASMA SPARY THE REAR SNAP DIAMERERS		2450.00	SR Technics Switzerland
62426					72-35-84		Package G	06	PLASMA SPRAY THE REAR FLANGE FACE		2450.00	SR Technics Switzerland
62427	58H348-01	EASA,FAA,CAAC,ANAC	19	28	72-35-85	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 10 HPC CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		355.00	SR Technics Switzerland
62427					72-35-85		Package F	05	FLANGE BOLTS REPLACEMENT REPAIR		565.00	SR Technics Switzerland
62427					72-35-85		Package G	06	SURFACE DAMAGE BLEND REPAIR		430.00	SR Technics Switzerland
62427					72-35-85		Package H	07	PIN (FLARED ASSEMBLY) REPLACEMENT REPAIR		535.00	SR Technics Switzerland
62427					72-35-85		Package I	08	BORESCOPE BOSS REPLACEMENT REPAIR		650.00	SR Technics Switzerland
62427					72-35-85		Package J	09	NUT ASSEMBLY REPLACEMENT REPAIR		620.00	SR Technics Switzerland
62428	58H317	EASA,FAA,CAAC,ANAC	19	28	72-35-86	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 11 HPC CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		380.00	SR Technics Switzerland
62428					72-35-86		Package F	05	TOUCH-UP COAT REPAIR (PWA 77 COATED PARTS)		505.00	SR Technics Switzerland
62428					72-35-86		Package G	06	SURFACE DAMAGE BLEND REPAIR (PWA 77 COATED PARTS)		500.00	SR Technics Switzerland
62429	58H318-01	EASA,FAA,CAAC,ANAC	19	28	72-35-87	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 12 HPC CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		375.00	SR Technics Switzerland
62429					72-35-87		Package F	05	FRONT AND REAR FLANGE BOLTS REPLACEMENT REPAIR		525.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
62429					72-35-87		Package G	06	TOUCH UP COAT REPAIR		490.00	SR Technics Switzerland
62429					72-35-87		Package H	07	SURFACE DAMAGE BLEND REPAIR		435.00	SR Technics Switzerland
62430	58H322-01	EASA,FAA,CAAC,ANAC	18	28	72-35-89	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 14 HPC CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
62430					72-35-89		Package B	01	FRONT SNAP DIA PLASMA COAT		1495.00	SR Technics Switzerland
62430					72-35-89		Package F	05	REAR FLANGE STUDS REPLACEMENT REPAIR		400.00	SR Technics Switzerland
62430					72-35-89		Package G	06	TOUCH-UP COAT REPAIR		510.00	SR Technics Switzerland
62430					72-35-89		Package H	07	BLEND SURFACE DAMAGE REPAIR		500.00	SR Technics Switzerland
62430					72-35-89		Package I	08	NUT ASSEMBLY REPLACEMENT REPAIR		350.00	SR Technics Switzerland
62430					72-35-89		Package J	09	FLARED ASSEMBLY PIN REPLACEMENT REPAIR		540.00	SR Technics Switzerland
62430					72-35-89		Package K	10	BORESCOPE BOSS REPLACEMENT REPAIR		655.00	SR Technics Switzerland
62430					72-35-89		Package N	13	REAR FLANGE HEAT SHIELD RETAINING POCKET COAT REPAIR		2350.00	SR Technics Switzerland
62451	58H320-01	EASA,FAA,CAAC,ANAC	19	28	72-35-88	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 13 HPC CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		380.00	SR Technics Switzerland
62451					72-35-88		Package F	05	REAR FLANGE BOLTS REPLACEMENT REPAIR		395.00	SR Technics Switzerland
62451					72-35-88		Package G	06	TOUCH-UP COAT REPAIR		505.00	SR Technics Switzerland
62451					72-35-88		Package H	07	SURFACE DAMAGE BLEND REPAIR		500.00	SR Technics Switzerland
62451					72-35-88		Package I	08	CLINCH NUT REPLACEMENT REPAIR		345.00	SR Technics Switzerland
62452	58H344-01	EASA,FAA,CAAC,ANAC	20	28	72-35-83	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 8 HPC CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		560.00	SR Technics Switzerland
62452					72-35-83		Package B	01	BLEND THE SURFACE DAMAGE		375.00	SR Technics Switzerland
62452					72-35-83		Package C	02	REPLACE THE REAR FLANGE BOLTS		375.00	SR Technics Switzerland
62468	58H345	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 9 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
62469	58H347	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 10 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
62470	58H323	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 12 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
62471	58H349	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 11 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
62472	58H324	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 13 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
62473	58H325	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 14 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
62544	58H400	EASA,FAA,CAAC,ANAC	20	28	72-35-69	HIGH PRESSURE COMPRESSOR (HPC) - HPC (OUTER) REAR CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1260.00	SR Technics Switzerland
62544					72-35-69		Package AE	57	BLEND REPAIR		875.00	SR Technics Switzerland
62544					72-35-69		Package AF	62	REMOVAL AND APPLICATION OF PWA 110-31 COAT REPAIR		925.00	SR Technics Switzerland
62544					72-35-69		Package AG	63	PWA 110 COAT TOUCH-UP REPAIR		1165.00	SR Technics Switzerland
62544					72-35-69		Package AH	64	REMOVAL AND APPLICATION OF PWA 53-47 OR PWA 271-47 COAT		2315.00	SR Technics Switzerland
62544					72-35-69		Package AI	69	REPLACE THE HPC SUPPORT	ONLY LABOR HOURS	3585.00	SR Technics Switzerland
72341	58H367	EASA,FAA,CAAC,ANAC	25	28	72-35-69	HIGH PRESSURE COMPRESSOR (HPC) - HPC OUTER REAR CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1355.00	SR Technics Switzerland
72341					72-35-69		Package C	16	WELD REPAIR FLANGE K BOLT HOLE CRACKS		2990.00	SR Technics Switzerland
72341					72-35-69		Package E	41	REPLACE THE IDENTIFICATION BRACKET		2000.00	SR Technics Switzerland
72341					72-35-69		Package F	44	OUTER FRONT SNAP DIA. PLASMA SPRAY		5265.00	SR Technics Switzerland
72341					72-35-69		Package G	45	INSERTS REPLACEMENT REPAIR		1360.00	SR Technics Switzerland
72341					72-35-69		Package H	47	FRONT FLANGE FACE PLASMA COAT REPAIR		2590.00	SR Technics Switzerland
72341					72-35-69		Package I	48	REAR SNAP DIAMETER PLASMA COAT REPAIR		4390.00	SR Technics Switzerland
72341					72-35-69		Package K	52	REAR W SEAL SHOULDER PLASMA COAT REPAIR		4995.00	SR Technics Switzerland
72341					72-35-69		Package M	53	STAGE 9 W SEAL SHOULDER PLASMA COAT REPAIR		4390.00	SR Technics Switzerland
72341					72-35-69		Package N	14	WELD REPAIR FLANGE H BOLT HOLE CRACKS		6245.00	SR Technics Switzerland
72341					72-35-69		Package O	54	INNER REAR FLANGE NUT PLATE REPLACEMENT REPAIR		1275.00	SR Technics Switzerland
72341					72-35-69		Package P	15	WELD REPAIR FLANGE J BOLT HOLE CRACKS		6245.00	SR Technics Switzerland
72341					72-35-69		Package Q	56	SURFACE DAMAGE BLEND REPAIR		1340.00	SR Technics Switzerland
72341					72-35-69		Package Y	51	PISTON RING SEAL DIA. PLASMACOAT		6245.00	SR Technics Switzerland
72341					72-35-69		Package Z	70	CASE WALL CRACK WELD REPAIR		3625.00	SR Technics Switzerland
130101	212842	EASA,CAAC,TCCA,CAA UK	4	21	73-11-05	PISTON RELIEF VALVE	Package A	CLN/INSP	CLEANING & INSPECTION		190.00	SR Technics Switzerland
130101					73-11-05		Package B		REWORK PISTON SEAT		265.00	SR Technics Switzerland
130632	310T4022-1	EASA,FAA,CAAC,ANAC	19	21	71-21-16	FWD ENGINE MOUNT - EVENER BAR ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		240.00	SR Technics Switzerland
130632	310T4022-2	EASA,FAA,CAAC,ANAC			71-21-16		Package B	2-1	BEARING REPLACEMENT		615.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
130632	31074022-3	EASA,FAA,CAAC,ANAC			71-21-16		Package C	2-1	BUSHING REPLACEMENT		615.00	SR Technics Switzerland
130632	31074022-4	EASA,FAA,CAAC,ANAC			71-21-16		Package D	2-2	BUSHING HOLE REPAIR		1015.00	SR Technics Switzerland
130632					71-21-16		Package E	2-2	BEARING HOLE REPAIR		760.00	SR Technics Switzerland
130632					71-21-16		Package F	2-2	SCRATCH AND GOUGE REPAIR		495.00	SR Technics Switzerland
131637	212844	EASA,FAA,CAAC,ANAC	21	21	73-11-04	FUEL-PUMP/DISTRIBUTION VALVE - FUEL PUMP - 94" - BODY RELIEF V	Package B		MASCHINE THE PISTON SEAT	ACCORDING CMM	755.00	SR Technics Switzerland
131669	221-0260-501	EASA,FAA,CAAC,ANAC	19	21	71-20-05	AFT ENGINE MOUNT - ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING & INSPECTION		300.00	SR Technics Switzerland
131669	221-0260-503	EASA,FAA,CAAC,ANAC			71-20-05		Package D	LIGHT	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PA EXAMPLE: LINK REPLACEMENT (1EA)		570.00	SR Technics Switzerland
131669	221-0260-505	EASA,FAA,CAAC,ANAC			71-20-05		Package E	MEDIUM	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PA EXAMPLE: LINKS REPLACEMENT (2EA)		1115.00	SR Technics Switzerland
131669	221-0263-501	EASA,FAA,CAAC,ANAC			71-20-05		Package F	HEAVY	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PA EXAMPLE: BEAM ASSY REPLACEMENT		1835.00	SR Technics Switzerland
131669	221-0263-503	EASA,FAA,CAAC,ANAC			71-20-05		Package G	OVERHAUL	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PART REPAIRS		2070.00	SR Technics Switzerland
131669	221-0263-505	EASA,FAA,CAAC,ANAC			71-20-05		Package SB00	PW4NAC 71-163	REPLACE ATTACHMENT HARDWARE WITH SERIALIZED PARTS	IN CONJUNCTION WITH PACKAGE HEAVY OR C	105.00	SR Technics Switzerland
131669	221-0263-509	EASA,FAA,CAAC,ANAC			71-20-05		Package SB01	PW4NAC A71-149	INSPECTION AND REPLACEMENT OF BEAM ASSEMBLY	IN CONJUNCTION WITH PACKAGE HEAVY OR C	105.00	SR Technics Switzerland
131669					71-20-05		Package SB02	PW4NAC 71-74	AFT ENGINE MOUNT INSPECTION		480.00	SR Technics Switzerland
132301	51R062	EASA,FAA,CAAC,ANAC	4	28	72-61-00	PW4 VALVE ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		355.00	SR Technics Switzerland
132301	791755	EASA,FAA,CAAC,ANAC			72-61-00		Package B		CHECK/REPLACE BUTTERFLY VALVE		145.00	SR Technics Switzerland
132777	221-0245-501	EASA,FAA,CAAC,ANAC	24	21	71-20-04	FWD ENGINE MOUNT - LINK ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1030.00	SR Technics Switzerland
132777	221-0245-503	EASA,FAA,CAAC,ANAC			71-20-04		Package B	01	BEARING REPLACEMENT		1850.00	SR Technics Switzerland
132777					71-20-04		Package F	05	SURFACE DAMAGE BLEND REPAIR		1135.00	SR Technics Switzerland
132777					71-20-04		Package SB00	PW4NAC 71-86	LINK INSPECTION AND REPLACEMENT OF		3215.00	SR Technics Switzerland
132793	718801-5	EASA,FAA,ANAC,CAA UK	12	21	73-11-04	FUEL PUMP	Package B	TEST	BENCH TEST		2585.00	SR Technics Switzerland
132793	718801-6	EASA,FAA,ANAC,CAA UK			73-11-04		Package C	TEST	PRE-TEST		370.00	SR Technics Switzerland
132793	718801-7	EASA,FAA,ANAC,CAA UK			73-11-04		Package E	MEDIUM	REPAIR		4275.00	SR Technics Switzerland
132793	720301-5	EASA,FAA,ANAC,CAA UK			73-11-04		Package G		OVERHAUL	EASA, FAA	7395.00	SR Technics Switzerland
132793	720301-6	EASA,FAA,ANAC,CAA UK			73-11-04		Package SB00	711000-73-7/ATC	PW4-FUEL PUMP-THRUST BEAR,ANTI FRETT,PAD		480.00	SR Technics Switzerland
132793	720301-7	EASA,FAA,ANAC,CAA UK			73-11-04		Package SB01	711000-73-11	PW4-FUEL PUMP-IMPR.STATIONARY SHAFT SEAL		480.00	SR Technics Switzerland
132793	721001-7	EASA,FAA,ANAC,CAA UK			73-11-04		Package SB02	PW4ENG 73-104	PW4-FUEL PUMP-NEW PUMP HOUSING		940.00	SR Technics Switzerland
132793					73-11-04		Package SB03	711000-73-15/AT	INTRODUCTION OF NEW FILTER COVER LOCKING NUTS		480.00	SR Technics Switzerland
132793					73-11-04		Package SB04	711000-73-14/AT	INTRODUCTION OF NEW MAIN STAGE BEARING		480.00	SR Technics Switzerland
132793					73-11-04		Package SB05	711000-73-16/AT	REPLACEMENT OF STATIONARY SHAFT SEAL PREFORMED PACKING		480.00	SR Technics Switzerland
132793					73-11-04		Package SB06	IA 069881	PW4-FUEL PUMP HOUSING-CRACK INSP./REPAIR		480.00	SR Technics Switzerland
132810	53H073	EASA,FAA,CAAC,ANAC	3	21	72-35-00	PW4 BRACKET TO TCC VALVE ACTUATOR	Package B		REPLACE OR TIGHTEN RIVETS		50.00	SR Technics Switzerland
132812	50P046	EASA,FAA,CAAC,ANAC	23	28	72-54-24	TURBINE EXHAUST CASE - AVERAGE PRESSURE AND TEMPERATURE PR	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland
132812	50P374-01	EASA,FAA,CAAC,ANAC			72-54-24		Package B	01	REFACE CONICAL CONNECTOR SEAT		655.00	SR Technics Switzerland
132812	50P422-01	EASA,FAA,CAAC,ANAC			72-54-24		Package C	INSP/CHECK-05	FLOW AND PRESSURE CHECK		170.00	SR Technics Switzerland
132812					72-54-24		Package SB00	PW4ENG 77-16	MODIFICATION OF THE PROBES		620.00	SR Technics Switzerland
132813	50P048	EASA,FAA,CAAC,ANAC	18	28	72-54-25	TURBINE EXHAUST CASE - THERMOCOUPLE HOUSING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		350.00	SR Technics Switzerland
133447	50P392	EASA,FAA,CAAC,ANAC	11	21	77-21-11	PROBE-THERMOCOUPLE T4.95	Package C		BENCH TEST	TESTING AND FAULT ISOLATION	665.00	SR Technics Switzerland
133447	HAD20899	EASA,FAA,ANAC			77-21-11		Package D		REPAIR		765.00	SR Technics Switzerland
133447	HAD21368	EASA,FAA,CAAC,ANAC			77-21-11		Package E		OVERHAUL		765.00	SR Technics Switzerland
133459	PBF1148-14H23	EASA,FAA,CAAC,ANAC	3	21	71-20-04	PW4 BOLT, FORWARD ENGINE MOUNT	Package A	CLN/INSP	CLEANING AND INSPECTION		170.00	SR Technics Switzerland
133477	825501-10	EASA,FAA,ANAC,CAA UK	23	21	73-11-04	FUEL-PUMP/DISTRIBUTION VALVE - FUEL PUMP - 94"	Package B	TEST	BENCH TEST	READJUSTMENT AND TESTING	2670.00	SR Technics Switzerland
133477	825501-11	EASA,FAA,ANAC,CAA UK			73-11-04		Package C		CRACK INSPECTION OF GEAR HOUSING		105.00	SR Technics Switzerland
133477	825501-12	EASA,FAA,CAAC,ANAC,CAA UK			73-11-04		Package C	TEST	PRE TEST AND TROUBLE SHOOTING	IN CONJUNCTION WITH PACKAGE LIGHT, MED	105.00	SR Technics Switzerland
133477	825501-8	EASA,FAA,ANAC,CAA UK			73-11-04		Package D	LIGHT	DISASSEMBLY,CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXC EXAMPLE: BODY RELIEF VALVE OR PISTON REL		2315.00	SR Technics Switzerland
133477	825501-9	EASA,FAA,ANAC,CAA UK			73-11-04		Package E	MEDIUM	DISASSEMBLY,CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXC EXAMPLE: SHAFT DRIVE MAIN REPLACEMENT		3175.00	SR Technics Switzerland
133477					73-11-04		Package F	HEAVY	DISASSEMBLY,CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXC EXAMPLE: BEARING THRUST OR HOUSING OR		4605.00	SR Technics Switzerland
133477					73-11-04		Package G	OVERHAUL	DISASSEMBLY,CLEANING, INSPECTION, ASSEMBLY AND FINAL TEST. EXCLUDED PIECE PART REPAIRS.		6230.00	SR Technics Switzerland
133477					73-11-04		Package SB00	711000-73-14	INTRODUCTION OF NEW MAIN STAGE BEARINGS	IN CONJUNCTION WITH HEAVY OR OV	115.00	SR Technics Switzerland
133477					73-11-04		Package SB01	711000-73-15	INTRODUCTION OF NEW FILTER COVER LOCKING NUTS	IN CONJUNCTION WITH LIGHT	115.00	SR Technics Switzerland
133477					73-11-04		Package SB02	711000-73-16	REPLACEMENT OF STATIONARY SHAFT SEAL PREFORMED PACKING	IN CONJUNCTION WITH LIGHT	115.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
133477					73-11-04		Package SB03	711000-73-13	INTRODUCTION OF ALTERNATIVE O-RING PACKINGS	IN CONJUNCTION WITH HEAVY OR OV	115.00	SR Technics Switzerland
133512	221-0051-511	EASA,FAA,CAAC,ANAC	21	35	78-10-04	EXHAUST NOZZLE ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		2080.00	SR Technics Switzerland
133512	221-0051-517	EASA,FAA,CAAC,ANAC			78-10-04		Package B	1	INCONEL SKIN CRACK		2670.00	SR Technics Switzerland
133512	221-0051-519	EASA,FAA,CAAC,ANAC			78-10-04		Package C	2	INCONEL SKIN TO CORE DELAMINATION		4315.00	SR Technics Switzerland
133512	221-0051-521	EASA,FAA,CAAC,ANAC			78-10-04		Package D	3	INCONEL PANEL SKIN REPAIR		3115.00	SR Technics Switzerland
133512	221-0051-523	EASA,FAA,CAAC,ANAC			78-10-04		Package J	9	NOZZLE OUTER BARREL TITANIUM SKIN		3400.00	SR Technics Switzerland
133512	221-0051-529	EASA,FAA,CAAC,ANAC			78-10-04		Package L	11	BARREL ALUMINUM SKIN FLUSH PATCH		3635.00	SR Technics Switzerland
133512	221-0051-533	EASA,FAA,CAAC,ANAC			78-10-04		Package O	14	NOZZEL BULKHEAD RING REPLACEMENT		10190.00	SR Technics Switzerland
133512	221-0051-535	EASA,FAA,CAAC,ANAC			78-10-04		Package P	15	PATCH SEAL SPRING DAMAGE TO AFT UPPER OUTER BARREL		7455.00	SR Technics Switzerland
133512	221-0051-537	EASA,FAA,CAAC,ANAC			78-10-04		Package T	INSP	CHECK AND REPLACE STOP-NUTS	ACC. 78-10-04-CHECK	3220.00	SR Technics Switzerland
133512	221-0066-101	EASA,FAA,CAAC,ANAC			78-10-04		Package U	INSP	REAPPLY DRY FILM LUBRICANT	ACC. 78-10-04-CHECK	400.00	SR Technics Switzerland
133512					78-10-04		Package V		REPLACE DEFECTIVE PARTS REFER TO IPL		255.00	SR Technics Switzerland
133514	221-4004-505	EASA,FAA,CAAC,ANAC	21	21	71-20-04	FWD ENGINE MOUNT - CROSSBEAM - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
133514					71-20-04		Package D	03	BUSHING REPLACEMENT		1945.00	SR Technics Switzerland
133514					71-20-04		Package F	05	BLEND NICKS, GOUGES AND SCRATCHES		470.00	SR Technics Switzerland
133525	221-4006-501	EASA,FAA,CAAC,ANAC	21	21	71-20-04	FWD ENGINE MOUNT - MAIN BEAM ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1145.00	SR Technics Switzerland
133525	221-4006-503	EASA,FAA,CAAC,ANAC,DUAL RELEASE EASA/TCCA			71-20-04		Package C	02	CROSS BEAM BOLT BUSHING REPLACEMENT		795.00	SR Technics Switzerland
133525					71-20-04		Package F	05	SURFACE DAMAGE BLEND REPAIR		910.00	SR Technics Switzerland
133525					71-20-04		Package G	06	SHEAR PIN BUSHING REPLACEMENT		1935.00	SR Technics Switzerland
134047			3	21	26-11-66	PW4 FIRE/OVERHEAT DETECTORS	Package B	TEST	PRE TEST		365.00	SR Technics Switzerland
134047					26-11-66		Package C	TEST	TEST		365.00	SR Technics Switzerland
134047					26-11-66		Package D		WELD-REPAIR OF CRACKED PART		145.00	SR Technics Switzerland
134047					26-11-66		Package E		REPLACEMENT REPAIR OF DAMAGED PART		135.00	SR Technics Switzerland
134047					26-11-66		Package F		OVERHAUL		605.00	SR Technics Switzerland
134178	51U714	EASA,FAA,CAAC,ANAC	19	21	71-22-00	AFT ENGINE MOUNT - ASSEMBLY - 100"	Package C		PREINSPECTION OF FORWARD ENGINE MOUNT ASSEMBLY	IN CONJUNCTION WITH PACKAGE LIGHT, MED	340.00	SR Technics Switzerland
134178	52U362	EASA,FAA,CAAC,ANAC			71-22-00		Package D	LIGHT	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PART REPAIRS		765.00	SR Technics Switzerland
134178	54T734	EASA,FAA,CAAC,ANAC			71-22-00		Package E	MEDIUM	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P EXAMPLE: LINK ASSY REPLACEMENT (2EA)		2190.00	SR Technics Switzerland
134178					71-22-00		Package F	HEAVY	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P EXAMPLE: REAR MOUNT SET REPLACEMENT		4040.00	SR Technics Switzerland
134178					71-22-00		Package G	OVERHAUL	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PART REPAIRS		4120.00	SR Technics Switzerland
134178					71-22-00		Package SB00	PW4G-100-71-7	IDENTIFICATION OF THE MOUNT ASSEMBLIES WITH A PART NUMBER A IN CONJUNCTION WITH PACKAGE LIGHT, MED		105.00	SR Technics Switzerland
134178					71-22-00		Package SB01	PW4G-100-71-8	INTRODUCTION OF NEW ENGINE MOUNT HARDWARE WITH ADDITION. IN CONJUNCTION WITH PACKAGE HEAVY OR C		105.00	SR Technics Switzerland
134180	75A001-11	EASA,FAA,CAAC,ANAC	23	21	78-11-12	PLUG ASSY OF EXHAUST - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		395.00	SR Technics Switzerland
134180	75A001-21	EASA,FAA,CAAC,ANAC			78-11-12		Package L	11	REMOVE AND REPL. PLUG END CAP		815.00	SR Technics Switzerland
134180					78-11-12		Package N	13	REMOVE BLIND RIVETS AND INSTALL SOLID RIVETS		1140.00	SR Technics Switzerland
134180					78-11-12		Package O	14	REMOVE AND REPL. BOLT CATCHER		1140.00	SR Technics Switzerland
134180					78-11-12		Package SB00	PW4G-100-78-96	REPLACE END CAP ATTACHMENT RIVETS TO IMPROVE DURABILITY	PART 001	1140.00	SR Technics Switzerland
135888	ST1264-05	EASA,FAA,CAAC,ANAC	4	28	72-34-00	PW4 BOLT FLANGE E	Package A	CLN/INSP	CLEANING & INSPECTION		80.00	SR Technics Switzerland
135888	ST5124-05	EASA,FAA,CAAC,ANAC			72-34-00		Package A	INSP-02	CHECK-02 AND REWORK OF FLANGE BOLTS		80.00	SR Technics Switzerland
135900	1A4447	EASA,FAA,CAAC,ANAC	25	28	72-35-78	HIGH PRESSURE COMPRESSOR (HPC) - ROD END BEARINGS	Package A	CLN/INSP	CLEANING AND INSPECTION		185.00	SR Technics Switzerland
135900					72-35-78		Package B	01	BEARING REPLACEMENT		335.00	SR Technics Switzerland
135902	50A193	EASA,FAA,CAAC,ANAC	27	28	72-54-85	TURBINE EXHAUST CASE - NO. 4 BEARING (COVER) SHIELD	Package A	CLN/INSP	CLEANING AND INSPECTION		250.00	SR Technics Switzerland
135902	50A656	EASA,FAA,CAAC,ANAC			72-54-85		Package B	01	CRACK BLEND REPAIR (FOR CRACKS 0.125 INCH (3.175 MM) OR LESS		170.00	SR Technics Switzerland
135902					72-54-85		Package C	01	CRACK WELD REPAIR (FOR CRACKS MORE THAN 0.125 INCH (3.175 MM)		690.00	SR Technics Switzerland
135905	50G547	EASA,FAA,CAAC,ANAC	26	28	72-34-52	INTERMEDIATE CASE - ANGLE GEARBOX (SUPPORT) BRACKET ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		335.00	SR Technics Switzerland
135905	52G153	EASA,FAA,CAAC,ANAC			72-34-52		Package B	01	NICKEL PLATE THE PIN DIAMETER		1000.00	SR Technics Switzerland
135905	52G409	EASA,FAA,CAAC,ANAC			72-34-52		Package C	02	REPAIR THE HOLE		1300.00	SR Technics Switzerland
135905					72-34-52		Package D	03	REPLACE THE BUSHING		325.00	SR Technics Switzerland
135905					72-34-52		Package SB00	PW4ENG 72-501	REPLACEMENT OF THE BRACKET ASSEMBLY FOR IMPROVED BOLT CLEARANCE		555.00	SR Technics Switzerland
135905					72-34-52		Package SB01	PW4ENG 72-692	MODIFICATION OF, TO ELIMINATE AN INTERFERENCE FIT BETWEEN THE BRACKET AND THE INTERMEDIATE CASE		700.00	SR Technics Switzerland
135911	50N286	EASA,FAA,CAAC,ANAC	27	28	72-53-16	LOW PRESSURE TURBINE (LPT) - STAGE 6 LPT DISK ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1250.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
135911	50N486-01	EASA,FAA,CAAC,ANAC			72-53-16		Package B	01	KNIFE-EDGE SEALS BLEND REPAIR		635.00	SR Technics Switzerland
135911	50N666-01	EASA,FAA,CAAC,ANAC,CAA UK			72-53-16		Package C	02	SURFACE DAMAGE BLEND REPAIR		910.00	SR Technics Switzerland
135911					72-53-16		Package D	03	FRONT FLANGE FACE PLASMA SPRAY REPAIR		4930.00	SR Technics Switzerland
135911					72-53-16		Package E	04	SNAP DIAMETER PLASMA SPRAY REPAIR		3825.00	SR Technics Switzerland
135911					72-53-16		Package F	05	RESTORE KNIFE-EDGE SEAL PLASMA COATING		3825.00	SR Technics Switzerland
135911					72-53-16		Package G	06	REPLACE FLANGE SEALS		905.00	SR Technics Switzerland
135911					72-53-16		Package P	15	SHOTPEEN REPAIR		610.00	SR Technics Switzerland
135911					72-53-16		Package SB00	AD 2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	1225.00	SR Technics Switzerland
135917	50T067	EASA,FAA,CAAC,ANAC	22	28	72-61-75	MAIN GEARBOX - OIL TANK SUMP ASSEMBLY	Package B	01	REPAIR OF SURFACE DAMAGE		310.00	SR Technics Switzerland
135917					72-61-75		Package C	02	WELD REPAIR OF CRACKS		505.00	SR Technics Switzerland
135931	50S813-01	EASA,FAA,CAAC,ANAC,CAA UK	44	35	72-35-10	HIGH PRESSURE COMPRESSOR (HPC) - DRUM ROTOR (REAR) DISK ASSE	Package A	CLN/INSP	CLEANING AND INSPECTION		2335.00	SR Technics Switzerland
135931	53H973-001	EASA,FAA,CAAC,ANAC			72-35-10		Package AJ	35	SURFACE DAMAGE BLEND REPAIR		1325.00	SR Technics Switzerland
135931	53H973-01	EASA,FAA,CAAC,ANAC			72-35-10		Package B	6	RESTORE KNIFE-EDGE SEAL PLASMA COAT		7520.00	SR Technics Switzerland
135931	54H803-001	EASA,FAA,CAAC,ANAC			72-35-10		Package C	4	SHOTPEEN BLADE SLOTS		1325.00	SR Technics Switzerland
135931	54H803-002	EASA,FAA,CAAC,ANAC			72-35-10		Package D	5	BLEND REPAIR TANGENTIAL SLOT RIM RAILS		1510.00	SR Technics Switzerland
135931	54H803-01	EASA,FAA,CAAC,ANAC			72-35-10		Package F	8	PLASMA SPRAY REPAIR REAR DRUM FRONT FLANGE SNAP DIAMETER		5005.00	SR Technics Switzerland
135931	56H013-001	EASA,FAA,CAAC,ANAC,CAA UK			72-35-10		Package G	9	PLASMA SPRAY REPAIR REAR DRUM REAR FLANGE SNAP DIAMETER		5005.00	SR Technics Switzerland
135931	56H013-01	EASA,FAA,CAAC,ANAC			72-35-10		Package H	12	PLASMA SPRAY BRUSH SEAL LAND		4835.00	SR Technics Switzerland
135931	58H236-01	EASA,FAA,CAAC,ANAC			72-35-10		Package I	13	BLEND LOCK SCREW DAMAGE IN BLADE SLOTS		2010.00	SR Technics Switzerland
135931					72-35-10		Package J	14	BLEND REPAIR SURFACE DAMAGE		1380.00	SR Technics Switzerland
135931					72-35-10		Package K	15	BLEND REPAIR DAMAGED KNIFE-EDGE SEALS		1365.00	SR Technics Switzerland
135931					72-35-10		Package SB00	AD 2005-25-09	FPI LIFE-LIMITED PART, HPC REAR DRUM		335.00	SR Technics Switzerland
135931					72-35-10		Package SB01	PW4ENG 72-565	BLADES, 14TH AND 15TH STAGE - MODIFICATION TO PROVIDE IMPROVED PLATFORM CLEARANCE AND BLADE LOCKIN		5005.00	SR Technics Switzerland
135931					72-35-10		Package SB03	PW4G-100-72-186	FPI OF THE 13TH, 14TH, AND 15TH STAGE BLADE LOADING AND LOCKIN AD 2012-18-17		500.00	SR Technics Switzerland
135931					72-35-10		Package SB04	PW4ENG 72-796	FPI OF THE 13TH, 14TH, AND 15TH STAGE BLADE LOADING AND LOCKIN AD 2012-18-17		500.00	SR Technics Switzerland
135931					72-35-10		Package SB05	PW4ENG 72-816	SEAL 13TH, 14TH AND 15TH STAGE - REPLACEMENT OF AND INTRODUC TO IMPROVE REAR DRUM ROTOR DURABILITY		875.00	SR Technics Switzerland
135931					72-35-10		Package SB05	PW4G-100-72-240	REPLACEMENT, INTRODUCTION OF A NEW SHOT PEEN SPECIFICATION, TO IMPROVE REAR DRUM ROTOR DURABILITY		875.00	SR Technics Switzerland
135931					72-35-10		Package SB06	PW4G-100-72-8	BLADES, 14TH AND 15TH STAGE - MODIFICATION TO PROVIDE IMPROVED PLATFORM CLEARANCE AND BLADE LOCKIN		5005.00	SR Technics Switzerland
135938	51T430	EASA,FAA,CAAC,ANAC	4	28	72-61-99	MOUNT IGNITION EXCITER	Package A	CLN/INSP	CLEANING AND INSPECTION		390.00	SR Technics Switzerland
135938	52U565-01	EASA,FAA,CAAC,ANAC			72-61-99		Package B	SPM	REPLACE MOUNT RESILIENT	SPM 70-43-00 RIVETING	460.00	SR Technics Switzerland
135956	57R000-006	EASA,FAA,CAAC,ANAC	30	28	72-61-10	MAIN GEARBOX - GEARBOX HOUSING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		2075.00	SR Technics Switzerland
135956	57R000-008	EASA,FAA,CAAC,ANAC			72-61-10		Package AA	26	REPAIR THE IDG GEARSHAFT FRONT BORE WITH A BUSHING		2495.00	SR Technics Switzerland
135956	57R000-010	EASA,FAA,CAAC,ANAC			72-61-10		Package AB	27	REPAIR THE SCAV. PUMP DR. GEARS. BEARING HOUS. BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956	57R000-012	EASA,FAA,CAAC,ANAC			72-61-10		Package AC	28	REPAIR THE EEC OIL NOZZLE BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956	70RS27	EASA,FAA,CAAC,ANAC			72-61-10		Package AD	29	REPAIR THE SCAVENGE PUMP BORE WITH PLASMA		3020.00	SR Technics Switzerland
135956	70R900-04	EASA,FAA,CAAC,ANAC			72-61-10		Package AE	30	REPAIR THE SCAVENGE PUMP MATING FACE WITH PLASMA		3160.00	SR Technics Switzerland
135956	71R000-09	EASA,FAA,CAAC,ANAC			72-61-10		Package AF	31	REPAIR THE REAR HYDR. PUMP BEARING BORE WITH PLASMA		3160.00	SR Technics Switzerland
135956	71R041	EASA,FAA,CAAC,ANAC			72-61-10		Package AH	33	REPAIR THE GEARBOX CENTER MOUNT BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956	71R135	EASA,FAA,CAAC,ANAC,CAA UK			72-61-10		Package AI	34	REPAIR THE SCAV. PUMP GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956	71R156	EASA,FAA,CAAC,ANAC			72-61-10		Package AJ	35	REPAIR THE SCAV. PUMP DRIVE GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package AK	36	INSTALL GEARBOX HOUSING ON MACHINE FIXTURE		70.00	SR Technics Switzerland
135956					72-61-10		Package AL	37	STUD AND LOCK RING REPLACEMENT		2435.00	SR Technics Switzerland
135956					72-61-10		Package AN	41	STUD HOLE THREAD DAMAGE HELICAL COIL INSERT REPAIR		1070.00	SR Technics Switzerland
135956					72-61-10		Package B	01	REPLACE LOCATING PIN		595.00	SR Technics Switzerland
135956					72-61-10		Package C	02	REPLACE HELICAL COIL INSERTS		630.00	SR Technics Switzerland
135956					72-61-10		Package D	03	APPLY ANODIZED TOUCH-UP		430.00	SR Technics Switzerland
135956					72-61-10		Package E	04	REPLACE THE BUSHINGS IN THE MOUNT CLEVIS		2805.00	SR Technics Switzerland
135956					72-61-10		Package F	05	REPAIR THE FUEL PUMP BEARING HOUSING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package G	06	REPAIR THE REAR HYDR. PUMP BEARING HOUSING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package H	07	REPAIR THE FUEL PUMP GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
135956					72-61-10		Package I	08	REPAIR THE STARTER DRIVE GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package J	09	REPAIR THE STARTER DRIVE GEARSHAFT BEARING HOUSING WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package K	10	REPAIR THE DRIVESHAFT HOUSING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package L	11	REPAIR THE DRIVESHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package M	12	REPAIR THE IDG GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package N	13	REPAIR THE IDG COVER BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package O	14	REPAIR THE IDG BEARING HOUSING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package P	15	REPAIR THE IDLER SHAFT FRONT BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package Q	16	REPAIR THE IDLER REAR FRONT BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package R	17	REPAIR THE DEOILER BEARING HOUSING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package S	18	REPAIR THE DEOILER GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package SB00	79-56	INCORPORATION OF AN OIL FILLER NECK BRACE		135.00	SR Technics Switzerland
135956					72-61-10		Package SB01	PWAENG 72-802	MODIFICATION AND REPLACEMENT TO IMPROVE DURABILITY		970.00	SR Technics Switzerland
135956					72-61-10		Package SB02	PWAENG 72-832	GEARSHAFT SCREWS - REPLACEMENT OF, TO IMPROVE SCREW RETENTION		160.00	SR Technics Switzerland
135956					72-61-10		Package T	19	REPAIR THE DEOILER CARBON SEAL BORE WITH A BUSHING		2560.00	SR Technics Switzerland
135956					72-61-10		Package U	20	REPAIR THE OIL FILTER TRANSFER TUBE HOLES WITH BUSHINGS		2290.00	SR Technics Switzerland
135956					72-61-10		Package V	21	REPAIR THE OIL TANK BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package W	22	REPAIR THE SCAVENGE PUMP GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package X	23	REPAIR THE SCAV. PUMP DRIVE GEARSHAFT BEARING BORE WITH A BUSHING		2290.00	SR Technics Switzerland
135956					72-61-10		Package Y	24	REPAIR THE EEC OIL NOZZLE FRONT BORE WITH A BUSHING		1630.00	SR Technics Switzerland
135956					72-61-10		Package Z	25	REPAIR THE EEC HOUSING BORE WITH A BUSHING		2205.00	SR Technics Switzerland
135966	50A593	EASA,FAA,CAAC,ANAC	30	28	72-32-80	LPC/LPT COUPLING - TURBINE SHAFT (COUPLING RETAINING) NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		540.00	SR Technics Switzerland
135966					72-32-80		Package B	01	ANTIGALLANT REPLACEMENT		1550.00	SR Technics Switzerland
135966					72-32-80		Package C	02	RESTORE CORROSION PREVENTIVE VARNISH		460.00	SR Technics Switzerland
135966					72-32-80		Package D	03	CHROME PLATE REPLACEMENT		1295.00	SR Technics Switzerland
135966					72-32-80		Package E	04	SURFACE DAMAGE BLEND REPAIR		730.00	SR Technics Switzerland
136090	70R106	EASA,FAA,CAAC,ANAC	23	28	72-61-42	MAIN GEARBOX - GEARBOX (SCAVENGE PUMP DRIVE) BEARING HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		430.00	SR Technics Switzerland
136090	70R672	EASA,FAA,CAAC,ANAC			72-61-42		Package C	02	ANODIZE TOUCH-UP		240.00	SR Technics Switzerland
136090	70R682	EASA,FAA,CAAC,ANAC			72-61-42		Package D	03	NICKEL PLATE THE BEARING JOURNAL		565.00	SR Technics Switzerland
136090					72-61-42		Package E	04	NICKEL PLATE THE OUTSIDE BORE		565.00	SR Technics Switzerland
136090					72-61-42		Package F	05	NICKEL PLATE THE OD		615.00	SR Technics Switzerland
136090					72-61-42		Package G	06	REPAIR THE FRONT ID WITH A BUSHING		555.00	SR Technics Switzerland
136090					72-61-42		Package H	07	REPAIR THE REAR ID WITH A BUSHING		555.00	SR Technics Switzerland
136090					72-61-42		Package SB00	40	GEARSHAFT SCREWS - REPLACEMENT OF, TO IMPROVE SCREW RETENTION		160.00	SR Technics Switzerland
136091	70R105	EASA,FAA,CAAC,ANAC	17	28	72-61-12	MAIN GEARBOX - GEARBOX (DEOILER) BEARING HOUSING ASSEMBLY	Package B	01	ANODIZE TOUCH UP		235.00	SR Technics Switzerland
136091					72-61-12		Package C	02	REPLACE HELICAL COIL INSERTS		280.00	SR Technics Switzerland
136091					72-61-12		Package D	03	NICKEL PLATE THE OD		1085.00	SR Technics Switzerland
136091					72-61-12		Package E	04	REPAIR THE SMALL ID WITH A BUSHING		780.00	SR Technics Switzerland
136092	70R050	EASA,FAA,CAAC,ANAC	23	21	72-61-57	MAIN GEARBOX - GEARBOX DRIVESHAFT PRESSURE TUBE ASSEMBLY	Package B	01	REPLACE ANTIGALLANT		565.00	SR Technics Switzerland
136094	50G003	EASA,FAA,CAAC,ANAC	23	28	72-62-12	ANGLE GEARBOX - GEARBOX DRIVESHAFT HOUSING ASSEMBLY	Package B	01	ANODIZE TOUCH-UP		145.00	SR Technics Switzerland
136094					72-62-12		Package C	02	SURFACE DAMAGE BLEND REPAIR		465.00	SR Technics Switzerland
136094					72-62-12		Package C	10	SURFACE DAMAGE BLEND REPAIR		465.00	SR Technics Switzerland
136094					72-62-12		Package D	03	REPLACE HELICAL COIL INSERTS		190.00	SR Technics Switzerland
136094					72-62-12		Package E	04	NICKEL PLATE REPAIR THE REAR FACE		1105.00	SR Technics Switzerland
136094					72-62-12		Package F	05	NICKEL PLATE REPAIR THE REAR ID		1105.00	SR Technics Switzerland
136094					72-62-12		Package G	06	NICKEL PLATE REPAIR THE FRONT FACE		1105.00	SR Technics Switzerland
136094					72-62-12		Package H	07	NICKEL PLATE REPAIR THE FRONT OD		1105.00	SR Technics Switzerland
136094					72-62-12		Package I	08	REAR BEARING JOURNAL BUSHING REPAIR		2755.00	SR Technics Switzerland
136094					72-62-12		Package J	09	FRONT BEARING JOURNAL BUSHING REPAIR		2085.00	SR Technics Switzerland
137363	50A026	EASA,FAA,CAAC,ANAC	26	28	72-35-95	HIGH PRESSURE COMPRESSOR (HPC) - NO. 2 BEARING RETAINING NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		470.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137363					72-35-95		Package B	01	RESTORE ANTIGALLANT		415.00	SR Technics Switzerland
137365	50A349	EASA,FAA,CAAC,ANAC	3	21	72-09-73	PW4 BRACKET, ASSY OF TRANSDUCER	Package A	CLN/INSP	CLEANING & INSPECTION		190.00	SR Technics Switzerland
137365	50A653	EASA,FAA,CAAC,ANAC			72-09-73		Package B		DOWEL PIN REPLACEMENT		605.00	SR Technics Switzerland
137367	50B040	EASA,FAA,CAAC,ANAC	29	28	72-31-15	LOW PRESSURE COMPRESSOR (LPC) - BEARING (INNER RACE) RETAININ	Package A	CLN/INSP	CLEANING AND INSPECTION		730.00	SR Technics Switzerland
137367					72-31-15		Package B	01	REPLACE SILVER PLATE	INCL. CLEANING AND INSPECTION	1370.00	SR Technics Switzerland
137368	50A222	EASA,FAA,CAAC,ANAC	26	28	72-32-04	LPC/LPT COUPLING - NO. 1.5 BEARING (INNER RACE) RETAINING NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		710.00	SR Technics Switzerland
137368					72-32-04		Package B	01	ANTIGALLANT REPLACEMENT		610.00	SR Technics Switzerland
137370	50A357	EASA,FAA,CAAC,ANAC	24	21	72-34-42	INTERMEDIATE CASE - MAIN BEARING (OUTER) SCAVENGE TUBE ASSE	Package A	CLN/INSP	CLEANING AND INSPECTION		270.00	SR Technics Switzerland
137371	50A353	EASA,FAA,CAAC,ANAC	25	21	72-34-25	INTERMEDIATE CASE - MAIN BEARING (OIL) PRESSURE TUBE ASSEMBL	Package A	CLN/INSP	CLEANING AND INSPECTION		435.00	SR Technics Switzerland
137372	50A609	EASA,FAA,CAAC,ANAC	9	28	72-34-30	PW4 NOZZLE OF #2 BEARING (100")	Package A	CLN/INSP	CLEANING AND INSPECTION		650.00	SR Technics Switzerland
137372	52A022-01	EASA,FAA,CAAC,ANAC			72-34-30		Package SB00	72-116	BRG 1.5/2, MODIFICATION FOR LESS WEAR		350.00	SR Technics Switzerland
137373	50A566	EASA,FAA,CAAC,ANAC	30	28	72-34-81	INTERMEDIATE CASE - NO. 1 BEARING REAR SUPPORT ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		455.00	SR Technics Switzerland
137373	50A639	EASA,FAA,CAAC,ANAC			72-34-81		Package B	01	ANODIZE TOUCH-UP		500.00	SR Technics Switzerland
137373	50A640	EASA,FAA,CAAC,ANAC			72-34-81		Package B	INSP-03	BLEND REPAIR		500.00	SR Technics Switzerland
137373					72-34-81		Package C	02	OIL PRESSURE MANIFOLD SUPPORT BRACKET REPLACEMENT		860.00	SR Technics Switzerland
137373					72-34-81		Package D	03	PLASMA SPRAY THE FRONT SUPPORT MATING DIAMETER		1975.00	SR Technics Switzerland
137373					72-34-81		Package E	04	PLASMA SPRAY THE FRONT OUTER DIAMETER		1975.00	SR Technics Switzerland
137373					72-34-81		Package F	05	PLASMA SPRAY THE REAR OUTER DIAMETER		1975.00	SR Technics Switzerland
137373					72-34-81		Package G	06	OIL PRESSURE MANIFOLD SUPPORT BRACKET BUSHING REPLACEMENT		1080.00	SR Technics Switzerland
137373					72-34-81		Package Q	16	BOLT HOLE BLEND REPAIR		550.00	SR Technics Switzerland
137373					72-34-81		Package R	17	REPAIR FRONT FLANGE BOLT HOLES		1115.00	SR Technics Switzerland
137373					72-34-81		Package S	18	REPAIR REAR FLANGE BOLT HOLES		1115.00	SR Technics Switzerland
137378	50G327	EASA,FAA,CAAC,ANAC	29	28	72-34-08	INTERMEDIATE CASE - SHOULDER STUD (NO. 2 BEARING DAMPER)	Package A	CLN/INSP	CLEANING AND INSPECTION		80.00	SR Technics Switzerland
137378	51G824	EASA,FAA,CAAC,ANAC			72-34-08		Package B	01	BLEND REPAIR		125.00	SR Technics Switzerland
137403	50J093	EASA,FAA,CAAC,ANAC	26	21	72-41-30	DIFFUSER AND COMBUSTOR - NO. 3 BEARING ELBOW ASSEMBLY (NO.	Package A	CLN/INSP	CLEANING AND INSPECTION		185.00	SR Technics Switzerland
137403					72-41-30		Package B	01	CHROMIUM PLATE ID SEAL LAND		2155.00	SR Technics Switzerland
137403					72-41-30		Package C	02	NICKEL PLATE REAR OD PILOT DIAMETER		2060.00	SR Technics Switzerland
137403					72-41-30		Package D	03	SHIELD WELD BEAD REPAIR		695.00	SR Technics Switzerland
137403					72-41-30		Package E	04	SHIELD CRACK WELD REPAIR		780.00	SR Technics Switzerland
137406	50J233	EASA,FAA,CAAC,ANAC	16	21	72-41-28	DIFFUSER AND COMBUSTOR - SEAL RING TRANSFER (NO. 3 BEARING C)	Package A	CLN/INSP	CLEANING AND INSPECTION		250.00	SR Technics Switzerland
137406	50J916	EASA,FAA,CAAC,ANAC			72-41-28		Package C	02	CHROMIUM PLATE SEAL RING TRANSFER TUBEINSIDE DIAMETER FOR WEAR GREATER THAN 1.2015 INCHES [30.518MM]		1965.00	SR Technics Switzerland
137406					72-41-28		Package D	03	REPAIR SEAL RING GROOVE		255.00	SR Technics Switzerland
137406					72-41-28		Package E	04	REPAIR SEAL LANDS		920.00	SR Technics Switzerland
137406					72-41-28		Package F	05	REPAIR SEAL RING GROOVE		170.00	SR Technics Switzerland
137406					72-41-28		Package G	06	SEAL LANDS WELD REPAIR		1550.00	SR Technics Switzerland
137409	50J248	EASA,FAA,CAAC,ANAC	27	21	72-41-23	DIFFUSER AND COMBUSTOR -TURBINE COOLING DUCT SENSING TUBE	Package A	CLN/INSP	CLEANING AND INSPECTION		435.00	SR Technics Switzerland
137409	50J927-01	EASA,FAA,CAAC,ANAC			72-41-23		Package C	02	APPLY ANTIGALLANT		650.00	SR Technics Switzerland
137409					72-41-23		Package D	03	CHROMIUM PLATE PROBE		1050.00	SR Technics Switzerland
137409					72-41-23		Package E	04	REPAIR SEAL RING GROOVE		540.00	SR Technics Switzerland
137409					72-41-23		Package E	05	REPAIR SEAL RING GROOVE		540.00	SR Technics Switzerland
137409					72-41-23		Package G	06	WELD REPAIR SEAL LANDS AND SEAL RING GROOVE		1065.00	SR Technics Switzerland
137413	50J366	EASA,FAA,CAAC,ANAC	31	21	72-41-24	DIFFUSER AND COMBUSTOR - NO. 3 BEARING OIL VENT (INNER) TUBE	Package A	CLN/INSP	CLEANING AND INSPECTION		190.00	SR Technics Switzerland
137413	50J922-01	EASA,FAA,CAAC,ANAC			72-41-24		Package C	02	REPAIR SEAL RING GROOVE		370.00	SR Technics Switzerland
137413					72-41-24		Package E	04	WELD REPAIR SEAL LANDS AND SEAL RING GROOVE		1065.00	SR Technics Switzerland
137417	50K109	EASA,FAA,CAAC,ANAC	26	28	72-51-06	TURBINE NOZZLE - STAGE 1 HPT DUCT SEGMENT	Package A	CLN/INSP	CLEANING AND INSPECTION		130.00	SR Technics Switzerland
137417					72-51-06		Package B	01	SHIPLAP WEAR WELD REPAIR		845.00	SR Technics Switzerland
137417					72-51-06		Package C	02	SURFACE DAMAGE BLEND REPAIR		305.00	SR Technics Switzerland
137418	53L033	EASA,FAA,CAAC,ANAC	26	28	72-52-15	HIGH PRESSURE TURBINE (HPT) - STAGE 1 HPT (BLADE) AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		450.00	SR Technics Switzerland
137418					72-52-15		Package SB00	PWAENG 72-636	MODIFICATION OF TO IMPROVE LOW CYCLE FATIGUE OF THE SECOND STAGE HPT AIR SEAL		305.00	SR Technics Switzerland
137418					72-52-15		Package SB01	PW4G-100-72-93	MODIFICATION OF TO IMPROVE LOW CYCLE FATIGUE OF THE SECOND STAGE HPT AIR SEAL		305.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137419	50L246-01	EASA,FAA,CAAC,ANAC	18	28	72-52-36	HIGH PRESSURE TURBINE (HPT) - STAGE 2 HPT (DUCT) BAND SEGMENT	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
137419					72-52-36		Package B	001	STAGE 2 HPT (DUCT) BAND SEGMENT ASSEMBLY		680.00	SR Technics Switzerland
137426	50N130-01	EASA,FAA,CAAC,ANAC	24	28	72-53-55	LOW PRESSURE TURBINE (LPT) - TURBINE CASE (STAGE 6 VANE) HEAT	Package A	CLN/INSP	CLEANING AND INSPECTION		250.00	SR Technics Switzerland
137426					72-53-55		Package B	01	DAMAGE AREA PATCH REPAIR	PRICE PER UNIT	540.00	SR Technics Switzerland
137436	70R101	EASA,FAA,CAAC,ANAC	3	28	72-61-16	PW4 GEARBOX DEOILER IMPELLER LOCK	Package B	01	REPAIR SURFACE DAMAGE BY MACHINING		150.00	SR Technics Switzerland
137436					72-61-16		Package C	02	PLATE THE TABS WITH NICKEL		380.00	SR Technics Switzerland
137442	217346	EASA,FAA,CAAC,ANAC	12	21	73-11-04	FUEL PUMP - 94" - SHAFT DRIVE MAIN	Package A		CRACK INSPECTION, MPI	ACCORDING CMM	235.00	SR Technics Switzerland
137535			22	21	75-37-00	TUBES-DIFFUSER AIR VENT SEAL	Package AN		REPLACE INSERT	ACCORDING SPM SPOP 415	540.00	SR Technics Switzerland
137535					75-37-00		Package SB00	PW4ENG 72-232	MODIFICATION OF TO INCORPORATE A THICKER FLANGE		1135.00	SR Technics Switzerland
137539	50B023	EASA,FAA,CAAC,ANAC	35	28	72-31-11	LOW PRESSURE COMPRESSOR (LPC) - STAGE 4 DUCT	Package A	CLN/INSP	CLEANING AND INSPECTION		1005.00	SR Technics Switzerland
137539	50B023-001	EASA,FAA,CAAC,ANAC			72-31-11		Package B	01	ANODIZE TOUCH-UP LPC STAGE 4 DUCT		370.00	SR Technics Switzerland
137539	50B227	EASA,FAA,CAAC,ANAC			72-31-11		Package C	02	REPLACE SILICONE RUBBER RUBSTRIP		3495.00	SR Technics Switzerland
137539	50B230	EASA,FAA,CAAC,ANAC			72-31-11		Package F	05	PLASMA SPRAY LPC STAGE 4 DUCT FRONT ID SNAP DIAMETER		2125.00	SR Technics Switzerland
137539	51B150	EASA,FAA,CAAC,ANAC			72-31-11		Package G	06	SILICONE RUBBER AIRSEAL REPAIR - LPC STAGE 4 DUCT		2815.00	SR Technics Switzerland
137539	51B154	EASA,FAA,CAAC,ANAC			72-31-11		Package J	09	BOLT HOLE FUSION WELD REPAIR		810.00	SR Technics Switzerland
137539					72-31-11		Package L	11	FUSION WELD REPAIR		3755.00	SR Technics Switzerland
137539					72-31-11		Package M	12	BENT FLANGE STRAIGHTENING REPAIR		2565.00	SR Technics Switzerland
137539					72-31-11		Package O	14	HOOK CRACKS AND GASPETH FOD DAMAGE WELD REPAIR	PW 94 INCH	6220.00	SR Technics Switzerland
137539					72-31-11		Package P	15	O-RING GROOVE FLANGE WELD REPAIR		2125.00	SR Technics Switzerland
137539					72-31-11		Package S	18	BLEND REPAIR		600.00	SR Technics Switzerland
137539					72-31-11		Package SB00	PW4ENG 72-39	MODIFICATION OF 4TH STAGE LPC DUCT AND INNER FAN EXIT CASE		910.00	SR Technics Switzerland
137539					72-31-11		Package SB01	PW4ENG 72-666	LPC IMPROVED RUBBER AIRSEAL MODIFICATION		3495.00	SR Technics Switzerland
137539					72-31-11		Package SB02	PW4G-100-72-119	LPC STATOR RUBBER REPLACEMENT		2315.00	SR Technics Switzerland
137539					72-31-11		Package T	19	OUTER DIAMETER LUG DAMAGE WELD REPAIR		1940.00	SR Technics Switzerland
137541	50B422	EASA,FAA,CAAC,ANAC	28	28	72-31-08	LOW PRESSURE COMPRESSOR (LPC) - DRUM ROTOR DISK ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1390.00	SR Technics Switzerland
137541	51B022-01	EASA,FAA,CAAC,ANAC,CAA UK			72-31-08		Package B	01	STRAIGHTEN KNIFE-EDGE SEAL		1275.00	SR Technics Switzerland
137541	53B200-01	EASA,FAA,CAAC,ANAC			72-31-08		Package C	02	BLEND REPAIR KNIFE EDGE SEAL		945.00	SR Technics Switzerland
137541					72-31-08		Package D	03	SURFACE DAMAGE BLEND REPAIR		2100.00	SR Technics Switzerland
137541					72-31-08		Package E	04	BLEND REPAIR BALANCE FLANGE		885.00	SR Technics Switzerland
137541					72-31-08		Package H	07	PLASMA SPRAY FRONT SNAP DIAMETER		4810.00	SR Technics Switzerland
137541					72-31-08		Package I	08	REPAIR TIEROD HOLES		3415.00	SR Technics Switzerland
137541					72-31-08		Package J	09	SHOTPEEN DRUM ROTOR DISK SLOTS		3815.00	SR Technics Switzerland
137541					72-31-08		Package L	11	BALANCE COUNTERWEIGHT REMOVAL AND INSTALLATION REPAIR		540.00	SR Technics Switzerland
137541					72-31-08		Package SB00	PW4ENG 72-665	REPETITIVE EDDY CURRENT INSPECTION OF THE BLADE LEADING EDGE ONLY BLADED DISK		885.00	SR Technics Switzerland
137542	50K044	EASA,FAA,CAAC,ANAC	20	28	72-51-01	TURBINE NOZZLE - STAGE 1 (VANE) HPT SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		890.00	SR Technics Switzerland
137542	50K107	EASA,FAA,CAAC,ANAC			72-51-01		Package AC	28	ANTI-ROTATION LOCK BOLT HOLE WELD REPAIR		1460.00	SR Technics Switzerland
137542	50K128	EASA,FAA,CAAC,ANAC			72-51-01		Package AE	30	SUPPORT FORWARD LIP PLASMA COAT REPAIR		2010.00	SR Technics Switzerland
137542	50K131	EASA,FAA,CAAC,ANAC			72-51-01		Package B	01	VANE RETAINING SLOTS WELD REPAIR		2150.00	SR Technics Switzerland
137542	50K182	EASA,FAA,CAAC,ANAC			72-51-01		Package C	02	REAR OUTER FACE PLASMA SPRAY REPAIR		1455.00	SR Technics Switzerland
137542	50K184	EASA,FAA,CAAC,ANAC			72-51-01		Package E	04	REAR INNER SEAL FACE PLASMA COAT REPAIR		3615.00	SR Technics Switzerland
137542	50K358-01	EASA,FAA,CAAC,ANAC			72-51-01		Package H	07	STAGE 1 HPT SEAL REPLACEMENT REPAIR		360.00	SR Technics Switzerland
137542	50K613	EASA,FAA,CAAC,ANAC			72-51-01		Package I	08	ANTI-ROTATION LUG CRACK WELD REPAIR		1750.00	SR Technics Switzerland
137542					72-51-01		Package K	10	DISASSEMBLE AND ASSEMBLE THE SUPPORT ASSEMBLY REPAIR		720.00	SR Technics Switzerland
137542					72-51-01		Package L	11	FRONT INNER DIAMETER PLASMA SPRAY REPAIR		4795.00	SR Technics Switzerland
137542					72-51-01		Package L	12	VANE RETAINING SLOTS WELD REPAIR		4795.00	SR Technics Switzerland
137542					72-51-01		Package L	15	ANTIROTATION LOCK LUG CRACK WELD REPAIR		4795.00	SR Technics Switzerland
137542					72-51-01		Package Q	16	REAR OUTER FACE PLASMA SPRAY REPAIR		3180.00	SR Technics Switzerland
137542					72-51-01		Package T	19	FRONT INNER FACE PLASMA SPRAY REPAIR		3455.00	SR Technics Switzerland
137542					72-51-01		Package U	20	REAR OUTER FACE PLASMA SPRAY REPAIR		3110.00	SR Technics Switzerland
137542					72-51-01		Package Z	25	MATING FACE PLASMA COAT REPAIR		2610.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137544	50D496	EASA,FAA,CAAC,ANAC	31	28	72-33-01	FAN CASE - ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1155.00	SR Technics Switzerland
137544	50D728	EASA,FAA,CAAC,ANAC			72-33-01		Package B	01	REPLACE FAN CASE ASSEMBLY LOCATING PIN		370.00	SR Technics Switzerland
137544	50D923-001	EASA,FAA,CAAC,ANAC			72-33-01		Package C	02	BLEND SURFACE DAMAGE REPAIR		1885.00	SR Technics Switzerland
137544	50D959	EASA,FAA,CAAC,ANAC			72-33-01		Package D	03	RUBSTRIP REPAIR		2800.00	SR Technics Switzerland
137544	51D707	EASA,FAA,CAAC,ANAC			72-33-01		Package E	04	PLASMA SPRAY THE REAR SNAP DIAMETER		1645.00	SR Technics Switzerland
137544					72-33-01		Package F	05	REPAIR DUCT SEGMENT HOLES		2820.00	SR Technics Switzerland
137544					72-33-01		Package G	06	REPAIR DUCT SEGMENT CRACKS		2820.00	SR Technics Switzerland
137544					72-33-01		Package H	07	REPAIR DUCT SEGMENT SURFACE DAMAGE WITH POTTING COMPOUND		2820.00	SR Technics Switzerland
137544					72-33-01		Package I	08	REPLACE SOME OF THE DUCT SEGMENTS		5010.00	SR Technics Switzerland
137544					72-33-01		Package J	09	REPLACE ALL DUCT SEGMENTS		13835.00	SR Technics Switzerland
137544					72-33-01		Package SB01	PW4ENG 72-671	INSPECTION THE DUCT SEGMENT RECESS OF THE FAN CASE FOR TOOL MARKS		280.00	SR Technics Switzerland
137544					72-33-01		Package SB04	000913-ED01	FAN EXIT GUIDE VANES-LEADING EDGE METAL SHIELD REPLACEMENT ED R.ESEE.000913-ED01		970.00	SR Technics Switzerland
137544					72-33-01		Package SB05	PW4ENG 72-489	INTRODUCTION OF DUCT SEGMENTS WITH INTERRUPTED CIRCUMFERENTIAL GROOVE		6840.00	SR Technics Switzerland
137545	50G506	EASA,FAA,CAAC,ANAC	21	28	72-34-12	INTERMEDIATE CASE - GEARBOX DRIVE BEVEL GEAR	Package A	CLN/INSP	CLEANING AND INSPECTION		525.00	SR Technics Switzerland
137545					72-34-12		Package B	01	BEARING JOURNAL DIAMETER CHROMIUM PLATE REPAIR		4730.00	SR Technics Switzerland
137545					72-34-12		Package C	02	INNER DIAMETER CHROMIUM PLATE REPAIR		5885.00	SR Technics Switzerland
137545					72-34-12		Package D	03	BEARING JOURNAL DIAMETER GROWTH REPAIR		790.00	SR Technics Switzerland
137547	51G174	EASA,FAA,CAAC,ANAC	32	28	72-34-50	INTERMEDIATE CASE - FOURTH STAGE COMPRESSOR STATOR ASSEMB	Package A	CLN/INSP	CLEANING AND INSPECTION		775.00	SR Technics Switzerland
137547	51G174-002	EASA,FAA,CAAC,ANAC			72-34-50		Package AC	20	SEALANT TOUCH-UP REPAIR		1815.00	SR Technics Switzerland
137547	51G774	EASA,FAA,CAAC,ANAC			72-34-50		Package B	01	TOUCH-UP PROTECTIVE COATING		560.00	SR Technics Switzerland
137547	51G774-001	EASA,FAA,CAAC,ANAC			72-34-50		Package C	02	REPLACE PIN		595.00	SR Technics Switzerland
137547	51G874	EASA,FAA,CAAC,ANAC			72-34-50		Package D	03	BLEND STATOR VANES REPAIR	REP.01 INCLUDED	1340.00	SR Technics Switzerland
137547	51G874-001	EASA,FAA,CAAC,ANAC			72-34-50		Package G	06	WELD THE LUGS ON THE OUTER SHROUD	REP.01 INCLUDED	3205.00	SR Technics Switzerland
137547	52G274	EASA,FAA,CAAC,ANAC			72-34-50		Package H	07	REPLACE VANES		6940.00	SR Technics Switzerland
137547	53G074	EASA,FAA,CAAC,ANAC			72-34-50		Package K	08	SMOOTH DAMAGE ON THE INNER SHROUD LUGS	REP.01 INCLUDED	1545.00	SR Technics Switzerland
137547					72-34-50		Package O	09	REPLACE VANES		4580.00	SR Technics Switzerland
137547					72-34-50		Package R	10	BLEND STATOR VANES (TITANIUM) REPAIR		1400.00	SR Technics Switzerland
137547					72-34-50		Package SB00	PW4ENG 72-819	REPLACEMENT OR MODIFICATION OF, TO INCORPORATE A BOLT LOCKING FEATURE		1240.00	SR Technics Switzerland
137547					72-34-50		Package SB01	PW4ENG 72-454	IMPROV.TH-INNER SHROUD		270.00	SR Technics Switzerland
137547					72-34-50		Package U	14	VANE RUBBER REPAIR	SEAL INNER SHROUD VANE	4175.00	SR Technics Switzerland
137547					72-34-50		Package V	14	VANE RUBBER REPAIR	SEAL OUTER SHROUD VANE	3890.00	SR Technics Switzerland
137547					72-34-50		Package W	15	BLEND THE OUTER SHROUD SURFACE DAMAGED		855.00	SR Technics Switzerland
137547					72-34-50		Package X	18	REMOVAL OF REMAINING CORROSION REPAIR		695.00	SR Technics Switzerland
137549	50H021	EASA,FAA,CAAC,ANAC	4	28	72-35-31	PW4 HPC INLET AIRSEAL	Package A	CLN/INSP	CLEANING & INSPECTION		835.00	SR Technics Switzerland
137549	56H279	EASA,FAA,CAAC,ANAC			72-35-31		Package B	02	BLEND REPAIR KNIFE EDGE SEAL		175.00	SR Technics Switzerland
137549					72-35-31		Package C	04	PLASMA SPRAY REPAIR SNAP DIAMETER		2795.00	SR Technics Switzerland
137549					72-35-31		Package D	06	REPAIR OF DAMAGED BALANCE FLANGE		920.00	SR Technics Switzerland
137549					72-35-31		Package E	07	BLEND REPAIR SURFACE DAMAGE		950.00	SR Technics Switzerland
137549					72-35-31		Package SB00	PW4ENG 72-653	HPC, KNIFE EDGE MODI. TO IMPROVE DURAB.		2160.00	SR Technics Switzerland
137550	50H218	EASA,FAA,CAAC,ANAC	34	28	72-35-32	HIGH PRESSURE COMPRESSOR (HPC) - DIFFUSER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		755.00	SR Technics Switzerland
137550	54H792	EASA,FAA,CAAC,ANAC,CAA UK			72-35-32		Package B	1	KNIFE-EDGE SEAL REPAIR		1015.00	SR Technics Switzerland
137550	54H846	EASA,FAA,CAAC,ANAC			72-35-32		Package D	3	BLEND REPAIR KNIFE-EDGE SEALS		790.00	SR Technics Switzerland
137550					72-35-32		Package E	4	RESTORE KNIFE-EDGE SEAL PLASMA COAT		2925.00	SR Technics Switzerland
137550					72-35-32		Package F	7	PLASMA REPAIR DIAMETER		2790.00	SR Technics Switzerland
137550					72-35-32		Package G	12	RESTORE HARDFACE OF BRUSH SEAL LAND		4175.00	SR Technics Switzerland
137550					72-35-32		Package G	8	RESTORE HARDFACE OF BRUSH SEAL LAND		4175.00	SR Technics Switzerland
137550					72-35-32		Package H	5	PLASMA COAT OR NICKEL PLATE REPAIR FRONT OUTSIDE DIAMETER		3480.00	SR Technics Switzerland
137550					72-35-32		Package J	17	SURFACE DAMAGE BLEND REPAIR		3475.00	SR Technics Switzerland
137550					72-35-32		Package J	9	SURFACE DAMAGE BLEND REPAIR		3475.00	SR Technics Switzerland
137552	50H793	EASA,FAA,CAAC,ANAC	30	28	72-35-51	HIGH PRESSURE COMPRESSOR (HPC) - INLET SYNCHRONIZING RING AS	Package A	CLN/INSP	CLEANING AND INSPECTION	PN50H792 FOR SHOP VISIT ONLY	370.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137552	53H929	EASA,FAA,ANAC			72-35-51		Package B	01	REPLACE RING ASSEMBLY PIN AND LEVER ARM		1225.00	SR Technics Switzerland
137552	53H930	EASA,FAA,CAAC,ANAC			72-35-51		Package C	02	REPLACE NUT PLATES		600.00	SR Technics Switzerland
137552	54H798-01	EASA,FAA,CAAC,ANAC			72-35-51		Package F	05	WELD REPAIR OF VANE ARM PIN HOLES		2535.00	SR Technics Switzerland
137552	54H881	EASA,FAA,CAAC,ANAC			72-35-51		Package H	07	BLEND RING SEGMENT SURFACE DAMAGE		600.00	SR Technics Switzerland
137552	54H882	EASA,FAA,CAAC,ANAC			72-35-51		Package L	11	APPLY PWA 578 PAINT		990.00	SR Technics Switzerland
137552					72-35-51		Package SB00	PW4ENG 72-432	SYNCHRONIZING RING - MODIFICATION OF PIN ATTACHMENT		1225.00	SR Technics Switzerland
137552					72-35-51		Package SB01	PW4ENG 72-474	SYNCHRONIZING RING - PAINT REMOVAL FROM ID		340.00	SR Technics Switzerland
137574	50J301	EASA,FAA,CAAC,ANAC	4	28	72-41-03	PW4 STAGE 15 HPC AIRSEALING RING	Package A	CLN/INSP	CLEANING & INSPECTION		695.00	SR Technics Switzerland
137574					72-41-03		Package B	01	PLASMA SPRAY SNAP DIAMETER		2550.00	SR Technics Switzerland
137575	50J419	EASA,FAA,CAAC,ANAC	26	28	72-41-05	DIFFUSER AND COMBUSTOR - DIFFUSER AIRSEALING RING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		775.00	SR Technics Switzerland
137575					72-41-05		Package C	02	PLASMA SPRAY SNAP DIAMETER		2560.00	SR Technics Switzerland
137575					72-41-05		Package D	03	PLASMA COAT REPAIR OIL PRESSURE TUBE BOSS ID		2560.00	SR Technics Switzerland
137575					72-41-05		Package E	04	PLASMA COAT REPAIR OIL SCAVENGE BOSS ID		2105.00	SR Technics Switzerland
137575					72-41-05		Package F	05	PLASMA COAT REPAIR BREATHER BOSS ID		2255.00	SR Technics Switzerland
137575					72-41-05		Package G	06	SLEEVE REPAIR OIL PRESSURE TUBE BOSS ID		2560.00	SR Technics Switzerland
137575					72-41-05		Package H	07	SLEEVE REPAIR OIL SCAVENGE BOSS ID		2315.00	SR Technics Switzerland
137575					72-41-05		Package I	08	SLEEVE REPAIR BREATHER BOSS ID		2315.00	SR Technics Switzerland
137575					72-41-05		Package J	09	SLEEVE REPAIR 12TH STAGE AIR SUPPLY TUBE BOSS		2560.00	SR Technics Switzerland
137575					72-41-05		Package K	10	SLEEVE REPAIR TOBI SENSE TUBE BOSS		2405.00	SR Technics Switzerland
137575					72-41-05		Package L	11	SLEEVE REPAIR OIL WEEP TUBE BOSS		2405.00	SR Technics Switzerland
137575					72-41-05		Package M	12	SLEEVE REPAIR NO. 3 BEARING COMPARTMENT BUFFER AIR BOSS		2405.00	SR Technics Switzerland
137575					72-41-05		Package N	13	BLEND REPAIR		765.00	SR Technics Switzerland
137575					72-41-05		Package O	14	BLEND REPAIR THE WORN ANTI - ROTATION SLOT		790.00	SR Technics Switzerland
137576	50J464-01	EASA,FAA,CAAC,ANAC	31	28	72-41-11	DIFFUSER AND COMBUSTOR - OUTER COMBUSTION CHAMBER ASSEM	Package A	CLN/INSP	CLEANING AND INSPECTION		3945.00	SR Technics Switzerland
137576	50J488-001	EASA,FAA,CAAC,ANAC			72-41-11		Package AA	26	WELD REPAIR WEAR ON BULKHEAD FRONT FACE		4395.00	SR Technics Switzerland
137576	50J488-01	EASA,FAA,CAAC,ANAC			72-41-11		Package AC	28	STRESS-RELIEF CYCLE		380.00	SR Technics Switzerland
137576	50J612-01	EASA,FAA,CAAC,ANAC			72-41-11		Package AD	29	LINER TRAILING EDGE WELD REPAIR		2825.00	SR Technics Switzerland
137576	50J748-01	EASA,FAA,CAAC,ANAC			72-41-11		Package AE	30	REPLACE NO. 4 THROUGH 8 LINER REPAIR		8530.00	SR Technics Switzerland
137576	50J943-001	EASA,FAA,CAAC,ANAC			72-41-11		Package AG	41	PLASMA COAT BUILD-UP REPAIR		4395.00	SR Technics Switzerland
137576	50J943-01	EASA,FAA,CAAC,ANAC			72-41-11		Package AH	43	WELD CRACKS IN FILLET WELDS OF REAR SEAL STIFFENER RING		925.00	SR Technics Switzerland
137576	50J944-001	EASA,FAA,CAAC,ANAC			72-41-11		Package AI	44	AFT LOUVER LIP DISTRESS PATCH REPAIR		760.00	SR Technics Switzerland
137576	50J944-01	EASA,FAA,CAAC,ANAC			72-41-11		Package AJ	47	BULKHEAD PATCH REPAIR	FILET RADIUS	760.00	SR Technics Switzerland
137576					72-41-11		Package AK	58	REAR STIFFENER CRACK WELD REPAIR		2090.00	SR Technics Switzerland
137576					72-41-11		Package AL	59	REAR STIFFENER PATCH REPAIR		2625.00	SR Technics Switzerland
137576					72-41-11		Package AM	64	COMBUSTION CHAMBER DOME DAMAGE WELD REPAIR		520.00	SR Technics Switzerland
137576					72-41-11		Package D	3	REPLACE THE HARDFACE ON THE SNAP DIAMETER REPAIR		750.00	SR Technics Switzerland
137576					72-41-11		Package E	4	REPLACE HARDFACE ON REAR STIFFENER REPAIR		875.00	SR Technics Switzerland
137576					72-41-11		Package F	5	BULKHEAD CRACK WELD REPAIR		5230.00	SR Technics Switzerland
137576					72-41-11		Package G	6	BULKHEAD CRACK PATCH REPAIR		1270.00	SR Technics Switzerland
137576					72-41-11		Package H	7	MOUNT LUG BUSHING REPLACEMENT		760.00	SR Technics Switzerland
137576					72-41-11		Package I	8	RESTORE PWA 265 PLASMA COAT REPAIR	SOURCE DEMO	3000.00	SR Technics Switzerland
137576					72-41-11		Package J	9	2ND WELD LINER CRACKS	NOT IN TO DOUBLE PASS AEREA	5165.00	SR Technics Switzerland
137576					72-41-11		Package J	9	WELD LINER CRACKS	NOT IN TO DOUBLE PASS AEREA	5165.00	SR Technics Switzerland
137576					72-41-11		Package K	10	2ND WELD LINER CRACKS	IN TO DOUBLE PASS AEREA	4270.00	SR Technics Switzerland
137576					72-41-11		Package K	10	WELD LINER CRACKS	IN TO DOUBLE PASS AEREA	4270.00	SR Technics Switzerland
137576					72-41-11		Package L	11	2ND PATCH WELD LINER CRACKS		4300.00	SR Technics Switzerland
137576					72-41-11		Package L	11	PATCH WELD LINER CRACKS		4300.00	SR Technics Switzerland
137576					72-41-11		Package M	12	RESIZE EXIT LINER AND REAR STIFFENER		905.00	SR Technics Switzerland
137576					72-41-11		Package N	13	RESTORE LOUVER GAP		1085.00	SR Technics Switzerland
137576					72-41-11		Package O	14	REPLACE IGNITER BOSS ASSEMBLY		1270.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137576					72-41-11		Package P	15	RESIZE REAR STIFFENER PLASMA REPAIR		885.00	SR Technics Switzerland
137576					72-41-11		Package Q	16	REPLACE NO. 7 AND 8 LINERS		6035.00	SR Technics Switzerland
137576					72-41-11		Package S	18	REPLACE NO. 4 THROUGH 6 LINERS REPAIR		4830.00	SR Technics Switzerland
137576					72-41-11		Package SB00	PW4ENG 72-152	IGNITOR PLUG INSP. OF FOR WEAR	& COMBUSTION CHAMBER ASSEMBLY, OUTFE	2670.00	SR Technics Switzerland
137576					72-41-11		Package SB04	PW4ENG 72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152(AIRBUS		11915.00	SR Technics Switzerland
137576					72-41-11		Package SB05	PW4ENG 72-601	CHAMBER ASSY, OUTER COMBUSTION - MODIF. OF TO INCORP. AN IGNITER GUIDE ASSEMBLY THAT WILL NOT ROTAT		555.00	SR Technics Switzerland
137576					72-41-11		Package U	20	REPLACE BULKHEAD ASSEMBLY REPAIR		2145.00	SR Technics Switzerland
137576					72-41-11		Package W	22	REPLACE BULKHEAD HARDFACE REPAIR		745.00	SR Technics Switzerland
137576					72-41-11		Package X	23	REPLACE ONE NOZZLE STATOR AND POSITIONING RINGS		2145.00	SR Technics Switzerland
137576					72-41-11		Package Y	24	REPAIR FUEL NOZZLE GUIDE RIVET HOLE		2800.00	SR Technics Switzerland
137576					72-41-11		Package Z	25	WELD THE MOUNT LUGS		2520.00	SR Technics Switzerland
137577	501685	EASA,FAA,CAAC,ANAC	23	28	72-41-02	DIFFUSER AND COMBUSTOR - COMPRESSOR EXIT STATOR ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		870.00	SR Technics Switzerland
137577	501685-001	EASA,FAA,CAAC,ANAC			72-41-02		Package B	01	REPLACE ANTIGALLING COMPOUND		550.00	SR Technics Switzerland
137577	51J285-001	EASA,FAA,CAAC,ANAC			72-41-02		Package C	02	BLEND THE COMPRESSOR EXIT STATOR ASSEMBLY VANES		1670.00	SR Technics Switzerland
137577	51J285-01	EASA,FAA,CAAC,ANAC			72-41-02		Package D	03	HONEYCOMB REPLACEMENT REPAIR		7765.00	SR Technics Switzerland
137577	51J385-001	EASA,FAA,CAAC,ANAC			72-41-02		Package E	04	PLASMA SPRAY REAR SNAP DIAMETER		3980.00	SR Technics Switzerland
137577	51J385-01	EASA,FAA,CAAC,ANAC			72-41-02		Package F	05	PLASMA SPRAY FRONT SNAP DIAMETER		3980.00	SR Technics Switzerland
137577	51J685-001	EASA,FAA,CAAC,ANAC			72-41-02		Package G	06	WELD REPAIR OUTER SHROUD SLOT CRACKS		7685.00	SR Technics Switzerland
137577	51J685-01	EASA,FAA,CAAC,ANAC			72-41-02		Package H	07	WELD REPAIR VANE CRACKS		11475.00	SR Technics Switzerland
137577	51J885-01	EASA,FAA,CAAC,ANAC			72-41-02		Package I	08	WELD REPAIR INNER FLANGE BOLT HOLES		7305.00	SR Technics Switzerland
137577					72-41-02		Package SB00	PW4ENG 72-464	REPLACEMENT OR MODIFICATION OF TO INCORPORATE JACKSCREW HOLES		765.00	SR Technics Switzerland
137580	50K036	EASA,FAA,CAAC,ANAC	25	28	72-51-08	TURBINE NOZZLE - COMBUSTION CHAMBER GUIDE ASSEMBLY (UPPER	Package A	CLN/INSP	CLEANING AND INSPECTION		405.00	SR Technics Switzerland
137580	50K193-01	EASA,FAA,CAAC,ANAC			72-51-08		Package B	01	HARDFACE COAT REPAIR		1370.00	SR Technics Switzerland
137580	50K365-01	EASA,FAA,CAAC,ANAC			72-51-08		Package E	04	WELD BUILD-UP COMBUSTION CHAMBER GUIDE (END TAB) SEAL MATING SURFACE		2680.00	SR Technics Switzerland
137580					72-51-08		Package F	05	AXIAL AND RADIAL CRACK WELD REPAIR		2680.00	SR Technics Switzerland
137580					72-51-08		Package G	06	COMBUSTION CHAMBER GUIDE TAB WELD REPAIR		2680.00	SR Technics Switzerland
137580					72-51-08		Package L	11	BOROSCOPE BOSS WELD REPAIR		2825.00	SR Technics Switzerland
137581	50K359-01	EASA,FAA,CAAC,ANAC	33	28	72-51-05	TURBINE NOZZLE - INNER COMBUSTION CHAMBER ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		2215.00	SR Technics Switzerland
137581	50K464-01	EASA,FAA,CAAC,ANAC			72-51-05		Package A	CLN/INSP	CLEANING AND INSPECTION		2215.00	SR Technics Switzerland
137581	50K488-01	EASA,FAA,CAAC,ANAC			72-51-05		Package AA	26	STRESS RELIEVE		1575.00	SR Technics Switzerland
137581					72-51-05		Package AC	28	SIZE THE REAR SUPPORT		835.00	SR Technics Switzerland
137581					72-51-05		Package AH	33	SUPPORT MATING FACE PLASMA COAT REPAIR		3250.00	SR Technics Switzerland
137581					72-51-05		Package AK	06	WELD REPAIR INNER LINER CRACKS IN THE CONSTANT THICKNESS SECT 2ND WELD REPAIR		945.00	SR Technics Switzerland
137581					72-51-05		Package AL	07	WELD REPAIR INNER LINER CRACKS EXTENDING INTO DOUBLE PASS SEC 2ND WELD REPAIR		945.00	SR Technics Switzerland
137581					72-51-05		Package C	01	ONE LUG NUT PLATE REPLACEMENT REPAIR		440.00	SR Technics Switzerland
137581					72-51-05		Package D	02	HARDFACE SUPPORT MATING FACE REPAIR		630.00	SR Technics Switzerland
137581					72-51-05		Package E	04	HARDFACE FRONT LINER		740.00	SR Technics Switzerland
137581					72-51-05		Package F	05	RESTORE PWA 265 PLASMA COAT REPAIR	SOURCE DEMO	3680.00	SR Technics Switzerland
137581					72-51-05		Package G	06	WELD REPAIR INNER LINER CRACKS IN THE CONSTANT THICKNESS SECTION		3680.00	SR Technics Switzerland
137581					72-51-05		Package H	07	WELD REPAIR INNER LINER CRACKS EXTENDING INTO DOUBLE PASS SECTION		3480.00	SR Technics Switzerland
137581					72-51-05		Package I	08	PATCH WELD REP. INNER LINER CRACKS > 0.030 INCH (0.762 MM) AND EXT. INTO THE DOUBLE PASS SECTION		3950.00	SR Technics Switzerland
137581					72-51-05		Package J	09	RESTORE COMBUSTION CHAMBER LOUVER GAP		255.00	SR Technics Switzerland
137581					72-51-05		Package K	10	CRACK WELD REPAIR COMBUSTION CHAMBER ASSEMBLY REAR SUPPORT PLATE		2720.00	SR Technics Switzerland
137581					72-51-05		Package L	11	REPLACE INNER COMBUSTION CHAMBER (REAR) SUPPORT PLATE		1885.00	SR Technics Switzerland
137581					72-51-05		Package N	13	REPLACE NO. 1 AND 2 COMBUSTION CHAMBER LINER SEGMENTS		3275.00	SR Technics Switzerland
137581					72-51-05		Package O	14	REPLACE NO. 4 AND 5 COMBUSTION CHAMBER LINER SEGMENTS		6245.00	SR Technics Switzerland
137581					72-51-05		Package P	15	REPLACE NO. 7 AND 8 COMBUSTION CHAMBER LINER SEGMENTS		3125.00	SR Technics Switzerland
137581					72-51-05		Package Q	16	SIZE THE FRONT LINER		1230.00	SR Technics Switzerland
137581					72-51-05		Package R	17	WELD REPAIR LINER LOUVER TRAILING EDGE		2350.00	SR Technics Switzerland
137581					72-51-05		Package SB00		MODIFICATION OF COMBUSTION CHAMBER OUTER/INNER LINER	ACCORDING TO SB PW4ENG 72-187.1 AND SB	2340.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137581					72-51-05		Package SB01	PW4ENG 72-490	CONVERSION OF A PW4460 OR PW4460 (-3) OR PW4462 (-3)	MCDONELL DOUGLAS	4985.00	SR Technics Switzerland
137581					72-51-05		Package SB02	PW4ENG 72-504	CONVERSION OF A PW4052, PW4056, PW4060, TO A PW4052(-3), PW40 BOEING		4525.00	SR Technics Switzerland
137581					72-51-05		Package SB03	PW4ENG 72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152(AIRBUS		4810.00	SR Technics Switzerland
137581					72-51-05		Package T	19	REPLACE NO. 4 THROUGH 8 COMBUSTION CHAMBER LINER SEGMENT		7390.00	SR Technics Switzerland
137583	50L014	EASA,FAA,CAAC,ANAC	17	28	72-52-21	HIGH PRESSURE TURBINE (HPT) - STAGE 1 HPT (INNER ROTATING) AIRS	Package A	CLN/INSP	CLEAN AND INSPECTION		1195.00	SR Technics Switzerland
137583	50L193	EASA,FAA,CAAC,ANAC			72-52-21		Package B	01	SURFACE DAMAGE BLEND REPAIR		890.00	SR Technics Switzerland
137583	50L659	EASA,FAA,CAAC,ANAC			72-52-21		Package C	02	KNIFE-EDGE SEALS BLEND REPAIR		1225.00	SR Technics Switzerland
137583					72-52-21		Package D	03	NICKEL PLATE REPAIR SNAP DIAMETER		1895.00	SR Technics Switzerland
137583					72-52-21		Package E	72-069548	REPL OF T1 AIRSEAL OR COATING OF KNIFE E		1900.00	SR Technics Switzerland
137584	50L156	EASA,FAA,CAAC,ANAC	36	28	72-52-22	HIGH PRESSURE TURBINE (HPT) - STAGE 2 HPT (ROTATING) AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		1575.00	SR Technics Switzerland
137584	50L195	EASA,FAA,CAAC,ANAC			72-52-22		Package B	INSP/CHK-03	CORROSION REPAIR ACCORDING SPOP 09 AND 10 SPM / CLEANING 01		1945.00	SR Technics Switzerland
137584	53L027	EASA,FAA,CAAC,ANAC			72-52-22		Package C	01	PLASMA SPRAY REAR MATING SURFACE		3600.00	SR Technics Switzerland
137584	53L030	EASA,FAA,CAAC,ANAC,CAA UK			72-52-22		Package D	02	PLASMA SPRAY REAR INNER SNAP DIAMETER		3600.00	SR Technics Switzerland
137584					72-52-22		Package E	03	PLASMA SPRAY REAR OUTER SNAP DIAMETER		3600.00	SR Technics Switzerland
137584					72-52-22		Package F	04	PLASMA SPRAY FRONT INNER SNAP DIAMETER		3600.00	SR Technics Switzerland
137584					72-52-22		Package G	05	PLASMA SPRAY FRONT OUTER SNAP DIAMETER		3600.00	SR Technics Switzerland
137584					72-52-22		Package I	07	KNIFE-EDGE SEALS BLEND REPAIR		885.00	SR Technics Switzerland
137584					72-52-22		Package J	08	PLASMA SPRAY REPAIR FRONT INNER MATING FACE		3600.00	SR Technics Switzerland
137584					72-52-22		Package K	09	COATING REPAIR FRONT OUTER MATING FACE		4375.00	SR Technics Switzerland
137584					72-52-22		Package L	10	MACHINE REPAIR FRONT INNER SNAP DIAMETER		2095.00	SR Technics Switzerland
137584					72-52-22		Package M	11	MACHINE REPAIR FRONT OUTER SNAP DIAMETER		2095.00	SR Technics Switzerland
137584					72-52-22		Package N	12	MACHINE REPAIR REAR INNER SNAP DIAMETER		2095.00	SR Technics Switzerland
137584					72-52-22		Package O	13	MACHINE REPAIR REAR OUTER SNAP DIAMETER		2095.00	SR Technics Switzerland
137584					72-52-22		Package SB01	PW4G-100-A72-80	AIR SEAL (ROTATING) HPT 2ND STAGE - INSPECTION OF FOR CRACKS		9475.00	SR Technics Switzerland
137584					72-52-22		Package SB02	PW4ENG A72-628	AIR SEAL (ROTATING) HPT 2ND STAGE - INSPECTION OF FOR CRACKS		9115.00	SR Technics Switzerland
137584					72-52-22		Package SB03	AD 2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	360.00	SR Technics Switzerland
137584					72-52-22		Package SB04	FAA-2011-25-09	LIFE LIMIT REDUCTION		480.00	SR Technics Switzerland
137585	50L248	EASA,FAA,CAAC,ANAC	30	28	72-52-20	HIGH PRESSURE TURBINE (HPT) - STAGE 1 HPT (OUTER ROTATING) AIR	Package A	CLN/INSP	CLEANING AND INSPECTION		1575.00	SR Technics Switzerland
137585	50L485	EASA,FAA,CAAC,ANAC			72-52-20		Package C	01	SURFACE DAMAGE BLEND REPAIR		1545.00	SR Technics Switzerland
137585	50L879	EASA,FAA,CAAC,ANAC,CAA UK			72-52-20		Package D	02	KNIFE-EDGE SEALS BLEND REPAIR		1415.00	SR Technics Switzerland
137585					72-52-20		Package E	04	COAT REAR OD MATING SURFACE		4690.00	SR Technics Switzerland
137585					72-52-20		Package F	05	SHOTPEEN REPAIR		715.00	SR Technics Switzerland
137585					72-52-20		Package SB00	PW4ENG 72-487	INCORPORATION OF HPT 1, TWO KNIFE EDGE SEAL		2515.00	SR Technics Switzerland
137585					72-52-20		Package SB01	PW4ENG 72-736	HPT-FPI HUBS & OUT.AIRSEAL,1ST & 2ND STG		395.00	SR Technics Switzerland
137585					72-52-20		Package SB02	PW4G-100-72-176	HPT-FPI HUBS & OUT.AIRSEAL,1ST & 2ND STG		395.00	SR Technics Switzerland
137585					72-52-20		Package SB03	PW4ENG A72-724	HPT STG 1 ROTATING AIRSEAL - INSPECTION	INSPECTION FOR SHARP RADIUS AND CRACKS	525.00	SR Technics Switzerland
137585					72-52-20		Package SB04	AD 2011-25-09	LIFE LIMIT CHECK	IN CONJUNCTION WITH PACKAGE A	155.00	SR Technics Switzerland
137587	50L287	EASA,FAA,CAAC,ANAC	5	28	72-52-37	PW4 STAGE 2 HPT DUCT SUPPORT (SEGMENT)	Package A	CLN/INSP	CLEANING AND INSPECTION		340.00	SR Technics Switzerland
137587	50L678	EASA,FAA,CAAC,ANAC			72-52-37		Package B	01	REPLACE ANTI-ROTATION PIN		400.00	SR Technics Switzerland
137587					72-52-37		Package SB00	72-462	ADDIT. COOLING HOLES & NEW SEALS		480.00	SR Technics Switzerland
137590	50N008	EASA,FAA,CAAC,ANAC	32	28	72-53-39	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT (OUTER ROTATING) AIRS	Package A	CLN/INSP	CLEANING AND INSPECTION		920.00	SR Technics Switzerland
137590	50N521	EASA,FAA,CAAC,ANAC,CAA UK			72-53-39		Package B	01	KNIFE-EDGE SEAL BLEND REPAIR		1320.00	SR Technics Switzerland
137590					72-53-39		Package C	02	SURFACE DAMAGE BLEND REPAIR		935.00	SR Technics Switzerland
137590					72-53-39		Package E	04	BLADE CONTACT FACE COAT REPAIR		1760.00	SR Technics Switzerland
137590					72-53-39		Package F	05	SNAP DIAMETER PLASMA SPRAY REPAIR		4165.00	SR Technics Switzerland
137590					72-53-39		Package G	06	REMOVE BENT COUNTERWEIGHT TAB REPAIR		1125.00	SR Technics Switzerland
137590					72-53-39		Package H	07	BALANCE REPAIR		1240.00	SR Technics Switzerland
137590					72-53-39		Package I	08	SHOTPEEN REPAIR		590.00	SR Technics Switzerland
137590					72-53-39		Package M	CLN-01	REMOVE CORROSION BY WET BLASTING		465.00	SR Technics Switzerland
137601	50N009	EASA,FAA,CAAC,ANAC	37	28	72-53-40	LOW PRESSURE TURBINE (LPT) - STAGE 4 LPT (ROTATING) AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		1070.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137601	50N346	EASA,FAA,CAAC,ANAC			72-53-40		Package B	01	SURFACE DAMAGE BLEND REPAIR		795.00	SR Technics Switzerland
137601	50N478	EASA,FAA,CAAC,ANAC			72-53-40		Package C	02	KNIFE-EDGE SEALS BLEND REPAIR		1125.00	SR Technics Switzerland
137601	50N478-001	EASA,FAA,CAAC,ANAC			72-53-40		Package D	03	ANTI-ROTATION LUG WELD REPAIR	P/N 50N009	3250.00	SR Technics Switzerland
137601	51N038	EASA,FAA,CAAC,ANAC,CAA UK			72-53-40		Package D	10	WELD REPAIR ANTI-ROTATION LUG	P/N 50N346, P/N 50N478, P/N 50N478-001, P/	3250.00	SR Technics Switzerland
137601	51N113	EASA,FAA,CAAC,ANAC			72-53-40		Package F	05	FRONT FACE PLASMA SPRAY REPAIR		3105.00	SR Technics Switzerland
137601	51N119	EASA,FAA,ANAC,CAA UK			72-53-40		Package G	06	BLADE MATING SURFACE PLASMA COAT REPAIR		2960.00	SR Technics Switzerland
137601					72-53-40		Package H	07	REAR DIAMETER COAT REPAIR		2750.00	SR Technics Switzerland
137601					72-53-40		Package I	08	FRONT DIAMETER PLASMA/DUAL WIRE ELECTRIC ARC COAT REPAIR		1935.00	SR Technics Switzerland
137601					72-53-40		Package J	09	BALANCE REPAIR		1050.00	SR Technics Switzerland
137601					72-53-40		Package N	13	SHOTPEEN REPAIR		970.00	SR Technics Switzerland
137601					72-53-40		Package O	INSP-01	REMOVE CORROSION BY WET BLASTING		465.00	SR Technics Switzerland
137601					72-53-40		Package SB00	AD 2015-22-03	LPT 4TH STAGE AIR SEAL REPLACEMENT	ONLY FOR 100" ENGINE	410.00	SR Technics Switzerland
137601					72-53-40		Package SB00	AD 2015-22-03	LPT 4TH STAGE AIR SEAL REPLACEMENT	ONLY FOR 94" ENGINE	410.00	SR Technics Switzerland
137601					72-53-40		Package SB01	AD 2018-13-02	PREVENT FAILURE OF THE 4TH STAGE LPT AIR SEAL		190.00	SR Technics Switzerland
137602	50N162	EASA,FAA,CAAC,ANAC	27	28	72-53-41	LOW PRESSURE TURBINE (LPT) - LOW PRESSURE TURBINE (LPT) - STAGI	Package A	CLN/INSP	CLEANING AND INSPECTION		1675.00	SR Technics Switzerland
137602	50N324	EASA,FAA,CAAC,ANAC			72-53-41		Package AE		REMOVE CORROSION		465.00	SR Technics Switzerland
137602	50N347	EASA,FAA,CAAC,ANAC			72-53-41		Package B	01	KNIFE-EDGE SEALS BLEND REPAIR		1100.00	SR Technics Switzerland
137602	50N419	EASA,FAA,CAAC,ANAC,CAA UK			72-53-41		Package C	02	SURFACE DAMAGE BLEND REPAIR		1110.00	SR Technics Switzerland
137602					72-53-41		Package D	03	ANTI-ROTATION LUG WELD REPAIR		3355.00	SR Technics Switzerland
137602					72-53-41		Package G	06	FRONT FACE PLASMA SPRAY REPAIR		3495.00	SR Technics Switzerland
137602					72-53-41		Package H	07	BLADE MATING SURFACE COAT REPAIR		3495.00	SR Technics Switzerland
137602					72-53-41		Package I	08	REAR MATING DIAMETER PLASMA COAT REPAIR		2890.00	SR Technics Switzerland
137602					72-53-41		Package J	09	FRONT MATING DIAMETER PLASMA COAT/DUAL WIREELECTRIC ARC COAT REPAIR		3230.00	SR Technics Switzerland
137602					72-53-41		Package K	10	BALANCE REPAIR		1095.00	SR Technics Switzerland
137602					72-53-41		Package M	12	ANTI-ROTATION LUG WELD REPAIR		2335.00	SR Technics Switzerland
137602					72-53-41		Package N	13	SHOTPEEN REPAIR		1020.00	SR Technics Switzerland
137640	50N260	EASA,FAA,CAAC,ANAC	26	21	72-53-18	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT (INNER) DUCT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		430.00	SR Technics Switzerland
137640	50N331	EASA,FAA,CAAC,ANAC			72-53-18		Package B	01	SURFACE DAMAGE BLEND REPAIR		360.00	SR Technics Switzerland
137640	50N536	EASA,FAA,CAAC,ANAC			72-53-18		Package D	03	REPLACE DAMAGED DUCT SEGMENT REPAIR		1420.00	SR Technics Switzerland
137640					72-53-18		Package E	04	REPLACE DAMAGED SUPPORT		935.00	SR Technics Switzerland
137640					72-53-18		Package F	05	REPLACE DAMAGED SEAL		805.00	SR Technics Switzerland
137640					72-53-18		Package H	07	STUD REPLACEMENT REPAIR		715.00	SR Technics Switzerland
137640					72-53-18		Package SB00	PWAENG 72-513	3RD STG DUCT AND SEAL SUPPORT MODIFICATION		1310.00	SR Technics Switzerland
137640					72-53-18		Package SB01	PWAENG 72-294	3RD STG REPLACEMENT OF LPT DUCT SEAL		1310.00	SR Technics Switzerland
137640					72-53-18		Package SB02	PWAG-100-72-41	REPLACE/MODIFY THE 3RD STAGE LPT SEALING RING SUPPORT ASSY AND 3RD STAGE LPT DUCT SEGMENTS.		1310.00	SR Technics Switzerland
137641	50G417	EASA,FAA,CAAC,ANAC	36	28	72-34-06	INTERMEDIATE CASE - NO. 2 BEARING SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		435.00	SR Technics Switzerland
137641	51D766	EASA,FAA,CAAC,ANAC			72-34-06		Package B	01	PIN REPLACEMENT REPAIR		685.00	SR Technics Switzerland
137641	51G082	EASA,FAA,CAAC,ANAC			72-34-06		Package C	02	REPLACE HELICOIL INSERT		1185.00	SR Technics Switzerland
137641	51G250	EASA,FAA,CAAC,ANAC			72-34-06		Package E	04	PLASMA SPRAY THE INTERMEDIATE CASE SNAP DIAMETER		3610.00	SR Technics Switzerland
137641					72-34-06		Package F	05	REPAIR THE DAMPER JOURNAL WITH A BUSHING		6560.00	SR Technics Switzerland
137641					72-34-06		Package J	09	SURFACE DAMAGE BLEND REPAIR		400.00	SR Technics Switzerland
137641					72-34-06		Package K	10	OVERSIZED PIN REPLACEMENT REPAIR		685.00	SR Technics Switzerland
137641					72-34-06		Package P	05	CHROME PLATE BUSHING		3980.00	SR Technics Switzerland
137641					72-34-06		Package SB00	PWAENG 72-179	BEARINGS FR T REPLACEMENT OF OIL TUBES AND SEALS		935.00	SR Technics Switzerland
137641					72-34-06		Package SB01	PWAENG 72-204	SEAL ASSEMBLY, NO 2 BEARING - MODIFICATION OF		5325.00	SR Technics Switzerland
137643	50H100	EASA,FAA,CAAC,ANAC	26	28	72-35-36	HIGH PRESSURE COMPRESSOR (HPC) - NO. 3 BEARING (INNER REAR HU	Package A	CLN/INSP	CLEANING AND INSPECTION		545.00	SR Technics Switzerland
137643	53H367	EASA,FAA,CAAC,ANAC			72-35-36		Package B	01	RESTORE ANTIGALLANT		620.00	SR Technics Switzerland
137643					72-35-36		Package C	02	RESTORE CORROSION PROTECTIVE COATING		1380.00	SR Technics Switzerland
137643					72-35-36		Package D	03	BLEND REPAIR		540.00	SR Technics Switzerland
137643					72-35-36		Package E	04	FRONT FACE BLEND REPAIR		540.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137649	310T3021-1	EASA,FAA,CAAC,ANAC	22	21	71-21-16	FWD ENGINE MOUNT - FITTING ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		985.00	SR Technics Switzerland
137649	310T4021-1	EASA,FAA,CAAC,ANAC			71-21-16		Package B	1-1	BUSHING REPLACEMENT		2580.00	SR Technics Switzerland
137649	310T4021-5	EASA,FAA,CAAC,ANAC			71-21-16		Package C	1-2	LUG HOLE REPAIR		3025.00	SR Technics Switzerland
137649	310T4021-7	EASA,FAA,CAAC,ANAC			71-21-16		Package D	1-2	JOURNAL REPAIR		4715.00	SR Technics Switzerland
137649					71-21-16		Package E	1-2	SHEAR PIN HOLE REPAIR		2415.00	SR Technics Switzerland
137649					71-21-16		Package F	1-2	SCRATCH AND GOUGE REPAIR		1120.00	SR Technics Switzerland
137656	501603-01	EASA,FAA,CAAC,ANAC	25	28	72-41-22	NO.3 BEARING AND AIRFRAME (OIL VENT AND TURBINE COOLING AIR	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland
137656	51J039-01	EASA,FAA,CAAC,ANAC			72-41-22		Package C	02	REPAIR SEAL RING GROOVE	PN 501603-01	905.00	SR Technics Switzerland
137656					72-41-22		Package C	05	REPAIR SEAL RING GROOVE	PN 51J039-01	905.00	SR Technics Switzerland
137656					72-41-22		Package D	03	RESTORE ANTIGALLING COMPOUND		415.00	SR Technics Switzerland
137715	50L013	EASA,FAA,CAAC,ANAC	28	28	72-52-23	HIGH PRESSURE TURBINE (HPT) - STAGE 2 HPT BLADE RETAINING PLAT	Package A	CLN/INSP	CLEANING AND INSPECTION		395.00	SR Technics Switzerland
137715	50L242	EASA,FAA,CAAC,ANAC,CAA UK			72-52-23		Package B	01	SURFACE DAMAGE BLEND REPAIR		570.00	SR Technics Switzerland
137715					72-52-23		Package C	02	FRONT OUTER MATING FACE PLASMA SPRAY REPAIR		3380.00	SR Technics Switzerland
137715					72-52-23		Package D	03	PLASMA SPRAY REPAIR WIRE SEAL AXIAL MATING FACE		2935.00	SR Technics Switzerland
137715					72-52-23		Package E	04	PLASMA SPRAY REPAIR ID BUMPER AXIAL MATING FACE		2935.00	SR Technics Switzerland
137715					72-52-23		Package F	05	PLASMA SPRAY REPAIR FRONT INNER SNAP DIAMETER		2935.00	SR Technics Switzerland
137715					72-52-23		Package L	011	UMBALANCE MARKING REPAIR		500.00	SR Technics Switzerland
137716	50G849	EASA,FAA,CAAC,ANAC	45	28	72-34-01	INTERMEDIATE CASE - COMPRESSOR INTERMEDIATE CASE ASSEMBLY -	Package A	CLN/INSP	CLEANING AND INSPECTION		1430.00	SR Technics Switzerland
137716	50G849-001	EASA,FAA,CAAC,ANAC			72-34-01		Package AA	42	WELD THE NO. 2 BEARING ALIGNMENT PIN HOLE		3380.00	SR Technics Switzerland
137716	50G918	EASA,FAA,CAAC,ANAC			72-34-01		Package AC	44	BLEND SURFACE DAMAGE ON THE FAN EXIT CASE FLANGE ASSEMBLY		845.00	SR Technics Switzerland
137716	50G918-001	EASA,FAA,CAAC,ANAC			72-34-01		Package AD	49	SURFACE DAMAGE BLEND REPAIR		1610.00	SR Technics Switzerland
137716	50G918-005	EASA,FAA,CAAC,ANAC			72-34-01		Package AE	100	STOP DRILL THE FAN EXIT FAIRING COVER CRACKS		305.00	SR Technics Switzerland
137716	51G021	EASA,FAA,CAAC,ANAC			72-34-01		Package AF	101	FAN EXIT FAIRING COVER REPLACEMENT		1050.00	SR Technics Switzerland
137716	51G021-001	EASA,FAA,CAAC,ANAC			72-34-01		Package AG	107	REPLACE HELICAL COIL INSERTS IN BOSSES WITH INSERTS		925.00	SR Technics Switzerland
137716	51G021-005	EASA,FAA,CAAC,ANAC			72-34-01		Package AH	SPM 70-11-00	ADD ENGINE SERIAL NUMBER ACC. SPM 70-11-00 GENERAL-01		160.00	SR Technics Switzerland
137716	51G344	EASA,FAA,CAAC,ANAC			72-34-01		Package AK	45	APPLY PROTECTIVE LAYER		1410.00	SR Technics Switzerland
137716	51G344-001	EASA,FAA,CAAC,ANAC			72-34-01		Package AL	140	BLEND REPAIR BRG 2 ALIGNEMENT PIN HOLE		120.00	SR Technics Switzerland
137716	51G478	EASA,FAA,CAAC,ANAC			72-34-01		Package AM	70	REPLACE CENTER BRACKETS		1000.00	SR Technics Switzerland
137716	51G478-001	EASA,FAA,CAAC,ANAC			72-34-01		Package AN	109	REPLACE FRONT BRACKETS		1000.00	SR Technics Switzerland
137716	51G533	EASA,FAA,CAAC,ANAC			72-34-01		Package B	74	REPLACE NUT PLATES		925.00	SR Technics Switzerland
137716	51G533-001	EASA,FAA,CAAC,ANAC			72-34-01		Package C	105	BLEND REPAIR FAIRING ASSEMBLY		1095.00	SR Technics Switzerland
137716	51G538	EASA,FAA,CAAC,ANAC			72-34-01		Package H	15	INSTALL INSERTS IN THE ANGLE GEARBOX MOUNT PAD THREADED HOLES		910.00	SR Technics Switzerland
137716	51G538-001	EASA,FAA,CAAC,ANAC			72-34-01		Package I	16	REPLACE NO. 1 BEARING SUPPORT FLANGE HELICAL COIL INSERTS WITH INSERTS		2450.00	SR Technics Switzerland
137716	51G538-003	EASA,FAA,CAAC,ANAC			72-34-01		Package I	45	REPLACE THE PROTECTIVE LAYER		2450.00	SR Technics Switzerland
137716	51G969-002	EASA,FAA,CAAC,ANAC			72-34-01		Package I	46	REPLACE OR BOND A STRUT SEAL		2450.00	SR Technics Switzerland
137716	51G969-003	EASA,FAA,CAAC,ANAC			72-34-01		Package J	17	REPLACE REAR INNER FLANGE HELICAL COIL INSERTS WITH INSERTS		2645.00	SR Technics Switzerland
137716	52G052-006	EASA,FAA,CAAC,ANAC			72-34-01		Package J	23	REPLACE FOURTH STATOR MOUNTING FLANGE HELICAL COIL INSERTS		2645.00	SR Technics Switzerland
137716	52G057	EASA,FAA,CAAC,ANAC			72-34-01		Package J	36	SEALANT REPAIR		2645.00	SR Technics Switzerland
137716	52G057-001	EASA,FAA,CAAC,ANAC			72-34-01		Package K	18	REPLACE INNER FAN EXIT CASE MOUNTING FLANGE HELICAL COIL INSERTS WITH INSERTS		920.00	SR Technics Switzerland
137716	52G058	EASA,FAA,CAAC,ANAC			72-34-01		Package L	19	REPAIR THREADED BOSS HOLES OR REPLACE BOSS HOLE HELICAL COIL INSERTS WITH INSERTS		910.00	SR Technics Switzerland
137716	52G059	EASA,FAA,CAAC,ANAC			72-34-01		Package M	20	BLEND THE SURFACE DAMAGE		1145.00	SR Technics Switzerland
137716	52G059-002	EASA,FAA,CAAC,ANAC			72-34-01		Package N	21	REPLACE NUT PLATE ON FRONT FAN EXIT CASE BRACKET ASSEMBLY		510.00	SR Technics Switzerland
137716	52G060	EASA,FAA,CAAC,ANAC			72-34-01		Package O	22	REPLACE A FAIRING WITH NO RIVETS AT THE LEADING EDGE WITH THE SAME		1245.00	SR Technics Switzerland
137716	52G133	EASA,FAA,CAAC,ANAC			72-34-01		Package P	24	REPLACE HELICAL COIL INSERTS AT 2, 4, AND 8 O'CLOCK POSITIONS		945.00	SR Technics Switzerland
137716	52G139-01	EASA,FAA,CAAC,ANAC			72-34-01		Package Q	26	REPLACE THE FRONT FAN EXIT CASE BRACKET ASSEMBLIES		445.00	SR Technics Switzerland
137716	52G142-001	EASA,FAA,CAAC,ANAC			72-34-01		Package R	27	REPLACE THE REAR FAN EXIT CASE BRACKET ASSEMBLIES		855.00	SR Technics Switzerland
137716	52G147-01	EASA,FAA,CAAC,ANAC			72-34-01		Package S	29	REPLACE THE THRUST MOUNT BUSHINGS		2345.00	SR Technics Switzerland
137716	52G148	EASA,FAA,CAAC,ANAC			72-34-01		Package SB01	PWENG 72-448	PROVIDE SHORTER INSERT FOR ALTERNATE USE WHERE REQUIRED		505.00	SR Technics Switzerland
137716	52G149	EASA,FAA,CAAC,ANAC			72-34-01		Package SB02	PWENG 72-490	CONVERSION OF A PW4460 OR PW4462 TO A PW4460 (-3) OR PW4462 (-3)		8625.00	SR Technics Switzerland
137716	52G209	EASA,FAA,CAAC,ANAC			72-34-01		Package SB03	PWENG 72-504	CONVERSION OF A PW4052, PW4056, PW4060, TO A PW4052(-3), PW4056(-3), OR PW4060(-3)		8625.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137716	52G209-002	EASA,FAA,CAAC,ANAC			72-34-01		Package SB04	PW4ENG 72-572	CONVERSION OF PW4152/56A/58 TO -3 / M34		8625.00	SR Technics Switzerland
137716	52G210	EASA,FAA,CAAC,ANAC			72-34-01		Package SB05	PW4ENG 72-669	REPLACEMENT OF WITH ALUMINUM FAIRINGS		460.00	SR Technics Switzerland
137716	52G210-001	EASA,FAA,CAAC,ANAC			72-34-01		Package SB06	PW4ENG 72-778	IMPROVED ATTACHMENT STRUT FAIRINGS		11105.00	SR Technics Switzerland
137716	52G456	EASA,FAA,CAAC,ANAC			72-34-01		Package SB07	PW4ENG 73-0088	PROBE (OR TRANSDUCER), N1, SPEED, IMPROVED INSTALLATION CONF 2.C. INSTALL STUD		315.00	SR Technics Switzerland
137716	52G545	EASA,FAA,CAAC,ANAC			72-34-01		Package SB08	PW4ENG 72-333	X-RAY INSPECTION OF THRUST BRACKET WELDS		555.00	SR Technics Switzerland
137716					72-34-01		Package SB09	PW4ENG 72-767	INSPECTION OF STRUT FAIRINGS FOR MISSING OR LOOSE RIVETS		425.00	SR Technics Switzerland
137716					72-34-01		Package SB10	PW4ENG-1-09	IMC-LINER BRACKETS INSPECTION		480.00	SR Technics Switzerland
137716					72-34-01		Package SB11	PW4ENG 72-848	IMC-MODI TO PREVENT LINER LIBERATION		730.00	SR Technics Switzerland
137716					72-34-01		Package SB12	PWENG 72-743	REPLACEMENT WITH ASYMMETRIC VANE PATTERN		23145.00	SR Technics Switzerland
137716					72-34-01		Package T	110	REPLACE THE CENTER BRACKET ASSEMBLIES		1795.00	SR Technics Switzerland
137716					72-34-01		Package T	122	REAR BRACKET REPLACEMENT REPAIR		1795.00	SR Technics Switzerland
137716					72-34-01		Package T	35	REPAIR THE THREADED HOLES IN THE GROUND HANDLING PAD		1795.00	SR Technics Switzerland
137716					72-34-01		Package T	37	REPLACE THE BAFFLES		1795.00	SR Technics Switzerland
137716					72-34-01		Package U	31	CRACKS/DAMAGE WELD REPAIR		3680.00	SR Technics Switzerland
137716					72-34-01		Package V	32	MACHINE THE FRONT MOUNT INNER SURFACE		1145.00	SR Technics Switzerland
137716					72-34-01		Package W	123	BLEND THRUST CLEVIS BRACKET		845.00	SR Technics Switzerland
137716					72-34-01		Package X	34	REPLACE A FAIRING WITH RIVETS ALL AROUND WITH A FAIRING WITHOUT INITIAL RIVET HOLES		4805.00	SR Technics Switzerland
137716					72-34-01		Package Z	39	REPLACE THE TIMING PIN		580.00	SR Technics Switzerland
137716					72-34-01		Package Z	41	APPLY ANODIZE TOUCH-UP SOLUTION		580.00	SR Technics Switzerland
137717	50G034	EASA,FAA,CAAC,ANAC	23	28	72-62-10	ANGLE GEARBOX - ANGLE GEARBOX HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		1560.00	SR Technics Switzerland
137717					72-62-10		Package B	06	REPAIR THE BORE WITH A BUSHING		1560.00	SR Technics Switzerland
137717					72-62-10		Package C	02	ANODIZE TOUCH-UP		235.00	SR Technics Switzerland
137717					72-62-10		Package D	03	SURFACE DAMAGE BLEND REPAIR		235.00	SR Technics Switzerland
137718	50G001	EASA,FAA,CAAC,ANAC	22	28	72-62-01	ANGLE GEARBOX - ANGLE GEARBOX HOUSING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1575.00	SR Technics Switzerland
137718					72-62-01		Package B	01	REPLACE HELICAL COIL INSERTS		730.00	SR Technics Switzerland
137718					72-62-01		Package C	02	ANODIZE TOUCH-UP		440.00	SR Technics Switzerland
137718					72-62-01		Package D	03	SURFACE DAMAGE BLEND REPAIR		535.00	SR Technics Switzerland
137718					72-62-01		Package E	04	PLATE THE GEARBOX HOUSING ID WITH NICKEL		2095.00	SR Technics Switzerland
137718					72-62-01		Package F	05	BOTTOM COVER ID NICKEL PLATE REPAIR		1840.00	SR Technics Switzerland
137718					72-62-01		Package G	06	PLATE THE SNOUT WITH NICKEL		2590.00	SR Technics Switzerland
137718					72-62-01		Package H	07	HOLLOW PIN REPLACEMENT REPAIR		1305.00	SR Technics Switzerland
137718					72-62-01		Package I	08	REPLACE THE BUSHING		1815.00	SR Technics Switzerland
137718					72-62-01		Package J	09	UPPER BEARING JOURNAL BUSHING REPAIR		2465.00	SR Technics Switzerland
137725	50D361	EASA,FAA,CAAC,ANAC	35	28	72-33-03	FAN CASE - FAN EXIT (OUTER) CASE	Package A	CLN/INSP	CLEANING AND INSPECTION		3250.00	SR Technics Switzerland
137725	50D364	EASA,FAA,CAAC,ANAC			72-33-03		Package B	01	APPLY ANODIZE TOUCH-UP SOLUTION		535.00	SR Technics Switzerland
137725	50D901	EASA,FAA,CAAC,ANAC			72-33-03		Package C	02	SMOOTH THE DAMAGE		905.00	SR Technics Switzerland
137725	50D901-001	EASA,FAA,CAAC,ANAC			72-33-03		Package D	03	STRAIGHTEN THE B1 FLANGE AND CRACK WELD REPAIR		3045.00	SR Technics Switzerland
137725	51D720	EASA,FAA,CAAC,ANAC			72-33-03		Package E	04	REPAIR A VANE BOLTHOLE WITH A BUSHING 94"	OEM CIR REPAIR	3885.00	SR Technics Switzerland
137725	53D925	EASA,FAA,CAAC,ANAC			72-33-03		Package G	06	PLASMA COAT THE OUTER REAR FLANGE SNAP DIAMETER		3775.00	SR Technics Switzerland
137725					72-33-03		Package H	07	SMOOTH THE DAMAGE		4140.00	SR Technics Switzerland
137725					72-33-03		Package I	08	CORROSION REMOVAL (INNER SURFACE) REPAIR		4015.00	SR Technics Switzerland
137725					72-33-03		Package J	09	B1 FLANGE SCALLOP CRACK REPAIR		865.00	SR Technics Switzerland
137725					72-33-03		Package L	11	COATING REPLACEMENT (INNER SURFACE) REPAIR		1620.00	SR Technics Switzerland
137725					72-33-03		Package N	13	FLANGE B BOLTHOLES BLEND/MACHINE REPAIR		685.00	SR Technics Switzerland
137725					72-33-03		Package O	14	CORROSION REMOVAL (INNER SURFACE) REPAIR		3595.00	SR Technics Switzerland
137725					72-33-03		Package P	15	DOUBLER REPAIR 94"	OEM CIR REPAIR	4300.00	SR Technics Switzerland
137725					72-33-03		Package SB00	PW4ENG 72-347	MODIFICATION OF TO INCORPORATE ADDITIONAL CUT IN THE B1 FLANGE		1515.00	SR Technics Switzerland
137725					72-33-03		Package SB01	PW4ENG 72-754	MODIFICATION OF FAN EXIT OUTER CASE		3145.00	SR Technics Switzerland
137726	50S001	EASA,FAA,CAAC,ANAC	48	28	72-35-40	HIGH PRESSURE COMPRESSOR (HPC) - FRONT CASE/OUTER AIRSEAL SE	Package A	CLN/INSP	CLEANING AND INSPECTION		1850.00	SR Technics Switzerland
137726	50S001-001	EASA,FAA,CAAC,ANAC			72-35-40		Package AA	26	WELD BOLT HOLE IN REAR FLANGE		3850.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137726	505007-01	EASA,FAA,CAAC,ANAC			72-35-40		Package AB	27	BLEND METAL SURFACE DAMAGE		920.00	SR Technics Switzerland
137726	51H224	EASA,FAA,CAAC,ANAC			72-35-40		Package AC	48	COMPRESSOR STATOR CYLINDER SUPPORT MOUNTING BRACKET LOCATING PIN REPLACEMENT REPAIR		1085.00	SR Technics Switzerland
137726	51H532	EASA,FAA,CAAC,ANAC			72-35-40		Package AD	49	STAGE 6 SHROUD LIP FACE PLASMA COAT REPAIR		2980.00	SR Technics Switzerland
137726	51H532-001	EASA,FAA,CAAC,ANAC			72-35-40		Package AE	30	PLASMA SPRAY REPAIR THE REAR SNAP DIAMETER		3285.00	SR Technics Switzerland
137726	51H532-002	EASA,FAA,CAAC,ANAC			72-35-40		Package AF	41	SHROUD GROOVE WEAR WELD REPAIR		5975.00	SR Technics Switzerland
137726	52H431	EASA,FAA,CAAC,ANAC			72-35-40		Package AG	47	STAGE 5 SHROUD AXIAL CONTACT SURFACES PLASMA COAT REPAIR		2925.00	SR Technics Switzerland
137726	52H433	EASA,FAA,CAAC,ANAC			72-35-40		Package AH		DISMANTLE AND COMPLETE BRACKETS		570.00	SR Technics Switzerland
137726	53H066	EASA,FAA,CAAC,ANAC			72-35-40		Package AI	35	REPLACE THE 7TH STAGE HPC RING STOP		610.00	SR Technics Switzerland
137726	53H066-001	EASA,FAA,CAAC,ANAC			72-35-40		Package AJ	37	PLASMA SPRAY REPAIR THE 6/7TH STAGE STATOR MATING FACE		5485.00	SR Technics Switzerland
137726	53H066-002	EASA,FAA,CAAC,ANAC			72-35-40		Package AK	42	STAGE 5-7 SHROUD AXIAL CONTACT SURFACES PLASMA COAT REPAIR		6485.00	SR Technics Switzerland
137726	53H066-003	EASA,FAA,CAAC,ANAC			72-35-40		Package AL	39	SPLIT FLANGE BOLT HOLES EDGE REPAIR		835.00	SR Technics Switzerland
137726	54H025	EASA,FAA,CAAC,ANAC			72-35-40		Package AN	44	REPLACEMENT OF HPC VSV BEARINGS		5980.00	SR Technics Switzerland
137726	54H134-01	EASA,FAA,CAAC,ANAC			72-35-40		Package AN	53	STAGE 5 THRU STAGE 7 SHROUD GROOVES WEAR WELD REPAIR		5980.00	SR Technics Switzerland
137726	55H293-01	EASA,FAA,CAAC,ANAC			72-35-40		Package B	01	REPLACE WORN HPC BEARING		1125.00	SR Technics Switzerland
137726	56H194	EASA,FAA,CAAC,ANAC			72-35-40		Package C	02	REPLACE HPC FRONT CASE/OUTER AIRSEAL SET HELICOIL INSERTS		1135.00	SR Technics Switzerland
137726	56H194	EASA,FAA,ANAC			72-35-40		Package D	03	REPLACE THREADED INSERT FOR HPC FRONT CASE/OUTER AIRSEAL SET BORESCOPE BOSS		600.00	SR Technics Switzerland
137726	58H006-01	EASA,FAA,CAAC,ANAC			72-35-40		Package E	04	REPLACE .250-28 THREADED INSERTS FOR HPC FRONT CASE/OUTER AIRSEAL SET 6/7 OUTER SHROUD BOLTS		670.00	SR Technics Switzerland
137726					72-35-40		Package F	05	BUSHING REPAIR - HPC FRONT CASE/OUTER AIRSEAL SET STATOR ACTUATOR SUPPORT LUGS		2465.00	SR Technics Switzerland
137726					72-35-40		Package G	06	WELD REPAIR OF STATOR CYLINDER LOWER SUPPORT LUGS		4175.00	SR Technics Switzerland
137726					72-35-40		Package H	07	WELD REPAIR OF CRACKED BOLT HOLES IN FLANGE		3850.00	SR Technics Switzerland
137726					72-35-40		Package I	08	WELD REPAIR OF CRACKS IN THE HPC FRONT CASE ASSEMBLY		5550.00	SR Technics Switzerland
137726					72-35-40		Package J	09	BLEND METAL SURFACE DAMAGE		990.00	SR Technics Switzerland
137726					72-35-40		Package M	12	WELD REPAIR OF SVA UPPER AND LOWER SUPPORT LUG HOLES		5550.00	SR Technics Switzerland
137726					72-35-40		Package N	13	PLASMA SPRAY REPAIR THE REAR FLANGE FACE		3300.00	SR Technics Switzerland
137726					72-35-40		Package O	14	PLASMA SPRAY REPAIR THE FRONT FLANGE FACE		3730.00	SR Technics Switzerland
137726					72-35-40		Package P	15	PLASMA SPRAY REPAIR THE 8TH STAGE STATOR MATING SNAP DIAMETER		5775.00	SR Technics Switzerland
137726					72-35-40		Package Q	16	PLASMA SPRAY REPAIR THE REAR SNAP DIAMETER		3160.00	SR Technics Switzerland
137726					72-35-40		Package R	17	PLASMA SPRAY REPAIR THE FRONT SNAP DIAMETER		7925.00	SR Technics Switzerland
137726					72-35-40		Package R	31	PLASMA SPRAY REPAIR THE FRONT SNAP DIAMETER		7925.00	SR Technics Switzerland
137726					72-35-40		Package S	18	FRONT FLANGE BOLT HOLE REPAIR (FLANGE E)		2340.00	SR Technics Switzerland
137726					72-35-40		Package SB00	PW4ENG 72-220	CASE ASSEMBLY, HPC, FRONT - REPLACEMENT OF		1210.00	SR Technics Switzerland
137726					72-35-40		Package SB02	PW4ENG 72-755	ROTOR STATOR MODULE, HPC - MODIF. OF TO INCORP. A RING CASE CI BOEING CONFIG.		2730.00	SR Technics Switzerland
137726					72-35-40		Package SB02	PW4ENG 72-756	ROTOR STATOR MODULE, HPC - MODIF. OF TO INCORP. A RING CASE CI AIRBUS CONFIG.		2730.00	SR Technics Switzerland
137726					72-35-40		Package SB02	PW4ENG 72-757	ROTOR STATOR MODULE, HPC - MODIF. OF TO INCORP. A RING CASE CI MCDONNELL CONFIG		2730.00	SR Technics Switzerland
137726					72-35-40		Package SB03	PW4ENG 72-326	CASE ASSEMBLY, HPC, FRONT - INCORPORATION OF BORESCOPE PLUGS WITH LOCKING TAB WASHERS		1210.00	SR Technics Switzerland
137726					72-35-40		Package SB04	PW4ENG 72-837	CASE ASSEMBLY, HPC, FRONT		290.00	SR Technics Switzerland
137726					72-35-40		Package SB05	PW4ENG 72-679	HPC,MODI OF FRT CASE+SHROUD WITH COATING		480.00	SR Technics Switzerland
137726					72-35-40		Package U	54	STAGE 7 FLOWPATH WEAR WELD BUILD-UP		1525.00	SR Technics Switzerland
137726					72-35-40		Package X	23	HPC VSV-BEARING REPLACEMENT		695.00	SR Technics Switzerland
137726					72-35-40		Package Y	24	REPLACE HPC FRONT CASE/OUTER AIRSEAL SET HELICOIL INSERTS		980.00	SR Technics Switzerland
137726					72-35-40		Package Z	25	BORESCOPE THREADED .5625-18 HOLE INSERT REPAIR		980.00	SR Technics Switzerland
137727	51D747	EASA,FAA,CAAC,ANAC	33	28	72-34-20	INTERMEDIATE CASE - NO. 1.5 BEARING SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		385.00	SR Technics Switzerland
137727	51D747-001	EASA,FAA,CAAC,ANAC			72-34-20		Package C	08	PLASMA SPRAY REAR SNAP DIAMETER BY (PWA 53-13 OR PWA 53-38)		1910.00	SR Technics Switzerland
137727	53D316	EASA,FAA,CAAC,ANAC			72-34-20		Package E	04	REPLACE CLINCH NUTS		570.00	SR Technics Switzerland
137727					72-34-20		Package F	05	REPLACE HELICAL COIL INSERTS		570.00	SR Technics Switzerland
137727					72-34-20		Package G	10	UPPER BEARING JOURNAL BUSHING REPAIR		2925.00	SR Technics Switzerland
137727					72-34-20		Package SB00	PW4ENG A72-656	INSPECTION OF THE SUPPORT FOR A THIN WALL CONDITION		1700.00	SR Technics Switzerland
137729	70R051	EASA,FAA,CAAC,ANAC	22	28	72-61-23	MAIN GEARBOX - GEARBOX DRIVESHAFT HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		495.00	SR Technics Switzerland
137729	70R911	EASA,FAA,CAAC,ANAC			72-61-23		Package C	02	ANODIZE TOUCH-UP		425.00	SR Technics Switzerland
137729					72-61-23		Package D	03	NICKEL PLATE THE FRONT ID		1220.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137729					72-61-23		Package E	04	NICKEL PLATE THE REAR OD		1370.00	SR Technics Switzerland
137729					72-61-23		Package F	05	NICKEL PLATE THE OIL TUBE HOLE INNER DIAMETER		1440.00	SR Technics Switzerland
137729					72-61-23		Package G	06	NICKEL PLATE THE FLANGE FACE		1370.00	SR Technics Switzerland
137729					72-61-23		Package H	07	REPLACE THE BUSHINGS IN THE MOUNT CLEVIS		990.00	SR Technics Switzerland
137729					72-61-23		Package I	08	REPAIR THE REAR ID WITH A BUSHING		2065.00	SR Technics Switzerland
137730	70R061	EASA,FAA,CAAC,ANAC	23	28	72-61-30	MAIN GEARBOX - GEARBOX BEARING HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		520.00	SR Technics Switzerland
137730					72-61-30		Package C	02	ANODIZE TOUCH-UP		680.00	SR Technics Switzerland
137730					72-61-30		Package D	03	NICKEL PLATE THE OD		1380.00	SR Technics Switzerland
137730					72-61-30		Package E	04	REPAIR THE FRONT ID WITH A BUSHING		1795.00	SR Technics Switzerland
137730					72-61-30		Package F	05	REPAIR THE MIDDLE ID WITH A BUSHING		1795.00	SR Technics Switzerland
137730					72-61-30		Package G	06	REPAIR THE REAR ID WITH A BUSHING		1795.00	SR Technics Switzerland
137731	70R063	EASA,FAA,CAAC,ANAC	22	28	72-61-28	MAIN GEARBOX - GEARBOX (FUEL PUMP DRIVE) BEARING HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		425.00	SR Technics Switzerland
137731	70R910	EASA,FAA,CAAC,ANAC			72-61-28		Package C	02	ANODIZE TOUCH-UP		155.00	SR Technics Switzerland
137731					72-61-28		Package D	03	NICKEL PLATE THE OD		1065.00	SR Technics Switzerland
137731					72-61-28		Package E	04	REPAIR THE FRONT ID WITH A BUSHING		1360.00	SR Technics Switzerland
137731					72-61-28		Package F	05	REPAIR THE MIDDLE ID WITH A BUSHING		1760.00	SR Technics Switzerland
137731					72-61-28		Package G	06	REPAIR THE REAR ID WITH A BUSHING		1360.00	SR Technics Switzerland
137731					72-61-28		Package H	07	REPLACE LOCATING PIN		350.00	SR Technics Switzerland
137731					72-61-28		Package I	08	REPAIR THE LOCATING PIN HOLE BUSHING	POST REQUISITE REPAIR-07 ALLREADY INCLUD	1555.00	SR Technics Switzerland
137732	70R065	EASA,FAA,CAAC,ANAC	22	28	72-61-26	MAIN GEARBOX - GEARBOX (STARTER DRIVE) GEARSHAFT ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		375.00	SR Technics Switzerland
137732	71R117	EASA,FAA,CAAC,ANAC			72-61-26		Package C	02	ANODIZE TOUCH-UP		300.00	SR Technics Switzerland
137732	71R169	EASA,FAA,CAAC,ANAC			72-61-26		Package D	03	NICKEL PLATE THE OD		885.00	SR Technics Switzerland
137732					72-61-26		Package E	04	REPAIR THE FRONT ID WITH A BUSHING		755.00	SR Technics Switzerland
137732					72-61-26		Package F	05	REPAIR THE MIDDLE ID WITH A BUSHING		755.00	SR Technics Switzerland
137732					72-61-26		Package G	06	REPAIR THE REAR ID WITH A BUSHING		875.00	SR Technics Switzerland
137733	70R067	EASA,FAA,CAAC,ANAC	24	28	72-61-32	MAIN GEARBOX - GEARBOX IDG DRIVE BEARING HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		520.00	SR Technics Switzerland
137733					72-61-32		Package C	02	ANODIZE TOUCH-UP		325.00	SR Technics Switzerland
137733					72-61-32		Package D	03	NICKEL PLATE THE OD		1380.00	SR Technics Switzerland
137733					72-61-32		Package E	04	REPAIR THE FRONT ID WITH A BUSHING		1795.00	SR Technics Switzerland
137733					72-61-32		Package F	05	REPAIR THE MIDDLE ID WITH A BUSHING		1795.00	SR Technics Switzerland
137733					72-61-32		Package J	SPM	REMOVE DEFECTIVE BOLTS FROM CLAMP	SPM 70-00-00-350-006/ SPOP 416	115.00	SR Technics Switzerland
137734	51R184	EASA,FAA,CAAC,ANAC	24	28	72-61-60	MAIN GEARBOX - MAIN OIL FILTER HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		370.00	SR Technics Switzerland
137734	70R093	EASA,FAA,CAAC,ANAC			72-61-60		Package C	02	ANODIZE TOUCH-UP		305.00	SR Technics Switzerland
137734	70R647	EASA,FAA,CAAC,ANAC			72-61-60		Package D	03	REPAIR THE FRONT ID WITH A BUSHING		765.00	SR Technics Switzerland
137734	70R647-001	EASA,FAA,CAAC,ANAC			72-61-60		Package E	04	REPAIR THE MIDDLE IDS WITH A BUSHING		765.00	SR Technics Switzerland
137734	70R654	EASA,FAA,CAAC,ANAC			72-61-60		Package F	05	REPAIR THE REAR BORES WITH BUSHINGS		765.00	SR Technics Switzerland
137734	70R914	EASA,FAA,CAAC,ANAC			72-61-60		Package H	06	REPLACE DAMAGED OR LOOSE STUDS		660.00	SR Technics Switzerland
137734	70R914-001	EASA,FAA,CAAC,ANAC			72-61-60		Package H	07	REPLACE DAMAGED OR LOOSE STUDS		660.00	SR Technics Switzerland
137734	70R962	EASA,FAA,CAAC,ANAC			72-61-60		Package SB00	PW4ENG 72-701	MGB-OIL FILTER HOUSING-MODIF.WITH STUDS		1050.00	SR Technics Switzerland
137734					72-61-60		Package SB01	PW4ENG 72-525	OIL FILTER HOUSING : NEW DUAL ELEMENT FILTER		915.00	SR Technics Switzerland
137735	70R102	EASA,FAA,CAAC,ANAC	22	28	72-61-18	MAIN GEARBOX - GEARBOX DEOILER HOUSING ASSEMBLY	Package B	01	REPLACE HELICAL COIL INSERTS		305.00	SR Technics Switzerland
137735					72-61-18		Package C	02	ANODIZE TOUCH-UP		280.00	SR Technics Switzerland
137735					72-61-18		Package D	03	NICKEL PLATE THE OD		715.00	SR Technics Switzerland
137735					72-61-18		Package E	04	NICKEL PLATE THE FLANGE FACE		715.00	SR Technics Switzerland
137736	50H470	EASA,FAA,CAAC,ANAC	30	28	72-35-05	HIGH PRESSURE COMPRESSOR (HPC) - FRONT HUB	Package A	CLN/INSP	CLEANING AND INSPECTION		1105.00	SR Technics Switzerland
137736	51H572	EASA,FAA,CAAC,ANAC,CAA UK			72-35-05		Package D	03	SURFACE DAMAGE BLEND REPAIR		1385.00	SR Technics Switzerland
137736					72-35-05		Package E	04	PLASMA SPRAY REPAIR - HPC FRONT HUB NO. 2 FRONT SEAL SEAT JOURNAL		3085.00	SR Technics Switzerland
137736					72-35-05		Package F	05	NO. 2 FRONT SEAL SEAT SHOULDER COAT REPAIR		4145.00	SR Technics Switzerland
137736					72-35-05		Package G	06	PLASMA SPRAY REPAIR - HPC FRONT HUB SNAP DIAMETER		2900.00	SR Technics Switzerland
137736					72-35-05		Package H	07	PLASMA SPRAY REPAIR - HPC FRONT HUB NO. 2 BEARING SHOULDER		2900.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137736					72-35-05		Package I	08	PLASMA SPRAY REPAIR - HPC FRONT HUB NO. 2 BEARING SEAL SEAT PILOT		2840.00	SR Technics Switzerland
137736					72-35-05		Package J	09	PLASMA SPRAY REPAIR - HPC FRONT HUB NO. 2 BEARING JOURNAL		3275.00	SR Technics Switzerland
137736					72-35-05		Package K	10	REPAIR ANTI-TORQUE SLOTS		2765.00	SR Technics Switzerland
137736					72-35-05		Package L	11	BLEND REPAIR ANTI-TORQUE LUGS		980.00	SR Technics Switzerland
137736					72-35-05		Package N	13	THREAD BLEND REPAIR		660.00	SR Technics Switzerland
137736					72-35-05		Package SB00	PW4ENG 72-201	HPC MOD.OF FRT HUB + DRUM ROT. DISK ASSY		480.00	SR Technics Switzerland
137737	50A559	EASA,FAA,CAAC,ANAC	25	28	72-61-81	MAIN GEARBOX - GEARBOX DRIVESHAFT (FRONT) HOUSING / HOUSING	Package A	CLN/INSP	CLEANING AND INSPECTION		580.00	SR Technics Switzerland
137737	51A006-01	EASA,FAA,CAAC,ANAC			72-61-81		Package B	01	NICKEL PLATE THE FRONT SNAP DIAMETER		925.00	SR Technics Switzerland
137737					72-61-81		Package C	02	NICKEL PLATE THE REAR SNAP DIAMETER		990.00	SR Technics Switzerland
137737					72-61-81		Package D	03	SURFACE DAMAGE BLEND REPAIR		410.00	SR Technics Switzerland
137737					72-61-81		Package E	04	PIN AND COLLAR SEALING COMPOUND REPAIR		480.00	SR Technics Switzerland
137737					72-61-81		Package F	05	CRACK WELD REPAIR		980.00	SR Technics Switzerland
137737					72-61-81		Package G	06	BENT MOUNT TAB COLD STRAIGHTENING REPAIR		380.00	SR Technics Switzerland
137737					72-61-81		Package H	07	FLANGE BOLT HOLE WELD REPAIR		755.00	SR Technics Switzerland
137737					72-61-81		Package M	INSP/CHECK 3	REPLACE DRIVE SHAFT HOUSING HELICOIL		315.00	SR Technics Switzerland
137738	70R508	EASA,FAA,CAAC,ANAC	27	28	72-61-31	MAIN GEARBOX - GEARBOX IDG DRIVE SPUR GEARSHAFT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1065.00	SR Technics Switzerland
137738	70R509	EASA,FAA,CAAC,ANAC			72-61-31		Package B	01	LAP CARBON SEAL MATING FACE		370.00	SR Technics Switzerland
137738	70R693	EASA,FAA,CAAC,ANAC			72-61-31		Package C	02	REPLACE OIL SCOOP		630.00	SR Technics Switzerland
137738	71R071	EASA,FAA,CAAC,ANAC			72-61-31		Package D	03	CHROMIUM PLATE FRONT SEALING FACE		1460.00	SR Technics Switzerland
137738	71R165	EASA,FAA,CAAC,ANAC			72-61-31		Package E	04	CHROMIUM PLATE SEALING FACE		1575.00	SR Technics Switzerland
137738					72-61-31		Package F	05	CHROMIUM PLATE FRONT BEARING JOURNAL		2200.00	SR Technics Switzerland
137738					72-61-31		Package F	07	PLATE THE FRONT BEARING SHOULDER WITH CHROMIUM		2200.00	SR Technics Switzerland
137738					72-61-31		Package G	06	CHROMIUM PLATE REAR BEARING JOURNAL		2200.00	SR Technics Switzerland
137738					72-61-31		Package G	08	PLATE THE REAR BEARING SHOULDER WITH CHROMIUM		2200.00	SR Technics Switzerland
137738					72-61-31		Package SB00	PW4ENG 72-581	MODIFICATION OT TO REMOVE THE CUP PLUG		155.00	SR Technics Switzerland
137738					72-61-31		Package SB01	PW4ENG 72-802	MODIFICATION AND REPLACEMENT TO IMPROVE DURABILITY		2200.00	SR Technics Switzerland
137739	70R149	EASA,FAA,CAAC,ANAC	25	28	72-61-11	MAIN GEARBOX - GEARBOX (DEOILER) SPUR GEARSHAFT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		580.00	SR Technics Switzerland
137739	71R154	EASA,FAA,CAAC,ANAC			72-61-11		Package B	01	NICKEL/CHROMIUM PLATE SEALING FACE		2090.00	SR Technics Switzerland
137739					72-61-11		Package F	05	LAP THE SEALING FACE		370.00	SR Technics Switzerland
137739					72-61-11		Package SB00	PW4ENG 72-802	MODIFICATION AND REPLACEMENT TO IMPROVE DURABILITY		570.00	SR Technics Switzerland
137740	50H953	EASA,FAA,CAAC,ANAC	30	28	72-35-67	HIGH PRESSURE COMPRESSOR (HPC) - HPC REAR SUPPORT	Package A	CLN/INSP	CLEANING AND INSPECTION		405.00	SR Technics Switzerland
137740					72-35-67		Package B	01	PLASMA COAT INNER FLANGE SNAP DIAMETER		2740.00	SR Technics Switzerland
137740					72-35-67		Package D	03	PLASMA COAT OUTER FLANGE FRONT FACE		2495.00	SR Technics Switzerland
137740					72-35-67		Package E	04	PLASMA COAT OUTER FLANGE SNAP DIAMETER (POST SB PW4ENG 72-298 AND SB PW4G-100-72-52)		2495.00	SR Technics Switzerland
137740					72-35-67		Package G	EA-12K324	PLASMA COAT OUTER FLANGE FRONT FACE EXTENDED LIMITS FOR MPN 55H302 ONLY		9425.00	SR Technics Switzerland
137740					72-35-67		Package J	09	INNER FACE FRONT FLANGE PLASMA COAT REPAIR		2515.00	SR Technics Switzerland
137741	50A289	EASA,FAA,CAAC,ANAC	30	28	72-34-11	INTERMEDIATE CASE - NO. 2 BEARING RETAINING NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		185.00	SR Technics Switzerland
137741					72-34-11		Package B	01	REPAIR THE ANTIGALLANT COMPOUND		410.00	SR Technics Switzerland
137741					72-34-11		Package C	02	BEARING FACE MACHINE REPAIR		600.00	SR Technics Switzerland
137741					72-34-11		Package SB00	PW4G-100-72-185	INCREASED TORQUE		135.00	SR Technics Switzerland
137741					72-34-11		Package SB01	PW4ENG 72-748	INCREASED FINAL ANGLE OF TURN		135.00	SR Technics Switzerland
137742	50A313	EASA,FAA,CAAC,ANAC	28	21	72-34-27	INTERMEDIATE CASE - NO. 1.5 AND 2 BEARING TUBE CONNECTOR ASS	Package A	CLN/INSP	CLEANING AND INSPECTION		220.00	SR Technics Switzerland
137742	50A691	EASA,FAA,CAAC,ANAC			72-34-27		Package B	01	PIN REPLACEMENT		305.00	SR Technics Switzerland
137742					72-34-27		Package C	02	ANODIZE TOUCH-UP		275.00	SR Technics Switzerland
137742					72-34-27		Package D	03	REPLACE HELI-COIL INSERT		300.00	SR Technics Switzerland
137742					72-34-27		Package E	04	BUSHING REPLACEMENT REPAIR		1315.00	SR Technics Switzerland
137743	50G005	EASA,FAA,CAAC,ANAC	5	28	72H2D02	PW4 ANGLE GEARBOX BEVEL GEAR ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		340.00	SR Technics Switzerland
137743	50G949	EASA,FAA,CAAC,ANAC			72H2D02		Package B	01	UPPER BEARING JOURNAL CHROMIUM PLATE		1490.00	SR Technics Switzerland
137743					72H2D02		Package C	02	LOWER BEARING JOURNAL CHROMIUM PLATE		1490.00	SR Technics Switzerland
137743					72H2D02		Package D	03	UPPER BEARING SHOULDER CHROMIUM PLATE		1490.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137743					72162102		Package E	04	LOWER BEARING SHOULDER CHROMIUM PLATE		1490.00	SR Technics Switzerland
137743					72162102		Package F	05	SURFACE DAMAGE BLEND REPAIR		180.00	SR Technics Switzerland
137744	50L629	EASA,FAA,CAAC,ANAC	5	28	72-52-35	PW4 STAGE 2 DUCT SEGMENT	Package A	CLN/INSP	CLEANING AND INSPECTION		95.00	SR Technics Switzerland
137744	53L135	EASA,FAA,CAAC,ANAC			72-52-35		Package C	02	GRIND REPLACEMENT DUCT SEGMENTS		500.00	SR Technics Switzerland
137744					72-52-35		Package SB00	72-795	INTRODUCTION OF THE ADVANTAGE PERFORMANCE UPGRADE CONFIGURATION TO IMPROVE HPT PERFORMANCE		480.00	SR Technics Switzerland
137744					72-52-35		Package SB01	PW4G-100-72-219	INCORPORATION OF THE ADVANTAGE 70 PERFORMANCE AND DURABILITY UPGRADE KIT		480.00	SR Technics Switzerland
137744					72-52-35		Package SB02	PW4G-100-72-220	CONVERSION OF A PW4168A ENGINE TO A PW4164-1D, PW4168-1D, PW4168A-1D, OR PW4170 ENGINE		480.00	SR Technics Switzerland
137746	70R005	EASA,FAA,CAAC,ANAC	26	28	72-61-22	MAIN GEARBOX - GEARBOX (DRIVE) SPUR GEARSHAFT	Package A	CLN/INSP	CLEANING AND INSPECTION		1120.00	SR Technics Switzerland
137746	71R073	EASA,FAA,CAAC,ANAC			72-61-22		Package B	02	CHROMIUM PLATE THE REAR BEARING JOURNAL		1750.00	SR Technics Switzerland
137746					72-61-22		Package C	01	CHROMIUM PLATE FRONT BEARING JOURNAL		1645.00	SR Technics Switzerland
137746					72-61-22		Package E	04	CHROMIUM PLATE REAR BEARING SHOULDER		1645.00	SR Technics Switzerland
137746					72-61-22		Package F	05	100" CHROMIUM PLATING FRONT BRG. JOURNAL		1680.00	SR Technics Switzerland
137746					72-61-22		Package J	09	GEAR TEETH INVOLUTE SURFACE REPAIR		270.00	SR Technics Switzerland
137747	70R003	EASA,FAA,CAAC,ANAC	27	28	72-61-21	MAIN GEARBOX - GEARBOX (IDLER) SPUR GEAR	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
137747	71R120	EASA,FAA,CAAC,ANAC			72-61-21		Package D	03	PLASMA COAT THE SHOULDER		1040.00	SR Technics Switzerland
137747					72-61-21		Package SB00	PW4ENG 72-664	DEOILER IDLER BRG WITH ANTI-ROT FEATURES	PW4000 - 94"	1750.00	SR Technics Switzerland
137747					72-61-21		Package SB01	PW4G-100-72-115	DEOILER IDLER BRG WITH ANTI-ROT FEATURES	PW4000 - 100"	1525.00	SR Technics Switzerland
137748	70R722	EASA,FAA,CAAC,ANAC	2	28	72-61-20	PW4 GEARBOX IDLER SHAFT	Package A	CLN/INSP	CLEANING & INSPECTION		525.00	SR Technics Switzerland
137748					72-61-20		Package B	01	CHROMIUM PLATE THE BEARING SHOULDER		1155.00	SR Technics Switzerland
137748					72-61-20		Package C	02	NICKEL PLATE THE REAR PILOT DIAMETER		815.00	SR Technics Switzerland
137748					72-61-20		Package D	03	NICKEL PLATE FRONT PILOT DIAMETER		815.00	SR Technics Switzerland
137748					72-61-20		Package E	04	CHROMIUM PLATE THE BEARING JOURNAL		1260.00	SR Technics Switzerland
137748					72-61-20		Package F	05	APPLY CADMIUM PLATE		250.00	SR Technics Switzerland
137749	70R554	EASA,FAA,CAAC,ANAC	4	28	72-61-41	PW4 GEARBOX SPUR GEARSHAFT (SCAVENGE PUMP DRIVE)	Package A	CLN/INSP	CLEANING AND INSPECTION		470.00	SR Technics Switzerland
137749	70R790-01	EASA,FAA,CAAC,ANAC			72-61-41		Package B	01	CHROMIUM PLATE FRONT BRG JOURNAL		1255.00	SR Technics Switzerland
137749					72-61-41		Package C	02	CHROMIUM PLATE REAR BRG JOURNAL		1255.00	SR Technics Switzerland
137749					72-61-41		Package D	03	CHROMIUM PLATE FRONT BRG SHOULDER		1255.00	SR Technics Switzerland
137749					72-61-41		Package E	04	CHROMIUM PLATE REAR BRG SHOULDER		1255.00	SR Technics Switzerland
137750	50N535	EASA,FAA,CAAC,ANAC	5	28	72153118	PW4 STAGE 3 LPT(INNER) DUCT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
137750					72153118		Package C	02	Restore PWA 73 Coating		495.00	SR Technics Switzerland
137750					72153118		Package H	07	Stud Replacement		540.00	SR Technics Switzerland
137750					72153118		Package SB01	72-513	3RD STG DUCT SEAL SUPPORT MODIF.		360.00	SR Technics Switzerland
137750					72153118		Package SB02	PW4G-100-72-41	LPT STG3 INNER DUCT- & SEAL RING PLASMA		360.00	SR Technics Switzerland
137753	50G103	EASA,FAA,CAAC,ANAC	24	28	72-33-12	FAN CASE - BLEED VALVE CONNECTING LINK - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		230.00	SR Technics Switzerland
137753	53D281	EASA,FAA,CAAC,ANAC			72-33-12		Package B	01	HOLE REPAIR		785.00	SR Technics Switzerland
137753					72-33-12		Package C	02	REPLACE THE BEARING		600.00	SR Technics Switzerland
137753					72-33-12		Package D	03	REPLACE THE ANTIGALLING COMPOUND		460.00	SR Technics Switzerland
137761	501602-01	EASA,FAA,CAAC,ANAC	35	28	72-41-06	DIFFUSER AND COMBUSTOR - NO. 3 BEARING FRONT COOLING DUCT /	Package A	CLN/INSP	CLEANING AND INSPECTION		895.00	SR Technics Switzerland
137761					72-41-06		Package B	01	NICKEL PLATE INNER SNAP DIAMETER		2230.00	SR Technics Switzerland
137761					72-41-06		Package D	03	RESTORE ANTIGALLANT NO.3		1065.00	SR Technics Switzerland
137761					72-41-06		Package E	04	WELD REPAIR CRACKS		4820.00	SR Technics Switzerland
137761					72-41-06		Package I	08	PLASMA SPRAY REP LARGE BOSS BORES		3030.00	SR Technics Switzerland
137761					72-41-06		Package J	09	OUTER SNAP DIAMETER PLASMA COAT REPAIR		2095.00	SR Technics Switzerland
137761					72-41-06		Package K	10	OUTER DIAMETER ROUND REPAIR		1230.00	SR Technics Switzerland
137762	50D151	EASA,FAA,CAAC,ANAC	32	28	72-33-09	FAN CASE - BLEED VALVE ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		790.00	SR Technics Switzerland
137762	50D151-001	EASA,FAA,CAAC,ANAC			72-33-09		Package B	01	ANODIZE TOUCH-UP		735.00	SR Technics Switzerland
137762	52D300	EASA,FAA,CAAC,ANAC			72-33-09		Package C	02	REPLACE RUBBER SEAL		1485.00	SR Technics Switzerland
137762	53D296	EASA,FAA,CAAC,ANAC			72-33-09		Package E	04	RESTORE TEFLON COATING		2035.00	SR Technics Switzerland
137762					72-33-09		Package F	05	REPLACE BUSHINGS		1020.00	SR Technics Switzerland
137762					72-33-09		Package G	06	HOLE REPAIR		1890.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137762					72-33-09		Package H	07	BLEND REPAIR		1400.00	SR Technics Switzerland
137762					72-33-09		Package SB00	PW4ENG 72-660	MODIFICATION OF THE 2.5 BLEED CAM FOLLOWER SLOTS		880.00	SR Technics Switzerland
137764	50N266	EASA,FAA,CAAC,ANAC	30	28	72-53-19	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT (INNER) SEALING RING AS	Package A	CLN/INSP	CLEANING AND INSPECTION		535.00	SR Technics Switzerland
137764	50N382-01	EASA,FAA,CAAC,ANAC			72-53-19		Package B	01	REPLACE HARDFACE		980.00	SR Technics Switzerland
137764	50N529-01	EASA,FAA,CAAC,ANAC			72-53-19		Package D	03	CRACK WELD REPAIR		5815.00	SR Technics Switzerland
137764	50N529-101	EASA,FAA,ANAC			72-53-19		Package K	SPM	REMOVE AND INSTALL DAMPER RING	ACC. SPM 70-43-00	530.00	SR Technics Switzerland
137764					72-53-19		Package SB00	PW4G-100-A72	LPT: REPL. AND/OR MOD. OF DISK & SEALS		500.00	SR Technics Switzerland
137765	50J362	EASA,FAA,CAAC,ANAC	29	28	72-41-08	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (FRONT) SEAL RING HOL	Package A	CLN/INSP	CLEANING AND INSPECTION	PN50J362-001P15 50J362-001P20 FOR SHOP V	435.00	SR Technics Switzerland
137765	50J362-001	EASA,FAA,CAAC,ANAC			72-41-08		Package B	01	CLINCH NUT REPLACEMENT		555.00	SR Technics Switzerland
137765	50J362-001P10	EASA,FAA,CAAC,ANAC			72-41-08		Package C	02	NICKEL PLATE REPAIR FRONT ID SNAP		1620.00	SR Technics Switzerland
137765	50J362-001P5	EASA,FAA,CAAC,ANAC			72-41-08		Package D	03	REAR SNAP INNER DIAMETER NICKEL PLATE REPAIR		1400.00	SR Technics Switzerland
137765	50J362P10	EASA,FAA,CAAC,ANAC			72-41-08		Package E	04	SEAL RING GROOVE REPAIR		1325.00	SR Technics Switzerland
137765	50J362P15	EASA,FAA,CAAC,ANAC			72-41-08		Package F	05	REPLACE RETAINING PIN(S)		1450.00	SR Technics Switzerland
137765	50J362P5	EASA,FAA,CAAC,ANAC			72-41-08		Package G	06	SMOOTH OUT DAMAGE TO THREADS		350.00	SR Technics Switzerland
137765	51J153	EASA,FAA,CAAC,ANAC			72-41-08		Package I	08	REPAIR THREADED HOLES - HELICAL COIL REPLACEMENT		495.00	SR Technics Switzerland
137765					72-41-08		Package J	09	BLEND SURFACE DAMAGE		495.00	SR Technics Switzerland
137765					72-41-08		Package K	INSP/CHK-05	LEAK CHECK		270.00	SR Technics Switzerland
137765					72-41-08		Package SB00	PW4ENG 72-684	INSPECTION FOR MICROSHREEN KAGE		340.00	SR Technics Switzerland
137765					72-41-08		Package U	20	JACKSCREW HOLE THREAD REPAIR		540.00	SR Technics Switzerland
137767	50L324	EASA,FAA,CAAC,ANAC	37	28	72-52-30	HIGH PRESSURE TURBINE (HPT) - TURBINE CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1825.00	SR Technics Switzerland
137767	50L440-003	EASA,FAA,CAAC,ANAC			72-52-30		Package AA	26	BOSS CORNER CRACK BLEND REPAIR		4380.00	SR Technics Switzerland
137767	50L533	EASA,FAA,CAAC,ANAC			72-52-30		Package AD	29	BRACKET REPLACEMENT		380.00	SR Technics Switzerland
137767	50L533-001	EASA,FAA,CAAC,ANAC			72-52-30		Package B	01	REPLACE NUT PLATES		855.00	SR Technics Switzerland
137767	50L533-002	EASA,FAA,CAAC,ANAC			72-52-30		Package C	02	PLASMA SPRAY REAR SNAP DIAMETER		3930.00	SR Technics Switzerland
137767	50L542	EASA,FAA,CAAC,ANAC			72-52-30		Package D	03	PLASMA SPRAY REAR FLANGE FACE		1740.00	SR Technics Switzerland
137767	50L669	EASA,FAA,CAAC,ANAC			72-52-30		Package E	04	PLASMA SPRAY REPAIR FRONT OD SNAP DIAMETER		4675.00	SR Technics Switzerland
137767	50L870	EASA,FAA,CAAC,ANAC			72-52-30		Package F	05	FRONT FLANGE FACE PLASMA COAT REPAIR		4850.00	SR Technics Switzerland
137767	50L870-001	EASA,FAA,CAAC,ANAC			72-52-30		Package H	07	RESTORE PWA 53-5 PLASMA SPRAY ON FRONT FACE		5570.00	SR Technics Switzerland
137767	50L870-002	EASA,FAA,CAAC,ANAC			72-52-30		Package J	09	SURFACE DAMAGE BLEND REPAIR		3440.00	SR Technics Switzerland
137767	50L870-003	EASA,FAA,CAAC,ANAC			72-52-30		Package K	10	PLASMA SPRAY REPAIR THE STAGE 2 HPT VANE MOUNT FLANGE		2275.00	SR Technics Switzerland
137767	50L888-01	EASA,FAA,CAAC,ANAC			72-52-30		Package L	11	REPAIR THREADED HOLES WITH HELICAL-COIL INSERTS		990.00	SR Technics Switzerland
137767					72-52-30		Package M	12	PLASMA SPRAY STG.1 OUTER AIR SEAL		4395.00	SR Technics Switzerland
137767					72-52-30		Package N	13	FRONT INNER RAIL CRACK WELD REPAIR		14305.00	SR Technics Switzerland
137767					72-52-30		Package SB00	PW4ENG 72-490	CONVERSION OF A PW4460 OR PW4460 (-3) OR PW4462 (-3)		520.00	SR Technics Switzerland
137767					72-52-30		Package SB01	PW4ENG 72-504	CONVERSION OF A PW4052, PW4056, PW4060 TO A PW4052(-3), PW4056(-3), OR PW4060(-3)		500.00	SR Technics Switzerland
137767					72-52-30		Package SB02	PW4ENG 72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152(-3), PW4156A(-3), OR PW4158(-3) ENGINE		520.00	SR Technics Switzerland
137767					72-52-30		Package SB03	PW4ENG 72-157	CASE & VANE ASSY, TURBINE - MODIFICATION OF TO INCORPORATE A SECOND STAGE TURBINE BORESCOPE PORT		1310.00	SR Technics Switzerland
137767					72-52-30		Package SB04	PW4ENG 72-392	CASE ASSY, HPT - MAKE A MODIFICATION TO MACHINE SCALLOPS IN M AND N FLANGES		6780.00	SR Technics Switzerland
137767					72-52-30		Package SB05	PW4ENG 72-34	CASE & VANE ASSY, TURBINE - MODIF. OF THE CAST CASE ASSY & THE 1 & REPL. OF THE 2ND & 1ST STG HPT DUCT SUI		3050.00	SR Technics Switzerland
137767					72-52-30		Package SB06	PW4ENG 72-462	ROTOR AND STATOR, HPT MODULE - INCORPORATE OF ADDITIONAL COOLING HOLES AND NEW SEALS		2790.00	SR Technics Switzerland
137771	50J337	EASA,FAA,CAAC,ANAC	29	28	72-41-10	DIFFUSER AND COMBUSTOR - NO. 3 BEARING HOUSING	Package A	CLN/INSP	CLEANING AND INSPECTION		405.00	SR Technics Switzerland
137771	50J504	EASA,FAA,CAAC,ANAC			72-41-10		Package B	01	SMOOTH OUT DAMAGE TO THREADS		680.00	SR Technics Switzerland
137771	50J782	EASA,FAA,CAAC,ANAC			72-41-10		Package E	04	NICKEL PLATE REPAIR THE COOLING DUCT FRONT SNAP DIAMETER		3335.00	SR Technics Switzerland
137771					72-41-10		Package E	04	PLASMA COAT REPAIR THE COOLING DUCT FRONT SNAP DIAMETER		3335.00	SR Technics Switzerland
137771					72-41-10		Package F	05	NICKEL PLATE REPAIR THE COOLING DUCT REAR SNAP DIAMETER		3605.00	SR Technics Switzerland
137771					72-41-10		Package F	05	PLASMA COAT REPAIR THE COOLING DUCT REAR SNAP DIAMETER		3605.00	SR Technics Switzerland
137771					72-41-10		Package G	06	NICKEL PLATE REPAIR FRONT CARBON SEAL SUPPORT SNAP DIAMETER		3800.00	SR Technics Switzerland
137771					72-41-10		Package H	07	NICKEL PLATE REPAIR REAR CARBON SEAL SUPPORT SNAP DIAMETER		3505.00	SR Technics Switzerland
137771					72-41-10		Package I	08	NICKEL PLATE REPAIR THE INNER MOUNT FLANGE SNAP DIAMETER		3605.00	SR Technics Switzerland
137771					72-41-10		Package I	08	PLASMA COAT REPAIR THE INNER MOUNT FLANGE SNAP DIAMETER		3605.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137771					72-41-10		Package J	09	PLASMA COAT REPAIR OUTER MOUNT FLANGE MATING DIAMETER		3505.00	SR Technics Switzerland
137771					72-41-10		Package J	09	NICKEL PLATE REPAIR OUTER MOUNT FLANGE SNAP DIAMETER		3505.00	SR Technics Switzerland
137771					72-41-10		Package K	10	REPAIR THREADED (JACKSCREW) HOLES		680.00	SR Technics Switzerland
137773	50A712-01	EASA,FAA,CAAC,ANAC	12	28	72-41-86	NO. 3 BEARING SEAL RING HOLDER	Package A	CLN/INSP	CLEANING AND INSPECTION		420.00	SR Technics Switzerland
137773					72-41-86		Package A	INSP-05	LEAK CHECK		420.00	SR Technics Switzerland
137773					72-41-86		Package D	03	REPLACE RETAINING PIN		3055.00	SR Technics Switzerland
137773					72-41-86		Package F	05	INSERT REPLACEMENT REPAIR		305.00	SR Technics Switzerland
137773					72-41-86		Package M	12	BLEND SURFACE DAMAGE (MPN 50A712-01)		305.00	SR Technics Switzerland
137786	70R077	EASA,FAA,CAAC,ANAC	25	28	72-61-24	MAIN GEARBOX - GEARBOX (STARTER DRIVE) GEARSHAFT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1020.00	SR Technics Switzerland
137786	71R147-01	EASA,FAA,CAAC,ANAC			72-61-24		Package B	01	LAP CARBON SEAL MATING FACE		280.00	SR Technics Switzerland
137786					72-61-24		Package C	02	CHROMIUM PLATE CARBON SEAL MATING FACE		1730.00	SR Technics Switzerland
137786					72-61-24		Package D	03	CHROMIUM PLATE FRONT BEARING JOURNAL		2475.00	SR Technics Switzerland
137786					72-61-24		Package D	05	PLATE THE FRONT BEARING SHOULDER WITH CHROMIUM		2475.00	SR Technics Switzerland
137786					72-61-24		Package E	04	CHROMIUM PLATE REAR BEARING JOURNAL		2475.00	SR Technics Switzerland
137786					72-61-24		Package E	06	PLATE THE REAR BEARING SHOULDER WITH CHROMIUM		2475.00	SR Technics Switzerland
137786					72-61-24		Package H	07	REPLACE THE BOLT		735.00	SR Technics Switzerland
137786					72-61-24		Package SB00	PW4ENG 72-802	MODIFICATION AND REPLACEMENT TO IMPROVE DURABILITY		495.00	SR Technics Switzerland
137789	50I110	EASA,FAA,CAAC,ANAC	29	21	72-41-34	DIFFUSER AND COMBUSTOR - DIFFUSER SEAL AIR VENT TUBE ASSEMB	Package A	CLN/INSP	CLEANING AND INSPECTION	PNS0110P5 FOR SHOP VISIT ONLY	210.00	SR Technics Switzerland
137789	50I110P10	EASA,FAA,CAAC,ANAC			72-41-34		Package C	02	REPAIR SEAL RING GROOVE		430.00	SR Technics Switzerland
137789	50I912-01	EASA,FAA,CAAC,ANAC			72-41-34		Package E	04	REPAIR BRACE TACK WELDS		410.00	SR Technics Switzerland
137789					72-41-34		Package F	05	REPAIR SEAL RING GROOVE		430.00	SR Technics Switzerland
137789					72-41-34		Package G	06	WELD REPAIR SEAL RING GROOVE		1020.00	SR Technics Switzerland
137789					72-41-34		Package H	07	SEAL LANDS PLASMA COAT REPAIR		715.00	SR Technics Switzerland
137790	50A160	EASA,FAA,CAAC,ANAC	25	28	72-41-83	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (OUTER RACE) RETAININ	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
137790					72-41-83		Package B	01	REPLACE SILVER PLATE	INCLUDING CLEANING, FPI AND INSPECTION	765.00	SR Technics Switzerland
137790					72-41-83		Package B	02	BLEND REPAIR		765.00	SR Technics Switzerland
137791	50A082	EASA,FAA,CAAC,ANAC	29	28	72-53-85	LOW PRESSURE TURBINE (LPT) - STAGE 6 LPT AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		355.00	SR Technics Switzerland
137791					72-53-85		Package C	02	BLEND REPAIR SURFACE DAMAGE		905.00	SR Technics Switzerland
137791					72-53-85		Package D	03	KNIFE-EDGE SEAL BLEND REPAIR		1110.00	SR Technics Switzerland
137791					72-53-85		Package E	04	RESTORE CORROSION PROTECTIVE COATING REPAIR		610.00	SR Technics Switzerland
137791					72-53-85		Package F	05	NICKEL PLATE REPAIR REAR SNAP DIAMETER		2440.00	SR Technics Switzerland
137791					72-53-85		Package G	06	NICKEL PLATE REPAIR FRONT SNAP DIAMETER		2440.00	SR Technics Switzerland
137791					72-53-85		Package H	07	PLASMA SPRAY REPAIR REAR SHOULDER FACE		2000.00	SR Technics Switzerland
137792	50A221	EASA,FAA,CAAC,ANAC	18	28	72-32-03	LPC/LPT COUPLING - NO. 1.5 BEARING SEAL SEAT	Package A	CLN/INSP	CLEANING AND INSPECTION		135.00	SR Technics Switzerland
137796	50P021	EASA,FAA,CAAC,ANAC	23	21	72-54-80	TURBINE EXHAUST CASE - NO. 4 BEARING SEAL (FRONT) SPACER	Package A	CLN/INSP	CLEANING AND INSPECTION		155.00	SR Technics Switzerland
137798	50I604-01	EASA,FAA,CAAC,ANAC	29	21	72-41-20	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (OIL) PRESSURE TUBE AS	Package A	CLN/INSP	CLEANING AND INSPECTION	PNS0108 FOR SHOP VISIT ONLY	210.00	SR Technics Switzerland
137798	51J041-01	EASA,FAA,CAAC,ANAC			72-41-20		Package SB00	PW4G-100-72-193	INSPECTION OF TO REMOVE TUBES WHICH MAY HAVE WELD CONTAMINATION		270.00	SR Technics Switzerland
137798					72-41-20		Package SB01	AOWC9264-G57233	NUMBER 3 BEARING COMPARTMENT OIL PRESSURE TUBE WELD CRACK		160.00	SR Technics Switzerland
137798					72-41-20		Package SB02	AD 2010-24-09	INSPECTION ACC. AD	IN CONJUNCTION WITH PACKAGE A	80.00	SR Technics Switzerland
137806	50A435	EASA,FAA,CAAC,ANAC	29	28	72-41-88	DIFFUSER AND COMBUSTOR - NO. 3 BEARING REAR COOLING DUCT AS	Package A	CLN/INSP	CLEANING AND INSPECTION		380.00	SR Technics Switzerland
137806					72-41-88		Package B	01	NICKEL PLATE REPAIR OF NO. 3 BEARING REAR COOLING DUCT ASSEMBLY OUTER SNAP DIAMETER		1655.00	SR Technics Switzerland
137806					72-41-88		Package C	02	NICKEL PLATE REPAIR OF NO. 3 BEARING REAR COOLING DUCT ASSEMBLY INNER SNAP DIAMETER		1555.00	SR Technics Switzerland
137806					72-41-88		Package D	03	RESTORE ANTIGALLING COMPOUND		665.00	SR Technics Switzerland
137806					72-41-88		Package E	04	WELD REPAIR CRACKS IN ASSEMBLY		2495.00	SR Technics Switzerland
137806					72-41-88		Package F	05	PLASMA COAT OUTER SNAP DIAMETER REPAIR		1715.00	SR Technics Switzerland
137806					72-41-88		Package G	06	INNER DUCT WALL WELD REPAIR - NO. 3 BEARING REAR COOLING DUCT ASSEMBLY		2705.00	SR Technics Switzerland
137811	50N102	EASA,FAA,CAAC,ANAC	23	28	72-53-21	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT (INNER) SEALING RING D	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
137811					72-53-21		Package B	01	REPLACE HARDFACE		810.00	SR Technics Switzerland
137813	70R555	EASA,FAA,CAAC,ANAC	10	28	72-61-44	PW4 SCAVENGE PUMP SPUR GEARSHAFT	Package A	CLN/INSP	CLEANING AND INSPECTION		300.00	SR Technics Switzerland
137813	70R618	EASA,FAA,CAAC,ANAC			72-61-44		Package B	01	BEARING JOURNAL CHROMIUM PLATE REPAIR		940.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137813					72-61-44		Package C	02	BEARING SHOULDER CHROMIUM PLATE REPAIR		1015.00	SR Technics Switzerland
137816	50G436	EASA,FAA,CAAC,ANAC	13	28	72-34-09	INTERMEDIATE CASE - NO. 2 BEARING HOUSING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1215.00	SR Technics Switzerland
137816	50G988	EASA,FAA,CAAC,ANAC			72-34-09		Package B	01	SMOOTH OUT DAMAGE TO THREAD		190.00	SR Technics Switzerland
137816	51D764	EASA,FAA,CAAC,ANAC			72-34-09		Package C	02	BEARING JOURNAL COAT REPAIR		1895.00	SR Technics Switzerland
137816					72-34-09		Package D	03	PLASMA SPRAY THE BEARING SHOULDER		1745.00	SR Technics Switzerland
137816					72-34-09		Package F	05	REPLACE THE SLAP PINS		275.00	SR Technics Switzerland
137816					72-34-09		Package SB00	PW4G-100-72-185	INCREASED FINAL ANGLE OF TURN INCORPORATION OF	ONLY DIMENSIONAL INSPECTION	115.00	SR Technics Switzerland
137816					72-34-09		Package SB01	PW4ENG 72-748	INCREASED FINAL ANGLE OF TURN INCORPORATION OF	ONLY DIMENSIONAL INSPECTION	115.00	SR Technics Switzerland
137818	50R410	EASA,FAA,CAAC,ANAC	24	28	72-41-91	DIFFUSER AND COMBUSTOR - GEARBOX LUG GUIDE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		985.00	SR Technics Switzerland
137818	70T533	EASA,FAA,CAAC,ANAC			72-41-91		Package B	01	NICKEL PLATE REAR END FACE		1105.00	SR Technics Switzerland
137818	70T626	EASA,FAA,CAAC,ANAC			72-41-91		Package C	02	NICKEL PLATE BEARING HOUSING		1310.00	SR Technics Switzerland
137820	70R113	EASA,FAA,CAAC,ANAC	7	28	72-61-61	PW4 RELIEF VALVE HOUSING (PRESSURE REGULATOR)	Package A	CLN/INSP	CLEANING AND INSPECTION		130.00	SR Technics Switzerland
137820					72-61-61		Package B	01	NICKEL PLATE THE FRONT OD SEAL LANDS		500.00	SR Technics Switzerland
137820					72-61-61		Package C	02	NICKEL PLATE THE REAR OD SEAL LANDS		500.00	SR Technics Switzerland
137825	50I400-01	EASA,FAA,CAAC,ANAC	27	21	72-41-25	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (SCAVENGE) TUBE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland
137825	50I661-01	EASA,FAA,CAAC,ANAC			72-41-25		Package D	03	SLEEVE REPLACEMENT REPAIR		910.00	SR Technics Switzerland
137825	51I037-01	EASA,FAA,CAAC,ANAC			72-41-25		Package E	04	REPAIR SEAL RING HOLDER GROOVE		910.00	SR Technics Switzerland
137825					72-41-25		Package F	05	REPAIR TUBE INSULATION		510.00	SR Technics Switzerland
137825					72-41-25		Package H	07	REMOVE WEAR ON CONNECTORS		505.00	SR Technics Switzerland
137825					72-41-25		Package I	08	REPAIR SEAL RING CONNECTOR GROOVE		845.00	SR Technics Switzerland
137825					72-41-25		Package J	09	REPAIR SEAL RING HOLDER GROOVE		845.00	SR Technics Switzerland
137827	50G038	EASA,FAA,CAAC,ANAC	5	28	72-62-13	PW4 GEARBOX DRIVE COUPLING	Package A	CLN/INSP	CLEANING AND INSPECTION		390.00	SR Technics Switzerland
137827					72-62-13		Package B	01	SPLINE TEETH SURFACE DAMAGE BLEND REPAIR		170.00	SR Technics Switzerland
137827					72-62-13		Package C	02	FRONT FACE CHROMIUM PLATE REPAIR		980.00	SR Technics Switzerland
137827					72-62-13		Package D	03	FRONT INNER DIAMETER CHROMIUM PLATE REPAIR		1040.00	SR Technics Switzerland
137828	50I109	EASA,FAA,CAAC,ANAC	27	21	72-41-27	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (COMPARTMENT) COOLING	Package A	CLN/INSP	CLEANING AND INSPECTION		210.00	SR Technics Switzerland
137828	50I915-01	EASA,FAA,CAAC,ANAC			72-41-27		Package D	03	REPAIR SEAL RING HOLDER GROOVE		735.00	SR Technics Switzerland
137828					72-41-27		Package E	04	REPAIR SEAL RING FERRULE GROOVE		715.00	SR Technics Switzerland
137828					72-41-27		Package F	05	REPAIR TUBE INSULATION		595.00	SR Technics Switzerland
137828					72-41-27		Package H	07	REPAIR SEAL RING HOLDER GROOVES		925.00	SR Technics Switzerland
137831	70R011	EASA,FAA,CAAC,ANAC	24	28	72-61-34	MAIN GEARBOX - GEARBOX (FRONT HYDRAULIC PUMP DRIVE) SPUR GEAR	Package A	CLN/INSP	CLEANING AND INSPECTION		1060.00	SR Technics Switzerland
137831	70R691	EASA,FAA,CAAC,ANAC			72-61-34		Package B	01	LAP CARBON SEAL MATING FACE		300.00	SR Technics Switzerland
137831					72-61-34		Package C	02	NICKEL/CHROMIUM PLATE SEALING FACE		1140.00	SR Technics Switzerland
137831					72-61-34		Package D	03	CHROMIUM PLATE FRONT BEARING JOURNAL		1140.00	SR Technics Switzerland
137831					72-61-34		Package E	04	CHROMIUM PLATE REAR BEARING JOURNAL		1140.00	SR Technics Switzerland
137831					72-61-34		Package F	05	PLATE THE BEARING SHOULDER WITH CHROMIUM		1140.00	SR Technics Switzerland
137832	70R010	EASA,FAA,CAAC,ANAC	27	28	72-61-29	MAIN GEARBOX - GEARBOX (REAR HYDRAULIC PUMP DRIVE) SPUR GEAR	Package A	CLN/INSP	CLEANING AND INSPECTION		1060.00	SR Technics Switzerland
137832					72-61-29		Package B	01	CHROMIUM PLATE SEALING FACE		1620.00	SR Technics Switzerland
137832					72-61-29		Package C	02	CHROMIUM PLATE FRONT BEARING JOURNAL		2590.00	SR Technics Switzerland
137832					72-61-29		Package C	04	PLATE THE FRONT BEARING SHOULDER WITH CHROMIUM		2590.00	SR Technics Switzerland
137832					72-61-29		Package D	03	CHROMIUM PLATE REAR BEARING JOURNAL		2590.00	SR Technics Switzerland
137832					72-61-29		Package D	06	PLATE THE REAR BEARING SHOULDER WITH CHROMIUM		2590.00	SR Technics Switzerland
137832					72-61-29		Package E	05	LAP THE SEALING FACE		510.00	SR Technics Switzerland
137833	70R009	EASA,FAA,CAAC,ANAC	27	28	72-61-27	MAIN GEARBOX - GEARBOX (FUEL PUMP DRIVE) SPUR GEARSHAFT ASS	Package A	02	CLEANING AND INSPECTION		1060.00	SR Technics Switzerland
137833					72-61-27		Package B	01	LAP CARBON SEAL MATING FACE		300.00	SR Technics Switzerland
137833					72-61-27		Package C	02	CHROMIUM PLATE SEALING FACE		2030.00	SR Technics Switzerland
137833					72-61-27		Package D	03	CHROMIUM PLATE FRONT BEARING JOURNAL		2030.00	SR Technics Switzerland
137833					72-61-27		Package D	06	PLATE THE FRONT BEARING SHOULDER WITH CHROMIUM		2030.00	SR Technics Switzerland
137833					72-61-27		Package E	04	CHROMIUM PLATE REAR BEARING JOURNAL		2075.00	SR Technics Switzerland
137833					72-61-27		Package E	05	PLATE THE REAR BEARING SHOULDER WITH CHROMIUM		2075.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137834	50A076	EASA,FAA,CAAC,ANAC	28	28	72-41-81	DIFFUSER AND COMBUSTOR - NO. 3 BEARING SEAL SPACER	Package A	CLN/INSP	CLEANING AND INSPECTION		230.00	SR Technics Switzerland
137834	51J322	EASA,FAA,CAAC,ANAC			72-41-81		Package B	01	NICKEL PLATE REP. ID PILOT DIAMETER		1380.00	SR Technics Switzerland
137834					72-41-81		Package C	02	NICKEL PLATE REP. END FACES		1465.00	SR Technics Switzerland
137834					72-41-81		Package D	03	BALANCE REPAIR		610.00	SR Technics Switzerland
137834					72-41-81		Package E	INSP	BLEND DAMAGE INSPECTION/CHECK-03		140.00	SR Technics Switzerland
137836	50I112	EASA,FAA,CAAC,ANAC	31	21	72-41-31	DIFFUSER AND COMBUSTOR -TURBINE BLADE COOLING TUBES	Package A	CLN/INSP	CLEANING AND INSPECTION		210.00	SR Technics Switzerland
137836	50I619-01	EASA,FAA,CAAC,ANAC			72-41-31		Package B	02	CHROMIUM PLATE TURBINE BLADE COOLING TUBES INSIDE DIAMETER		1950.00	SR Technics Switzerland
137836	51J033-01	EASA,FAA,CAAC,ANAC			72-41-31		Package C	03	REPAIR SEAL RING HOLDER GROOVE		905.00	SR Technics Switzerland
137836					72-41-31		Package G	08	REPAIR SEAL RING HOLDER GROOVE		735.00	SR Technics Switzerland
137837	51R073	EASA,FAA,CAAC,ANAC	20	28	72-41-92	DIFFUSER AND COMBUSTOR - GEARBOX SUPPORT CLEVIS, LEFT AND Ri	Package A	CLN/INSP	CLEANING AND INSPECTION		685.00	SR Technics Switzerland
137837	51R074	EASA,FAA,CAAC,ANAC			72-41-92		Package C	02	BUSHING REPAIR SUPPORT CLEVIS REPAIR		570.00	SR Technics Switzerland
137837					72-41-92		Package D	03	LUG INNER SURFACE BLENDING		340.00	SR Technics Switzerland
137837					72-41-92		Package E		REMOVE DEFECTIVE BOLTS FROM CLAMP		170.00	SR Technics Switzerland
137839	70R616	EASA,FAA,CAAC,ANAC	17	28	72-61-45	MAIN GEARBOX - GEARBOX (EEC/PMA ALTERNATOR DRIVE) SPUR GEAI	Package A	CLN/INSP	CLEANING AND INSPECTION		1080.00	SR Technics Switzerland
137839	70R777	EASA,FAA,CAAC,ANAC			72-61-45		Package B	01	FRONT BEARING JOURNAL CHROMIUM PLATE REPAIR		1050.00	SR Technics Switzerland
137839	70R964	EASA,FAA,CAAC,ANAC			72-61-45		Package C	02	CHROMIUM PLATE REAR BEARING JOURNAL		1050.00	SR Technics Switzerland
137839					72-61-45		Package D	03	INNER BEARING SHOULDER CHROMIUM PLATE REPAIR		1205.00	SR Technics Switzerland
137845	50A017	EASA,FAA,CAAC,ANAC	25	28	72-34-21	INTERMEDIATE CASE - GEARBOX DRIVE BEVEL GEARSHAFT	Package A	CLN/INSP	CLEANING AND INSPECTION		535.00	SR Technics Switzerland
137845					72-34-21		Package B	01	CHROMIUM PLATE OR COAT REPAIR UPPER BEARING JOURNAL		1135.00	SR Technics Switzerland
137845					72-34-21		Package C	02	CHROMIUM PLATE OR COAT LOWER BEARING JOURNAL		1800.00	SR Technics Switzerland
137845					72-34-21		Package D	03	SMOOTH OUT DAMAGE TO THE SURFACE		600.00	SR Technics Switzerland
137846	50A452	EASA,FAA,CAAC,ANAC	29	28	72-34-82	INTERMEDIATE CASE - NO. 1 BEARING FRONT SUPPORT	Package A	CLN/INSP	CLEANING AND INSPECTION		450.00	SR Technics Switzerland
137846	50A641	EASA,FAA,CAAC,ANAC			72-34-82		Package B	01	RESTORE PROTECTIVE COATING ON NO. 1 BEARING FRONT SUPPORT		600.00	SR Technics Switzerland
137846	51A398	EASA,FAA,CAAC,ANAC			72-34-82		Package C	02	PLASMA SPRAY THE BEARING JOURNAL		1795.00	SR Technics Switzerland
137846					72-34-82		Package D	03	PLASMA SPRAY THE INNER FRONT DIAMETER		1545.00	SR Technics Switzerland
137846					72-34-82		Package E	04	PLASMA SPRAY THE REAR ID		1545.00	SR Technics Switzerland
137846					72-34-82		Package L	INSP/CHECK-03	BLEND AEREA B AND OR D		205.00	SR Technics Switzerland
137848	50I111	EASA,FAA,CAAC,ANAC	4	21	72-41-33	PW4 DIFFUSER SEAL AIR VENT TUBE	Package A	CLN/INSP	CLEANING AND INSPECTION		190.00	SR Technics Switzerland
137849	50I489-01	EASA,FAA,CAAC,ANAC	31	21	72-41-19	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (BREATHER) TUBE ASSE	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
137849	50I605-01	EASA,FAA,CAAC,ANAC			72-41-19		Package D	03	REPAIR SEAL RING CONNECTOR GROOVE		915.00	SR Technics Switzerland
137849	50I614	EASA,FAA,CAAC,ANAC			72-41-19		Package E	04	REPAIR SEAL RING HOLDER GROOVE		660.00	SR Technics Switzerland
137849	50I662-01	EASA,FAA,CAAC,ANAC			72-41-19		Package F	05	REPAIR TUBE INSULATION		395.00	SR Technics Switzerland
137849	50I762-01	EASA,FAA,CAAC,ANAC			72-41-19		Package H	07	REPAIR SEAL RING CONNECTOR GROOVE		1035.00	SR Technics Switzerland
137849	51J032-01	EASA,FAA,CAAC,ANAC			72-41-19		Package I	08	REPAIR SEAL RING HOLDER GROOVE		765.00	SR Technics Switzerland
137849	51J035-01	EASA,FAA,CAAC,ANAC			72-41-19		Package L	11	REMOVE WEAR ON CONNECTORS		395.00	SR Technics Switzerland
137849	51I194-01	EASA,FAA,CAAC,ANAC			72-41-19		Package M	12	REMOVE WEAR ON CONNECTORS		520.00	SR Technics Switzerland
137849	51I196-01	EASA,FAA,CAAC,ANAC			72-41-19		Package N	13	REPAIR SEAL RING CONNECTOR GROOVE		1030.00	SR Technics Switzerland
137849					72-41-19		Package SB00	PW4ENG 72-696	INSPECTION OF WELD BEAD GROOVE		255.00	SR Technics Switzerland
137849					72-41-19		Package SB03	PW4G-100-72-144	NO3 BRG BREATHER TUBE,INSP,WELD GROOVE		270.00	SR Technics Switzerland
137852	50G342	EASA,FAA,CAAC,ANAC	30	28	72-34-02	INTERMEDIATE CASE - FAN EXIT CASE FLANGE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		360.00	SR Technics Switzerland
137852	52G112-01	EASA,FAA,CAAC,ANAC			72-34-02		Package B	01	TOUCH UP PROTECTION LAYER		660.00	SR Technics Switzerland
137852	53D717-01	EASA,FAA,CAAC,ANAC			72-34-02		Package C	02	NUT PLATE REPLACEMENT		940.00	SR Technics Switzerland
137852					72-34-02		Package D	03	SMOOTH SURFACE DAMAGE		990.00	SR Technics Switzerland
137852					72-34-02		Package E	04	REPLACE ANTI-GALLANT COMPOUND		670.00	SR Technics Switzerland
137852					72-34-02		Package H	07	FAN EXIT GUIDE VANE FLANGE PLASMA COAT REPAIR		2095.00	SR Technics Switzerland
137852					72-34-02		Package I	08	NUT PLATE REPLACEMENT REPAIR		500.00	SR Technics Switzerland
137852					72-34-02		Package J	09	SURFACE DAMAGE REPAIR		430.00	SR Technics Switzerland
137852					72-34-02		Package K	10	ANTIGALLING COMPOUND REPLACEMENT REPAIR		660.00	SR Technics Switzerland
137854	310T4038-1	EASA,FAA,CAAC,ANAC	3	21	71-21-16	PW4 ENGINE FORWARD MOUNT SHEAR PIN	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland
137854					71-21-16		Package N	013	CHROME PLATE REPAIR		440.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137856	310T3037-4	EASA,FAA,CAAC,ANAC	4	21	71-21-16	PW4 BOEING AFT ENGINE MOUNT SHEAR PIN	Package A	CLN/INSP	CLEANING & INSPECTION		365.00	SR Technics Switzerland
137856					71-21-16		Package B	12-1	CHROME PLATE REPAIR		810.00	SR Technics Switzerland
137895	50G492	EASA,FAA,CAAC,ANAC	3	28	72-62-17	PW4 ANGLE GEARBOX (REAR OIL) NOZZLE ASSY	Package B	01	REPLACE PROTECTIVE COATING		175.00	SR Technics Switzerland
137895	51G088	EASA,FAA,CAAC,ANAC			72-62-17		Package SB00	PW4ENG 72-131	MODIFICATION OF AGB OIL NOZZLE ASSIES		715.00	SR Technics Switzerland
137907	50R367-01	EASA,FAA,CAAC,ANAC	28	28	72-61-73	MAIN GEARBOX - LUBE OIL TANK ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		240.00	SR Technics Switzerland
137907	50R380-01	EASA,FAA,CAAC,ANAC			72-61-73		Package B	01	REPLACE NUT PLATE	PN50R315-01 FOR SHOP VISIT ONLY	970.00	SR Technics Switzerland
137907	51R053-01	EASA,FAA,CAAC,ANAC			72-61-73		Package C	02	WELD LOOSE INTERNAL PARTS		635.00	SR Technics Switzerland
137907	51R118-01	EASA,FAA,CAAC,ANAC			72-61-73		Package D	03	NICKEL PLATE MOUNT FLANGE SEAL LANDS		1450.00	SR Technics Switzerland
137907	51R126-01	EASA,FAA,CAAC,ANAC			72-61-73		Package E	04	WELD OIL TANK CRACK AND SKIN PENETRATION		955.00	SR Technics Switzerland
137907					72-61-73		Package F	05	REPAIR DENTS		1185.00	SR Technics Switzerland
137907					72-61-73		Package G	06	SURFACE DAMAGE BLEND REPAIR		570.00	SR Technics Switzerland
137907					72-61-73		Package I	20	WELD OIL TANK CRACK AND SKIN PENETRATION		2335.00	SR Technics Switzerland
137907					72-61-73		Package J	21	NICKEL PLATE REPAIR		1480.00	SR Technics Switzerland
137907					72-61-73		Package K	22	TUBE BOSS INNER DIAMETER NICKEL PLATE REPAIR		1480.00	SR Technics Switzerland
137907					72-61-73		Package SB00	PW4ENG 79-56	INCORPORATION OF AN OIL FILLER NECK BRACE		2200.00	SR Technics Switzerland
137907					72-61-73		Package SB01	PW4ENG 79-47	REMOVAL OF OIL TANK REMOTE FILL OPTION		270.00	SR Technics Switzerland
137907					72-61-73		Package SB02	PW4ENG 79-65	RELOCAT,FILLER NECK,MINIMIZE DIHEDRAL		80.00	SR Technics Switzerland
137907					72-61-73		Package X	23	WELD REPAIR ON SUMP PUMP LOCK WIRE TAB		1450.00	SR Technics Switzerland
137912	50J352	EASA,FAA,CAAC,ANAC	24	21	72-41-21	DIFFUSER AND COMBUSTOR - NO. 3 BEARING PACKING TRANSFER TUE	Package A	CLN/INSP	CLEANING AND INSPECTION	PN50J352P10 50J352P15 FOR SHOP VISIT ONL	205.00	SR Technics Switzerland
137912	50J926	EASA,FAA,CAAC,ANAC,TCCA			72-41-21		Package B	INSP-03	BLEND REPAIR		105.00	SR Technics Switzerland
137912					72-41-21		Package C	02	CHROMIUM PLATE NO. 3 BEARING TRANSFER TUBE INSIDE DIAMETER FOR WEAR GREATER THAN 2.3265 INCHES		2350.00	SR Technics Switzerland
137912					72-41-21		Package D	03	REPAIR SEAL RING GROOVE		270.00	SR Technics Switzerland
137912					72-41-21		Package E	04	WELD REPAIR SEAL LANDS		1545.00	SR Technics Switzerland
137912					72-41-21		Package F	05	REPAIR SEAL RING GROOVE		240.00	SR Technics Switzerland
137912					72-41-21		Package G	06	SEAL LANDS WELD REPAIR		1545.00	SR Technics Switzerland
137912					72-41-21		Package H	07	LUGS WELD REPAIR		1175.00	SR Technics Switzerland
137912					72-41-21		Package I	08	PLASMA COAT REPAIR		1105.00	SR Technics Switzerland
137913	50J348	EASA,FAA,CAAC,ANAC	18	21	72-41-26	DIFFUSER AND COMBUSTOR - NO. 3 BEARING PACKING TRANSFER TUE	Package A	CLN/INSP	CLEANING AND INSPECTION		440.00	SR Technics Switzerland
137913	50J911	EASA,FAA,CAAC,ANAC			72-41-26		Package C	02	INNER DIAMETER NICKEL-CHROMIUM PLATE		2440.00	SR Technics Switzerland
137913					72-41-26		Package D	03	REPAIR SEAL RING GROOVE		495.00	SR Technics Switzerland
137913					72-41-26		Package E	04	REPAIR SEAL LANDS		1340.00	SR Technics Switzerland
137913					72-41-26		Package F	05	WELD REPAIR SEAL LANDS		1265.00	SR Technics Switzerland
137913					72-41-26		Package G	06	REPAIR SEAL RING GROOVE		495.00	SR Technics Switzerland
137913					72-41-26		Package H	07	BLEND REPAIR		430.00	SR Technics Switzerland
137913					72-41-26		Package I	08	LUGS WELD REPAIR		795.00	SR Technics Switzerland
137913					72-41-26		Package SB00	PW4ENG 72-652	TUBES - SPHERICAL SEAL LAND CONFIGURATIO		1220.00	SR Technics Switzerland
137913					72-41-26		Package SB01	PW4G-100-72-102	TUBES - SPHERICAL SEAL LAND CONFIGURATIO		1190.00	SR Technics Switzerland
137914	50J234	EASA,FAA,CAAC,ANAC	20	21	72-41-29	DIFFUSER AND COMBUSTOR - SEAL RING TRANSFER (NO. 3 BEARING C	Package A	CLN/INSP	CLEANING AND INSPECTION		500.00	SR Technics Switzerland
137914	50J925	EASA,FAA,CAAC,ANAC			72-41-29		Package C	02	CHROMIUM PLATE SEAL RING TRANSFER TUBEINSIDE DIAMETER FOR WEAR GREATER THAN 1.2015 INCHES (30.518MM)		1770.00	SR Technics Switzerland
137914					72-41-29		Package D	03	REPAIR SEAL RING GROOVE		410.00	SR Technics Switzerland
137914					72-41-29		Package E	04	REPAIR SEAL LANDS		845.00	SR Technics Switzerland
137914					72-41-29		Package F	05	REPAIR SEAL RING GROOVE		165.00	SR Technics Switzerland
137916	50D447	EASA,FAA,CAAC,ANAC	29	28	72-33-10	FAN CASE - ROD END CLEVIS (BLEED VALVE ACTUATOR)	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
137916	55D089	EASA,FAA,CAAC,ANAC			72-33-10		Package B	01	HOLE REPAIR		835.00	SR Technics Switzerland
137916					72-33-10		Package C	02	REPLACE THE ANTIGALLANT		465.00	SR Technics Switzerland
137916					72-33-10		Package C	03	REPLACE THE ANTIGALLANT	PN 55D089	465.00	SR Technics Switzerland
137921	50G667	EASA,FAA,CAAC,ANAC	24	28	72-33-81	FAN CASE - FAN EXIT (FRONT) LINER SEGMENT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		775.00	SR Technics Switzerland
137921	51G770-01	EASA,FAA,CAAC,ANAC			72-33-81		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	135.00	SR Technics Switzerland
137921	52G195-01	EASA,FAA,CAAC,ANAC			72-33-81		Package B	01	REPLACE SPLICE PLATE		1010.00	SR Technics Switzerland
137921					72-33-81		Package C	02	REPLACE NUT PLATES		1010.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137921					72-33-81		Package D	03	REPLACE WASHERS		685.00	SR Technics Switzerland
137921					72-33-81		Package F	05	SURFACE DAMAGE REPAIR (MINOR)		685.00	SR Technics Switzerland
137921					72-33-81		Package G	06	LINER SURFACE PATCH REPAIR		1005.00	SR Technics Switzerland
137921					72-33-81		Package H	07	LEADING EDGE EROSION REPAIR		685.00	SR Technics Switzerland
137922	802473	EASA,FAA,CAAC,ANAC	24	28	72-54-02	TURBINE EXHAUST CASE - ENGINE SUPPORT CLEVIS BOSS ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		455.00	SR Technics Switzerland
137922					72-54-02		Package B	01	REPAIR THREADED HOLES WITH HELICAL COIL INSERTS		600.00	SR Technics Switzerland
137922					72-54-02		Package C	02	REPLACE BUSHING		1990.00	SR Technics Switzerland
137922					72-54-02		Package D	03	NICKEL PLATE REPAIR HOLE ID		2715.00	SR Technics Switzerland
137922					72-54-02		Package SB00	PWAENG 72-198	BOSS ASSEMBLY, ENGINE SUPPORT CLEVIS - MODIFICATION		815.00	SR Technics Switzerland
137924	310T4025-2	EASA,FAA,CAAC,ANAC	19	21	71-21-16	FWD ENGINE MOUNT - BEARING HOUSING - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1060.00	SR Technics Switzerland
137924					71-21-16		Package B	4-1	BEARING REPLACEMENT		570.00	SR Technics Switzerland
137924					71-21-16		Package C	4-1	SCRATCH AND GOUGE REPAIR		820.00	SR Technics Switzerland
137926	50N003	EASA,FAA,CAAC,ANAC,CAA UK	29	28	72-53-13	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT DISK	Package A	CLN/INSP	CLEANING AND INSPECTION		1275.00	SR Technics Switzerland
137926	50N803	EASA,FAA,CAAC,ANAC,CAA UK			72-53-13		Package C	01	SURFACE DAMAGE BLEND REPAIR		1645.00	SR Technics Switzerland
137926					72-53-13		Package D	02	MACHINE REPAIR FRONT FACE		1015.00	SR Technics Switzerland
137926					72-53-13		Package E	03	PLASMA SPRAY REPAIR REAR AIRSEAL SNAP DIAMETER (ID)		2160.00	SR Technics Switzerland
137926					72-53-13		Package F	04	PLASMA SPRAY REPAIR REAR AIRSEAL SNAP DIAMETER (OD)		2035.00	SR Technics Switzerland
137926					72-53-13		Package G	05	PLASMA SPRAY REPAIR FRONT AIRSEAL SNAP DIAMETER		2065.00	SR Technics Switzerland
137926					72-53-13		Package H	07	SHOTPEEN REPAIR		720.00	SR Technics Switzerland
137926					72-53-13		Package I	08	PLASMA SPRAY AIRSEAL MATING FACE		2160.00	SR Technics Switzerland
137926					72-53-13		Package SB00	2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	500.00	SR Technics Switzerland
137930	50L194	EASA,FAA,CAAC,ANAC	28	28	72-52-38	HIGH PRESSURE TURBINE (HPT) - STAGE 2 HPT (REAR CASE) SEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland
137930	50L668	EASA,FAA,CAAC,ANAC			72-52-38		Package B	01	RESTORE REAR FACE HARDFACE		4900.00	SR Technics Switzerland
137930					72-52-38		Package B	02	PLASMA SPRAY REPAIR FRONT FACE		4900.00	SR Technics Switzerland
137930					72-52-38		Package B	03	INNER DIAMETER PLASMA COAT REPAIR		4900.00	SR Technics Switzerland
137930					72-52-38		Package E	04	BLEND REPAIR		340.00	SR Technics Switzerland
137930					72-52-38		Package SB00	SB PWENG 72-33	FEATURING ADDITIONAL CLEARANCES WITH MATING PARTS		925.00	SR Technics Switzerland
137930					72-52-38		Package SB01	SB PWENG 72-46	INCORPORATION OF ADDITIONAL COOLING HOLES AND NEW SEALS		1420.00	SR Technics Switzerland
137931	50P024	EASA,FAA,CAAC,ANAC	23	28	72-54-01	TURBINE EXHAUST CASE - HOUSING NO. 4 BRG SEAL OF TURBINE EXH/	Package B	47	NICKEL PLATE REPAIR THE FIT BETWEEN CARBON SEAL HOUSING AND TEC FLANGE INNER DIAMETER		1755.00	SR Technics Switzerland
137932	50P138	EASA,FAA,CAAC,ANAC	24	28	72-54-01	TURBINE EXHAUST CASE - TURBINE EXHAUST CASE ASSEMBLY - NO. 4 I	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland
137932	50P263	EASA,FAA,CAAC,ANAC			72-54-01		Package AB	27	WELD REPAIR RIVET HOLE DAMAGE	TURBINE EXHAUST CASE ASSY REQUIRED!	990.00	SR Technics Switzerland
138114	50G057	EASA,FAA,CAAC,ANAC	11	28	72-62-03	ANGLE GEARBOX BEVEL GEARSHAFT ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		370.00	SR Technics Switzerland
138114	51G373	EASA,FAA,CAAC,ANAC			72-62-03		Package B	01	CHROMIUM PLATE OR PWA 3620678 COAT FRONT BEARING JOURNAL		1105.00	SR Technics Switzerland
138114					72-62-03		Package C	02	CHROMIUM PLATE OR PWA 3620678 COAT REAR BEARING JOURNAL		1140.00	SR Technics Switzerland
138114					72-62-03		Package D	02	NICKEL AND CHROMIUM PLATE REAR BEARING JOURNAL		1175.00	SR Technics Switzerland
138114					72-62-03		Package E	03	CHROMIUM PLATE OR PWA 3620678 COAT FRONT BEARING SHOULDER		1105.00	SR Technics Switzerland
138114					72-62-03		Package F	04	CHROMIUM PLATE OR PWA 3620678 COAT REAR BEARING SHOULDER		1105.00	SR Technics Switzerland
138114					72-62-03		Package G	05	SURFACE DAMAGE BLEND REPAIR		530.00	SR Technics Switzerland
138114					72-62-03		Package H	06	REPLACE THE CUP PLUG		670.00	SR Technics Switzerland
138115	50H859	EASA,FAA,CAAC,ANAC	48	28	72-35-07	HIGH PRESSURE COMPRESSOR (HPC) - DRUM ROTOR (FRONT) DISK AS	Package A	CLN/INSP	CLEANING AND INSPECTION		2495.00	SR Technics Switzerland
138115	50H859-001	EASA,FAA,CAAC,ANAC			72-35-07		Package AI	34	FRONT DRUM REAR MATING DIAMETER DUAL WIRE ARC COAT REPAIR		2950.00	SR Technics Switzerland
138115	50S106-01	EASA,FAA,CAAC,ANAC,CAA UK			72-35-07		Package D	03	SHOTPEEN BLADE SLOTS	(INCL. REP-010)	3310.00	SR Technics Switzerland
138115	50S826-01	EASA,FAA,CAAC,ANAC			72-35-07		Package H	07	BLEND REPAIR TANGENTIAL SLOT RIM RAILS		990.00	SR Technics Switzerland
138115	51H426-01	EASA,FAA,CAAC,ANAC			72-35-07		Package I	08	BLEND REPAIR KNIFE-EDGE SEALS		810.00	SR Technics Switzerland
138115	52H559-01	EASA,FAA,CAAC,ANAC			72-35-07		Package J	09	RESTORE KNIFE-EDGE SEAL PLASMA COAT		4250.00	SR Technics Switzerland
138115	52H559-101	EASA,FAA,CAAC,ANAC			72-35-07		Package K	10	RESTORE ANTIGALLING COATING TO AXIAL BLADE SLOTS (STAGE 6, 7 AND 8)		2475.00	SR Technics Switzerland
138115	52H926-01	EASA,FAA,CAAC,ANAC			72-35-07		Package L	11	SURFACE DAMAGE BLEND REPAIR		5665.00	SR Technics Switzerland
138115	52H926-101	EASA,FAA,CAAC,ANAC			72-35-07		Package M	12	REPLACE 9TH STAGE HPC DRUM ROTOR (FRONT) DISK TUBE ASSEMBLY		2990.00	SR Technics Switzerland
138115	53H676-01	EASA,FAA,CAAC,ANAC			72-35-07		Package N	13	PLASMA SPRAY REPAIR FRONT DRUM FRONT OUTER ID SNAP DIAMETER		4595.00	SR Technics Switzerland
138115	53H676-101	EASA,FAA,CAAC,ANAC			72-35-07		Package O	14	PLASMA SPRAY REPAIR FRONT DRUM FRONT INNER OD SNAP DIAMETER		4595.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
138115	53H976-01	EASA,FAA,CAAC,ANAC			72-35-07		Package P	15	PLASMA SPRAY REPAIR FRONT DRUM REAR SNAP DIAMETER		4595.00	SR Technics Switzerland
138115	54H626-01	EASA,FAA,CAAC,ANAC			72-35-07		Package S	18	REPLACE ANTI-VORTEX TUBES		1355.00	SR Technics Switzerland
138115	54H626-101	EASA,FAA,CAAC,ANAC			72-35-07		Package SB00	AD 2005-25-09	FPI LIFE-LIMITED PART, HPC FRONT DRUM	IN CONJUNCTION WITH PACKAGE A	90.00	SR Technics Switzerland
138115	54H816-01	EASA,FAA,CAAC,ANAC			72-35-07		Package SB01	PW4ENG 72-322	RESTORE ANTIGALLING COATING TO BLADE SLOT STG. 6		1765.00	SR Technics Switzerland
138115	54H816-101	EASA,FAA,CAAC,ANAC			72-35-07		Package SB02	PW4ENG 72-745	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	85.00	SR Technics Switzerland
138115	55H106-01	EASA,FAA,CAAC,ANAC,CAA UK			72-35-07		Package SB03	PW4ENG 72-782	MODIFICATION OF THE 12TH STAGE DISK TO REMOVE CRACKS AND REDUCE STRESS		18420.00	SR Technics Switzerland
138115	55H106-101	EASA,FAA,CAAC,ANAC,CAA UK			72-35-07		Package SB03	PW4G 100-72-205	MODIFICATION OF THE 12TH STAGE DISK TO REMOVE CRACKS AND REDUCE STRESS		18420.00	SR Technics Switzerland
138115					72-35-07		Package SB04	PW4ENG 72-799	10TH STAGE DISK HPC INSPECTION OF THE AVT SHELF SLOTS FOR CRAC FAA-2010-24-14		555.00	SR Technics Switzerland
138115					72-35-07		Package SB05	PW4G-100-72-226	10TH STAGE DISK HPC INSPECTION OF THE AVT SHELF SLOTS FOR CRAC FAA-2010-24-14		425.00	SR Technics Switzerland
138115					72-35-07		Package SB07	PW4ENG A72-722	BORESKOPE INSPECTION OF THE 6TH TO 7TH STAGE SPACER AREA FOR AD-FAA-2002-12-15		2065.00	SR Technics Switzerland
138115					72-35-07		Package SB08	PW4G-100-72-239	BLEED TUBE ASSY 9TH STAGE HPC, INTRODUCTION OF, TO IMPROVE FRONT COMPRESSOR DURABILITY		1495.00	SR Technics Switzerland
138115					72-35-07		Package SB09	PW4ENG 72-201	MODIFICATION OF HPC FRONT; AND DISK ASSEMBLY, DRUM ROTOR		175.00	SR Technics Switzerland
138115					72-35-07		Package SB10	PW4ENG A72-833	EDDY CURRENT AND ULTRASONIC INSPECTION OF THE 10TH STAGE DIS AD 2016-08-09		5205.00	SR Technics Switzerland
138115					72-35-07		Package SB11	PW4G100-A72-255	EDDY CURRENT AND ULTRASONIC INSPECTION OF THE 10TH STAGE DIS AD 2016-08-09		5205.00	SR Technics Switzerland
138115					72-35-07		Package SB12	PW4ENG 72-814	REPL./MODI OF ANTI VORTEX TUBES		1080.00	SR Technics Switzerland
138115					72-35-07		Package SB13	PW4G-100-72-	FPI HPC FRNT DRUM SHELF SLOTS		330.00	SR Technics Switzerland
138115					72-35-07		Package SB15	PW4ENG 72-845	HPC, NEW DRUM ROTOR DISK ASSY		480.00	SR Technics Switzerland
138115					72-35-07		Package SB16	PW4G-100-72-260	HPC, NEW DRUM ROTOR DISK ASSY		480.00	SR Technics Switzerland
138115					72-35-07		Package SB17	PW4ENG 72-809	FPI HPC FRONT DRUM SHELF SLOTS (ONE TIME)	PART ONE	480.00	SR Technics Switzerland
138148	50N405	EASA,FAA,CAAC,ANAC	23	28	72-53-15	LOW PRESSURE TURBINE (LPT) - STAGE 5 REAR TURBINE HUB	Package A	CLN/INSP	CLEANING AND INSPECTION		630.00	SR Technics Switzerland
138148	50N505	EASA,FAA,CAAC,ANAC			72-53-15		Package B	01	SURFACE DAMAGE BLEND REPAIR		1015.00	SR Technics Switzerland
138148	51N305	EASA,FAA,CAAC,ANAC			72-53-15		Package C	02	FRONT FACE MACHINE REPAIR		1185.00	SR Technics Switzerland
138148	51N405	EASA,FAA,CAAC,ANAC			72-53-15		Package D	03	FRONT FLANGE FACE PLASMA SPRAY REPAIR		3700.00	SR Technics Switzerland
138148	51N505	EASA,FAA,CAAC,ANAC,CAA UK			72-53-15		Package E	04	INNER SNAP DIAMETER PLASMA SPRAY REPAIR		3395.00	SR Technics Switzerland
138148					72-53-15		Package F	05	AIRSEAL MATING DIAMETER PLASMA COAT REPAIR		3395.00	SR Technics Switzerland
138148					72-53-15		Package G	06	MATING SNAP DIAMETER PLASMA SPRAY REPAIR		3245.00	SR Technics Switzerland
138148					72-53-15		Package H	07	MATING SNAP DIAMETER PLASMA SPRAY REPAIR		3405.00	SR Technics Switzerland
138148					72-53-15		Package J	09	AIRSEAL SNAP DIAMETER PLASMA SPRAY REPAIR		2755.00	SR Technics Switzerland
138148					72-53-15		Package K	10	SHOTPEEN REPAIR		540.00	SR Technics Switzerland
138148					72-53-15		Package SB00	AD 2005-25-09	FPI OF LIFE LIMITED PARTS		440.00	SR Technics Switzerland
138162	221-4047-503	EASA,FAA,CAAC,ANAC	25	21	71-20-04	FWD ENGINE MOUNT - MOUNT SUPPORT - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1085.00	SR Technics Switzerland
138162	221-4047-505	EASA,FAA,CAAC,ANAC			71-20-04		Package F	05	NICKS, GOUGES AND SCRATCHES REPAIR		340.00	SR Technics Switzerland
138162	221-4047-507	EASA,FAA,CAAC,ANAC			71-20-04		Package I	08	APPLICATION OF CORROSION RESISTANT FINISHES TO SUPPORT		920.00	SR Technics Switzerland
138162					71-20-04		Package J	09	BUSHING REPLACEMENT		1570.00	SR Technics Switzerland
138162					71-20-04		Package J	10	BUSHING REPLACEMENT	FOR PN 221-4047-507	1570.00	SR Technics Switzerland
138162					71-20-04		Package SB00	PW4NAC 71-74	INSPECTION AND ELECTRO ETCHING		120.00	SR Technics Switzerland
138162					71-20-04		Package SB01	PW4MD11 71-104	BERYLLIUM COPPER BUSHING INSTALLATION	MD11	1570.00	SR Technics Switzerland
138162					71-20-04		Package SB01	PW4NAC 71-152	BERYLLIUM COPPER BUSHING INSTALLATION	AIRBUS	1570.00	SR Technics Switzerland
138164	221-4004-503	EASA,FAA,CAAC,ANAC	4	21	71-20-04	PW4 ENG FWD MOUNT CROSSBEAM	Package A	CLN/INSP	CLEANING & INSPECTION		345.00	SR Technics Switzerland
138164					71-20-04		Package D	003	BUSHING REPLACEMENT		1945.00	SR Technics Switzerland
138166	50H552	EASA,FAA,CAAC,ANAC	24	28	72-35-74	HIGH PRESSURE COMPRESSOR (HPC) - LEVER SET	Package A	CLN/INSP	CLEANING AND INSPECTION		1075.00	SR Technics Switzerland
138166	53H090	EASA,FAA,CAAC,ANAC			72-35-74		Package B	01	PLASMA SPRAY HPC INLET LEVER OD JOURNAL		1705.00	SR Technics Switzerland
138166					72-35-74		Package SB00	PW4ENG 72-246	INCORPORATION OF A MORE DURABLE COMPRESSOR STATOR CYLINDER SUPPORT WITH REVISED RIG PIN SLOTS		600.00	SR Technics Switzerland
138242	50B202	EASA,FAA,CAAC,ANAC	24	28	72-31-04	LOW PRESSURE COMPRESSOR (LPC) - STAGE 2 LPC BLADE - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		60.00	SR Technics Switzerland
138242	50B902	EASA,FAA,CAAC,ANAC			72-31-04		Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
138243	50B203	EASA,FAA,CAAC,ANAC	22	28	72-31-05	LOW PRESSURE COMPRESSOR (LPC) - STAGE 3 LPC BLADE - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		60.00	SR Technics Switzerland
138243	50B903	EASA,FAA,CAAC,ANAC			72-31-05		Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
138244	51B104	EASA,FAA,CAAC,ANAC	23	28	72-31-06	LOW PRESSURE COMPRESSOR (LPC) - STAGE 4 LPC BLADE - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		60.00	SR Technics Switzerland
138244	51B404	EASA,FAA,CAAC,ANAC			72-31-06		Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
138252	50D373-007	EASA,FAA,CAAC,ANAC	35	35	72-33-04	FAN CASE - FAN EXIT INNER CASE ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION	FPI CASE	2320.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
138252	500628-003	EASA,FAA,CAAC,ANAC			72-33-04		Package AA	46	CAM SLOT TAB OUTSIDE DIAMETER REPAIR		4955.00	SR Technics Switzerland
138252	500628-01	EASA,FAA,CAAC,ANAC			72-33-04		Package AC	48	BENT SPLITTER FAIRING FLANGE REPAIR		2920.00	SR Technics Switzerland
138252	500630-003	EASA,FAA,CAAC,ANAC			72-33-04		Package AD	49	INNER CASE DOUBLER PLATE REPAIR		3475.00	SR Technics Switzerland
138252	500937-003	EASA,FAA,CAAC,ANAC			72-33-04		Package AE	52	WELD A CRACKED OR OVERSIZED CAM SLOT LINER RIVET HOLE		4195.00	SR Technics Switzerland
138252	500937-01	EASA,FAA,CAAC,ANAC			72-33-04		Package AF	53	WELD AN OVERSIZED BEARING PAD RIVET HOLE		7590.00	SR Technics Switzerland
138252	520286-01	EASA,FAA,CAAC,ANAC			72-33-04		Package AG	55	WELD DAMAGED SPLITTER FAIRING NUTPLATE BOLT OR RIVET HOLE REPAIR		1365.00	SR Technics Switzerland
138252	530515-01	EASA,FAA,CAAC,ANAC			72-33-04		Package AH	63	BLEED VALVE SCREEN INNER SURFACE BLEND REPAIR		505.00	SR Technics Switzerland
138252	530924-01	EASA,FAA,CAAC,ANAC			72-33-04		Package AI	67	FRONT CASE REAR FLANGE RIVET HOLE CRACK WELD REPAIR		3785.00	SR Technics Switzerland
138252					72-33-04		Package B	01	REPLACE LPC STATOR NUT PLATES		350.00	SR Technics Switzerland
138252					72-33-04		Package C	02	REPLACE LPC SPLITTER FAIRING NUT OPTION		330.00	SR Technics Switzerland
138252					72-33-04		Package D	03	REPLACE BLEED VALVE DUCT BRACKET		3160.00	SR Technics Switzerland
138252					72-33-04		Package D	05	REPLACE DUCT BRACKET		3160.00	SR Technics Switzerland
138252					72-33-04		Package D	07	REPLACE DUCT BRACKET		3160.00	SR Technics Switzerland
138252					72-33-04		Package E	04	REPLACE BLEED VALVE DUCT BRACKET ASSEMBLY NUT OPTIONS		1085.00	SR Technics Switzerland
138252					72-33-04		Package F	06	REPLACE BLEED VALVE DUCT BRACKET ASSEMBLY NUT OPTIONS		855.00	SR Technics Switzerland
138252					72-33-04		Package G	08	REPLACE BLEED VALVE DUCT HELICOIL INSERTS		350.00	SR Technics Switzerland
138252					72-33-04		Package H	09	REPLACE REAR ANGLE GANGNUT ASSEMBLY		685.00	SR Technics Switzerland
138252					72-33-04		Package H	10	REPLACE REAR GANGNUT ASSEMBLY NUT PLATES		685.00	SR Technics Switzerland
138252					72-33-04		Package I	11	REPLACE BRACKET ASSEMBLY		1525.00	SR Technics Switzerland
138252					72-33-04		Package I	12	REPLACE BRACKET ASSEMBLY NUT PLATES		1525.00	SR Technics Switzerland
138252					72-33-04		Package J	13	REPLACE THE GUIDE VANE PIN RIVET AND COLLAR		170.00	SR Technics Switzerland
138252					72-33-04		Package K	14	TOUCH UP ANODIZE		330.00	SR Technics Switzerland
138252					72-33-04		Package L	16	REPLACE RUBBER SEAL		1005.00	SR Technics Switzerland
138252					72-33-04		Package M	17	REPLACE A RIVETED BEARING PAD WITH A RIVETED BEARING PAD		1835.00	SR Technics Switzerland
138252					72-33-04		Package N	18	REPLACE BEARINGS IN BELLCRANK BRACKET		445.00	SR Technics Switzerland
138252					72-33-04		Package R	22	REPLACE A BONDED BEARING PAD WITH A BONDED BEARING PAD		1620.00	SR Technics Switzerland
138252					72-33-04		Package S	24	REPLACE A BONDED BEARING PAD WITH A RIVETED BEARING PAD		2290.00	SR Technics Switzerland
138252					72-33-04		Package SB00	PW4ENG 72-39	LPC, 4TH STAGE, AND, CASE ASSEMBLY, FAN EXIT, INNER - MODIFICATION OF OD SNAP DIAMETERS		680.00	SR Technics Switzerland
138252					72-33-04		Package SB01	PW4ENG 72-346	REPLACEMENT OF OR MODIFICATION OF TO INCORPORATE BOLTED - ON BELLCRANK B		790.00	SR Technics Switzerland
138252					72-33-04		Package SB02	PW4ENG 72-660	MODIF.OF.TO INCORP. NEW 2.5 BLD ROLLER CAM FOLLOWERS, STEEL CAM FOLLOWER SLOT LINERS, & BEARING PADS		10800.00	SR Technics Switzerland
138252					72-33-04		Package T	25	REPAIR THE ABLATIVE COATING		1520.00	SR Technics Switzerland
138252					72-33-04		Package U	27	WELD THE CAM SLOTS IN THE BLEED VALVE DUCT		3335.00	SR Technics Switzerland
138252					72-33-04		Package V	28	REPAIR DAMAGED FIRE ABLATIVE COATING WITH FIRE ABLATIVE BLANKETS		2015.00	SR Technics Switzerland
138252					72-33-04		Package W	29	WELD CRACKS AND RECONTOUR THE GUSSETS IN THE BLEED VALVE DUCT		5425.00	SR Technics Switzerland
138252					72-33-04		Package X	42	REPAIR DAMAGED FOIL ON THE FIRE ABLATIVE BLANKETS		2195.00	SR Technics Switzerland
138252					72-33-04		Package Y	44	FRONT INNER CASE (NEW) REPLACEMENT REPAIR		1805.00	SR Technics Switzerland
138252					72-33-04		Package Z	45	REPLACE LINER REPAIR		910.00	SR Technics Switzerland
138258	50A439	EASA,FAA,CAAC,ANAC	27	28	72-41-12	DIFFUSER AND COMBUSTOR - DOWELED END (COMBUSTION CHAMBE	Package A	CLN/INSP	CLEANING AND INSPECTION		190.00	SR Technics Switzerland
138258	50I618	EASA,FAA,CAAC,ANAC			72-41-12		Package C	02	RESTORE HARDFACE COATING TO DOWELED END	MINIMUM OF 10 EA.	580.00	SR Technics Switzerland
138378	50K306	EASA,FAA,CAAC,ANAC	23	28	72-51-05	TURBINE NOZZLE - INNER COMBUSTION CHAMBER ASSEMBLY - PLATE	Package B	01	ONE LUG NUT PLATE REPLACEMENT REPAIR		1400.00	SR Technics Switzerland
138378					72-51-05		Package K	10	CRACK WELD REPAIR REAR SUPPORT PLATE		2730.00	SR Technics Switzerland
138379	70R529	EASA,FAA,CAAC,ANAC	22	28	72-61-33	MAIN GEARBOX - GEARBOX (FRONT HYDRAULIC PUMP DRIVE) BEARIN	Package B	01	REPLACE HELICAL COIL INSERTS		510.00	SR Technics Switzerland
138379	70R637	EASA,FAA,CAAC,ANAC			72-61-33		Package C	02	ANODIZE TOUCH-UP		500.00	SR Technics Switzerland
138379	70R698	EASA,FAA,CAAC,ANAC			72-61-33		Package D	03	NICKEL PLATE THE OIL METERING PLUG HOLE OUTSIDE BORE		1050.00	SR Technics Switzerland
138379	70R969	EASA,FAA,CAAC,ANAC			72-61-33		Package E	04	NICKEL PLATE THE OIL METERING PLUG HOLE INSIDE BORE		1050.00	SR Technics Switzerland
138379	70R976	EASA,FAA,CAAC,ANAC			72-61-33		Package F	05	NICKEL PLATE THE OD		1115.00	SR Technics Switzerland
138379					72-61-33		Package G	06	REPLACE DAMAGED OR LOOSE STUDS		1015.00	SR Technics Switzerland
138379					72-61-33		Package H	07	BEARING SUPPORT BORE NICKEL PLATE REPAIR		1210.00	SR Technics Switzerland
138380	51H229-01	EASA,FAA,CAAC,ANAC	30	28	72-35-73	HIGH PRESSURE COMPRESSOR (HPC) - COMPRESSOR STATOR CYLINDE	Package A	CLN/INSP	CLEANING AND INSPECTION		445.00	SR Technics Switzerland
138380	53H036-01	EASA,FAA,CAAC,ANAC			72-35-73		Package AN		STOP NUTS REPLACEMENT	ACCORDING SPM 70-00-00	650.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
138380	53H214-01	EASA,FAA,CAAC,ANAC			72-35-73		Package B	01	NICKEL PLATE REPAIR FOR COMPRESSOR CYLINDER SUPPORT ASSEMBLY LOWER JOURNALS		5175.00	SR Technics Switzerland
138380	54H967	EASA,FAA,CAAC,ANAC			72-35-73		Package C	02	NICKEL PLATE REPAIR FOR COMPRESSOR CYLINDER SUPPORT ASSEMBLY UPPER JOURNALS		5955.00	SR Technics Switzerland
138380	54H974-01	EASA,FAA,CAAC,ANAC			72-35-73		Package D	03	NICKEL PLATE REPAIR FOR HOLES		4205.00	SR Technics Switzerland
138380	54H975-01	EASA,FAA,CAAC,ANAC			72-35-73		Package E	04	REPAIR OF WORN LOWER ATTACHMENT HOLES		3140.00	SR Technics Switzerland
138380	58H032-01	EASA,FAA,CAAC,ANAC			72-35-73		Package F	05	RESTORE THICKNESS OF WORN LOWER SUPPORT LEAVES - (SVA BRACKET)		3215.00	SR Technics Switzerland
138380	58H033-01	EASA,FAA,CAAC,ANAC			72-35-73		Package I	08	RESTORE THICKNESS OF WORN LOWER SUPPORT LEAVES		3215.00	SR Technics Switzerland
138380					72-35-73		Package K	10	REPAIR OF CRACKS IN SVA BRACKET FLANGE		3600.00	SR Technics Switzerland
138380					72-35-73		Package M	12	RIVET REPLACEMENT REPAIR ON STIFFENING PANELS		3420.00	SR Technics Switzerland
138380					72-35-73		Package Q	16	EPOXY COAT REPLACEMENT REPAIR		1400.00	SR Technics Switzerland
138380					72-35-73		Package R	17	NUT PLATE NUT REPLACEMENT REPAIR		2145.00	SR Technics Switzerland
138380					72-35-73		Package SB00	PW4ENG 72-685	PROVIDE A NEW COMPRESSOR STATOR CYLINDER SUPPORT ASSEMBLY WITH A BRACE THAT HAS A CLEARANCE CUT		1100.00	SR Technics Switzerland
138380					72-35-73		Package SB00	PW4G-100-72-130	PROVIDE A NEW COMPRESSOR STATOR CYLINDER SUPPORT ASSEMBLY WITH A BRACE THAT HAS A CLEARANCE CUT		1100.00	SR Technics Switzerland
138381	70R234	EASA,FAA,CAAC,ANAC	22	28	72-61-47	MAIN GEARBOX - GEARBOX GENERATOR (EEC/PMA ALTERNATOR) HOUSING	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
138381	70R633	EASA,FAA,CAAC,ANAC			72-61-47		Package B	01	REPLACE HELICAL COIL INSERTS		600.00	SR Technics Switzerland
138381	70R771	EASA,FAA,CAAC,ANAC			72-61-47		Package C	02	APPLY ANODIZE TOUCH-UP SOLUTION		500.00	SR Technics Switzerland
138381	70R902	EASA,FAA,CAAC,ANAC			72-61-47		Package D	03	NICKEL PLATE THE OD		1175.00	SR Technics Switzerland
138381	71R003	EASA,FAA,CAAC,ANAC			72-61-47		Package E	04	REPAIR THE FRONT ID WITH A BUSHING		1095.00	SR Technics Switzerland
138381					72-61-47		Package F	05	REPAIR THE MIDDLE ID WITH A BUSHING		1095.00	SR Technics Switzerland
138381					72-61-47		Package G	06	REPLACE HELICAL COIL INSERTS		380.00	SR Technics Switzerland
138381					72-61-47		Package H	07	PMA DRIVE HOUSING BLEND REPAIR		550.00	SR Technics Switzerland
138381					72-61-47		Package I	08	PMA DRIVE HOUSING BLEND REPAIR		415.00	SR Technics Switzerland
138381					72-61-47		Package SB00	78F-98.A	EEC GENERATOR HOUSING - TAPPING OF HOLES		500.00	SR Technics Switzerland
138382	310T3033-1	EASA,FAA,CAAC,ANAC	19	21	71-21-16	AFT ENGINE MOUNT - CENTER LINK ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		295.00	SR Technics Switzerland
138382	310T3033-2	EASA,FAA,CAAC,ANAC			71-21-16		Package B	7-1	BEARING REPLACEMENT		1205.00	SR Technics Switzerland
138382	310T3033-3	EASA,FAA,CAAC,ANAC			71-21-16		Package C	7-1	BLEND REPAIR		255.00	SR Technics Switzerland
138382	310T3033-7	EASA,FAA,CAAC,ANAC			71-21-16		Package D	7-2	REPAIR FOR OVERSIZE BEARING		1815.00	SR Technics Switzerland
138383	310T4032-14	EASA,FAA,CAAC,ANAC	3	21	71-21-16	PW4 HANGER FLEX MOUNT	Package A	CLN/INSP	CLEANING AND INSPECTION		210.00	SR Technics Switzerland
138383					71-21-16		Package B	14-1	BUSHING REPLACEMENT		475.00	SR Technics Switzerland
138383					71-21-16		Package C	14-2	REP 14-2 BUSHING REPLACEMENT AND HOLE REPAIR		990.00	SR Technics Switzerland
138579	70R043	EASA,FAA,CAAC,ANAC	25	28	72-61-35	MAIN GEARBOX - GEARBOX FRONT HYDRAULIC PUMP DRIVE BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		505.00	SR Technics Switzerland
138579					72-61-35		Package B	01	REPLACE CORROSION PROTECTIVE COATING		555.00	SR Technics Switzerland
138579					72-61-35		Package C	02	NICKEL PLATE THE PACKING LANDS		1205.00	SR Technics Switzerland
138579					72-61-35		Package D	03	NICKEL PLATE THE END FACE		1205.00	SR Technics Switzerland
138579					72-61-35		Package E	04	CHROMIUM PLATE THE REAR BEARING SHOULDER		1820.00	SR Technics Switzerland
138579					72-61-35		Package F	05	CHROMIUM PLATE THE FRONT BEARING SHOULDER		1820.00	SR Technics Switzerland
138579					72-61-35		Package G	06	NICKEL PLATE THE FRONT INNER DIAMETER		1205.00	SR Technics Switzerland
138628	50P128	EASA,FAA,CAAC,ANAC	30	21	72-54-08	TURBINE EXHAUST CASE - NO. 4 BEARING OIL SCAVENGE (OUTER) TUB	Package A	CLN/INSP	CLEANING AND INSPECTION		275.00	SR Technics Switzerland
138628	50P274-01	EASA,FAA,CAAC,ANAC			72-54-08		Package B	01	FERRULE TUBE FITTING PLASMA COAT REPAIR		410.00	SR Technics Switzerland
138628	50P275-01	EASA,FAA,CAAC,ANAC			72-54-08		Package G	06	REPLACE THE PIN		990.00	SR Technics Switzerland
138628	50P313-01	EASA,FAA,CAAC,ANAC			72-54-08		Package K	SPM	REPAIR OF THE TUBE CONICAL SEAT	ACC SPM 70-00-00 REPAIR 22	305.00	SR Technics Switzerland
138630	50P070	EASA,FAA,CAAC,ANAC	32	21	72-54-07	TURBINE EXHAUST CASE - NO. 4 BEARING OIL PRESSURE TUBE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		460.00	SR Technics Switzerland
138630	50P273-01	EASA,FAA,CAAC,ANAC			72-54-07		Package B	01	FERRULE TUBE FITTING AND SLEEVE PLASMA COAT REPAIR		575.00	SR Technics Switzerland
138630	50P276-01	EASA,FAA,CAAC,ANAC			72-54-07		Package C		REMOVAL OF CARBON IN TUBE (BAKE METHOD)		750.00	SR Technics Switzerland
138630	50P312-01	EASA,FAA,CAAC,ANAC			72-54-07		Package G	06	REPLACE THE PIN		745.00	SR Technics Switzerland
138630					72-54-07		Package J	09	HOUSING WEAR PLASMA COAT REPAIR		835.00	SR Technics Switzerland
138631	50P031	EASA,FAA,CAAC,ANAC	3	28	72-54-10	PW4 NO. 4 BEARING (OIL) NOZZLE	Package A	CLN/INSP	CLEANING & INSPECTION		170.00	SR Technics Switzerland
138662	50B245-01	EASA,FAA,CAAC,ANAC	30	28	72-31-28	LOW PRESSURE COMPRESSOR (LPC) - NO. 1 BEARING SEAL SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		395.00	SR Technics Switzerland
138662					72-31-28		Package C	03	LOOSE OR DAMAGED CLINCH NUT REPLACEMENT REPAIR		500.00	SR Technics Switzerland
138662					72-31-28		Package D	05	OUTER MATING DIAMETER PLASMA COAT REPAIR	(TITANIUM PART)	1455.00	SR Technics Switzerland
138663	50G439	EASA,FAA,CAAC,ANAC	30	28	72-34-01	INTERMEDIATE CASE - COMPRESSOR INTERMEDIATE CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		450.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
138663	51G232	EASA,FAA,CAAC,ANAC			72-34-01		Package B	44	BLEND SURFACE DAMAGE ON THE FAN EXIT CASE FLANGE ASSEMBLY		845.00	SR Technics Switzerland
138663	51G233	EASA,FAA,CAAC,ANAC			72-34-01		Package C	50	MAKE STRAIGHT AND BLEND THE FAN EXIT CASE FLANGE		740.00	SR Technics Switzerland
138663	51G447	EASA,FAA,CAAC,ANAC			72-34-01		Package D	96	TOUCH UP FAN EXIT CASE FLANGE ASSEMBLY PROTECTION LAYER REPAIR		685.00	SR Technics Switzerland
138663	52G113-01	EASA,FAA,CAAC,ANAC			72-34-01		Package E	97	FAN EXIT CASE FLANGE ASSEMBLY NUT PLATE REPLACEMENT		815.00	SR Technics Switzerland
138663					72-34-01		Package F	98	FAN EXIT CASE FLANGE ASSEMBLY ANTI-GALLANT REPAIR		685.00	SR Technics Switzerland
138663					72-34-01		Package G	117	PLASMA SPRAY REPAIR FLANGE D1 SURFACE		1890.00	SR Technics Switzerland
138805	51A578	EASA,FAA,CAAC,ANAC	13	28	72-53-84	LOW PRESSURE TURBINE (LPT) - NO 4 BEARING RETAINING PLATE	Package A	CLN/INSP	CLEANING AND INSPECTION		395.00	SR Technics Switzerland
138805					72-53-84		Package B	01	NICKEL PLATE REPAIR SNAP DIAMETER		1005.00	SR Technics Switzerland
138805					72-53-84		Package C	02	NICKEL PLATE REPAIR PREFORMED PACKING SEAL LAND		1005.00	SR Technics Switzerland
138809	217563-1	EASA,FAA,CAAC,ANAC	22	21	73-11-04	FUEL-PUMP/DISTRIBUTION VALVE - FUEL PUMP - INLET HOUSING	Package B		REPLACE SLEEVE BEARING	ACCORDING CMM	1400.00	SR Technics Switzerland
138811	800999-1	EASA,FAA,ANAC	20	21	73-21-64	FUEL METRING UNIT -JFC131-2- HOUSING	Package B	1-1	REMOVAL AND REPLACEMENT OF RING LOCKED STUDS		695.00	SR Technics Switzerland
139227	50J550-01	EASA,FAA,CAAC,ANAC	33	28	72-41-41	DIFFUSER AND COMBUSTOR - HPC (REAR) EXIT BRUSH SEAL ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		395.00	SR Technics Switzerland
139227					72-41-41		Package B	01	BRUSH SEAL REPLACEMENT REPAIR		1015.00	SR Technics Switzerland
139227					72-41-41		Package C	02	PLASMA SPRAY SNAP DIAMETER		2125.00	SR Technics Switzerland
139227					72-41-41		Package D	03	PLASMA COAT REPAIR OIL PRESSURE TUBE BOSS ID		2125.00	SR Technics Switzerland
139227					72-41-41		Package E	04	PLASMA COAT REPAIR OIL SCAVENGE BOSS ID		2005.00	SR Technics Switzerland
139227					72-41-41		Package F	05	PLASMA SPRAY REPAIR BREATHER BOSS ID		2005.00	SR Technics Switzerland
139227					72-41-41		Package G	06	SLEEVE REPAIR OIL PRESSURE TUBE BOSS ID		2450.00	SR Technics Switzerland
139227					72-41-41		Package H	07	SLEEVE REPAIR OIL SCAVENGE TUBE BOSS ID		2280.00	SR Technics Switzerland
139227					72-41-41		Package I	08	SLEEVE REPAIR BREATHER BOSS ID		2280.00	SR Technics Switzerland
139227					72-41-41		Package J	09	SLEEVE REPAIR 12TH STAGE AIR SUPPLY TUBE BOSS		2280.00	SR Technics Switzerland
139227					72-41-41		Package K	10	SLEEVE REPAIR TOBI SENSE TUBE BOSS		2200.00	SR Technics Switzerland
139227					72-41-41		Package L	11	SLEEVE REPAIR OIL WEEP TUBE BOSS		2200.00	SR Technics Switzerland
139227					72-41-41		Package M	12	SLEEVE REPAIR NO.3 BEARING COMPARTMENT BUFFER AIR BOSS		2280.00	SR Technics Switzerland
139227					72-41-41		Package N	13	SURFACE DAMAGE BLEND REPAIR		1040.00	SR Technics Switzerland
139227					72-41-41		Package O	14	SNAP DIAMETER PLASMA SPRAY REPAIR		2325.00	SR Technics Switzerland
139227					72-41-41		Package R	17	WELD REPAIR BUFFER AIR BOSS OUTSIDE DIAMETER		2865.00	SR Technics Switzerland
139227					72-41-41		Package SB00	72-219577	N2-VIBRATION PREVENTIVE ACTIONS	ONLY BRUSH SEAL INSPECTION	90.00	SR Technics Switzerland
139227					72-41-41		Package T	19	ANIT ROTATION SLOT BLEND REPAIR		285.00	SR Technics Switzerland
139227					72-41-41		Package V	21	PARTIAL TUBE BOSS WELD REPAIR		3040.00	SR Technics Switzerland
139228	50J837-01	EASA,FAA,CAAC,ANAC	29	28	72-41-39	DIFFUSER AND COMBUSTOR - HPC EXIT BRUSH SEAL SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
139228	50J841-01	EASA,FAA,CAAC,ANAC			72-41-39		Package B	01	REPLACE BRUSH SEAL		805.00	SR Technics Switzerland
139228	50J987-01	EASA,FAA,CAAC,ANAC			72-41-39		Package F	05	SURFACE DAMAGE BLEND REPAIR		560.00	SR Technics Switzerland
139228					72-41-39		Package G	06	SUPPORT CRACK WELD REPAIR		1840.00	SR Technics Switzerland
139228					72-41-39		Package SB00	PWMENG 72-630	HPC EXIT BRUSH SEAL SUPPORT MODIFICATION		1315.00	SR Technics Switzerland
139228					72-41-39		Package SB01	72-219577	N2-VIBRATION PREVENTIVE ACTIONS	ONLY BRUSH SEAL INSPECTION	90.00	SR Technics Switzerland
139229	50K154-01	EASA,FAA,CAAC,ANAC	32	28	72-51-12	TURBINE NOZZLE - STAGE 1 HPT BRUSH SEAL AND SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		745.00	SR Technics Switzerland
139229					72-51-12		Package B	01	HPT BRUSH SEAL REPLACEMENT REPAIR		1095.00	SR Technics Switzerland
139229					72-51-12		Package E	04	SURFACE DAMAGE BLEND REPAIR		305.00	SR Technics Switzerland
139276	50L247-01	EASA,FAA,CAAC,ANAC	19	28	72-52-33	HIGH PRESSURE TURBINE (HPT) - STAGE 1 HPT BAND SEGMENT	Package A	CLN/INSP	CLEANING AND INSPECTION		335.00	SR Technics Switzerland
139276	55L032-01	EASA,FAA,CAAC,ANAC			72-52-33		Package B	01	CRACK REPAIR		735.00	SR Technics Switzerland
139302	54H767	EASA,FAA,CAAC,ANAC,CAA UK	36	35	72-35-09	HIGH PRESSURE COMPRESSOR (HPC) - TURBINE DRIVE SHAFT	Package A	CLN/INSP	CLEANING AND INSPECTION		870.00	SR Technics Switzerland
139302					72-35-09		Package AA	26	REAR HUB FRONT JOURNAL CHROMIUM P		2900.00	SR Technics Switzerland
139302					72-35-09		Package AB	27	REAR HUB TURBINE PILOT DIAMETER REAR JOURNAL CHROMIUM PLATE		4905.00	SR Technics Switzerland
139302					72-35-09		Package AC	28	NO3 BEARING SEAL SEAT SHOULDER PLASMA COAT REPAIR		4910.00	SR Technics Switzerland
139302					72-35-09		Package AG	32	SPLINE GALLING REPAIR		820.00	SR Technics Switzerland
139302					72-35-09		Package B	01	NICKEL PLATE HPC REAR HUB NO. 3 BEARING HEAT SHIELD REAR JOURNAL		4435.00	SR Technics Switzerland
139302					72-35-09		Package C	02	NICKEL PLATE HPC REAR HUB NO. 3 BEARING HEAT SHIELD FRONT JOURNAL		4435.00	SR Technics Switzerland
139302					72-35-09		Package F	05	CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING JOURNAL		4710.00	SR Technics Switzerland
139302					72-35-09		Package G	06	CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING SEAL SPACER JOURNAL		4710.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139302					72-35-09		Package H	07	CHROMIUM PLATE HPC REAR HUB NO. 3 BEARING FRONT SEAL JOURNAL		4710.00	SR Technics Switzerland
139302					72-35-09		Package I	08	NICKEL PLATE HPC REAR HUB NO. 3 BEARING SEAL SEAT SHOULDER		4825.00	SR Technics Switzerland
139302					72-35-09		Package J	09	BLEND REPAIR REAR HUB TORQUE SLOT LUGS		1340.00	SR Technics Switzerland
139302					72-35-09		Package L	11	PLASMA SPRAY HPC FRONT SNAP DIAMETER		4715.00	SR Technics Switzerland
139302					72-35-09		Package O	14	BLEND REPAIR SURFACE DAMAGE		945.00	SR Technics Switzerland
139302					72-35-09		Package P	15	BLEND REPAIR KNIFE-EDGE SEALS		810.00	SR Technics Switzerland
139302					72-35-09		Package R	17	BLEND REPAIR SPLINE SURFACE DAMAGE		1185.00	SR Technics Switzerland
139302					72-35-09		Package U	20	REPAIR THE HEAT SHIELD ANTI-ROTATION SLOT SURFACE DAMAGE		2475.00	SR Technics Switzerland
139302					72-35-09		Package X	23	SKIM MACHINE CUT REPAIR FRONT SNAP DIAMETER		1460.00	SR Technics Switzerland
139302					72-35-09		Package Y	24	SKIM MACHINE CUT REPAIR REAR SNAP DIAMETER		1460.00	SR Technics Switzerland
139302					72-35-09		Package Z	25	SKIM MACHINE CUT REPAIR NO3 BEARING STACKUP SHOULDER REAR HUB		480.00	SR Technics Switzerland
139323	50A722	EASA,FAA,CAAC,ANAC	29	28	72-52-80	HIGH PRESSURE TURBINE (HPT) - NO. 3 BEARING RETAINING NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		540.00	SR Technics Switzerland
139323	51A358	EASA,FAA,CAAC,ANAC			72-52-80		Package B	01	REPLACE SILVER PLATE		935.00	SR Technics Switzerland
139323					72-52-80		Package C	02	NICKEL PLATE REPAIR FRONT ID PILOT DIAMETER		3055.00	SR Technics Switzerland
139323					72-52-80		Package D	03	MACHINE REPAIR FRONT FACE		1890.00	SR Technics Switzerland
139323					72-52-80		Package E	04	OUTER SURFACE CORROSION REPAIR		375.00	SR Technics Switzerland
139323					72-52-80		Package I	08	REAR FLANGE DENTS POLISH		105.00	SR Technics Switzerland
139332	50A721	EASA,FAA,CAAC,ANAC	26	28	72-52-83	HIGH PRESSURE TURBINE (HPT) - TURBINE SHAFT SPACER	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
139332					72-52-83		Package B	01	SURFACE DAMAGE MACHINE GRIND REPAIR		845.00	SR Technics Switzerland
139575	800967-1	EASA,FAA,ANAC	22	21	73-21-64	FUEL METRING UNIT - JFC131-2 - GEAR	Package F	5-2	REPAIR OF THE TRANSMITTER RESOLVER AND CONTACTS WHEN THE SPUR GEAR IS WORN IN TWO OPPOSITE QUADR		290.00	SR Technics Switzerland
139575					73-21-64		Package SB00	SB JFC131-2-73-	REPLACEMENT OF THE SPUR GEAR AND THE SEGMENT GEAR		660.00	SR Technics Switzerland
139579	51G470	EASA,FAA,CAAC,ANAC	10	28	72-34-01	PW4 (94") COVER ASSY OF FAN EXIT CASE ASSEMBLY	Package A	CLN/INSP	CLEANING & INSPECTION		105.00	SR Technics Switzerland
139579	51G472	EASA,FAA,CAAC,ANAC			72-34-01		Package B	100	STOP DRILL FAIRING COVER CRACKS		305.00	SR Technics Switzerland
139579	51G487	EASA,FAA,CAAC,ANAC			72-34-01		Package C	101	REPLACEMENT OF FAN EXIT FAIRING		1050.00	SR Technics Switzerland
139579	51G488	EASA,FAA,CAAC,ANAC			72-34-01		Package D	SPM	REPLACE STOPS ACC. SPM		90.00	SR Technics Switzerland
139630	420193	EASA,FAA,CAAC,ANAC	9	21	24-21-43	CABLE POWER ELECTRICAL ID	Package C		TEST		745.00	SR Technics Switzerland
139630	55T119	EASA,FAA,CAAC,ANAC			24-21-43		Package E		REPAIR		1355.00	SR Technics Switzerland
139630					24-21-43		Package G		OVERHAUL		2425.00	SR Technics Switzerland
139672	50A526	EASA,FAA,CAAC,ANAC	33	28	72-31-83	LOW PRESSURE COMPRESSOR (LPC) - COMPRESSOR BLADE (STAGE 1) L	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
139672	51A480	EASA,FAA,CAAC,ANAC			72-31-83		Package B	01	REPLACE ANTIROTATION PIN		340.00	SR Technics Switzerland
139672	52A078	EASA,FAA,CAAC,ANAC			72-31-83		Package D	03	PWA 595 ALUMINUM COATING REPAIR		4400.00	SR Technics Switzerland
139672	52A079	EASA,FAA,CAAC,ANAC			72-31-83		Package E	INSP-03	INSP/CHECK-03 BLEND SURFACE DAMAGE		135.00	SR Technics Switzerland
139689	51R071	EASA,FAA,CAAC,ANAC	4	28	72-41-91	PW4 GEARBOX LUG GUIDE ASSEMBLY	Package A	CLN/INSP	CLEANING & INSPECTION		340.00	SR Technics Switzerland
139689	51R130	EASA,FAA,CAAC,ANAC			72-41-91		Package B	005	PLASMA COAT BEARING HOUSING		1430.00	SR Technics Switzerland
139689					72-41-91		Package C	INSP/CHECK-06	GEARBOX LUG GUIDE ASSEMBLY		100.00	SR Technics Switzerland
139689					72-41-91		Package SB00	PW4G-100-72-10	REPLACEMENT OF MAIN GEARBOX MOUNT CENTER GUIDE		480.00	SR Technics Switzerland
139695	54T937	EASA,FAA,CAAC,ANAC	21	21	71-22-11	AFT ENGINE MOUNT - LINK AND LINK ASSEMBLY - SECONDARY	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
139695	54T939	EASA,FAA,CAAC,ANAC			71-22-11		Package B	01	REAR MOUNT LINK AND LINK ASSEMBLY BEARING DISASSEMBLY, MARKING, REPLACEMENT AND ASSEMBLY		350.00	SR Technics Switzerland
139695	55T619	EASA,FAA,CAAC,ANAC			71-22-11		Package C	02	SECONDARY LINK BEARING OVAL TRACK PLASMA SPRAY REPAIR		555.00	SR Technics Switzerland
139695					71-22-11		Package D	03	SECONDARY LINK OUTER SURFACE PLASMA SPRAY REPAIR		540.00	SR Technics Switzerland
139695					71-22-11		Package E	04	PRIMARY AND SECONDARY LINK SURFACE DAMAGE BLEND REPAIR		445.00	SR Technics Switzerland
139714	50U594-01	EASA,FAA,CAAC,ANAC	17	21	72-35-00	HIGH PRESSURE COMPRESSOR (HPC) - BRACKET-ASSY OF LC	Package A	CLN/INSP	CLEANING AND INSPECTION		230.00	SR Technics Switzerland
139714	58T656-001	EASA,FAA,CAAC,ANAC			72-35-00		Package AE		REPLACE DEFECTIVE NUTPLATES	ACC. SPM 70-43-00	160.00	SR Technics Switzerland
139714	58T656-01	EASA,FAA,CAAC,ANAC			72-35-00		Package SB00	PW4G-100-72-75	MODIFICATION OF TO REMOVE AND UNSUSED NUTPLAT		315.00	SR Technics Switzerland
139722	50D461	EASA,FAA,CAAC,ANAC	31	28	72-33-09	FAN CASE - BLEED VALVE ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		795.00	SR Technics Switzerland
139722	53D546	EASA,FAA,CAAC,ANAC			72-33-09		Package B	01	ANODIZE TOUCH-UP		735.00	SR Technics Switzerland
139722					72-33-09		Package H	07	BLEND REPAIR		460.00	SR Technics Switzerland
139722					72-33-09		Package I	08	REPLACE SILICONE RUBBER SEAL		1465.00	SR Technics Switzerland
139722					72-33-09		Package J	09	HOLE REPAIR		1885.00	SR Technics Switzerland
139722					72-33-09		Package L	11	REPLACE TEFLON COATING		2030.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139722					72-33-09		Package M	12	BUSHING REPLACEMENT		1020.00	SR Technics Switzerland
139722					72-33-09		Package SB00	PW4G-100-72-112	MODIFICATION OF TO INCORPORATE NEW ROLLER CAM FOLLOWERS		1765.00	SR Technics Switzerland
139723	50D653	EASA,FAA,CAAC,ANAC	26	28	72-33-12	FAN CASE - BLEED VALVE CONNECTING LINK - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
139723	53D361	EASA,FAA,CAAC,ANAC			72-33-12		Package C	02	REPLACE THE BEARING		765.00	SR Technics Switzerland
139723					72-33-12		Package D	03	REPLACE THE ANTIGALLING COMPOUND		455.00	SR Technics Switzerland
139723					72-33-12		Package E	04	CONNECTING PIN HOLE REPAIR		765.00	SR Technics Switzerland
139725	50K138-001	EASA,FAA,CAAC,ANAC	27	28	72-51-03	TURBINE NOZZLE - STAGE 1 HPT (BLADE) COOLING DUCT ASSEMBLY-1C	Package A	CLN/INSP	CLEANING AND INSPECTION		480.00	SR Technics Switzerland
139725	50K138-01	EASA,FAA,CAAC,ANAC			72-51-03		Package B	01	FRONT FLANGE FACE PLASMA SPRAY REPAIR		3545.00	SR Technics Switzerland
139725	50K373-001	EASA,FAA,CAAC,ANAC			72-51-03		Package D	03	PLASMA SPRAY INNER COMBUSTION CHAMBER DIAMETER		3480.00	SR Technics Switzerland
139725	50K373-01	EASA,FAA,CAAC,ANAC			72-51-03		Package E	04	FRONT DIAMETER PLASMA SPRAY REPAIR		3480.00	SR Technics Switzerland
139725	50K610-01	EASA,FAA,CAAC,ANAC			72-51-03		Package F	05	LOCATING PIN REPLACEMENT		815.00	SR Technics Switzerland
139725	50K610-101	EASA,FAA,CAAC,ANAC			72-51-03		Package G	06	WELD REPAIR THE PS4 TUBE HOLE		4330.00	SR Technics Switzerland
139725					72-51-03		Package H	07	OUTER FLANGE BOLTHOLE CRACKS WELD REPAIR		4825.00	SR Technics Switzerland
139725					72-51-03		Package I	08	OUTER FLANGE FRONT FACE WELD REPAIR		4165.00	SR Technics Switzerland
139725					72-51-03		Package J	09	FUNCTIONAL AIRFLOW (CHECK) REPAIR		1465.00	SR Technics Switzerland
139725					72-51-03		Package N	13	REPLACE THE CLINCH NUTS		680.00	SR Technics Switzerland
139725					72-51-03		Package O	14	PLASMA COAT REPAIR THE BRUSH SEAL SUPPORT DIAMETER		3050.00	SR Technics Switzerland
139725					72-51-03		Package P	15	INNER FLANGE BOLT HOLE CRACKS WELD REPAIR		4050.00	SR Technics Switzerland
139725					72-51-03		Package R	17	OUTER FLANGE FRONT FACE PLASMA SPRAY REPAIR		3070.00	SR Technics Switzerland
139725					72-51-03		Package SB00	PW4G-100-72-109	INCRP. OF ADDITIONAL PLATFORM AND AIRFOIL COOLING WHICH REQUIRES A NEW FIRST STAGE HPT COOLING DUC		3405.00	SR Technics Switzerland
139725					72-51-03		Package SB01	PW4G-100-72-172	INSPECTION AND MODIFICATION OF THE VANE CAVITIES		630.00	SR Technics Switzerland
139725					72-51-03		Package SB02	PW4G-100-72-219	MODIFICATION OF TO INCORPORATE THE ADVANTAGE 7D PERFORMANCE		1465.00	SR Technics Switzerland
139725					72-51-03		Package SB03	PW4G-100-72-220	CONVERSION OF PW4164 PW4168 OR PW4168A TO A PW4164-1D PW4 MDIFY OLD ASSY TO THE NEW FLOW CONFIGI		2425.00	SR Technics Switzerland
139725					72-51-03		Package SB04	000696-ED01	MODIFICATION TO INCREASE TOBI FLOW		3250.00	SR Technics Switzerland
139725					72-51-03		Package Y	24	OUTER FLANGE REAR FACE PLASMA COAT REPAIR		2955.00	SR Technics Switzerland
139725					72-51-03		Package Z	25	BLEND REPAIR		530.00	SR Technics Switzerland
139726	50N007	EASA,FAA,CAAC,ANAC	29	28	72-53-38	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT (INNER ROTATING) AIRSE	Package A	CLN/INSP	CLEANING AND INSPECTION		900.00	SR Technics Switzerland
139726	50N381	EASA,FAA,CAAC,ANAC			72-53-38		Package B	01	KNIFE-EDGE SEALS BLEND REPAIR		1400.00	SR Technics Switzerland
139726	50N412	EASA,FAA,CAAC,ANAC,CAA UK			72-53-38		Package B	06	KNIFE-EDGE SEALS BLEND REPAIR		1400.00	SR Technics Switzerland
139726	50N420	EASA,FAA,CAAC,ANAC,CAA UK			72-53-38		Package C	02	SURFACE DAMAGE BLEND REPAIR		1170.00	SR Technics Switzerland
139726					72-53-38		Package E	04	SNAP DIAMETER PLASMA SPRAY REPAIR		3145.00	SR Technics Switzerland
139726					72-53-38		Package F	05	AIRSEAL BALANCE REPAIR		1105.00	SR Technics Switzerland
139726					72-53-38		Package F	07	AIRSEAL BALANCE REPAIR		1105.00	SR Technics Switzerland
139726					72-53-38		Package I	08	COUNTERWEIGHT TAB REPAIR		1545.00	SR Technics Switzerland
139726					72-53-38		Package M	CLN-01	REMOVE CORROSION BY WET BLASTING		465.00	SR Technics Switzerland
139728	50A281	EASA,FAA,CAAC,ANAC	37	28	72-32-01	LPC/LPT COUPLING - TURBINE SHAFT COUPLING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		900.00	SR Technics Switzerland
139728	51A275	EASA,FAA,CAAC,ANAC,CAA UK			72-32-01		Package B	01	REPLACE ANTIGALLANT		815.00	SR Technics Switzerland
139728					72-32-01		Package C	02	PLASMA SPRAY TURBINE SHAFT COUPLING NO. 1.5 BEARING SPACER JOURNAL		4630.00	SR Technics Switzerland
139728					72-32-01		Package D	03	PLASMA SPRAY TURBINE SHAFT COUPLING NO. 1.5 BEARING JOURNAL		4825.00	SR Technics Switzerland
139728					72-32-01		Package E	04	PLASMA SPRAY TURBINE SHAFT COUPLING FAN HUB SHOULDER		4450.00	SR Technics Switzerland
139728					72-32-01		Package F	05	PLASMA SPRAY TURBINE SHAFT COUPLING FAN HUB FRONT PILOT DIAMETER		4175.00	SR Technics Switzerland
139728					72-32-01		Package G	06	FRONT PILOT DIAMETER PLASMA COAT REPAIR		5080.00	SR Technics Switzerland
139728					72-32-01		Package H	07	PLASMA SPRAY TURBINE SHAFT COUPLING NUT PILOT DIAMETER		5755.00	SR Technics Switzerland
139728					72-32-01		Package I	08	PLASMA SPRAY TURBINE SHAFT COUPLING FAN HUB REAR PILOT DIAMETER		3455.00	SR Technics Switzerland
139728					72-32-01		Package J	09	PLASMA SPRAY TURBINE SHAFT COUPLING REAR PILOT DIAMETER		4010.00	SR Technics Switzerland
139728					72-32-01		Package K	10	PLASMA SPRAY TURBINE SHAFT COUPLING MOTION PICKUP DIAMETER		5800.00	SR Technics Switzerland
139728					72-32-01		Package L	11	REPLACE TURBINE SHAFT COUPLING ASSEMBLY MOTION PICKUP WHEEL		505.00	SR Technics Switzerland
139728					72-32-01		Package M	12	BLEND REPAIR		1310.00	SR Technics Switzerland
139728					72-32-01		Package N	13	FAN HUB SHOULDER PLASMA COAT REPAIR	FRONT	1900.00	SR Technics Switzerland
139728					72-32-01		Package O	14	PLASMA SPRAY REPAIR		1900.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139728					72-32-01		Package P	15	FAN HUB SHOULDER PLASMA COAT REPAIR	REAR	1900.00	SR Technics Switzerland
139730	51A397-01	EASA,FAA,CAAC,ANAC	30	28	72-34-81	INTERMEDIATE CASE - NO. 1 BEARING REAR SUPPORT ASSEMBLY - 100	Package A	CLN/INSP	CLEANING AND INSPECTION		450.00	SR Technics Switzerland
139730					72-34-81		Package B	01	ANODIZE TOUCH-UP		500.00	SR Technics Switzerland
139730					72-34-81		Package B	INSP-03	BLEND REPAIR		500.00	SR Technics Switzerland
139730					72-34-81		Package C	07	OIL PRESSURE MANIFOLD SUPPORT BRACKET REPLACEMENT		855.00	SR Technics Switzerland
139730					72-34-81		Package G	06	OIL PRESSURE MANIFOLD SUPPORT BRACKET BUSHING REPLACEMENT		1080.00	SR Technics Switzerland
139730					72-34-81		Package Q	16	BOLT HOLE BLEND REPAIR		550.00	SR Technics Switzerland
139730					72-34-81		Package R	19	REPAIR FRONT FLANGE BOLT HOLES		1115.00	SR Technics Switzerland
139730					72-34-81		Package S	20	REPAIR REAR FLANGE BOLT HOLES		1115.00	SR Technics Switzerland
139732	50A178	EASA,FAA,CAAC,ANAC	31	28	72-31-84	LOW PRESSURE COMPRESSOR (LPC) - FAN EXIT FAIRING	Package A	CLN/INSP	CLEANING AND INSPECTION		620.00	SR Technics Switzerland
139732	50A786-01	EASA,FAA,CAAC,ANAC			72-31-84		Package AN		PART- AND SERIALNUMBER MARKING		140.00	SR Technics Switzerland
139732	51A541-01	EASA,FAA,CAAC,ANAC			72-31-84		Package B	01	REPLACE FAN EXIT FAIRING ANTIGALLING COMPOUND		685.00	SR Technics Switzerland
139732	51A627-01	EASA,FAA,CAAC,ANAC			72-31-84		Package C	02	PUNCTURE REPAIR FAN EXIT FAIRING		1410.00	SR Technics Switzerland
139732	51A630-01	EASA,FAA,CAAC,ANAC			72-31-84		Package D	03	REPAIR CHIPPED, ABRADED OR DELAMINATED FAN EXIT FAIRING		1655.00	SR Technics Switzerland
139732	51A754-01	EASA,FAA,CAAC,ANAC			72-31-84		Package G	05	TOUCH-UP FAN EXIT FAIRING PROTECTIVE COATING		3030.00	SR Technics Switzerland
139732					72-31-84		Package G	06	REPLACE PROTECTIVE LAYER REPAIR		3030.00	SR Technics Switzerland
139732					72-31-84		Package I	08	INSIDE DIAMETER SURFACE ABRASION REPAIR		685.00	SR Technics Switzerland
139732					72-31-84		Package K	10	REPLACE DAMAGED LEADING EDGE SHIELD		2155.00	SR Technics Switzerland
139732					72-31-84		Package L	11	LEADING EDGE EROSION (HOLE) REPAIR		755.00	SR Technics Switzerland
139732					72-31-84		Package L	11	LEADING EDGE FILLER REPAIR		755.00	SR Technics Switzerland
139732					72-31-84		Package L	11	METAL SHIELD BUT JOINT GAP REPAIR		755.00	SR Technics Switzerland
139732					72-31-84		Package M	12	CRUSHED REAR EDGE REPAIR		2005.00	SR Technics Switzerland
139732					72-31-84		Package S	18	LEADING EDGE SHIELD INNER LIP DISBOND REPAIR		885.00	SR Technics Switzerland
139732					72-31-84		Package SB00	PW4ENG 72-296	MODIF OF LEADING EDGE		4375.00	SR Technics Switzerland
139733	51B571-001	EASA,FAA,CAAC,ANAC	33	28	72-31-09	LOW PRESSURE COMPRESSOR (LPC) - STAGE 1 COMPRESSOR STATOR /	Package A	CLN/INSP	CLEANING AND INSPECTION		920.00	SR Technics Switzerland
139733	51B571-01	EASA,FAA,CAAC,ANAC			72-31-09		Package AA	26	REPLACE DAMAGED STATOR VANE REPAIR		10020.00	SR Technics Switzerland
139733	55B051-01	EASA,FAA,CAAC,ANAC			72-31-09		Package AC	28	REPLACE INDIVIDUAL INNER SHROUD SEGMENT REPAIR		7255.00	SR Technics Switzerland
139733					72-31-09		Package AE	30	BOLT HOLE FUSION WELD REPAIR		1760.00	SR Technics Switzerland
139733					72-31-09		Package AG	32	WELD OVERSIZED VANE ATTACHMENT RIVET HOLES		5690.00	SR Technics Switzerland
139733					72-31-09		Package AI	34	BENT FLANGE STRAIGHTENING REPAIR		2925.00	SR Technics Switzerland
139733					72-31-09		Package AJ	42	OUTER SHROUD PWA 36003 SILICONE RUBBER REPLACEMENT REPAIR		3410.00	SR Technics Switzerland
139733					72-31-09		Package AK	40	OUTER SHROUD SURFACE DAMAGE WELD REPAIR		1740.00	SR Technics Switzerland
139733					72-31-09		Package AL	41	FAIRING TO INNER SHROUD CRACK REPAIR		855.00	SR Technics Switzerland
139733					72-31-09		Package B	01	ANODIZE TOUCH-UP		510.00	SR Technics Switzerland
139733					72-31-09		Package Q	16	BLEND REPAIR VANES AND OUTER SHROUD		855.00	SR Technics Switzerland
139733					72-31-09		Package S	18	CRACK REPAIR LPC STAGE 1 COMPRESSOR STATOR ASSEMBLY INNER SHROUD		1545.00	SR Technics Switzerland
139733					72-31-09		Package T	19	REPLACE LPC (STAGE 1) COMPRESSOR STATOR ASSEMBLY INNER AIRSEAL		2245.00	SR Technics Switzerland
139733					72-31-09		Package V	21	FAIRING SCUFFING, FRAYING, NICKS, CHIPS AND DENTS REPAIR		2435.00	SR Technics Switzerland
139733					72-31-09		Package Y	24	REPLACE DAMAGED VANE POTTING COMPOUND REPAIR		2680.00	SR Technics Switzerland
139733					72-31-09		Package Z	25	FAIRING POTTING FILLER COMPOUND VOID AND CRACK REPAIR		2345.00	SR Technics Switzerland
139734	51D874-01	EASA,FAA,CAAC,ANAC	33	28	72-34-50	INTERMEDIATE CASE - FOURTH STAGE COMPRESSOR STATOR ASSEMB	Package A	CLN/INSP	CLEANING AND INSPECTION		780.00	SR Technics Switzerland
139734	53G174	EASA,FAA,CAAC,ANAC			72-34-50		Package B	01	TOUCH-UP PROTECTIVE COATING		560.00	SR Technics Switzerland
139734					72-34-50		Package C	02	REPLACE PIN		590.00	SR Technics Switzerland
139734					72-34-50		Package G	06	WELD THE LUGS ON THE OUTER SHROUD	REP.01 INCLUDED	1970.00	SR Technics Switzerland
139734					72-34-50		Package L	09	REPLACE VANES		2870.00	SR Technics Switzerland
139734					72-34-50		Package N	10	BLEND STATOR VANES (TITANIUM) REPAIR		685.00	SR Technics Switzerland
139734					72-34-50		Package O	11	PLASMA SPRAY INNER SHROUD		1965.00	SR Technics Switzerland
139734					72-34-50		Package Q	13	BLEND REPAIR FOR DAMAGED INNER SHROUD LUGS		685.00	SR Technics Switzerland
139734					72-34-50		Package R	14	VANE RUBBER REPAIR	SEAL INNER SHROUD VANE	1815.00	SR Technics Switzerland
139734					72-34-50		Package S	14	VANE RUBBER REPAIR	SEAL OUTER SHROUD VANE	1815.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139734					72-34-50		Package SB00	PW4G-100-72-243	REPLACEMENT OR MODIFICATION OF, TO INCORPORATE A BOLT LOCKING FEATURE		1200.00	SR Technics Switzerland
139734					72-34-50		Package T	15	BLEND THE QUETER SHROUD SURFACE DAMAGED		290.00	SR Technics Switzerland
139734					72-34-50		Package U	20	SEALANT TOUCH-UP REPAIR		2270.00	SR Technics Switzerland
139734					72-34-50		Package W	18	REMOVAL OF REMAINING CORROSION REPAIR		370.00	SR Technics Switzerland
139738	50K037	EASA,FAA,CAAC,ANAC	26	28	72-51-80	TURBINE NOZZLE - COMBUSTION CHAMBER CLAMP ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
139738	51K209-01	EASA,FAA,CAAC,ANAC			72-51-80		Package B	01	HARDFACE REPLACEMENT REPAIR		980.00	SR Technics Switzerland
139738	51K211-01	EASA,FAA,CAAC,ANAC			72-51-80		Package C	02	TAB BLEND REPAIR		505.00	SR Technics Switzerland
139738					72-51-80		Package D	03	TAB WELD REPAIR		1400.00	SR Technics Switzerland
139738					72-51-80		Package E	04	WELD JOINT CRACK WELD REPAIR		1340.00	SR Technics Switzerland
139739	50D757	EASA,FAA,CAAC,ANAC	32	35	72-33-04	FAN CASE - FAN EXIT INNER CASE ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		2320.00	SR Technics Switzerland
139739	51D627	EASA,FAA,CAAC,ANAC			72-33-04		Package AE	48	BENT SPLITTER FAIRING FLANGE REPAIR		990.00	SR Technics Switzerland
139739	51D628	EASA,FAA,CAAC,ANAC			72-33-04		Package AJ	68	CASE WALL INNER DIAMETER BLEND REPAIR		555.00	SR Technics Switzerland
139739	51D629	EASA,FAA,CAAC,ANAC			72-33-04		Package AL	69	BLEND OR REAM REAR FLANGE BOLTHOLE		555.00	SR Technics Switzerland
139739	51D703	EASA,FAA,CAAC,ANAC			72-33-04		Package AM	70	BLEND OR REAM SPLITTER FAIRING FLANGE BOLTTOLES		560.00	SR Technics Switzerland
139739	51D705	EASA,FAA,CAAC,ANAC			72-33-04		Package B	14	TOUCH UP ANODIZE		330.00	SR Technics Switzerland
139739	51D986	EASA,FAA,CAAC,ANAC			72-33-04		Package C	30	REPLACE THE FAN EXIT INNER CASE GUIDE VANE PIN RIVET AND COLLAR		1120.00	SR Technics Switzerland
139739	52D321-001	EASA,FAA,CAAC,ANAC			72-33-04		Package D	31	SCREEN REPLACEMENT		860.00	SR Technics Switzerland
139739	52D321-01	EASA,FAA,CAAC,ANAC			72-33-04		Package E	32	REPLACE RUBBER SEAL		1520.00	SR Technics Switzerland
139739	52D618-001	EASA,FAA,CAAC,ANAC			72-33-04		Package E	60	REPLACE RUBBER SEAL		1520.00	SR Technics Switzerland
139739	52D618-01	EASA,FAA,CAAC,ANAC			72-33-04		Package F	33	REPLACE LPC STATOR NUT PLATES		350.00	SR Technics Switzerland
139739	54D078-01	EASA,FAA,CAAC,ANAC			72-33-04		Package G	34	REPLACE LPC SPLITTER FAIRING NUT OPTION		330.00	SR Technics Switzerland
139739					72-33-04		Package H	35	REPLACE FRONT ANGLE GANG NUT ASSEMBLIES		540.00	SR Technics Switzerland
139739					72-33-04		Package I	36	REPLACE THE ANGLE GANG NUT ASSEMBLY NUT PLATES		540.00	SR Technics Switzerland
139739					72-33-04		Package K	41	REPLACE REAR ANGLE GANG NUT ASSEMBLIES		465.00	SR Technics Switzerland
139739					72-33-04		Package L	42	REPAIR DAMAGED FOIL ON THE FIRE ABLATIVE BLANKETS		2185.00	SR Technics Switzerland
139739					72-33-04		Package N	47	REPLACE FIRE SHIELD SEGMENT REPAIR		780.00	SR Technics Switzerland
139739					72-33-04		Package O	55	WELD DAMAGED SPLITTER FAIRING NUTPLATE BOLT OR RIVET HOLE REPAIR		1365.00	SR Technics Switzerland
139739					72-33-04		Package P	57	CUT SEAL REPAIR		570.00	SR Technics Switzerland
139739					72-33-04		Package Q	58	WELD DAMAGE ON THE VANES IN THE BLEED VALVE DUCT		990.00	SR Technics Switzerland
139739					72-33-04		Package R	59	REPAIR HEAT SHIELD BLANKET		720.00	SR Technics Switzerland
139739					72-33-04		Package S	61	BLEND REPAIR SURFACE DAMAGE		630.00	SR Technics Switzerland
139739					72-33-04		Package SB00	PW4G-100-72-164	MODIFICATION OF INNER CASE		1665.00	SR Technics Switzerland
139739					72-33-04		Package SB01	PW4G-100-72-163	FIRE SHIELD AT FAN INNR EXIT CASE, INSPECTION	PROCEDURE A	1465.00	SR Technics Switzerland
139739					72-33-04		Package SB02	PW4G-100-72-163	FIRE SHIELD AT FAN INNR EXIT CASE, INSPECTION	PROCEDURE B	4100.00	SR Technics Switzerland
139739					72-33-04		Package U	64	REPLACE HELICAL INSERTS		305.00	SR Technics Switzerland
139740	52D315-001	EASA,FAA,CAAC,ANAC	28	35	72-33-01	FAN CASE ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		925.00	SR Technics Switzerland
139740	52D315-002	EASA,FAA,CAAC,ANAC			72-33-01		Package AB	27	BLEND REPAIR		280.00	SR Technics Switzerland
139740	52D315-01	EASA,FAA,CAAC,ANAC			72-33-01		Package AC	28	RESTORE CORROSION PROTECTIVE COATING REPAIR		915.00	SR Technics Switzerland
139740	52D333-001	EASA,FAA,CAAC,ANAC			72-33-01		Package AF	31	360 DEGREE EPOXY FILLER RUBSTRIP PANEL REPAIR		40080.00	SR Technics Switzerland
139740	52D333-002	EASA,FAA,CAAC,ANAC			72-33-01		Package AI	34	ICE LINER JOINT DISBOND REPAIR		1465.00	SR Technics Switzerland
139740	52D333-01	EASA,FAA,CAAC,ANAC			72-33-01		Package AL	37	KEVLAR BELT EPOXY FILLET SEAL ADHESIVE		1695.00	SR Technics Switzerland
139740	52D523-01	EASA,FAA,CAAC,ANAC			72-33-01		Package O	14	BONDED FAN CASE LINERS LOCAL REPAIRS		2900.00	SR Technics Switzerland
139740	53D198-01	EASA,FAA,CAAC,ANAC			72-33-01		Package P	15	REPAIR FOR WEAR AND HOLES IN RUBSTRIP AS DEEP AS THE KEVLAR REINFORCED LAYER		3055.00	SR Technics Switzerland
139740	54D027-01	EASA,FAA,CAAC,ANAC			72-33-01		Package R	17	AROMATIC POLYAMIDE FIBER FABRIC PROTECTIVE COATING REPAIR		1465.00	SR Technics Switzerland
139740	55D061-01	EASA,FAA,CAAC,ANAC			72-33-01		Package SB00	PW4G-100-72-89	RUBSTRIP INSPECTION FOR WEAR AND WEAR INDICATOR HOLES		945.00	SR Technics Switzerland
139740					72-33-01		Package SB01	000913-ED01	FAN EXIT GUIDE VANES-LEADING EDGE METAL SHIELD REPLACEMENT	ED R.ESEE.000913-ED01	970.00	SR Technics Switzerland
139740					72-33-01		Package T	19	BLEND SURFACE DAMAGE REPAIR		635.00	SR Technics Switzerland
139740					72-33-01		Package V	21	PLASMA SPRAY THE REAR SNAP DIAMETER		2695.00	SR Technics Switzerland
139740					72-33-01		Package X	23	ACOUSTIC LINER SURFACE DAMAGE BLEND REPAIR		1365.00	SR Technics Switzerland
139747	51K000	EASA,FAA,CAAC,ANAC	29	28	72-51-05	TURBINE NOZZLE - INNER COMBUSTION CHAMBER ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		1200.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139747	51K100	EASA,FAA,CAAC,ANAC			72-51-05		Package AB	27	SIZE THE FRONT LINER		2370.00	SR Technics Switzerland
139747	52K200	EASA,FAA,CAAC,ANAC			72-51-05		Package AD	29	SIZE THE REAR SUPPORT		660.00	SR Technics Switzerland
139747					72-51-05		Package AE	30	STRESS RELIEVE		600.00	SR Technics Switzerland
139747					72-51-05		Package AG	32	REPLACE INNER LINER SEGMENTS		2790.00	SR Technics Switzerland
139747					72-51-05		Package AL	37	BLEND REPAIR OF CHAFING		505.00	SR Technics Switzerland
139747					72-51-05		Package AM	38	WELD REPAIR OF CHAFING OR CRACKS		835.00	SR Technics Switzerland
139747					72-51-05		Package AN	39	NUT PLATE CLEARANCE HOLES AND RIVET HOLES WELD REPAIR		2705.00	SR Technics Switzerland
139747					72-51-05		Package AN	39	TWO LUG NUT PLATE REPLACEMENT REPAIR		2705.00	SR Technics Switzerland
139747					72-51-05		Package C	02	HARDFACE SUPPORT MATING FACE REPAIR		1985.00	SR Technics Switzerland
139747					72-51-05		Package E	20	FRONT LINER HARDFACE REPAIR		1370.00	SR Technics Switzerland
139747					72-51-05		Package K	21	CRACK WELD REPAIR COMBUSTION CHAMBER ASSEMBLY REAR SUPPORT PLATE		2825.00	SR Technics Switzerland
139747					72-51-05		Package Z	25	REPLACE INNER LINER SEGMENTS		3595.00	SR Technics Switzerland
139749	510998-001	EASA,FAA,CAAC,ANAC	27	28	72-33-08	FAN CASE - BLEED VALVE DUCT ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		1305.00	SR Technics Switzerland
139749	53D062-01	EASA,FAA,CAAC,ANAC			72-33-08		Package AE	03	REPLACE A RIVETED BEARING PAD BEFORE INSTALLATION		1580.00	SR Technics Switzerland
139749	53D539-01	EASA,FAA,CAAC,ANAC			72-33-08		Package B	01	TOUCH UP ANODIZE		480.00	SR Technics Switzerland
139749					72-33-08		Package C	02	INSTALL NEW RUBBER SEAL		1655.00	SR Technics Switzerland
139749					72-33-08		Package C	02	REPLACE RUBBER SEAL		1655.00	SR Technics Switzerland
139749					72-33-08		Package D	03	REPLACE A RIVETED BEARING PAD AFTER INSTALLATION		1935.00	SR Technics Switzerland
139749					72-33-08		Package F	05	WELD THE CAM SLOTS		1365.00	SR Technics Switzerland
139749					72-33-08		Package G	06	INSTALL HELICAL TWINSETS		510.00	SR Technics Switzerland
139749					72-33-08		Package G	06	REPLACE HELICAL INSERTS		510.00	SR Technics Switzerland
139749					72-33-08		Package I	08	INSTALL NEW INSULATION BLANKETS		650.00	SR Technics Switzerland
139749					72-33-08		Package I	08	REPLACE DAMAGED INSULATION BLANKETS		650.00	SR Technics Switzerland
139749					72-33-08		Package J	09	REPAIR DAMAGED INSULATION BLANKETS		565.00	SR Technics Switzerland
139749					72-33-08		Package K	10	REPLACE ANTIGALLANT COMPOUND REPAIR		495.00	SR Technics Switzerland
139749					72-33-08		Package L	11	BLEND REPAIR		650.00	SR Technics Switzerland
139749					72-33-08		Package M	12	CAM SLOT TAB OUTSIDE DIAMETER REPAIR		3905.00	SR Technics Switzerland
139749					72-33-08		Package N	13	REPLACE LINER REPAIR		1230.00	SR Technics Switzerland
139749					72-33-08		Package O	14	WELD A CRACKED OR OVERSIZED CAM SLOT LINER RIVET HOLE		1945.00	SR Technics Switzerland
139749					72-33-08		Package P	15	WELD AN OVERSIZED BEARING PAD RIVET HOLE		2720.00	SR Technics Switzerland
139749					72-33-08		Package Q	16	REPAIR DAMAGED FOIL ON THE FIRE ABLATIVE BLANKETS		1240.00	SR Technics Switzerland
139749					72-33-08		Package Q	17	REPAIR DAMAGED FOIL ON THE FIRE ABLATIVE BLANKETS		1240.00	SR Technics Switzerland
139749					72-33-08		Package SB00	PW4G-100-72-67	REPLACEMENT OF OR MODIFICATION OF THE BEARING PADS		3290.00	SR Technics Switzerland
139749					72-33-08		Package SB01	PW4G-100-72-112	SLOT LINER MODIFICATION		2625.00	SR Technics Switzerland
139750	52J200	EASA,FAA,CAAC,ANAC	35	28	72-41-11	DIFFUSER AND COMBUSTOR - OUTER COMBUSTION CHAMBER ASSEM	Package A	CLN/INSP	CLEANING AND INSPECTION		3165.00	SR Technics Switzerland
139750	52J200-001	EASA,FAA,CAAC,ANAC			72-41-11		Package AA	26	WELD REPAIR WEAR ON BULKHEAD FRONT FACE		3330.00	SR Technics Switzerland
139750	54J200	EASA,FAA,CAAC,ANAC			72-41-11		Package AC	37	STRESS-RELIEF CYCLE FOR OUTER COMBUSTION CHAMBER ASSEMBLY		1645.00	SR Technics Switzerland
139750	54J300	EASA,FAA,CAAC,ANAC			72-41-11		Package AG	41	PLASMA COAT BUILD-UP REPAIR		1830.00	SR Technics Switzerland
139750	54J300-001	EASA,FAA,CAAC,ANAC			72-41-11		Package AI	64	COMBUSTION CHAMBER DOME DAMAGE WELD REPAIR		1310.00	SR Technics Switzerland
139750					72-41-11		Package AJ	35	RADIAL SHRINKAGE ON DOME SNAP DIAMETER REPAIR		1080.00	SR Technics Switzerland
139750					72-41-11		Package AM	71	REAR SHELL STIFFENER WELD REPAIR		1255.00	SR Technics Switzerland
139750					72-41-11		Package AN	73	REAR STIFFENER WELD REPAIR		1575.00	SR Technics Switzerland
139750					72-41-11		Package D	03	REPLACE THE HARDFACE ON THE SNAP DIAMETER REPAIR		785.00	SR Technics Switzerland
139750					72-41-11		Package E	36	REPLACE HARDFACE ON REAR STIFFENER REPAIR		670.00	SR Technics Switzerland
139750					72-41-11		Package F	05	BULKHEAD CRACK WELD REPAIR		3850.00	SR Technics Switzerland
139750					72-41-11		Package G	06	BULKHEAD CRACK PATCH REPAIR		5435.00	SR Technics Switzerland
139750					72-41-11		Package H	07	MOUNT LUG BUSHING REPLACEMENT		1065.00	SR Technics Switzerland
139750					72-41-11		Package O	39	REPLACE IGNITER GUIDE ASSEMBLY		1620.00	SR Technics Switzerland
139750					72-41-11		Package P	40	RESIZE REAR STIFFENER PLASMA REPAIR		670.00	SR Technics Switzerland
139750					72-41-11		Package Q	38	REPLACE LINER SEGMENTS		6995.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139750					72-41-11		Package SB00	PW4G-100-72-74	MODIFICATION OF TO INCORPORATE A SPARK IGNITER GUIDE WITH ANTI-ROTATION FEATURE		615.00	SR Technics Switzerland
139750					72-41-11		Package SB01	PW4G-100-72-253	REPLACEMENT OF, WITH WASPALOY NUTS TO REDUCE NUT LIBERATION		4630.00	SR Technics Switzerland
139750					72-41-11		Package W	22	REPLACE BULKHEAD HARDFACE REPAIR		600.00	SR Technics Switzerland
139750					72-41-11		Package X	23	REPLACE ONE NOZZLE STATOR AND POSITIONING RINGS		2590.00	SR Technics Switzerland
139750					72-41-11		Package Y	24	REPAIR FUEL NOZZLE GUIDE RIVET HOLE		2900.00	SR Technics Switzerland
139750					72-41-11		Package Z	25	WELD THE MOUNT LUGS		3035.00	SR Technics Switzerland
139751	56T081	EASA,FAA,CAAC,ANAC	24	21	71-21-13	FWD ENGINE MOUNT - THRUST LINK BEAM ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		330.00	SR Technics Switzerland
139751	59T795	EASA,FAA,CAAC,ANAC			71-21-13		Package B	01	BLEND THE SURFACE DAMAGE		350.00	SR Technics Switzerland
139751					71-21-13		Package C	02	OVERSIZE BUSHING REPAIR		3710.00	SR Technics Switzerland
139752	51D653-001	EASA,FAA,CAAC,ANAC	44	28	72-34-01	INTERMEDIATE CASE - COMPRESSOR INTERMEDIATE CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1185.00	SR Technics Switzerland
139752	51D653-003	EASA,FAA,CAAC,ANAC			72-34-01		Package AA	112	REPLACE THE FAN EXIT CASE MID FLANGE BRACKETS		1565.00	SR Technics Switzerland
139752	51D653-004	EASA,FAA,CAAC,ANAC			72-34-01		Package AA	67	BAFFLE REPLACEMENT REPAIR		1565.00	SR Technics Switzerland
139752	51D653-01	EASA,FAA,CAAC,ANAC			72-34-01		Package AA	68	REPLACE THE FRONT FAN EXIT CASE BRACKET ASSEMBLIES		1565.00	SR Technics Switzerland
139752	51D653-201	EASA,FAA,CAAC,ANAC			72-34-01		Package AA	70	REPLACE THE CENTER FAN EXIT CASE BRACKET ASSEMBLIES		1565.00	SR Technics Switzerland
139752	52D348-001	EASA,FAA,CAAC,ANAC			72-34-01		Package AB	69	REPLACE THE BIFURCATION FAIRING TOP CENTER BRACKET ASSEMBLY		305.00	SR Technics Switzerland
139752	52D348-002	EASA,FAA,CAAC,ANAC			72-34-01		Package AC	71	REPLACE THE REAR FAN EXIT CASE BRACKET ASSEMBLIES		570.00	SR Technics Switzerland
139752	52D348-003	EASA,FAA,CAAC,ANAC			72-34-01		Package AD	73	REPLACE THE THRUST MOUNT BUSHINGS		2890.00	SR Technics Switzerland
139752	52D348-004	EASA,FAA,CAAC,ANAC			72-34-01		Package AE	74	REPLACE NUT PLATES, INNER LINER SEGMENT CONNECTION		1380.00	SR Technics Switzerland
139752	52D348-005	EASA,FAA,CAAC,ANAC			72-34-01		Package AF	75	REPLACE THE BIFURCATION FAIRING MOUNT BRACKETS		665.00	SR Technics Switzerland
139752	52D348-006	EASA,FAA,CAAC,ANAC			72-34-01		Package AG	83	FAN EXIT CASE SURFACE DAMAGE BLEND REPAIR		570.00	SR Technics Switzerland
139752	52D348-01	EASA,FAA,CAAC,ANAC			72-34-01		Package AH	90	COMPRESSOR INTERMEDIATE CASE FLANGE ASSEMBLY PROTECTION LAYER TOUCH UP REPAIR		1465.00	SR Technics Switzerland
139752	52D348-010	EASA,FAA,CAAC,ANAC			72-34-01		Package AH	91	COMPRESSOR INTERMEDIATE CASE FLANGE ASSEMBLY NUT PLATE REPLACEMENT		1465.00	SR Technics Switzerland
139752	52D348-101	EASA,FAA,CAAC,ANAC			72-34-01		Package AH	92	COMPRESSOR INTERMEDIATE CASE FLANGE ASSEMBLY ANTIGALLANT COMPOUND REPLACEMENT		1465.00	SR Technics Switzerland
139752	52D348-201	EASA,FAA,CAAC,ANAC			72-34-01		Package AI	107	REPLACE HELICAL COIL INSERTS IN BOSSES WITH INSERTS		480.00	SR Technics Switzerland
139752	52D348-401	EASA,FAA,CAAC,ANAC			72-34-01		Package AI	116	REPLACE HELICAL COIL INSERTS		540.00	SR Technics Switzerland
139752	52D348-501	EASA,FAA,CAAC,ANAC			72-34-01		Package AK	140	BLEND REPAIR BRG 2 ALIGNMENT PIN HOLE		85.00	SR Technics Switzerland
139752	54D028-01	EASA,FAA,CAAC,ANAC			72-34-01		Package AL	SPM 70-11-00	ADD ENGINE SERIAL NUMBER ACC. SPM 70-11-00 GENERAL-01		160.00	SR Technics Switzerland
139752					72-34-01		Package AM	115	REPLACE THE FAN EXIT CASE FRONT BRACKETS		1550.00	SR Technics Switzerland
139752					72-34-01		Package B	20	BLEND THE SURFACE DAMAGE		1240.00	SR Technics Switzerland
139752					72-34-01		Package C	33	WELD CRACKED STRUTS		8155.00	SR Technics Switzerland
139752					72-34-01		Package C	34	REPLACE A FAIRING WITH RIVETS ALL AROUND WITH A FAIRING WITHOUT INITIAL RIVET HOLES		8155.00	SR Technics Switzerland
139752					72-34-01		Package D	23	REPLACE FOURTH STATOR MOUNTING FLANGE HELICAL COIL INSERTS		1380.00	SR Technics Switzerland
139752					72-34-01		Package E	24	REPLACE HELICAL COIL INSERTS AT 2, 4, AND 8 O'CLOCK POSITIONS		935.00	SR Technics Switzerland
139752					72-34-01		Package F	32	MACHINE THE FRONT MOUNT INNER SURFACES		380.00	SR Technics Switzerland
139752					72-34-01		Package G	31	CRACKS/DAMAGE WELD REPAIR		2535.00	SR Technics Switzerland
139752					72-34-01		Package I	43	WELD THE WEAR ON THE INLET GUIDE VANE MATING FACE		3510.00	SR Technics Switzerland
139752					72-34-01		Package J	SPM 70-43-00	REPLACE RIVETS ACC. SPM 70-43-00		455.00	SR Technics Switzerland
139752					72-34-01		Package J	SPM 70-48-00	REPLACE PROTECTIVE SHIELD ACC. SPM 70-48-00		455.00	SR Technics Switzerland
139752					72-34-01		Package K	44	BLEND SURFACE DAMAGE ON THE FAN EXIT CASE FLANGE ASSEMBLY		1370.00	SR Technics Switzerland
139752					72-34-01		Package N	54	REPAIR THE THREADED HOLES IN GROUND HANDLING PADS		1340.00	SR Technics Switzerland
139752					72-34-01		Package O	55	SEALANT REPAIR		4250.00	SR Technics Switzerland
139752					72-34-01		Package P	56	REPLACE E FLANGE SCREW THREAD INSERTS (HELICAL COIL)		715.00	SR Technics Switzerland
139752					72-34-01		Package Q	57	REPLACE INNER FAN EXIT CASE MOUNTING FLANGE SCREW THREAD INSERTS (HELICAL COIL)		715.00	SR Technics Switzerland
139752					72-34-01		Package R	58	REPAIR THREADED BOSS HOLES OR REPLACE BOSS HOLE SCREW THREAD INSERTS		6145.00	SR Technics Switzerland
139752					72-34-01		Package S	59	REPLACE 2.5 BLEED VALVE DUCT FLANGE SCREW THREAD INSERTS		715.00	SR Technics Switzerland
139752					72-34-01		Package SB00	AD 2000-16-02	FWD ENGINE MOUNT - VISUAL INSPECTION		505.00	SR Technics Switzerland
139752					72-34-01		Package SB01	PW4G-100-72-017	REPLACEMENT WITH ASYMMETRIC VANE PATTERN		2625.00	SR Technics Switzerland
139752					72-34-01		Package SB02	PW4G-100-72-110	INSPECTION OF FRONT ENGINE MOUNT RECESS FIT AND MACHINING TO CORRECT IF REQUIRED		1125.00	SR Technics Switzerland
139752					72-34-01		Package SB04	PW4G-100-72-173	INSPECTION OF FAN EXIT CASE REAR, REAR BRACKET ASSEMBLY ATTACHMENT FOR LOOSE OR MISSING RIVETS		6230.00	SR Technics Switzerland
139752					72-34-01		Package SB05	PW4G-100-72-174	REPL. OF FAN EXIT CASE OUTSIDE DIA BRACKET ASSEM. WITH REDES. ATTACHMENT FOR IMPROVED DURABILITY		4375.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139752					72-34-01		Package SB06	PW4G-100-72-178	REPLACE THE INTERMEDIATE CASE, FECR FRONT, REAR AND MIDDLE BR PART A		4305.00	SR Technics Switzerland
139752					72-34-01		Package SB06	PW4G-100-72-178	REPLACE THE INTERMEDIATE, FECR OD LINDER SEGMENTS AND INSTALL PART B		4305.00	SR Technics Switzerland
139752					72-34-01		Package SB07	PW4G-100-72-204	FAIRINGS, ALUMINUM STRUT, COMPRESSOR INTERMEDIATE CASE ASSEMBLY - IMPROVED ATTACHMENT		2470.00	SR Technics Switzerland
139752					72-34-01		Package SB08	PW4G-100-72-196	INSPECTION OF STRUT FAIRINGS FOR MISSING OR LOOSE RIVETS		985.00	SR Technics Switzerland
139752					72-34-01		Package T	60	REPLACE NO. 1 BEARING SUPPORT FLANGE SCREW THREAD INSERTS		715.00	SR Technics Switzerland
139752					72-34-01		Package U	61	REPLACE SCREW THREAD INSERTS AT STRUT LOCATION NO. 2 AND 3		715.00	SR Technics Switzerland
139752					72-34-01		Package V	62	REPLACE THE PROTECTIVE LAYER		2665.00	SR Technics Switzerland
139752					72-34-01		Package W	41	APPLY ANODIZE TOUCH-UP SOLUTION		715.00	SR Technics Switzerland
139752					72-34-01		Package W	63	APPLY ANODIZE TOUCH-UP SOLUTION		715.00	SR Technics Switzerland
139752					72-34-01		Package X	64	REPLACE STRUT SEALANT		2665.00	SR Technics Switzerland
139752					72-34-01		Package Y	65	REPLACE THE TIMING PIN		1155.00	SR Technics Switzerland
139752					72-34-01		Package Z	66	REPAIR THE SEALANT AROUND THE BAFFLES		865.00	SR Technics Switzerland
139755	508322	EASA,FAA,CAAC,ANAC	21	28	72-31-04	LOW PRESSURE COMPRESSOR (LPC) - STAGE 2 LPC BLADE - 100"	Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
139756	508323	EASA,FAA,CAAC,ANAC	25	28	72-31-05	LOW PRESSURE COMPRESSOR (LPC) - STAGE 3 LPC BLADE - 100"	Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
139756					72-31-05		Package SB00	EO 520295	INSPECT BLADE ROOT	ONLY AFTER EO-520294 ON BLADED DRUM	75.00	SR Technics Switzerland
139757	508424	EASA,FAA,CAAC,ANAC	20	28	72-31-06	LOW PRESSURE COMPRESSOR (LPC) - STAGE 4 LPC BLADE - 100"	Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
139758	508862	EASA,FAA,CAAC,ANAC	23	28	72-31-21	LOW PRESSURE COMPRESSOR (LPC) - INSERT - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		70.00	SR Technics Switzerland
139758					72-31-21		Package B	01	BLEND REPAIR		80.00	SR Technics Switzerland
139758					72-31-21		Package C	02	REPLACE SILICONE RUBBER SEAL		135.00	SR Technics Switzerland
139759	508043	EASA,FAA,CAAC,ANAC	27	28	72-31-12	LOW PRESSURE COMPRESSOR (LPC) - (DRUM TO HUB) TIEROD	Package A	CLN/INSP	CLEANING AND INSPECTION		95.00	SR Technics Switzerland
139759	508880	EASA,FAA,CAAC,ANAC			72-31-12		Package B	01	RESTORE ANTIGALLANT		85.00	SR Technics Switzerland
139759	538023	EASA,FAA,CAAC,ANAC			72-31-12		Package B	02	RESTORE ANTIGALLANT		85.00	SR Technics Switzerland
139760	508882-01	EASA,FAA,CAAC,ANAC,CAA UK	16	28	72-31-08	LOW PRESSURE COMPRESSOR (LPC) - DRUM ROTOR DISK ASSEMBLY -	Package A	CLN/INSP	CLEANING AND INSPECTION		1385.00	SR Technics Switzerland
139760					72-31-08		Package B	01	STRAIGHTEN KNIFE-EDGE SEAL		1275.00	SR Technics Switzerland
139760					72-31-08		Package C	02	BLEND REPAIR KNIFE EDGE SEAL		945.00	SR Technics Switzerland
139760					72-31-08		Package D	03	SURFACE DAMAGE BLEND REPAIR		2095.00	SR Technics Switzerland
139760					72-31-08		Package E	04	BLEND REPAIR BALANCE FLANGE		890.00	SR Technics Switzerland
139760					72-31-08		Package H	07	PLASMA SPRAY FRONT SNAP DIAMETER		4810.00	SR Technics Switzerland
139760					72-31-08		Package I	08	TIEROD HOLES REPAIR		3415.00	SR Technics Switzerland
139760					72-31-08		Package J	09	SHOTPEEN DRUM ROTOR DISK SLOTS		3810.00	SR Technics Switzerland
139760					72-31-08		Package L	11	BALANCE COUNTERWEIGHT REMOVAL AND INSTALLATION REPAIR		550.00	SR Technics Switzerland
139760					72-31-08		Package SB00	72-EO-520295	LPC, 3RD STG BLADES: INSP. BLADE ROOT		330.00	SR Technics Switzerland
139761	508936	EASA,FAA,CAAC,ANAC	23	28	72-31-03	LOW PRESSURE COMPRESSOR (LPC) - STAGE 1.6 LPC BLADE - 100"	Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
139762	501764	EASA,FAA,CAAC,ANAC	29	28	72-41-08	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (FRONT) SEAL RING HOL	Package A	CLN/INSP	CLEANING AND INSPECTION		600.00	SR Technics Switzerland
139762	501764-001	EASA,FAA,CAAC,ANAC			72-41-08		Package F	05	REPLACE RETAINING PIN(S)		1065.00	SR Technics Switzerland
139762	501764-001P10	EASA,FAA,CAAC,ANAC			72-41-08		Package G	06	SMOOTH OUT DAMAGE TO THREADS		535.00	SR Technics Switzerland
139762	501764-001P15	EASA,FAA,CAAC,ANAC			72-41-08		Package I	08	REPAIR THREADED HOLES - HELICAL COIL REPLACEMENT		765.00	SR Technics Switzerland
139762	501764-001P20	EASA,FAA,CAAC,ANAC			72-41-08		Package K	10	CLINCH NUT REPLACEMENT		810.00	SR Technics Switzerland
139762	501764-001P5	EASA,FAA,CAAC,ANAC			72-41-08		Package S	18	BLEND SURFACE DAMAGE		795.00	SR Technics Switzerland
139762	501764P5	EASA,FAA,CAAC,ANAC			72-41-08		Package SB00	72-216526	INSPECTION OF NO. 3 BRG COMPRESSOR FRONT SUMP THIN WALL		600.00	SR Technics Switzerland
139764	50N322-01	EASA,FAA,CAAC,ANAC	24	28	72-53-71	LOW PRESSURE TURBINE (LPT) - TURBINE CASE (STAGE 6 AIRSEALING F	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
139764	50N565-01	EASA,FAA,CAAC,ANAC			72-53-71		Package B	01	DAMAGE AREA PATCH REPAIR		610.00	SR Technics Switzerland
139765	50N886	EASA,FAA,CAAC,ANAC,CAA UK	26	28	72-53-16	LOW PRESSURE TURBINE (LPT) - STAGE 6 LPT DISK ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		1250.00	SR Technics Switzerland
139765	51N706	EASA,FAA,CAAC,ANAC			72-53-16		Package B	01	KNIFE-EDGE SEALS BLEND REPAIR		520.00	SR Technics Switzerland
139765					72-53-16		Package C	02	SURFACE DAMAGE BLEND REPAIR		910.00	SR Technics Switzerland
139765					72-53-16		Package J	09	FRONT FLANGE FACE PLASMA SPRAY REPAIR		4925.00	SR Technics Switzerland
139765					72-53-16		Package K	10	FRONT DIAMETER PLASMA SPRAY		3120.00	SR Technics Switzerland
139765					72-53-16		Package M	12	REAR FLANGE FACE PLASMA SPRAY REPAIR		3510.00	SR Technics Switzerland
139765					72-53-16		Package N	13	REAR DIAMETER PLASMA SPRAY REPAIR		3025.00	SR Technics Switzerland
139765					72-53-16		Package P	15	SHOTPEEN REPAIR		610.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139765					72-53-16		Package S	18	RESTORE KNIFE EDGE SEAL PLASMA COATING		4775.00	SR Technics Switzerland
139765					72-53-16		Package SB00	AD 2005-25-09	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	425.00	SR Technics Switzerland
139765					72-53-16		Package SB01	PW4G-100-72-252	LPT, INSPECT FOR AD AFFECTED TGD's	AD FAA 2015-21-04	480.00	SR Technics Switzerland
139778	51N249-01	EASA,FAA,CAAC,ANAC	30	28	72-53-67	LOW PRESSURE TURBINE (LPT) - STAGE 7 LPT CASE ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		475.00	SR Technics Switzerland
139778					72-53-67		Package B	01	REPLACE THE REAR FLANGE LOCATING PIN		1005.00	SR Technics Switzerland
139778					72-53-67		Package D	03	PLASMA SPRAY REPAIR FRONT FLANGE SNAP DIAMETER		2405.00	SR Technics Switzerland
139778					72-53-67		Package E	04	PLASMA SPRAY REPAIR REAR SNAP DIAMETER		2405.00	SR Technics Switzerland
139778					72-53-67		Package G	06	WELD REPAIR VANE ANTI-ROTATION SLOT		3480.00	SR Technics Switzerland
139778					72-53-67		Package H	07	PLASMA SPRAY REPAIR VANE REAR OD PLATFORM MATING SURFACE		2605.00	SR Technics Switzerland
139778					72-53-67		Package I	08	PLASMA SPRAY REPAIR THE VANE REAR PLATFORM MATING FACE		2605.00	SR Technics Switzerland
139778					72-53-67		Package J	09	SURFACE DAMAGE BLEND REPAIR		905.00	SR Technics Switzerland
139778					72-53-67		Package J	10	ANTIROTATION SLOT FILLET RADIII CRACK BLEND REPAIR		905.00	SR Technics Switzerland
139778					72-53-67		Package L	11	ANTIROTATION SLOT FILLET RADIII CRACK WELD REPAIR		3305.00	SR Technics Switzerland
139780	51N418-01	EASA,FAA,CAAC,ANAC	2	28	72-53-70	PW4 STG 7 LPT (OUTER) AIRSEALING RING 5	Package A	CLN/INSP	CLEANING & INSPECTION		70.00	SR Technics Switzerland
139782	51N348-01	EASA,FAA,CAAC,ANAC	31	35	72-53-17	LOW PRESSURE TURBINE (LPT) - LOW PRESSURE TURBINE - REAR TURB	Package A	CLN/INSP	CLEANING AND INSPECTION		1890.00	SR Technics Switzerland
139782	51N548-01	EASA,FAA,CAAC,ANAC			72-53-17		Package AA	26	REPLACE RIVETED - ON ANGLED BRACKET (POST SB PW4ENG 72-336)		590.00	SR Technics Switzerland
139782					72-53-17		Package AC	39	MACHINE REPAIR VANE ANTI- ROTATION SLOTS TO REMOVE CRACKS (STAGE 3 AND STAGE 4)		5800.00	SR Technics Switzerland
139782					72-53-17		Package AD	29	STAGE 3 VANE REAR SUPPOT LIP MATING SURFACE PLASMA COAT REPAIR		5830.00	SR Technics Switzerland
139782					72-53-17		Package AE	30	STAGE 4 VANE REAR SUPPOT LIP MATING SURFACE PLASMA COAT REPAIR		5830.00	SR Technics Switzerland
139782					72-53-17		Package AF	31	STAGE 5 VANE REAR SUPPOT LIP MATING SURFACE PLASMA COAT REPAIR		5830.00	SR Technics Switzerland
139782					72-53-17		Package AG	32	STAGE 6 VANE REAR SUPPOT LIP MATING SURFACE PLASMA COAT REPAIR		5830.00	SR Technics Switzerland
139782					72-53-17		Package AH	33	STAGE 3 VANE HOOK INNER DIAMETER PLASMA COAT REPAIR		12620.00	SR Technics Switzerland
139782					72-53-17		Package AK	36	PLASMA SPRAY REPAIR FRONT FLANGE FACE (WITHOUT BRACKET)		3005.00	SR Technics Switzerland
139782					72-53-17		Package AL	75	CRACK BLEND REPAIR STG. 3-6		570.00	SR Technics Switzerland
139782					72-53-17		Package AM	38	REAR FLANGE BRACKET REPLACEMENT REPAIR		455.00	SR Technics Switzerland
139782					72-53-17		Package AN	69	PLASMA REPAIR STG.4 VANE HOOK INN		2980.00	SR Technics Switzerland
139782					72-53-17		Package B	01	REPLACE FRONT FLANGE LOCATING PIN		855.00	SR Technics Switzerland
139782					72-53-17		Package C	02	REPLACE REAR FLANGE LOCATING PIN		1105.00	SR Technics Switzerland
139782					72-53-17		Package D	03	REPAIR FRONT AND REAR FLANGE THREADS WITH HELICAL COIL INSERTS		580.00	SR Technics Switzerland
139782					72-53-17		Package F	05	SURFACE DAMAGE BLEND REPAIR		1695.00	SR Technics Switzerland
139782					72-53-17		Package G	06	STAGE 2 HPT SEAL MATING SURFACE PLASMA COAT REPAIR		3440.00	SR Technics Switzerland
139782					72-53-17		Package H	37	PLASMA SPRAY REPAIR REAR FLANGE FACE (WITH BRACKET)		3350.00	SR Technics Switzerland
139782					72-53-17		Package I	08	PLASMA SPRAY REPAIR FRONT FLANGE SNAP DIAMETER		3400.00	SR Technics Switzerland
139782					72-53-17		Package J	09	PLASMA SPRAY REPAIR REAR FLANGE SNAP DIAMETER		3155.00	SR Technics Switzerland
139782					72-53-17		Package SB03		SPECIAL INSTRUCTION (SI) NO. 224-F18 FPI ON LPT FRONT FLANGE		465.00	SR Technics Switzerland
139782					72-53-17		Package SB03	AD 2012-14-09	AD FAA-2012-14-09.00 / DIM. INSPECTION		465.00	SR Technics Switzerland
139782					72-53-17		Package SB03	PW4G-100-A72-262 / DIMENSIONAL INSPECTION		465.00	SR Technics Switzerland	
139782					72-53-17		Package SB05	AD 2021-05-16	REMOVE LPT 4TH STAGE AIR SEAL RING SEGMENT ASSEMBLYDIMENSIONAL INSPECTION		465.00	SR Technics Switzerland
139782					72-53-17		Package T	19	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 3)		4860.00	SR Technics Switzerland
139782					72-53-17		Package U	20	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 4)		3820.00	SR Technics Switzerland
139782					72-53-17		Package V	21	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 5)		3820.00	SR Technics Switzerland
139782					72-53-17		Package W	22	VANE REAR OUTER DIAMETER PLATFORM MATING SURFACE PLASMA COAT REPAIR (STAGE 6)		3820.00	SR Technics Switzerland
139782					72-53-17		Package X	44	REPAIR THE FORWARD INNER RAIL CRACKS BY STOP DRILLING		7170.00	SR Technics Switzerland
139782					72-53-17		Package Z	25	REPLACE LPT BORESCOPE BOSS		780.00	SR Technics Switzerland
139784	52B313	EASA,FAA,CAAC,ANAC	26	28	72-31-02	LOW PRESSURE COMPRESSOR (LPC) - STAGE 1.3 LPC BLADE - 100"	Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
139785	53B013-001	EASA,FAA,CAAC,ANAC	30	28	72-31-20	LOW PRESSURE COMPRESSOR (LPC) - STAGE 1.3 COMPRESSOR STATOF	Package A	CLN/INSP	CLEANING AND INSPECTION		745.00	SR Technics Switzerland
139785	53B013-01	EASA,FAA,CAAC,ANAC			72-31-20		Package B	01	ANODIZE TOUCH-UP		765.00	SR Technics Switzerland
139785	54B613-001	EASA,FAA,CAAC,ANAC			72-31-20		Package C	02	BLEND REPAIR VANES AND OUTER SHROUD		1515.00	SR Technics Switzerland
139785	54B613-01	EASA,FAA,CAAC,ANAC			72-31-20		Package D	03	CRACK REPAIR LPC STAGE 1.3 COMPRESSOR STATOR ASSEMBLY INNER SHROUD		465.00	SR Technics Switzerland
139785	56B713-01	EASA,FAA,CAAC,ANAC			72-31-20		Package E	04	SILICONE RUBBER INNER AIRSEAL REPAIR		4820.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139785					72-31-20		Package F	05	SILICONE RUBBER OUTER AIRSEAL REPAIR		4965.00	SR Technics Switzerland
139785					72-31-20		Package G	06	ALUMINUM BAND REPLACEMENT FOR INNER SHROUD		1465.00	SR Technics Switzerland
139785					72-31-20		Package J	09	INNER OR OUTER SIDE SEALANT OUTER SHROUD		7270.00	SR Technics Switzerland
139785					72-31-20		Package L	11	REPLACE DAMAGED VANE POTTING COMPOUND REPAIR		2230.00	SR Technics Switzerland
139785					72-31-20		Package M	12	BOLT HOLE FUSION WELD REPAIR		1400.00	SR Technics Switzerland
139785					72-31-20		Package N	13	RIVET HOLES WELD		5550.00	SR Technics Switzerland
139785					72-31-20		Package P	15	BENT FLANGE STRAIGHTENING		4020.00	SR Technics Switzerland
139785					72-31-20		Package R	17	INNER SHROUD REPLACEMENT REPAIR		4435.00	SR Technics Switzerland
139785					72-31-20		Package S	18	SILICONE RUBBER INNER AIRSEAL REPAIR		3570.00	SR Technics Switzerland
139785					72-31-20		Package SB00	PW4G-100-72-119	REPLACEMENT OR MODIFICATION OF LPC STATOR ASSY 1.6 - 3 STG 1.3 & 4.TH STG DUCT RUBBER		10075.00	SR Technics Switzerland
139785					72-31-20		Package SB01	PW4G-100-72-189	REPLACEMENT OR MODIFICATION TO INCORPORATE IMPROVED INNER SHROUD RUBSTRIPS		8395.00	SR Technics Switzerland
139785					72-31-20		Package T	09	VANE REPLACEMENT		3020.00	SR Technics Switzerland
139815	50H940	EASA,FAA,CAAC,ANAC	23	28	72-35-99	HIGH PRESSURE COMPRESSOR (HPC) - MISCELLANEOUS PARTS	Package A	CLN/INSP	CLEANING & INSPECTION		185.00	SR Technics Switzerland
139815	53H624-01	EASA,FAA,CAAC,ANAC			72-35-99		Package B	01	REPLACE RUNNER ASSEMBLY	PW100INCH	315.00	SR Technics Switzerland
139815	54H923-01	EASA,FAA,CAAC,ANAC			72-35-99		Package C	02	REPLACE PIN DETAIL	PW100INCH	300.00	SR Technics Switzerland
139815	58H369	EASA,FAA,CAAC,ANAC			72-35-99		Package D	03	REPLACE RUNNER DETAIL	PW94INCH / PW100INCH	315.00	SR Technics Switzerland
139822	50S060-01	EASA,FAA,CAAC,ANAC	41	28	72-35-69	HIGH PRESSURE COMPRESSOR (HPC) - HPC OUTER REAR CASE ASSEMB	Package A	CLN/INSP	CLEANING AND INSPECTION		1355.00	SR Technics Switzerland
139822	50S061	EASA,FAA,CAAC,ANAC			72-35-69		Package AA	48	REAR SNAP DIAMETER PLASMA COAT REPAIR		4390.00	SR Technics Switzerland
139822	55H203-01	EASA,FAA,CAAC,ANAC			72-35-69		Package AE	52	REAR W SEAL SHOULDER PLASMA COAT OR DUAL WIRE ELECTRIC ARC COAT REPAIR		5280.00	SR Technics Switzerland
139822	56H397-01	EASA,FAA,CAAC,ANAC			72-35-69		Package AF	53	STAGE 9 W SEAL SHOULDER PLASMA COAT REPAIR		4995.00	SR Technics Switzerland
139822					72-35-69		Package AI	56	SURFACE DAMAGE BLEND REPAIR		1455.00	SR Technics Switzerland
139822					72-35-69		Package AL	71	INSERT REPLACEMENT REPAIR		2025.00	SR Technics Switzerland
139822					72-35-69		Package AM	54	INNER REAR FLANGE NUT PLATE AND GANG NUT CHANNEL REPLACEMENT REPAIR		1380.00	SR Technics Switzerland
139822					72-35-69		Package AN	72	REAR SUPPORT REPLACEMENT REPAIR		2425.00	SR Technics Switzerland
139822					72-35-69		Package C	17	WELD REPAIR INNER FLANGE BOLT HOLE CRACKS		3120.00	SR Technics Switzerland
139822					72-35-69		Package D	22	REPLACE HELICAL COIL INSERTS		785.00	SR Technics Switzerland
139822					72-35-69		Package E	23	REPLACE HARDFACE ON 8/9TH STG STATOR BEARING SURFACE		5460.00	SR Technics Switzerland
139822					72-35-69		Package F	24	PLASMA SPRAY REP REAR FLANGE FACE		4795.00	SR Technics Switzerland
139822					72-35-69		Package G	25	PLASMA SPRAY REP FRONT FLANGE FACE		4795.00	SR Technics Switzerland
139822					72-35-69		Package H	26	PLASMA SPRAY REP REAR SNAP DIAMETER		4795.00	SR Technics Switzerland
139822					72-35-69		Package I	27	PLASMA SPRAY REP FRONT "W" SEAL SHOULDER		4795.00	SR Technics Switzerland
139822					72-35-69		Package J	28	PLASMA SPRAY 9/10TH FRONT SUPPORT OUTER SNAP DIAMETER		4795.00	SR Technics Switzerland
139822					72-35-69		Package K	29	PLASMA SPRAY 9/10TH FRONT SUPPORT INNER SNAP DIAMETER		4795.00	SR Technics Switzerland
139822					72-35-69		Package L	30	PLASMA SPRAY REP OUTER FRONT SNAP DIAMETER		4795.00	SR Technics Switzerland
139822					72-35-69		Package M	31	PLASMA SPRAY 9/10TH INTERMEDIATE SUPPORT OUTER SNAP DIAMETER		4795.00	SR Technics Switzerland
139822					72-35-69		Package N	32	WELD REPAIR FLANGE H BOLT HOLE CRACKS		3120.00	SR Technics Switzerland
139822					72-35-69		Package O	33	WELD REPAIR FLANGE J BOLT HOLE CRACKS		3120.00	SR Technics Switzerland
139822					72-35-69		Package P	34	WELD REPAIR FLANGE K BOLT HOLE CRACKS		3120.00	SR Technics Switzerland
139822					72-35-69		Package Q	35	PLASMA SPRAY 9/10TH FRONT SUPPORT INNER DIAMETER		4795.00	SR Technics Switzerland
139822					72-35-69		Package R	36	HELICAL COIL INSERT REP OF .5625-18 THREADED BORESCOPE HOLE		880.00	SR Technics Switzerland
139822					72-35-69		Package S	37	PLASMA SPRAY REP REAR SNAP AXIAL SURFACE		4795.00	SR Technics Switzerland
139822					72-35-69		Package T		REMOVAL AND VISUALLY INSPECTION OF ALL BRACKETS		745.00	SR Technics Switzerland
139822					72-35-69		Package U	39	WALL BLEND REPAIR		615.00	SR Technics Switzerland
139822					72-35-69		Package V	41	REPLACE THE IDENTIFICATION BRACKET		2000.00	SR Technics Switzerland
139822					72-35-69		Package W	67	REAR CASE ASSEMBLY WELD REPAIR		2755.00	SR Technics Switzerland
139822					72-35-69		Package Z	47	FRONT FLANGE FACE PLASMA COAT REPAIR		2590.00	SR Technics Switzerland
139830	54H779-01	EASA,FAA,CAAC,ANAC	35	28	72-35-51	HIGH PRESSURE COMPRESSOR (HPC) - INLET SYNCHRONIZING RING AS	Package A	CLN/INSP	CLEANING AND INSPECTION	PN54H779-01 54H794-01 FOR SHOP VISIT ONL	370.00	SR Technics Switzerland
139830	54H794-01	EASA,FAA,CAAC,ANAC			72-35-51		Package B	01	REPLACE RING ASSEMBLY PIN AND LEVER ARM		1200.00	SR Technics Switzerland
139830	55H818-01	EASA,FAA,CAAC,ANAC			72-35-51		Package C	02	REPLACE NUT PLATES		590.00	SR Technics Switzerland
139830	55H820-01	EASA,FAA,CAAC,ANAC			72-35-51		Package F	05	WELD REPAIR OF VANE ARM PIN HOLES		2495.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139830	56H075-01	EASA,FAA,CAAC,ANAC			72-35-51		Package H	07	BLEND RING SEGMENT SURFACE DAMAGE		590.00	SR Technics Switzerland
139830	56H076-01	EASA,FAA,CAAC,ANAC			72-35-51		Package L	11	APPLY PWA 578 PAINT		975.00	SR Technics Switzerland
139830					72-35-51		Package SB00	PW4G-100-72-114	SYNCHRONIZING RING - MODIFICATION FOR IMPROVED ARM DURABILIT Package B and C		1100.00	SR Technics Switzerland
139830					72-35-51		Package SB01	72-EO-520754	INSPECT THE UNISON RING PINS ON THE IGV STAGE FOR WEAR/LOSSENESS		595.00	SR Technics Switzerland
139830					72-35-51		Package SB02	PW4G-100-72-171	REPETITIVE INSPECTION FOR TACK WELD CRACKS AND WAER		595.00	SR Technics Switzerland
139834	54H781-01	EASA,FAA,CAAC,ANAC	33	28	72-35-53	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 6 HPC SYNCHRONIZING R	Package A	INSP/CHK	CLEANING AND INSPECTION	PN54H781-01 54H903-01 55H827-01 FOR SHO	375.00	SR Technics Switzerland
139834	54H796-01	EASA,FAA,CAAC,ANAC			72-35-53		Package B	01	REPLACE RING ASSEMBLY PIN AND LEVER ARM		1270.00	SR Technics Switzerland
139834	54H903-01	EASA,FAA,CAAC,ANAC			72-35-53		Package C	02	REPLACE NUT PLATES		720.00	SR Technics Switzerland
139834	55H827-01	EASA,FAA,CAAC,ANAC			72-35-53		Package F	05	WELD REPAIR OF VANE ARM PIN HOLES		2605.00	SR Technics Switzerland
139834	55H829-01	EASA,FAA,CAAC,ANAC			72-35-53		Package H	07	BLEND RING SEGMENT SURFACE DAMAGE		335.00	SR Technics Switzerland
139834	56H085-01	EASA,FAA,CAAC,ANAC			72-35-53		Package L	11	APPLY PWA 578 PAINT		1035.00	SR Technics Switzerland
139834	56H086-01	EASA,FAA,CAAC,ANAC			72-35-53		Package SB00	PW4G-100-72-114	SYNCHRONIZING RING - MODIFICATION FOR IMPROVED ARM DURABILITY		1145.00	SR Technics Switzerland
139836	55H831-01	EASA,FAA,CAAC,ANAC	34	28	72-35-54	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 7 HPC SYNCHRONIZING R	Package A	CLN/INSP	CLEANING AND INSPECTION	PN55H831-01 FOR SHOP VISIT ONLY	440.00	SR Technics Switzerland
139836	55H833-01	EASA,FAA,CAAC,ANAC			72-35-54		Package B	01	REPLACE RING ASSEMBLYPIN AND LEVER ARM		1165.00	SR Technics Switzerland
139836	56H087-01	EASA,FAA,CAAC,ANAC			72-35-54		Package C	02	REPLACE NUT PLATES		690.00	SR Technics Switzerland
139836	56H090-01	EASA,FAA,CAAC,ANAC			72-35-54		Package F	05	WELD REPAIR OF VANE ARM PIN HOLES		2515.00	SR Technics Switzerland
139836					72-35-54		Package H	07	BLEND RING SEGMENT SURFACE DAMAGE		325.00	SR Technics Switzerland
139836					72-35-54		Package L	11	APPLY PWA 578 PAINT		990.00	SR Technics Switzerland
139836					72-35-54		Package SB00	PW4G-100-72-114	SYNCHRONIZING RING - MODIFICATION FOR IMPROVED ARM DURABILITY		1110.00	SR Technics Switzerland
139842	70R673	EASA,FAA,CAAC,ANAC	15	28	72-61-50	MAIN GEARBOX - GEARBOX DRIVESHAFT HOUSING ASSEMBLY (REAR)	Package B	01	REPLACE HELICAL COIL INSERTS		145.00	SR Technics Switzerland
139842					72-61-50		Package C	02	APPLY ANODIZE TOUCH-UP SOLUTION		120.00	SR Technics Switzerland
139842					72-61-50		Package D	03	PIN REPLACEMENT		135.00	SR Technics Switzerland
139842					72-61-50		Package E	04	FRONT OUTER MATING DIAMETER NICKEL PLATE REPAIR		1170.00	SR Technics Switzerland
139842					72-61-50		Package F	05	REAR OUTER MATING DIAMETER NICKEL PLATE REPAIR		1170.00	SR Technics Switzerland
139842					72-61-50		Package G	06	FRONT FACE NICKEL PLATE REPAIR		1230.00	SR Technics Switzerland
139842					72-61-50		Package H	07	REAR FACE NICKEL PLATE REPAIR-		1170.00	SR Technics Switzerland
139842					72-61-50		Package I	08	INSERT REPLACEMENT REPAIR		120.00	SR Technics Switzerland
139843	70R675	EASA,FAA,CAAC,ANAC	25	28	72-61-52	MAIN GEARBOX - GEARBOX DRIVE SHAFT HOUSING ASSEMBLY (FRONT	Package A	CLN/INSP	CLEANING AND INSPECTION		365.00	SR Technics Switzerland
139843					72-61-52		Package B	01	REPLACE HELICAL COIL INSERTS		280.00	SR Technics Switzerland
139843					72-61-52		Package C	02	APPLY ANODIZE TOUCH-UP SOLUTION		275.00	SR Technics Switzerland
139843					72-61-52		Package D	03	NICKEL PLATE FRONT ID		1140.00	SR Technics Switzerland
139843					72-61-52		Package F	05	NICKEL PLATE TRANSFER TUBE HOLE ID		1655.00	SR Technics Switzerland
139843					72-61-52		Package G	06	NICKEL PLATE REAR FLANGE FACE		1815.00	SR Technics Switzerland
139843					72-61-52		Package H	07	BUSHING REPLACEMENT IN MOUNT CLEVISES		1385.00	SR Technics Switzerland
139843					72-61-52		Package I	08	NICKEL PLATE REAR ID		1015.00	SR Technics Switzerland
139843					72-61-52		Package J	09	NICKEL PLATE FRONT FLANGE FACE		1795.00	SR Technics Switzerland
139843					72-61-52		Package K	10	NICKEL PLATE ALTERNATOR PORT ID		1795.00	SR Technics Switzerland
139843					72-61-52		Package L	11	NICKEL PLATE BUSHING HOLE		2350.00	SR Technics Switzerland
139844	70R680	EASA,FAA,CAAC,ANAC	13	28	72-61-93	MAIN GEARBOX - GEARBOX SPUR GEAR	Package A	CLN/INSP	CLEANING AND INSPECTION		345.00	SR Technics Switzerland
139844					72-61-93		Package B	01	SILVER FLASH REPAIR		1285.00	SR Technics Switzerland
139845	70R792	EASA,FAA,CAAC,ANAC	23	28	72-61-42	MAIN GEARBOX - GEARBOX (SCAVENGE PUMP DRIVE) BEARING HOUSI	Package B	01	REPLACE HELICAL COIL INSERTS		440.00	SR Technics Switzerland
139845					72-61-42		Package C	02	ANODIZE TOUCH-UP		255.00	SR Technics Switzerland
139845					72-61-42		Package I	08	REPAIR THE REAR ID WITH A BUSHING		1180.00	SR Technics Switzerland
139845					72-61-42		Package J	09	REPLACE HELICAL COIL INSERTS		630.00	SR Technics Switzerland
139845					72-61-42		Package M	12	NICKEL PLATE THE OD		1325.00	SR Technics Switzerland
139847	70R934	EASA,FAA,CAAC,ANAC	7	28	72-61-44	PW4 GEARBOX (SCAVENGE PUMP DRIVE) SPUR	Package A	CLN/INSP	CLEANING AND INSPECTION		170.00	SR Technics Switzerland
139847	70R935	EASA,FAA,CAAC,ANAC			72-61-44		Package D	03	CHROMIUM PLATE BEARING JOURNAL		1050.00	SR Technics Switzerland
139847					72-61-44		Package E	04	CHROMIUM PLATE BEARING SHOULDER		1050.00	SR Technics Switzerland
139853	55A221	EASA,FAA,CAAC,ANAC	23	28	72-31-82	LOW PRESSURE COMPRESSOR (LPC) - STAGE 1 LPC BLADE ASSEMBLY 1'	Package A	CLN/INSP	CLEANING AND INSPECTION	PN55A221-001 FOR SHOP VISIT ONLY	165.00	SR Technics Switzerland
139853	55A221-002	EASA,FAA,CAAC,ANAC			72-31-82		Package C	10	MOMENT WEIGHT ADJUSTMENT		95.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139853	57A721	EASA,FAA,CAAC,ANAC			72-31-82		Package C	INSP/CHK-05	MOMENT WEIGH BLADE ASSEMBLY		95.00	SR Technics Switzerland
139853	57A821	EASA,FAA,CAAC,ANAC			72-31-82		Package SB00	PW4G-100-1-99	LUBRICATION OF THE 1ST STAGE LPC BLADE ASSEMBLY (FAN BLADE) ROOT		180.00	SR Technics Switzerland
139853					72-31-82		Package SB00	PW4G-100-72-150	ULTRASONIC INSPECTION OF THE BLADE ROOT ATTACHMENT AREA FOR CRACKS		180.00	SR Technics Switzerland
139853					72-31-82		Package SB01	PW4G-100-72-175	MODIFICATION OF TO INCORPORATE A MORE DURABLE BLADE ROOT COATING		90.00	SR Technics Switzerland
139853					72-31-82		Package SB02	PW4G-100-72-101	REPL. OF OR MODIFICATION OF TO REDEFINE THE GROOVE IN PLATFORM UPPER SURFACE		90.00	SR Technics Switzerland
139860	54T656-01	EASA,FAA,CAAC,ANAC	25	21	71-21-15	FWD ENGINE MOUNT - MOUNT SET ASSY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
139860	59T792-01	EASA,FAA,CAAC,ANAC			71-21-15		Package B	01	MOUNT SET SURFACE DAMAGE BLEND REPAIR		1370.00	SR Technics Switzerland
139860					71-21-15		Package C	02	MOUNT SET HALVES SURFACE DAMAGE BLEND REPAIR		525.00	SR Technics Switzerland
139860					71-21-15		Package E	04	REPLACE THE ANTIGALLING COMPOUND REPAIR		540.00	SR Technics Switzerland
139860					71-21-15		Package SB04	PW4G-100-71-26	APPLICATION OF ANTI-GALLANT COMPOUND TO THE MOUNT MAIN BEAM (SNOUT)		275.00	SR Technics Switzerland
140266	51D742-01	EASA,FAA,CAAC,ANAC	24	28	72-34-01	INTERMEDIATE CASE - COMPRESSOR INTERMEDIATE CASE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		915.00	SR Technics Switzerland
140266					72-34-01		Package B	89	BLEND COMPRESSOR INTERMEDIATE CASE FLANGE ASSEMBLY		840.00	SR Technics Switzerland
140266					72-34-01		Package C	90	PROTECTION LAYER TOUCH UP REPAIR		685.00	SR Technics Switzerland
140266					72-34-01		Package D	91	NUT PLATE REPLACEMENT		810.00	SR Technics Switzerland
140266					72-34-01		Package E	92	ANTIGALLANT COMPOUND REPLACEMENT		685.00	SR Technics Switzerland
140742	51U691-01	EASA,FAA,CAAC,ANAC	19	21	71-22-15	AFT ENGINE MOUNT - MOUNT SET ASSY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		1030.00	SR Technics Switzerland
140742	56T060	EASA,FAA,CAAC,ANAC			71-22-15		Package B	01	MOUNT BUSHINGS BLEND REPAIR		340.00	SR Technics Switzerland
140742	59T793-01	EASA,FAA,CAAC,ANAC			71-22-15		Package C	02	SURFACE DAMAGE BLEND REPAIR		340.00	SR Technics Switzerland
140742					71-22-15		Package D	03	OVERSIZE BUSHING REPAIR		2995.00	SR Technics Switzerland
144406	50T218	EASA,FAA,CAAC,ANAC	24	28	72-09-77	ENGINE GENERAL - COMMON PARTS - TURBINE CASE COOLING DUCT /	Package A	CLN/INSP	CLEANING AND INSPECTION		380.00	SR Technics Switzerland
144406	52T926	EASA,FAA,CAAC,ANAC			72-09-77		Package B	01	REPLACE LOOSE OR MISSING RIVETS REPAIR - TCC DUCT ASSEMBLY		540.00	SR Technics Switzerland
144406	55T351-01	EASA,FAA,CAAC,ANAC			72-09-77		Package C	02	WELD DAMAGED ON ELONGATED RIVET HOLES REPAIR - TCC DUCT ASSEMBLY		745.00	SR Technics Switzerland
144406					72-09-77		Package D	03	TURBINE CASE COOLING DUCT BOTTOM SEGMENT REPAIR		1995.00	SR Technics Switzerland
144410	50J479	EASA,FAA,CAAC,ANAC	5	28	72-41-11	PW4 (94") STATOR, FUEL NOZZLE	Package B	01	REPLACE FUEL NOZZLE GUIDE HARDFACE		170.00	SR Technics Switzerland
144410	50J781	EASA,FAA,CAAC,ANAC			72-41-11		Package C	02	REPLACE FUEL NOZZLE GUIDE CERAMIC COAT		105.00	SR Technics Switzerland
144410					72-41-11		Package D	42	FUEL NOZZLE GUIDE FRONT LIP WELD REPAIR		490.00	SR Technics Switzerland
144727	56T082	EASA,FAA,CAAC,ANAC	24	21	71-21-14	FWD ENGINE MOUNT - THRUST LINK ASSEMBLY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		335.00	SR Technics Switzerland
144727	59T796	EASA,FAA,CAAC,ANAC			71-21-14		Package B	01	BEARING REPLACEMENT REPAIR		2215.00	SR Technics Switzerland
144727					71-21-14		Package C	02	SURFACE DAMAGE BLEND REPAIR		345.00	SR Technics Switzerland
601742	70R114	EASA,FAA,CAAC,ANAC	3	28	72-61-62	PW4 PRESSURE (REGULATOR) RELF VALVE	Package B	01	CHROMIUM PLATE PILOT DIAMETER		405.00	SR Technics Switzerland
603649	50N288	EASA,FAA,CAAC,ANAC,CAA UK	13	28	72-53-31	LOW PRESSURE TURBINE (LPT) - STAGE 3 LPT (OUTER VANE) DUCT ASS	Package A	CLN/INSP	CLEANING AND INSPECTION		755.00	SR Technics Switzerland
603649					72-53-31		Package B	01	DUCT CRACKS AND WORN AREAS WELD REPAIR		1760.00	SR Technics Switzerland
609966	51G530-01	EASA,FAA,CAAC,ANAC	18	28	72-33-85	FAN CASE - FAN EXIT LEADING EDGE	Package A	CLN/INSP	CLEANING AND INSPECTION		595.00	SR Technics Switzerland
609966	51G595	EASA,FAA,CAAC,ANAC			72-33-85		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	145.00	SR Technics Switzerland
609966	52G194-01	EASA,FAA,CAAC,ANAC			72-33-85		Package C	02	PROTECTIVE (FLUOROELASTOMER) FINISH REPAIR		880.00	SR Technics Switzerland
609966	52G412-01	EASA,FAA,CAAC,ANAC			72-33-85		Package D	03	WASHERS REPLACEMENT REPAIR		760.00	SR Technics Switzerland
609966					72-33-85		Package E	04	SPLICE PLATE REPLACEMENT REPAIR		795.00	SR Technics Switzerland
609966					72-33-85		Package F	05	NUT PLATES REPLACEMENT REPAIR		570.00	SR Technics Switzerland
609966					72-33-85		Package G	06	MINOR SURFACE DAMAGE REPAIR		905.00	SR Technics Switzerland
609966					72-33-85		Package I	08	SURFACE DAMAGE REPAIR (POLYURETHANE COATING)		880.00	SR Technics Switzerland
610164	70R104	EASA,FAA,CAAC,ANAC	20	28	72-61-15	MAIN GEARBOX - GEARBOX DOILER IMPELLER ASSEMBLY	Package D	03	NICKEL PLATE THE PILOT DIAMETER		990.00	SR Technics Switzerland
610164					72-61-15		Package E	04	NICKEL PLATE THE OD SNAP DIAMETER		1065.00	SR Technics Switzerland
610741	21W4150-505	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - FIRE DETECTOR, ENGINE TO PYLON WIRE HARN	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	440.00	SR Technics Switzerland
610741	21W4150-507	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2890.00	SR Technics Switzerland
610741					71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4390.00	SR Technics Switzerland
610741					71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	5260.00	SR Technics Switzerland
610743	21W4132-505	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - FIRE DETECTOR, ENGINE TO PYLON WIRE HARN	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	445.00	SR Technics Switzerland
610743	21W4132-507	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2765.00	SR Technics Switzerland
610743					71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3135.00	SR Technics Switzerland
610743					71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	3580.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610744	21W4120-507	EASA,FAA,CAAC,ANAC	20	21	71-51-01	EEC, A CHANNEL WIRE HARNESS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	505.00	SR Technics Switzerland
610744	21W4120-511	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	3375.00	SR Technics Switzerland
610744	21W4120-515	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5655.00	SR Technics Switzerland
610744	21W4120-521	EASA,FAA,CAAC,ANAC			71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	8075.00	SR Technics Switzerland
610744					71-51-01		Package SB00	PW4NAC 71-155	REWORK OF EEC WIRE HARNESS (W1W2 AND SUPPLEMENTAL CONTROL	IN CONJUNCTION WITH PACKAGE MEDIUM O	985.00	SR Technics Switzerland
610745	21W4118-507	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - EEC, B CHANNEL WIRE HARNESS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	410.00	SR Technics Switzerland
610745	21W4118-511	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	3135.00	SR Technics Switzerland
610745	21W4118-513	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4010.00	SR Technics Switzerland
610745	21W4118-515	EASA,FAA,CAAC,ANAC			71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	4885.00	SR Technics Switzerland
610746	21W4116-503	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - THRUST REVERSER INLET ANTI-ICE WIRE HARNE	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	535.00	SR Technics Switzerland
610746	21W4116-505	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2140.00	SR Technics Switzerland
610746	21W4116-507	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4325.00	SR Technics Switzerland
610746					71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	5015.00	SR Technics Switzerland
610747	21W4114-507	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - IDG CONTROL WIRE HARNESS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610747	21W4114-509	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	3375.00	SR Technics Switzerland
610747					71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5655.00	SR Technics Switzerland
610747					71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	8075.00	SR Technics Switzerland
610748	21W4083-501	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - BAROSWITCH HARNESS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	410.00	SR Technics Switzerland
610748	21W4083-503	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1700.00	SR Technics Switzerland
610748					71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2390.00	SR Technics Switzerland
610748					71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	3135.00	SR Technics Switzerland
610749	21W4076-511	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - TR CONTROL WIRE HARNESS - 5 CONNECTIONS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610749					71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2330.00	SR Technics Switzerland
610749					71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4135.00	SR Technics Switzerland
610749					71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	5015.00	SR Technics Switzerland
610750	21W4076-509	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - TR CONTROL WIRE HARNESS - 7 CONNECTIONS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	425.00	SR Technics Switzerland
610750	21W4076-515	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2140.00	SR Technics Switzerland
610750	21W4076-519	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4640.00	SR Technics Switzerland
610750					71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	6015.00	SR Technics Switzerland
610750					71-51-01		Package SB00	PW4NAC 71-136	THRUST REVERSER COMMAND CIRCUIT REWIRE	IN CONJUNCTION WITH PACKAGE MEDIUM O	975.00	SR Technics Switzerland
610751	21W4072-531	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - CORE WIRE HARNESS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	3010.00	SR Technics Switzerland
610751	21W4072-535	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	6055.00	SR Technics Switzerland
610751	21W4072-537	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	8465.00	SR Technics Switzerland
610751	21W4072-539	EASA,FAA,CAAC,ANAC			71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	11955.00	SR Technics Switzerland
610751	21W4072-541	EASA,FAA,CAAC,ANAC			71-51-01		Package SB00	PW4NAC 71-70	REPLACEMENT OF HIGH STALE TEMPERATURE SENSOR CABLE	IN CONJUNCTION WITH PACKAGE MEDIUM O	980.00	SR Technics Switzerland
610751	21W4072-543	EASA,FAA,CAAC,ANAC			71-51-01		Package SB01	PW4NAC 71-73	ENGINE WIRE HARNESS CONNECTORS - MODIFICATION OF	IN CONJUNCTION WITH PACKAGE MEDIUM O	980.00	SR Technics Switzerland
610751					71-51-01		Package SB02	PW4NAC 71-89	WIRE HARNESS REWORK TO ACCOMMODATE NEW FUEL METERING UN	IN CONJUNCTION WITH PACKAGE MEDIUM O	980.00	SR Technics Switzerland
610751					71-51-01		Package SB03	PW4NAC 71-88	MODIFICATION OF WIRE HARNESS TO ADD JUMPER WIRE	IN CONJUNCTION WITH PACKAGE MEDIUM O	980.00	SR Technics Switzerland
610751					71-51-01		Package SB04	PW4NAC 71-133	WIRE HARNESS CONNECTOR FOR THE FMU SOLENOID - REPLACEMENT	IN CONJUNCTION WITH PACKAGE MEDIUM O	980.00	SR Technics Switzerland
610751					71-51-01		Package SB05	PW4NAC 71-147	HARNESS TO STARTER - MODIFICATION AND REROUTING	IN CONJUNCTION WITH PACKAGE MEDIUM O	980.00	SR Technics Switzerland
610816			19	21	71-51-02	ELECTRICAL HARNESS - EEC / LVDT JUNCTION BOX HARNESS ASSEMBLY	Package C	TEST	PRE TEST	PN221-5078-511 FOR SHOP VISIT ONLY	1030.00	SR Technics Switzerland
610816					71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2525.00	SR Technics Switzerland
610816					71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	7040.00	SR Technics Switzerland
610816					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	9190.00	SR Technics Switzerland
610832	221W5068-503	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - FAN CATEGORY I/IV HARNESS ASSEMBLY - MC I	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	635.00	SR Technics Switzerland
610832	221W5068-505	EASA,FAA,CAAC,ANAC			71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1640.00	SR Technics Switzerland
610832	221W5068-507	EASA,FAA,CAAC,ANAC			71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3930.00	SR Technics Switzerland
610832					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	4865.00	SR Technics Switzerland
610835	221W5102-505	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - CORE MISC. HARNESS ASSEMBLY - MC DONNEL	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	715.00	SR Technics Switzerland
610835	221W5102-509	EASA,FAA,CAAC,ANAC			71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1675.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610835	221W5102-515	EASA,FAA,CAAC,ANAC			71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4310.00	SR Technics Switzerland
610835	221W5102-517	EASA,FAA,CAAC,ANAC			71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	5425.00	SR Technics Switzerland
610841			19	21	71-51-02	ELECTRICAL HARNESS - EEC CHANNEL "B" HARNESS ASSEMBLY - MC DC	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	425.00	SR Technics Switzerland
610841					71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1095.00	SR Technics Switzerland
610841					71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2320.00	SR Technics Switzerland
610841					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	2800.00	SR Technics Switzerland
610845	221W5144-513	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - THRUST REVERSER RH LVDT HARNESS ASSEMBL	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	625.00	SR Technics Switzerland
610845					71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1640.00	SR Technics Switzerland
610845					71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3920.00	SR Technics Switzerland
610845					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	4865.00	SR Technics Switzerland
610847	221W5146-513	EASA,FAA,CAAC,ANAC	19	21	71-51-02	THRUST REVERSER LH LVDT HARNESS ASSEMBLY - MC DONNELL DOUG	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610847					71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1370.00	SR Technics Switzerland
610847					71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3315.00	SR Technics Switzerland
610847					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	4105.00	SR Technics Switzerland
610855	221W5197-501	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - BELLMOUTH CATEGORY I HARNESS ASSEMBLY	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	465.00	SR Technics Switzerland
610855	221W5197-503	EASA,FAA,CAAC,ANAC			71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1185.00	SR Technics Switzerland
610855	221W5197-505	EASA,FAA,CAAC,ANAC			71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2755.00	SR Technics Switzerland
610855					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	3400.00	SR Technics Switzerland
610864	221W5110-501	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - IDG CONTROL ADAPTER HARNESS ASSEMBLY - I	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	465.00	SR Technics Switzerland
610864					71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1325.00	SR Technics Switzerland
610864					71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2890.00	SR Technics Switzerland
610864					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	3520.00	SR Technics Switzerland
610876	221-5190-505	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - THRUST REVERSER JUNCTION BOX HARNESS AS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	625.00	SR Technics Switzerland
610876	221-5190-507	EASA,FAA,CAAC,ANAC			71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1815.00	SR Technics Switzerland
610876	221-5190-509	EASA,FAA,CAAC,ANAC			71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4095.00	SR Technics Switzerland
610876					71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	5035.00	SR Technics Switzerland
610901	420684	EASA,FAA,CAAC,ANAC	19	21	73-21-18	EEC WIRING HARNESS WF04 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	745.00	SR Technics Switzerland
610901	55T139	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1935.00	SR Technics Switzerland
610901					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5055.00	SR Technics Switzerland
610901					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	6480.00	SR Technics Switzerland
610903	420012	EASA,FAA,CAAC,ANAC	19	21	73-21-18	EEC WIRING HARNESS WF05 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	745.00	SR Technics Switzerland
610903					73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1935.00	SR Technics Switzerland
610903					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5055.00	SR Technics Switzerland
610903					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	6480.00	SR Technics Switzerland
610904	420686	EASA,FAA,CAAC,ANAC	19	21	73-21-18	EEC WIRING HARNESS WF06 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	745.00	SR Technics Switzerland
610904	55T137	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1935.00	SR Technics Switzerland
610904					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5055.00	SR Technics Switzerland
610904					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	6480.00	SR Technics Switzerland
610905	420687	EASA,FAA,CAAC,ANAC	19	21	73-21-18	EEC WIRING HARNESS WF07 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	945.00	SR Technics Switzerland
610905	55T140	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2390.00	SR Technics Switzerland
610905					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	6495.00	SR Technics Switzerland
610905					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	8390.00	SR Technics Switzerland
610906	420015	EASA,FAA,CAAC,ANAC	19	21	73-21-18	EEC WIRING HARNESS WF08 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	465.00	SR Technics Switzerland
610906	55T128	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1710.00	SR Technics Switzerland
610906					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3520.00	SR Technics Switzerland
610906					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	4390.00	SR Technics Switzerland
610907	420016	EASA,FAA,CAAC,ANAC	20	21	73-21-18	EEC WIRING HARNESS WF09 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	425.00	SR Technics Switzerland
610907	421137	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1115.00	SR Technics Switzerland
610907	55T129	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2225.00	SR Technics Switzerland
610907					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFPE	2665.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610907					73-21-18		Package SB00	73-39	REPLACEMENT OF ALUMEL AND CHROMEL CONTACTS	IN CONIUNCTION WITH PACKAGE HEAVY	280.00	SR Technics Switzerland
610914	420017	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS WF10 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	435.00	SR Technics Switzerland
610914	55T130	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1010.00	SR Technics Switzerland
610914					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2230.00	SR Technics Switzerland
610914					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	2705.00	SR Technics Switzerland
610915	420018	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS WF11 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	435.00	SR Technics Switzerland
610915	55T131	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1010.00	SR Technics Switzerland
610915					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2150.00	SR Technics Switzerland
610915					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	2625.00	SR Technics Switzerland
610916	420692	EASA,FAA,CAAC,ANAC	20	21	73-21-18	WIRING HARNESS WF12 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610916	421138	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1940.00	SR Technics Switzerland
610916	55T138	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4080.00	SR Technics Switzerland
610916					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	5020.00	SR Technics Switzerland
610916					73-21-18		Package SB00	73-39	REPLACEMENT OF ALUMEL AND CHROMEL CONTACTS	IN CONIUNCTION WITH PACKAGE HEAVY	280.00	SR Technics Switzerland
610918	420020	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS WF13 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610918	55T133	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1940.00	SR Technics Switzerland
610918					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4080.00	SR Technics Switzerland
610918					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	5020.00	SR Technics Switzerland
610919	420021	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS WF14 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	745.00	SR Technics Switzerland
610919	55T134	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1940.00	SR Technics Switzerland
610919					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4820.00	SR Technics Switzerland
610919					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	6005.00	SR Technics Switzerland
610920	420695	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS WF15 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610920	55T141	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1900.00	SR Technics Switzerland
610920					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3850.00	SR Technics Switzerland
610920					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	4635.00	SR Technics Switzerland
610922	420844	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS-ASSY WC 2 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1450.00	SR Technics Switzerland
610922	421259	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	3230.00	SR Technics Switzerland
610922	59T783	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	8980.00	SR Technics Switzerland
610922					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	12355.00	SR Technics Switzerland
610922					73-21-18		Package SB00	72-39	REPLACEMENT OF ALUMELAND AND CHROMEL CONTACTS WITH STANI	IN CONIUNCTION WITH PACKAGE HEAVY	280.00	SR Technics Switzerland
610923	420653	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS-ASSY WC 3 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	845.00	SR Technics Switzerland
610923	420653-2	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2030.00	SR Technics Switzerland
610923	421260	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5355.00	SR Technics Switzerland
610923	55T113	EASA,FAA,CAAC,ANAC			73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	6750.00	SR Technics Switzerland
610923					73-21-18		Package SB00	73-59	VIBRATION WIRE CHAFING ELIMINATION	IN CONIUNCTION WITH PACKAGE MEDIUM O	280.00	SR Technics Switzerland
610925	420655	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS-ASSY WC 5 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	550.00	SR Technics Switzerland
610925	420815	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1870.00	SR Technics Switzerland
610925	420815-2	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3850.00	SR Technics Switzerland
610925	421341	EASA,FAA,CAAC,ANAC			73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	4635.00	SR Technics Switzerland
610925	55T147	EASA,FAA,CAAC,ANAC			73-21-18		Package SB00	73-59	VIBRATION WIRE CHAFING ELIMINATION	IN CONIUNCTION WITH PACKAGE MEDIUM O	280.00	SR Technics Switzerland
610926	420656	EASA,FAA,CAAC,ANAC	20	21	73-21-18	WIRING HARNESS-ASSY WC 6 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	845.00	SR Technics Switzerland
610926	420816	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2030.00	SR Technics Switzerland
610926	420816-3	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5355.00	SR Technics Switzerland
610926	421342	EASA,FAA,CAAC,ANAC			73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	6750.00	SR Technics Switzerland
610926	55T148	EASA,FAA,CAAC,ANAC			73-21-18		Package SB00	73-59	VIBRATION WIRE CHAFING ELIMINATION	IN CONIUNCTION WITH PACKAGE MEDIUM O	280.00	SR Technics Switzerland
610926					73-21-18		Package SB01	73-39	REPLACEMENT OF ALUMEL AND CHROMEL CONTACTS	IN CONIUNCTION WITH PACKAGE HEAVY	280.00	SR Technics Switzerland
610927	420777	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS-ASSY WC 7 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	445.00	SR Technics Switzerland
610927	420777-3	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1485.00	SR Technics Switzerland
610927	421343	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3015.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610927	55T144	EASA,FAA,CAAC,ANAC			73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	3600.00	SR Technics Switzerland
610927					73-21-18		Package SB00	73-59	VIBRATION WIRE CHAFING ELIMINATION	IN CONJUNCTION WITH PACKAGE MEDIUM O	280.00	SR Technics Switzerland
610928	420658	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS-ASSY WC 8 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	945.00	SR Technics Switzerland
610928	55T117	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2295.00	SR Technics Switzerland
610928					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	6095.00	SR Technics Switzerland
610928					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	7665.00	SR Technics Switzerland
610929	420659	EASA,FAA,CAAC,ANAC	19	21	73-21-18	WIRING HARNESS-ASSY WC 9 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610929	55T118	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1870.00	SR Technics Switzerland
610929					73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3850.00	SR Technics Switzerland
610929					73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	4620.00	SR Technics Switzerland
610980	420084	EASA,FAA,CAAC,ANAC	4	21	73-21-XX	W12/PW4 94" (4 PLUG) EEC WIRE HARNESS	Package A	TEST	PRE TEST	TESTING AND FAULT ISOLATION	400.00	SR Technics Switzerland
610980					73-21-XX		Package B	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2140.00	SR Technics Switzerland
610980					73-21-XX		Package C	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5900.00	SR Technics Switzerland
610980					73-21-XX		Package D	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	7655.00	SR Technics Switzerland
610983	420087	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W2 (7 CONNECTIONS) - BOEING	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	850.00	SR Technics Switzerland
610983	46228	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2295.00	SR Technics Switzerland
610983	46462	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5985.00	SR Technics Switzerland
610983	46462-5	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	7665.00	SR Technics Switzerland
610983					73-21-60		Package SB00	73-54	DEACTIVATION OF TRC AND TCA CIRCUITS	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610983					73-21-60		Package SB01	73-55	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL	IN CONJUNCTION WITH PACKAGE MEDIUM O	745.00	SR Technics Switzerland
610983					73-21-60		Package SB02	72-0755	RCC MODIFICATION	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610985	420438	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W2 (12 CONNECTIONS) - BOEING	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1135.00	SR Technics Switzerland
610985	420438-3	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2910.00	SR Technics Switzerland
610985	421661	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	9115.00	SR Technics Switzerland
610985	577797	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	12435.00	SR Technics Switzerland
610985					73-21-60		Package SB00	73-54	DEACTIVATION OF TRC AND TCA CIRCUITS	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610986	420077	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W3 (8 CONNECTIONS) - MC DONNELL DOUGLAS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	745.00	SR Technics Switzerland
610986	46476	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2035.00	SR Technics Switzerland
610986	537877	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5250.00	SR Technics Switzerland
610986					73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	6860.00	SR Technics Switzerland
610990	420082	EASA,FAA,CAAC,ANAC	4	21	73-21-61	W7/PW4 94" (2 PLUG) EEC WIRE HARNESS	Package A	TEST	PRE TEST	TESTING AND FAULT ISOLATION	400.00	SR Technics Switzerland
610990	46623	EASA,FAA,CAAC,ANAC			73-21-61		Package B	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2140.00	SR Technics Switzerland
610990	537991	EASA,FAA,CAAC,ANAC			73-21-61		Package C	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5900.00	SR Technics Switzerland
610990					73-21-61		Package D	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	7655.00	SR Technics Switzerland
610991	420095	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W8 - BOEING	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	430.00	SR Technics Switzerland
610991	567002	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1030.00	SR Technics Switzerland
610991					73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2205.00	SR Technics Switzerland
610991					73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	2720.00	SR Technics Switzerland
611011	420104	EASA,FAA,CAAC,ANAC	19	21	73-21-53	EEC WIRE HARNESS W11 - AIRBUS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	425.00	SR Technics Switzerland
611011	46963	EASA,FAA,CAAC,ANAC			73-21-53		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2140.00	SR Technics Switzerland
611011					73-21-53		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5900.00	SR Technics Switzerland
611011					73-21-53		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	7655.00	SR Technics Switzerland
611194	23830-000	EASA,FAA,CAAC,ANAC	19	21	77-21-06	EGT (T3)THERMOCOUPLE BOX AND CABLE - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	425.00	SR Technics Switzerland
611194	HAD21988	EASA,FAA,CAAC,ANAC			77-21-06		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1565.00	SR Technics Switzerland
611194					77-21-06		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4060.00	SR Technics Switzerland
611194					77-21-06		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	5245.00	SR Technics Switzerland
611204	922-224-000-031	EASA,FAA,CAAC,ANAC	19	21	77-32-14	VIBRO-METER ENGINE VIBRATION ACCELEROMETER HARNESS - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	360.00	SR Technics Switzerland
611204					77-32-14		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	670.00	SR Technics Switzerland
611204					77-32-14		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	1475.00	SR Technics Switzerland
611204					77-32-14		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AF	1835.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
614222	51T370	EASA,FAA,CAAC,ANAC	5	21	72-09-71	PW4 TUBES EXTERNAL	Package A	CLN/INSP	CLEANING AND INSPECTION		230.00	SR Technics Switzerland
614222	51T461	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		230.00	SR Technics Switzerland
614222	52T836-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	ANTISIZE COMPOUND APPLICATION		80.00	SR Technics Switzerland
614222	53T234-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	THRUST WIRE INSTALLATION		270.00	SR Technics Switzerland
614222	54T418-01	EASA,FAA,CAAC,ANAC			72-09-71		Package D	04	BLEND REPAIR SURFACE DAMAGE		230.00	SR Technics Switzerland
614222	55T611-01	EASA,FAA,CAAC,ANAC			72-09-71		Package E	05	DENT REPAIR		1490.00	SR Technics Switzerland
614222	57T397-01	EASA,FAA,CAAC,ANAC			72-09-71		Package F	07	LINER,NUT,REDUCER,ELBOW,SLEEVE REPLACEMENT		810.00	SR Technics Switzerland
614222	57T785-01	EASA,FAA,CAAC,ANAC			72-09-71		Package G	11	REPAIR OF DAMAGED AREA ON HEAT SHIELD		280.00	SR Technics Switzerland
614222	59T737-01	EASA,FAA,CAAC,ANAC			72-09-71		Package H	22	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00	180.00	SR Technics Switzerland
614222					72-09-71		Package SB00	PW4ENG 79-64	NO. 3 BRG TUBE (LP19) COUPLING NUT REPLACEMENT		230.00	SR Technics Switzerland
619760	51R122	EASA,FAA,CAAC,ANAC	3	21	XX-XX-XX	PW4 MISCELLANEOUS PARTS	Package B		INSERT REPLACEMENT ACCORDING SPM		200.00	SR Technics Switzerland
619764	50L923-01	EASA,FAA,CAAC,ANAC	13	28	72-52-16	HIGH PRESSURE TURBINE (HPT) - HPT FLANGE SPACER	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
619764					72-52-16		Package B	01	LOOSE DAMAGED OR MISSING RIVETS REPLACEMENT REPAIR	PN 50L923-01 ONLY	340.00	SR Technics Switzerland
620009	50A234	EASA,FAA,CAAC,ANAC	22	21	72-54-12	TURBINE EXHAUST CASE - NO. 4 BEARING (PRESSURE AND SCAVENGE)	Package A	CLN/INSP	CLEANING AND INSPECTION		290.00	SR Technics Switzerland
624103	730842B	EASA,FAA,CAAC,ANAC	2	21	24-19-03	PW4 (94") QUICK ATTACH-DETACH ADAPTER	Package A	CLN/INSP	CLEANING & INSPECTION		700.00	SR Technics Switzerland
630155	58H435-01	EASA,FAA,CAAC,ANAC	15	28	72-35-93	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 8 AIR SEAL SUPPORT SEG	Package A	CLN/INSP	CLEANING AND INSPECTION		670.00	SR Technics Switzerland
630155					72-35-93		Package B	01	BOLT, RIVET AND BOLT RETAINER REPLACEMENT REPAIR		955.00	SR Technics Switzerland
631312	420504	EASA,FAA,CAAC,ANAC	6	21	24-21-42	IDG POWER CABLES DICONNECT BLOCK	Package B		TEST		380.00	SR Technics Switzerland
631312	52U192	EASA,FAA,CAAC,ANAC			24-21-42		Package D		LIGHT REPAIR		520.00	SR Technics Switzerland
631312	58T213	EASA,FAA,CAAC,ANAC			24-21-42		Package E		MEDIUM REPAIR		760.00	SR Technics Switzerland
631312	9072230-1	EASA,FAA,CAAC,ANAC			24-21-42		Package F		HEAVY REPAIR		1135.00	SR Technics Switzerland
650957	51G253	EASA,FAA,CAAC,ANAC	13	28	72-34-16	HPC SHROUD 5.STG RETAINING RING	Package A	CLN/INSP	CLEANING AND INSPECTION		475.00	SR Technics Switzerland
650957					72-34-16		Package B	01	SHROUD RETAINING RING OUTER LUG FRONT FACE PLASMA COAT REPAIR		1455.00	SR Technics Switzerland
650957					72-34-16		Package D	INSP/CHK-03	VISUAL INSPECTION		530.00	SR Technics Switzerland
651409	771724	EASA,FAA,CAAC,ANAC	4	21	72-54-03	PW4 PIN, ENGINE SUPPORT BOSS	Package A	CLN/INSP	CLEANING & INSPECTION		275.00	SR Technics Switzerland
652052	50P359_	EASA,FAA,CAAC,ANAC	3	21	72-54-19	PW4 TUBE, TRANSFER (DAMPER TUBE)	Package A	CLN/INSP	CLEANING & INSPECTION		115.00	SR Technics Switzerland
652054	50P022	EASA,FAA,CAAC,ANAC	2	28	72-54-16	NO.4 BEARING HOUSING SEAL RING	Package A	CLN/INSP	CLEANING & INSPECTION		190.00	SR Technics Switzerland
652057	50P023_	EASA,FAA,CAAC,ANAC	3	28	72-54-13	PW4 PLATE, NO.4 BRG (OUTER RACE) RETAINING	Package A	CLN/INSP	CLEANING & INSPECTION		135.00	SR Technics Switzerland
652076	50G682	EASA,FAA,CAAC,ANAC	4	28	72-35-96	PW4 NUT LOCK, NO. 2 BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		325.00	SR Technics Switzerland
652104	50G039	EASA,FAA,CAAC,ANAC	5	28	72-34-53	PW4 DRIVESHAFT ASSEMBLY, GEARBOX	Package A	CLN/INSP	CLEANING AND INSPECTION		440.00	SR Technics Switzerland
652104					72-34-53		Package B	01	EXPANSION PLUG REPLACEMENT		125.00	SR Technics Switzerland
652105	616464	EASA,FAA,CAAC,ANAC	4	28	72-34-24	PW4 COUPLING, GEARBOX DRIVESHAFT	Package A	CLN/INSP	CLEANING AND INSPECTION		290.00	SR Technics Switzerland
652129	50A130	EASA,FAA,CAAC,ANAC	4	28	72-52-81	PW4 LOCK, NO.3 BEARING NUT	Package A	CLN/INSP	CLEANING & INSPECTION		225.00	SR Technics Switzerland
652148	50L273	EASA,FAA,CAAC,ANAC	3	28	72-52-24	STAGE 2 HPT (BLADE RETAINING PLATE) KEY	Package A	CLN/INSP	CLEANING & INSPECTION		150.00	SR Technics Switzerland
652150	50L016	EASA,FAA,CAAC,ANAC	3	28	72-52-25	PW4 LOCK, TURBINE HUB	Package A	CLN/INSP	CLEANING & INSPECTION		155.00	SR Technics Switzerland
652165	50N279_	EASA,FAA,CAAC,ANAC	4	28	72-53-37	PW4 STAGE 6 LPT (OUTER) AIRSEALING RING	Package A	CLN/INSP	CLEANING AND INSPECTION		270.00	SR Technics Switzerland
652178	5005438-01	EASA,FAA,CAAC,ANAC	2	28	72-53-XX	PW4 STOP, INSTRUMENTATION PLUG	Package A	CLN/INSP	CLEANING & INSPECTION		45.00	SR Technics Switzerland
652204	70R124	EASA,FAA,CAAC,ANAC	2	21	72-61-36	PW4 GEARBOX SPACER, SLEEVE	Package A	CLN/INSP	CLEANING & INSPECTION		140.00	SR Technics Switzerland
652205	50K110	EASA,FAA,CAAC,ANAC	4	28	72-51-07	PW4 STOP, STAGE 1 HPT DUCT	Package A	CLN/INSP	CLEANING & INSPECTION		45.00	SR Technics Switzerland
652406	50I647-01	EASA,FAA,CAAC,ANAC	3	28	72-41-99	PW4 COVER ASSY, BOSS	Package A	CLN/INSP	CLEANING & INSPECTION		185.00	SR Technics Switzerland
652515	50I855-01	EASA,FAA,CAAC,ANAC	2	21	72-41-99	PW4 IGNITER, BOSS	Package A	CLN/INSP	CLEANING & INSPECTION		265.00	SR Technics Switzerland
654914	70T332	EASA,FAA,CAAC,ANAC	3	28	72-61-90	GEARBOX UPPER SUPPORT UNK PIN SPACER	Package A	CLN/INS	CLEANING & INSPECTION		115.00	SR Technics Switzerland
655052	52A402-01	EASA,FAA,CAAC,ANAC	20	35	72-53-80	LOW PRESSURE TURBINE (LPT) - FRONT COMPRESSOR DRIVE TURBINE	Package A	CLN/INSP	CLEANING AND INSPECTION		1305.00	SR Technics Switzerland
655052	52A402-101	EASA,FAA,CAAC,ANAC			72-53-80		Package AA	26	NICKEL PLATE REPAIR FOR 7TH STAGE LPT AIRSEAL SHOULDER		4205.00	SR Technics Switzerland
655052	52A577-01	EASA,FAA,CAAC,ANAC			72-53-80		Package AB	27	FLANGE FACE PLASMA SPRAY REPAIR		4205.00	SR Technics Switzerland
655052					72-53-80		Package AC	28	FLANGE SNAP DIAMETER PLASMA SPRAY REPAIR		4205.00	SR Technics Switzerland
655052					72-53-80		Package AF	31	INNER DIAMETER SPACER BORE PLASMA SPRAY REPAIR		3350.00	SR Technics Switzerland
655052					72-53-80		Package AI	34	PLASME COATE 6TH STAGE LPT AIRSEAL FRONT SNAP MATING DIAMETER		2390.00	SR Technics Switzerland
655052					72-53-80		Package AM	40	PROTECTIVE COAT REMOVAL AND COAT REPAIR		3915.00	SR Technics Switzerland
655052					72-53-80		Package AN	39	COAT TOUCH-UP BY PWA 36252		2200.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
655052					72-53-80		Package E	04	REPAIR NO. 4 BEARING RETAINING PLATE HOLES		1340.00	SR Technics Switzerland
655052					72-53-80		Package R	17	SHAFT BALANCE (BY WAX APPLICATION) REPAIR		4205.00	SR Technics Switzerland
655052					72-53-80		Package S	18	SURFACE DAMAGE BLEND REPAIR		4205.00	SR Technics Switzerland
655052					72-53-80		Package S	32	SHOTPEEN AFTER BLEND REPAIR		4205.00	SR Technics Switzerland
655052					72-53-80		Package SB01	PW4G-100-72-263	REPLACEMENT COATING		3605.00	SR Technics Switzerland
655052					72-53-80		Package U	20	REAR COUPLING PILOT DIAMETER PLASMA SPRAY REPAIR		3980.00	SR Technics Switzerland
655052					72-53-80		Package V	21	FRONT COUPLING PILOT DIAMETER PLA		875.00	SR Technics Switzerland
655052					72-53-80		Package W	22	NICKEL PLATE REPAIR NO. 4 BEARING RETAINING PLATE MATING DIAMETER		2670.00	SR Technics Switzerland
655052					72-53-80		Package X	23	MACHINE REPAIR FRONT SPACER SURFACE		3980.00	SR Technics Switzerland
655052					72-53-80		Package Z	25	TIEBOLD HOLES BUSHING REPAIR		4205.00	SR Technics Switzerland
655302	50D118	EASA,FAA,CAAC,ANAC	5	28	72-33-11	SHOULDER BOLT OF BLEED VALVE ACTUATOR CLEVIS	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
655313	50G873	EASA,FAA,CAAC,ANAC	10	28	72-34-10	PW4 RING, #2 BRG HOUSING SEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		715.00	SR Technics Switzerland
655336	58H438-01	EASA,FAA,CAAC,ANAC	3	28	72-35-82	PW4 SPACER SET, HPC	Package A	CLN/INSP	CLEANING & INSPECTION		210.00	SR Technics Switzerland
656280	70T328	EASA,FAA,CAAC,ANAC	3	28	72-61-84	PW4 LINK GEARBOX SUPPORT	Package A	CLN/INSP	CLEANING AND INSPECTION		250.00	SR Technics Switzerland
656432	50B046	EASA,FAA,CAAC,ANAC	8	28	72-31-17	PIN NO. 1 BRG SEAL ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		80.00	SR Technics Switzerland
656433	50B048	EASA,FAA,CAAC,ANAC	2	28	72-31-17	SPACER NO.1 BRG SEAL ASSY	Package A	CLN/INSP	CLEANING & INSPECTION		135.00	SR Technics Switzerland
656434	50A037	EASA,FAA,CAAC,ANAC	4	21	72-31-17	COLLAR NO.1 BRG SEAL ASSY	Package A	CLN/INSP	CLEANING & INSPECTION		45.00	SR Technics Switzerland
656574	50S059	EASA,FAA,CAAC,ANAC	3	28	72-35-XX	PW4 (100") 5TH - 15TH STAGE HPC SEAL SET	Package B		MACHINE STAGE 5 - 15 OUTER AIR SEAL SET		11990.00	SR Technics Switzerland
656574	50S753	EASA,FAA,CAAC,ANAC			72-35-XX		Package SB00	PW4G-100-72-260	INTRODUCTION OF A NEW HPC DRUM ROTOR DISK		3165.00	SR Technics Switzerland
657988	50U394-01	EASA,FAA,CAAC,ANAC	4	21	72-54-41	PW4 #4 BRG OIL SCAVANGE TUBE	Package A	CLN/INSP	CLEANING AND INSPECTION		360.00	SR Technics Switzerland
657988					72-54-41		Package B	22	CONICAL SEAT REPAIR	SPM/SOP	425.00	SR Technics Switzerland
657988					72-54-41		Package SB00	72-EO-524706	BSI BRG. #4 LUBRICATION & SCAVENGE TUBES	BORESCOPE INSPECTION	105.00	SR Technics Switzerland
662554	51J100	EASA,FAA,CAAC,ANAC	15	28	72-41-11	DIFFUSER AND COMBUSTOR - OUTER COMBUSTION CHAMBER ASSEM	Package A	CLN/INSP	CLEANING AND INSPECTION		3215.00	SR Technics Switzerland
662554	51J381	EASA,FAA,CAAC,ANAC			72-41-11		Package AC	37	STRESS-RELIEF CYCLE FOR OUTER COMBUSTION CHAMBER ASSEMBLY		1645.00	SR Technics Switzerland
662554	51J382	EASA,FAA,CAAC,ANAC			72-41-11		Package AD	48	WELD THE MOUNT LUGS		1935.00	SR Technics Switzerland
662554	51J500	EASA,FAA,CAAC,ANAC			72-41-11		Package AE	49	DOME DIAMETER HARDFACE REPLACEMENT REPAIR		1465.00	SR Technics Switzerland
662554					72-41-11		Package AF	51	PLASMA COAT BUILD-UP REPAIR		1300.00	SR Technics Switzerland
662554					72-41-11		Package AH	55	WEAR ON BULKHEAD FRONT FACE WELD REPAIR		1465.00	SR Technics Switzerland
662554					72-41-11		Package AI	64	COMBUSTION CHAMBER DOME DAMAGE WELD REPAIR		1310.00	SR Technics Switzerland
662554					72-41-11		Package AK	50	DOME SNAP DIAMETER RADIAL SHRINKAGE REPAIR		1815.00	SR Technics Switzerland
662554					72-41-11		Package AL	52	REPLACE BULKHEAD HARDFACE REPAIR		1105.00	SR Technics Switzerland
662554					72-41-11		Package AM	56	LINER SEGMENT REPLACEMENT REPAIR		2645.00	SR Technics Switzerland
662554					72-41-11		Package AN	56	FUEL NOZZLE GUIDE SWIRLER AND HEAT SHIELD REPLACEMENT REPAIR		2370.00	SR Technics Switzerland
662554					72-41-11		Package E	36	REPLACE HARDFACE ON REAR STIFFENER REPAIR		680.00	SR Technics Switzerland
662554					72-41-11		Package H	07	MOUNT LUG BUSHING REPLACEMENT		1065.00	SR Technics Switzerland
662554					72-41-11		Package N	73	REAR STIFFENER WELD REPAIR		1730.00	SR Technics Switzerland
662554					72-41-11		Package O	39	REPLACE IGNITER GUIDE ASSEMBLY		1620.00	SR Technics Switzerland
662554					72-41-11		Package P	40	RESIZE REAR STIFFENER PLASMA REPAIR		680.00	SR Technics Switzerland
662554					72-41-11		Package R	75	BULKHEAD FUEL NOZZLE PORTS CRACK WELD REPAIR		3025.00	SR Technics Switzerland
662554					72-41-11		Package S	76	LINER COOLING HOLE AXIAL CRACK WELD REPAIR		2730.00	SR Technics Switzerland
662554					72-41-11		Package SB00	PW4G100-72-253	REPLACEMENT OF WITH WASPALOY NUTS TO REDUCE NUT LIBERATION		3615.00	SR Technics Switzerland
662554					72-41-11		Package SB01	FAA-2020-25-09	REPLACEMENT OF 3RD STAGE LPT OTD		480.00	SR Technics Switzerland
662554					72-41-11		Package SB02	PW4G-100-72-265	OUTER CC. MODIFICATION TO INCREASE DURABILITY		1025.00	SR Technics Switzerland
664199	50I036	EASA,FAA,CAAC,ANAC	14	45	72-41-01	PW4 CASE ASSY OF DIFFUSER	Package A	CLN/INSP	CLEANING AND INSPECTION		1465.00	SR Technics Switzerland
664199	50I713-001	EASA,FAA,CAAC,ANAC			72-41-01		Package AA	45	REPAIR THE REAR FACE OF THE REAR INNER HOOK		4505.00	SR Technics Switzerland
664199	50I713-002	EASA,FAA,CAAC,ANAC			72-41-01		Package AB	46	BUSHING REMOVAL REPAIR, TUBE BOSS INSIDE DIAMETER		765.00	SR Technics Switzerland
664199	50I713-003	EASA,FAA,CAAC,ANAC			72-41-01		Package AC	51	STRUT EXTENDED CRACK MACHINE REPAIR		1950.00	SR Technics Switzerland
664199	50I713-01	EASA,FAA,CAAC,ANAC			72-41-01		Package AD	53	REAR INNER HOOK, NOZZLE SEATING SURFACE PLASMA COAT REPAIR		4505.00	SR Technics Switzerland
664199	50I779-001	EASA,FAA,CAAC,ANAC			72-41-01		Package AE	52	EXIT STATOR SNAP DIAMETER PLASMA COAT REPAIR		4165.00	SR Technics Switzerland
664199	50I779-002	EASA,FAA,CAAC,ANAC			72-41-01		Package AF	55	IGNITER BOSS THREAD SLEEVE REPAIR		2560.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
664199	501779-003	EASA,FAA,CAAC,ANAC			72-41-01		Package AG	59	PLASMA SPRAY EXIT STATOR SNAP DIAMETER		4495.00	SR Technics Switzerland
664199	501779-004	EASA,FAA,CAAC,ANAC			72-41-01		Package B	01	EXIT STATOR SNAP DIAMETER PLASMA COAT REPAIR		4165.00	SR Technics Switzerland
664199	501779-005	EASA,FAA,CAAC,ANAC			72-41-01		Package C	02	REPLACE DIFFUSER CASE ASSEMBLY REAR FLANGE LOCATING PIN		1210.00	SR Technics Switzerland
664199	501779-006	EASA,FAA,CAAC,ANAC			72-41-01		Package D	03	REPAIR DIFFUSER CASE ASSEMBLY BORESCOPE BOSS THREADS USING HELICAL COIL INSERT		1560.00	SR Technics Switzerland
664199	501779-01	EASA,FAA,CAAC,ANAC			72-41-01		Package E	04	PLASMA SPRAY AIRSEAL MOUNTING FLANGE SNAP DIAMETER		4205.00	SR Technics Switzerland
664199	51J146-01	EASA,FAA,CAAC,ANAC			72-41-01		Package F	05	FRONT INNER FLANGE MATING DIAMETER PLASMA COAT REPAIR		4165.00	SR Technics Switzerland
664199					72-41-01		Package G	06	PLASMA SPRAY FRONT FLANGE OUTER SNAP DIAMETER		4165.00	SR Technics Switzerland
664199					72-41-01		Package H	07	REAR OUTER MATING DIAMETER PLASMA COAT/DUAL WIRE ELECTRIC ARC COAT REPAIR		4165.00	SR Technics Switzerland
664199					72-41-01		Package I	08	PLASMA SPRAY STAGE 1 TURBINE VANE SUPPORT SNAP DIAMETER		4165.00	SR Technics Switzerland
664199					72-41-01		Package J	09	PLASMA SPRAY NO. 3 BEARING MOUNTING FLANGE SNAP DIAMETER		4165.00	SR Technics Switzerland
664199					72-41-01		Package K	10	PLASMA SPRAY FRONT OUTER FLANGE FACE		4165.00	SR Technics Switzerland
664199					72-41-01		Package L	11	PLASMA SPRAY FRONT INNER FLANGE FACE		2185.00	SR Technics Switzerland
664199					72-41-01		Package M	12	PLASMA SPRAY REAR OUTER FLANGE FACE		4165.00	SR Technics Switzerland
664199					72-41-01		Package N	13	PLASMA SPRAY REAR INNER FLANGE FACE		4165.00	SR Technics Switzerland
664199					72-41-01		Package O	14	BLEND SURFACE DAMAGE		815.00	SR Technics Switzerland
664199					72-41-01		Package P	15	REPLACE GANG NUT CHANNEL ASSEMBLIES		780.00	SR Technics Switzerland
664199					72-41-01		Package Q	16	REPLACE FUEL NOZZLE PAD INSERT		1185.00	SR Technics Switzerland
664199					72-41-01		Package R	26	BUSHING REPAIR INTERNAL TUBE BOSS ID (TACK WELD METHOD)		6265.00	SR Technics Switzerland
664199					72-41-01		Package S	27	BUSHING REPAIR NO. 3 BEARING (OIL) PRESSURE TUBE BOSS ID (TACK WELD METHOD)		1740.00	SR Technics Switzerland
664199					72-41-01		Package SB00	PW4ENG A72-753	FLUORESCENT PENETRANT INSPECTION (FPI)	IN CONJUNCTION WITH PACKAGE A	650.00	SR Technics Switzerland
664199					72-41-01		Package SB01	PW4ENG A72-681	RE-IDENTIFICATION AND INSPECTION OF AREA BETWEEN THE TT3 (OVAL) BOSS AND THE BRACKET (ROUND) BOSS		630.00	SR Technics Switzerland
664199					72-41-01		Package SB01	PW4G100 A72-123	RE-IDENTIFICATION AND INSPECTIUN-OF AREA BETWEEN THE TT3 (OVAL) BOSS AND THE BRACKET (ROUND) BOSS		630.00	SR Technics Switzerland
664199					72-41-01		Package SB02	PW4ENG 72-699	MODIFICATION OF TO REDUCE STRESS IN THE TT3 BOSS AREA		140.00	SR Technics Switzerland
664199					72-41-01		Package SB03	PW4ENG 72-710	MODIFICATION OF TO REMOVE CRACKS AND POROSITY IN THE BRACKET BOSS AREAS		140.00	SR Technics Switzerland
664199					72-41-01		Package SB03	PW4G-100-72-157	MODIFICATION OF TO REMOVE CRACKS AND POROSITY IN THE BRACKET BOSS AREAS		140.00	SR Technics Switzerland
664199					72-41-01		Package T	28	BUSHING REPAIR INTERNAL TUBE BOSS ID (TACK WELD METHOD)		2585.00	SR Technics Switzerland
664199					72-41-01		Package U	30	WELD REPAIR CRACKS (VENDOR APPLICATION)		10770.00	SR Technics Switzerland
664199					72-41-01		Package V	31	STRUT SURFACE CRACK REPAIR (VENDOR APPLICATION)		10770.00	SR Technics Switzerland
664199					72-41-01		Package W	32	HELICAL COIL INSERT REPAIR EEC BURNER PRESSURE BOSS AND P53 MUSCLE AIR BOSS		740.00	SR Technics Switzerland
664199					72-41-01		Package X	33	HELICAL COIL INSERT REPAIR SERVICE BOSS THREADS		1000.00	SR Technics Switzerland
664199					72-41-01		Package Y	34	HELICAL COIL INSERT REPAIR BRACKET MOUNTING (DOGBONE) BOSSES		740.00	SR Technics Switzerland
664199					72-41-01		Package Z	40	OVERSIZE THREADED INSERT REPAIR FOR FUEL NOZZLE PAD		2435.00	SR Technics Switzerland
664199					72-41-01		Package Z	42	OVERSIZE THREADED INSERT REPAIR FOR BRACKET MOUNTING BOSSES		2435.00	SR Technics Switzerland
665040	51G175	EASA,FAA,CAAC,ANAC	4	28	72-34-35	CARBON SEAL ASSEMBLY BRG.1.5/2	Package A	ASSEMBLY	ASSEMBLE SEAL ASSEMBLY		315.00	SR Technics Switzerland
665041	51D765	EASA,FAA,CAAC,ANAC	4	28	72-34-04	SEAL ASSY BRG.2	Package A	ASSEMBLY	ASSEMBLE SEAL ASSEMBLY		360.00	SR Technics Switzerland
665124	75A007-5	EASA,FAA,CAAC,ANAC	9	21	78-11-12	EXHAUST PLUG END CAP	Package A	CLN/INSP	CLEANING AND INSPECTION		365.00	SR Technics Switzerland
665124					78-11-12		Package E	004	CRACKS WELD REPAIR		2095.00	SR Technics Switzerland
665124					78-11-12		Package I	008	WELD REPAIR		2515.00	SR Technics Switzerland
665443	71R152-01	EASA,FAA,CAAC,ANAC	2	21	72-09-71	PW4 TUBES	Package A	CLN/INSP	CLEANING & INSPECTION		420.00	SR Technics Switzerland
665443					72-09-71		Package A	INSP-05	PRESSURE TEST		420.00	SR Technics Switzerland
665443					72-09-71		Package B	01	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
665443					72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		285.00	SR Technics Switzerland
665443					72-09-71		Package E	04	BLEND REPAIR SURFACE DAMAGE		125.00	SR Technics Switzerland
665443					72-09-71		Package F	05	DENT REPAIR WITHOUT REMOVABLE PARTS		1700.00	SR Technics Switzerland
665443					72-09-71		Package L	11	BLEND REPAIR OF SURFACE DAMAGED AREA ON HEAT SHIELD, TUBE CONNECTOR NUTS, COUPLING, FERRULE		155.00	SR Technics Switzerland
665443					72-09-71		Package W	22	REPAIR OUTER/INNER CONICAL SEAT	SPM 70-00-00	240.00	SR Technics Switzerland
668091	51A562-002	EASA,FAA,CAAC,ANAC	5	28	72-41-85	CARBON SEAL ASSEMBLY BRG.3 REAR	Package A	CLN/INSP	DISASSEMBLY, CLEANING, ASSEMBLY, TEST		1085.00	SR Technics Switzerland
670922	50G894	EASA,FAA,CAAC,ANAC	4	28	72-34-15	PW4 NO.2 BRG REAR SEAL SEAT	Package A	CLN/INSP	CLEANING & INSPECTION		125.00	SR Technics Switzerland
670946	51A681	EASA,FAA,CAAC,ANAC,TCCA	6	28	72-31-80	PW4 COVER FOR CONESEGMT	Package A	CLN/INSP	CLEANING AND INSPECTION		295.00	SR Technics Switzerland
670946	51A760	EASA,FAA,CAAC,ANAC,TCCA			72-31-80		Package C	002	LOCAL REPAIR OF SURFACE DAMAGE		760.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
670946					72-31-80		Package D	003	LOCAL REPAIR OF PROTECTIVE SURFAC		1705.00	SR Technics Switzerland
670946					72-31-80		Package SB00	PW4ENG 72-619	INLET COMP. FRONT CONE SEGMENT REPL.		380.00	SR Technics Switzerland
670946					72-31-80		Package SB01	PW4G-100-72-70	INLET CONE SEGMENT: P/N 794629 TO 51A681		360.00	SR Technics Switzerland
671061	505069	EASA,FAA,CAAC,ANAC	4	28	72-35-69	PW4 RCC REAR SUPPORT HPC REAR CASE	Package A	CLN/INSP	CLEANING & INSPECTION		620.00	SR Technics Switzerland
671157	50A614	EASA,FAA,CAAC,ANAC	4	28	72-34-32	PW4 GEARBOX DRIVE (OIL) NOZZLE ASSEMBLY	Package A	CLN/INSP	Cleaning and inspection		340.00	SR Technics Switzerland
671176	50A317	EASA,FAA,CAAC,ANAC	5	28	72-34-29	PW4 OIL NOZZLE ASSEMBLY BRG NO. 1.15	Package A	CLN/INSP	Cleaning and inspection		250.00	SR Technics Switzerland
672293	420587	EASA,FAA,CAAC,ANAC	3	21	73-21-19	PW4 BIFURCATION CONDUIT (100")	Package A	CLN/INSP	CLEANING & INSPECTION		355.00	SR Technics Switzerland
672293	58T543	EASA,FAA,CAAC,ANAC			73-21-19		Package B	TEST	PRE TEST		1200.00	SR Technics Switzerland
672293					73-21-19		Package H	07	REPLACE NUT PLATES		140.00	SR Technics Switzerland
672293					73-21-19		Package J	09	REPLACE RUBBER BUMPER PLUG IN THE SHOBOX BUMPER BRACKET		160.00	SR Technics Switzerland
672785	52G530-01	EASA,FAA,CAAC,ANAC	4	28	72-34-01	FAN EXIT CASE BRACKET ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		360.00	SR Technics Switzerland
672785					72-34-01		Package B	SPM	REPLACE NUTPLATES		270.00	SR Technics Switzerland
672786	51T766-01	EASA,FAA,CAAC,ANAC	4	21	72-09-73	PW4 VARIOUS BRACKETS GENERAL	Package A	CLN/INSP	CLEANING AND INSPECTION		360.00	SR Technics Switzerland
672786	52T309-01	EASA,FAA,CAAC,ANAC			72-09-73		Package B	SPM	REPLACE INSERTS		135.00	SR Technics Switzerland
672786	58T534-01	EASA,FAA,CAAC,ANAC			72-09-73		Package C	SPM	REPLACE NUTPLATES		155.00	SR Technics Switzerland
672786	59T929-01	EASA,FAA,CAAC,ANAC			72-09-73		Package D	SPM	REPLACE SPRING TENSION CLIP		145.00	SR Technics Switzerland
672791	56T214-01	EASA,FAA,CAAC,ANAC	2	21	72-09-71	PW4 EXTERNAL TUBES	Package A	CLN/INSP	CLEANING & INSPECTION		230.00	SR Technics Switzerland
672791					72-09-71		Package A	INSP-CHECK-05	PRESSURE TEST		230.00	SR Technics Switzerland
672791					72-09-71		Package B	01	APPLY ANTIGALLING COMPOUND		80.00	SR Technics Switzerland
672791					72-09-71		Package C	02	THRUST WIRE INSTALLATION		270.00	SR Technics Switzerland
672791					72-09-71		Package D	04	BLEND REPAIR SURFACE DAMAGE		230.00	SR Technics Switzerland
672791					72-09-71		Package E	05	DENT REPAIR		1490.00	SR Technics Switzerland
672791					72-09-71		Package F	07	LINER,NUT,REDUCER,ELBOW,SLEEVE REPLACEMENT		810.00	SR Technics Switzerland
672791					72-09-71		Package G	10	HEAT SHIELD REPAIR OF BLEED DUCT		455.00	SR Technics Switzerland
672791					72-09-71		Package H	11	REPAIR OF DAMAGED AREA ON HEAT SHIELD TUBE CONNECTOR NUTS, COUPLING, FERRULE		280.00	SR Technics Switzerland
672791					72-09-71		Package I	12	DAMAGED AREA HEATSHIELD STRAP GUIDE REPAIR		270.00	SR Technics Switzerland
672791					72-09-71		Package SB00	PW4G-100-A72-15	INSPECTION OF STARTING AIR ACTUATION TUBE (AA96)	SB PW4G-100-A72-158	275.00	SR Technics Switzerland
672791					72-09-71		Package SB01	PW4G-100-80-5	STARTER, CONNECT. ASSEMBLY MODI OR REPLACEMENT RR TUBE TO D PART 001		2075.00	SR Technics Switzerland
672791					72-09-71		Package W	22	REPAIR CONICAL SEAT	70-00-00	180.00	SR Technics Switzerland
672809	50U794-01	EASA,FAA,CAAC,ANAC	5	21	72-09-71	PW4000 TUBES	Package A	CLN/INSP	Cleaning and inspection		420.00	SR Technics Switzerland
672809	52T574-01	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		420.00	SR Technics Switzerland
672809	52T830-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	ANTISIZE COMPOUND APPLICATION		80.00	SR Technics Switzerland
672809	53T193-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	THRUST WIRE INSTALLATION		395.00	SR Technics Switzerland
672809	54T376-01	EASA,FAA,CAAC,ANAC			72-09-71		Package D	48	OIL TUBE, COATING REPAIR		730.00	SR Technics Switzerland
672809	58T361-01	EASA,FAA,CAAC,ANAC			72-09-71		Package E	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	425.00	SR Technics Switzerland
672809	59T379-01	EASA,FAA,CAAC,ANAC			72-09-71		Package F	SPM	RIVET REMOVAL PROCEDURE	SPM 70-43-00	355.00	SR Technics Switzerland
672811	50P187-01	EASA,FAA,CAAC,ANAC	4	21	72-09-71	PW4 Tubes external	Package A	CLN/INSP	Cleaning and inspection		420.00	SR Technics Switzerland
672811	50P189-01	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	INSPECTION CHECK 05	PRESSURE TEST	420.00	SR Technics Switzerland
672811	50P196-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	ANTISIZE COMPOUND APPLICATION		80.00	SR Technics Switzerland
672811	51A296-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	THRUST WIRE INSTALLATION		285.00	SR Technics Switzerland
672811	59T129-01	EASA,FAA,CAAC,ANAC			72-09-71		Package D	04	REBLEND REPAIR SURFACE DAMAGE		180.00	SR Technics Switzerland
672811					72-09-71		Package E	05	DENT REPAIR		1435.00	SR Technics Switzerland
672811					72-09-71		Package F	07	LINER,NUT,REDUCER,ELBOW,SLEEVE REPLACEMENT		905.00	SR Technics Switzerland
672811					72-09-71		Package G	11	REPAIR OF DAMAGED AREA ON HEAT SHIELD TUBE		280.00	SR Technics Switzerland
672811					72-09-71		Package H	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	275.00	SR Technics Switzerland
672812	52T576-01	EASA,FAA,CAAC,ANAC	4	21	72-09-71	PW4 TUBES (REPAIR HEAVY) CCP > 4000 USD	Package A	CLN/INSP	Cleaning and inspection		420.00	SR Technics Switzerland
672812	53T209-01	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	INSPECTION CHECK 05	PRESSURE TEST	420.00	SR Technics Switzerland
672812	58T362-01	EASA,FAA,CAAC,ANAC,TCCA			72-09-71		Package B	01	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
672812					72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		395.00	SR Technics Switzerland
672812					72-09-71		Package D	04	BLEND REPAIR SURFACE DAMAGE		230.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672812					72-09-71		Package E	05	DENT REPAIR		1435.00	SR Technics Switzerland
672812					72-09-71		Package F	07	LINER,NUT,REDUCER,ELBOW,SLEEVE REPLACEMENT		905.00	SR Technics Switzerland
672812					72-09-71		Package G	11	REPAIR OF DAMAGED AREA ON HEAT SHIELD		280.00	SR Technics Switzerland
672812					72-09-71		Package H	13	MINOR GOUGE, TEAR, CUT OF FLEXIBLE TUBE FIRE SLEEVE REPAIR		280.00	SR Technics Switzerland
672812					72-09-71		Package I	18	FLANGE COAT REPLACEMENT		780.00	SR Technics Switzerland
672812					72-09-71		Package J	20	STRAINER ELEMENT HOUSING ASSY FLA		375.00	SR Technics Switzerland
672812					72-09-71		Package K	SPM	REPLACE DEFECT INSERTS		220.00	SR Technics Switzerland
672812					72-09-71		Package L	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	425.00	SR Technics Switzerland
672812					72-09-71		Package M	SPM	REPLACE RIVETED STOP NUT	SPM 70-43-00	355.00	SR Technics Switzerland
672813	53T165-01	EASA,FAA,CAAC,ANAC	4	21	72-09-71	PW4 TUBES (REPAIR MEDIUM) CCP 2000-4000	Package A	CLN/INSP	CLEANING AND INSPECTION		420.00	SR Technics Switzerland
672813					72-09-71		Package A	INSP-05	INSPECTION CHECK 05	PRESSURE TEST	420.00	SR Technics Switzerland
672813					72-09-71		Package B	01	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
672813					72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		285.00	SR Technics Switzerland
672813					72-09-71		Package D	04	BLEND REPAIR SURFACE DAMAGE		125.00	SR Technics Switzerland
672813					72-09-71		Package E	05	DENT REPAIR WITHOUT REMOVABLE PARTS		1490.00	SR Technics Switzerland
672813					72-09-71		Package F	11	REPAIR OF DAMAGED AREA ON HEAT SHIELD		280.00	SR Technics Switzerland
672813					72-09-71		Package G	48	OIL TUBE, COATING REPAIR		685.00	SR Technics Switzerland
672813					72-09-71		Package H	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	425.00	SR Technics Switzerland
672813					72-09-71		Package I	SPM	REPLACE RIVETED STOP NUT ACC.	SPM 70-43-00	355.00	SR Technics Switzerland
672814	50G809	EASA,FAA,ANAC	6	21	72-09-71	PW4 TUBES	Package A	CLN/INSP	CLEANING & INSPECTION		260.00	SR Technics Switzerland
672814	50G811	EASA,FAA,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		260.00	SR Technics Switzerland
672814	51G864-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
672814	51U930-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		290.00	SR Technics Switzerland
672814	57T896-01	EASA,FAA,CAAC,ANAC			72-09-71		Package D	04	BLEND REPAIR OF SURFACE DAMAGE		145.00	SR Technics Switzerland
672814	58T064-01	EASA,FAA,CAAC,ANAC			72-09-71		Package E	05	DENT REPAIR		1490.00	SR Technics Switzerland
672814					72-09-71		Package F	11	REPAIR OF DAMAGED AREA ON HEAT SHIELD TUBE		240.00	SR Technics Switzerland
672814					72-09-71		Package G	48	OIL TUBE COATING REPAIR		685.00	SR Technics Switzerland
672814					72-09-71		Package H	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	350.00	SR Technics Switzerland
672814					72-09-71		Package I	SPM	REPLACE RIVETED STOP NUT	SPM 70-43-00	290.00	SR Technics Switzerland
672815	56T656-01	EASA,FAA,CAAC,ANAC	4	21	72-09-71	PW4 TUBES (REPAIR LIGHT) CCP 800 - 20	Package A	CLN/INSP	CLEANING AND INSPECTION		420.00	SR Technics Switzerland
672815					72-09-71		Package A	INSP-05	PRESSURE TEST		420.00	SR Technics Switzerland
672815					72-09-71		Package B	01	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
672815					72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		285.00	SR Technics Switzerland
672815					72-09-71		Package D	SPM	REPAIR CONICAL SEAT		425.00	SR Technics Switzerland
672815					72-09-71		Package E	SPM	REPLACE RIVETED STOP NUT ACC.	SPM 70-43-00	285.00	SR Technics Switzerland
672816	51G818-01	EASA,FAA,CAAC,ANAC	5	21	72-09-71	PW4 TUBES (REPAIR LIGHT) CCP 800 - 2000	Package A	CLN/INSP	CLEANING AND INSPECTION		420.00	SR Technics Switzerland
672816	51G819-01	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		420.00	SR Technics Switzerland
672816	51G822-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
672816	51G862-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		395.00	SR Technics Switzerland
672816	53T684-01	EASA,FAA,CAAC,ANAC			72-09-71		Package D	SPM	REPAIR CONICAL SEAT		425.00	SR Technics Switzerland
672816					72-09-71		Package E	SPM	REPLACE RIVETED STOP NUT ACC.	SPM 70-43-00	355.00	SR Technics Switzerland
672817	51G861	EASA,FAA,ANAC	5	21	72-09-71	PW4 TUBES (INSPECTION ONLY) CCP <800	Package A	CLN/INSP	CLEANING AND INSPECTION		315.00	SR Technics Switzerland
672817	52G126-01	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		315.00	SR Technics Switzerland
672817					72-09-71		Package B	01	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
672817					72-09-71		Package C	SPM	REPAIR CONICAL SEAT		305.00	SR Technics Switzerland
672854	51B426-01	EASA,FAA,CAAC,ANAC	6	28	72-31-10	PW4000 94" LPC COMPRESSOR STG. 1,6,2 & 3	Package A	CLN/INSP	CLEANING AND INSPECTION		1110.00	SR Technics Switzerland
672854	54B916	EASA,FAA,CAAC,ANAC			72-31-10		Package AE	30	DAMAGED VANE POTTING (DRY ROTTED) COMPOUND REPLACEMENT REPAIR		9120.00	SR Technics Switzerland
672854	55B021-01	EASA,FAA,CAAC,ANAC			72-31-10		Package AF	39	BENT FLANGE STRAIGHTENING REPAIR		3055.00	SR Technics Switzerland
672854	56B016-001	EASA,FAA,CAAC,ANAC			72-31-10		Package AI	46	MISSING SILICONE RUBBER SEALANT REPLACEMENT REPAIR		8320.00	SR Technics Switzerland
672854	56B016-01	EASA,FAA,CAAC,ANAC			72-31-10		Package AJ	47	INNER AIRSEAL REPLACEMENT REPAIR		8540.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672854	568116	EASA,FAA,CAAC,ANAC			72-31-10		Package AK	48	INNER SHROUD REPLACEMENT REPAIR		14580.00	SR Technics Switzerland
672854	568116-003	EASA,FAA,CAAC,ANAC			72-31-10		Package AL	37	REMOVAL OF CORROSION		20735.00	SR Technics Switzerland
672854					72-31-10		Package B	01	ANODIZE TOUCH-UP		535.00	SR Technics Switzerland
672854					72-31-10		Package C	02	BLEND REPAIR VANES		1375.00	SR Technics Switzerland
672854					72-31-10		Package C	05	BLEND REPAIR OUTER SHROUD		1375.00	SR Technics Switzerland
672854					72-31-10		Package D	03	CRACK REPAIR (MINOR) LPC (STAGE 1.6, 2, AND 3) COMPRESSOR STATOR ASSEMBLY INNER SHROUD		495.00	SR Technics Switzerland
672854					72-31-10		Package E	04	REPLACE LPC (STAGE 1.6, 2 AND 3) COMPRESSOR STATOR ASSEMBLY INNER SHROUD		17695.00	SR Technics Switzerland
672854					72-31-10		Package G	06	REPLACE VANE REPAIR		16640.00	SR Technics Switzerland
672854					72-31-10		Package M	12	PUT THE JACKSCREW HOLES IN NEW POSITIONS		1570.00	SR Technics Switzerland
672854					72-31-10		Package N	13	REPLACE SILICONE RUBBER RUBSTRIP LPC (STAGE 1.6, 2 AND 3) COMPRESSOR STATOR ASSEMBLY		11290.00	SR Technics Switzerland
672854					72-31-10		Package O	14	ALUMINUM BAND REPLACEMENT		9490.00	SR Technics Switzerland
672854					72-31-10		Package P	15	REPLACE INNER SHROUD		11290.00	SR Technics Switzerland
672854					72-31-10		Package Q	16	REPAIR THE AREA AROUND A JACKSCREW HOLE WITH A DOUBLER		1020.00	SR Technics Switzerland
672854					72-31-10		Package SB00	PW4ENG 72-666	LPC, 1ST STAGE STATOR & 4TH STAGE DUCT -REPL. OF, OR MODIFIC. TC LPC STAGE 1.6, 2 AND 3 IMPROVED RUBBER R		17270.00	SR Technics Switzerland
672854					72-31-10		Package SB01	PW4ENG 72-781	NEW 1.6, 2ND, AND 3RD STAGE LPC SHROUD SEGMENTS AND SEAL SEGMENTS		21865.00	SR Technics Switzerland
672857	518626-001	EASA,FAA,CAAC,ANAC	5	28	72-31-10	PW4000 100" LPC COMPRESSOR STG 1.6 - 3	Package A	CLN/INSP	CLEANING AND INSPECTION		1110.00	SR Technics Switzerland
672857	518626-002	EASA,FAA,CAAC,ANAC			72-31-10		Package AE	30	DAMAGED VANE POTTING (DRY ROTTED) COMPOUND REPLACEMENT REPAIR		9120.00	SR Technics Switzerland
672857	518626-01	EASA,FAA,CAAC,ANAC			72-31-10		Package AF	44	INNER AIRSEAL REPLACEMENT REPAIR		8540.00	SR Technics Switzerland
672857	538186	EASA,FAA,CAAC,ANAC			72-31-10		Package AG	46	MISSING SILICONE RUBBER SEALANT REPLACEMENT REPAIR		8320.00	SR Technics Switzerland
672857	538226-01	EASA,FAA,CAAC,ANAC			72-31-10		Package AK	36	INNER SHROUD ALUMINUM BAND REPLACEMENT REPAIR		9490.00	SR Technics Switzerland
672857	598816-001	EASA,FAA,CAAC,ANAC			72-31-10		Package AL	37	REMOVAL OF CORROSION RESIDUE	CONTAINS REP-21 AND REP-17	17695.00	SR Technics Switzerland
672857	598816-01	EASA,FAA,CAAC,ANAC			72-31-10		Package AM	43	INNER SHROUD REPLACEMENT REPAIR		14580.00	SR Technics Switzerland
672857					72-31-10		Package AN	39	BENT FLANGE STRAIGHTENING REPAIR		3055.00	SR Technics Switzerland
672857					72-31-10		Package B	01	ANODIZE TOUCH-UP		535.00	SR Technics Switzerland
672857					72-31-10		Package R	17	BLEND REPAIR OUTER SHROUD AND VANE		1375.00	SR Technics Switzerland
672857					72-31-10		Package S	18	SILICONE RUBBER OUTER AIRSEAL REPAIR		9760.00	SR Technics Switzerland
672857					72-31-10		Package SB00	PW4G-100-72-119	REPLACEMENT OR MODIFICATION OF LPC STATOR ASSY 1.6 - 3 STG 1.3 & 4.TH STG DUCT RUBBER		15250.00	SR Technics Switzerland
672857					72-31-10		Package SB01	PW4G-100-72-189	REPLACEMENT OR MODIFICATION TO INCORPORATE IMPROVED INNER SHROUD RUBSTRIPS		12785.00	SR Technics Switzerland
672857					72-31-10		Package SB02	PW4G-100-72-259	REPLACEMENT OR MODIFICATION TO INCREASE THE 3RD STAGE BLADE TIP TO OUTER AIR SEAL (OAS) CLEARANCE		600.00	SR Technics Switzerland
672857					72-31-10		Package SB03	PW4G-100-72-259	C3STATOR INCREASED BLADE TIP CLEARANCE		8005.00	SR Technics Switzerland
672857					72-31-10		Package T	19	CRACK REPAIR LPC STAGE 1.6, 2 AND 3 COMPRESSOR STATOR ASSEMBLY INNER SHROUD		495.00	SR Technics Switzerland
672857					72-31-10		Package U	20	REPLACE THE INNER AIRSEAL REPAIR		8480.00	SR Technics Switzerland
672857					72-31-10		Package V	21	REPLACE VANE REPAIR		16640.00	SR Technics Switzerland
673029	56H191-01	EASA,FAA,CAAC,ANAC,CAA UK	5	28	72-35-61	PW4 STG 11 & 12 COMPRESSOR STATOR SET	Package A	CLN/INSP	CLEANING AND INSPECTION		1175.00	SR Technics Switzerland
673029					72-35-61		Package AA	26	WELD FEATHERSEAL SLOT AND FELTMETAL RUBSTRIP		14850.00	SR Technics Switzerland
673029					72-35-61		Package E	04	REPLACE FELTMETAL STG.12 OS 25501		6000.00	SR Technics Switzerland
673029					72-35-61		Package F	05	REPLACE FELTMETAL STG.13 OS 25501		6000.00	SR Technics Switzerland
673029					72-35-61		Package H	07	INDIVIDUAL VANE REPLACEMENT OS 255007		8415.00	SR Technics Switzerland
673029					72-35-61		Package O	14	REPLACE PWA 53-78 PLASMA COAT		1170.00	SR Technics Switzerland
673029					72-35-61		Package P	15	BLEND STAGE 11 AND 12 HPC		645.00	SR Technics Switzerland
673029					72-35-61		Package R	17	WELD CRACKS IN ANTI ROTATION SLOT		1580.00	SR Technics Switzerland
673029					72-35-61		Package S	18	WELD CRACKS IN THE OUTER SHROUD LUG		1295.00	SR Technics Switzerland
673032	57H283-01	EASA,FAA,CAAC,ANAC	5	28	72-35-62	PW4 STG 13 AND 14 COMPRESSOR STATOR SET	Package A	CLN/INSP	CLEANING AND INSPECTION		1850.00	SR Technics Switzerland
673032					72-35-62		Package AA	26	WELD CRACKS IN THE ANTI-ROTATION SLOTS		1875.00	SR Technics Switzerland
673032					72-35-62		Package AB	27	WELD CRACKS IN THE OUTER SHROUD LUG		1130.00	SR Technics Switzerland
673032					72-35-62		Package AF	31	BOROSCOPE BOSS REPLACEMENT REPAIR		1630.00	SR Technics Switzerland
673032					72-35-62		Package AG	32	FEATHERSEAL SLOT AND FELTMETAL RUBSTRIP POCKET WELD		8435.00	SR Technics Switzerland
673032					72-35-62		Package B	01	BLEND REPAIR		555.00	SR Technics Switzerland
673032					72-35-62		Package E	04	REPLACE FELTMETAL STG.14 OS 25501		5000.00	SR Technics Switzerland
673032					72-35-62		Package F	05	REPLACE FELTMETAL STG.15 OS 25501		5000.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
673032					72-35-62		Package R	17	DUAL ARC WIRE COATING OF THE FRONT FACE FOR WEAR UP		2125.00	SR Technics Switzerland
673032					72-35-62		Package S	18	REMOVE AND REPLACE PWA 53-78		940.00	SR Technics Switzerland
673035	56H519-01	EASA,FAA,CAAC,ANAC	6	35	72-35-60	PW4 STAGE 9 AND 10 COMPRESSOR STATOR SET	Package A	CLN/INSP	CLEANING AND INSPECTION		1700.00	SR Technics Switzerland
673035					72-35-60		Package AE	28	WELD REPAIR DAMAGED SHROUD AREAS		2415.00	SR Technics Switzerland
673035					72-35-60		Package AI	32	AXIAL FLANGE CREEKS WELD REPAIR		3905.00	SR Technics Switzerland
673035					72-35-60		Package AJ	32	PLASMA AND WELD REPAIR AXIAL FLAN		5560.00	SR Technics Switzerland
673035					72-35-60		Package AK	36	INTERMIXING STATOR SET STG. 9 AND STG. 10		580.00	SR Technics Switzerland
673035					72-35-60		Package B	01	BLEND VANES		1210.00	SR Technics Switzerland
673035					72-35-60		Package C	02	REMOVE AND REPLACE NUT ASSEMBLIES		455.00	SR Technics Switzerland
673035					72-35-60		Package D	03	REPLACE OUTER SHROUD FELTMETAL SEAL SEGMENTS (STAGE 10)		9900.00	SR Technics Switzerland
673035					72-35-60		Package E	04	REPLACE OUTER SHROUD FELTMETAL SEAL SEGMENTS (STAGE 11)		9900.00	SR Technics Switzerland
673035					72-35-60		Package I	08	INTERMEDIATE "W" SEAL FACE		2670.00	SR Technics Switzerland
673035					72-35-60		Package J	09	PLASMA SPRAY FRONT SEAL FACE		2910.00	SR Technics Switzerland
673035					72-35-60		Package K	10	PLASMA SPRAY REPAIR OF THE REAR SNAP DIAMETER (SURFACE XC)		2995.00	SR Technics Switzerland
673035					72-35-60		Package L	11	PLASMA SPRAY REPAIR OF THE INTERMEDIATE "W" SEAL INNER SNAP DIAMETER (SURFACE D)		3215.00	SR Technics Switzerland
673035					72-35-60		Package M	12	PLASMA SPRAY REPAIR THE INTERMEDIATE "W" SEAL OUTER SNAP DIAMETER (SURFACE E)		3215.00	SR Technics Switzerland
673035					72-35-60		Package N	13	PLASMA SPRAY REPAIR OF THE FRONT SEAL INNER SNAP DIAMETER (SURFACE F)		3215.00	SR Technics Switzerland
673035					72-35-60		Package O	14	PLASMA SPRAY REPAIR OF THE FRONT SEAL OUTER SNAP DIAMETER (SURFACE G)		3215.00	SR Technics Switzerland
673035					72-35-60		Package R	17	REPAIR CRACKED SEGMENT END FLANGE HOLES		1975.00	SR Technics Switzerland
673035					72-35-60		Package S	18	WELD REPAIR CRACKS IN THE OUTER SHROUD LUG		1525.00	SR Technics Switzerland
673035					72-35-60		Package V	21	REPLACE THE INNER AIR SEAL ANTI-ROTATION PINS		1310.00	SR Technics Switzerland
673035					72-35-60		Package X	23	WELD THE 9TH STAGE VANE DAMAGE		3180.00	SR Technics Switzerland
673035					72-35-60		Package Y	24	AXIAL FLANGE SQUARENESS REPAIR		1225.00	SR Technics Switzerland
673035					72-35-60		Package Z	25	BORESCOPE BOSS REPLACEMENT REPAIR		1700.00	SR Technics Switzerland
673637	51H530	EASA,FAA,CAAC,ANAC	4	28	72-35-67	PW4 HPC REAR SUPPORT	Package A	CLN/INSP	CLEANING AND INSPECTION		445.00	SR Technics Switzerland
673637	55H302	EASA,FAA,CAAC,ANAC			72-35-67		Package B	01	PLASMA COAT INNER FLANGE SNAP DIAMETER		2420.00	SR Technics Switzerland
673637					72-35-67		Package D	03	PLASMA COAT OUTER FLANGE FRONT FACE		2420.00	SR Technics Switzerland
673637					72-35-67		Package E	04	PLASMA COAT OUTER FLANGE SNAP DIAMETER		2420.00	SR Technics Switzerland
673637					72-35-67		Package F	05	RESTORE CORROSION PROTECTIVE COATING		1295.00	SR Technics Switzerland
673637					72-35-67		Package J	09	INNER FACE FRONT FLANGE PLASMA COAT REPAIR		2220.00	SR Technics Switzerland
673642	50R408	EASA,FAA,CAAC,ANAC	5	28	72-41-92	PW4 GEARBOX SUPPORT CLEVIS, LEFT AND RI	Package A	CLN/INSP	CLEANING AND INSPECTION		205.00	SR Technics Switzerland
673642	50R409	EASA,FAA,CAAC,ANAC			72-41-92		Package B	01	CHROME PLATE INDEX 1 HOLE SUPPORT CLEVIS		1490.00	SR Technics Switzerland
673642	70T530	EASA,FAA,CAAC,ANAC			72-41-92		Package C	02	BUSHING REPAIR SUPPORT CLEVIS HOLES		850.00	SR Technics Switzerland
673642	70T531	EASA,FAA,CAAC,ANAC			72-41-92		Package D		REMOVE DEFECTIVE BOLTS FROM CLAMP		170.00	SR Technics Switzerland
673649	70T334	EASA,FAA,CAAC,ANAC	4	28	72-61-87	PW4 GEARBOX SUPPORT LINK LOWER HOLLOW PIN	Package A	CLN/INSP	Cleaning and inspection		175.00	SR Technics Switzerland
673657	796146	EASA,FAA,CAAC,ANAC	6	28	72-53-84	PW4 NO.4 BEARING RETAINING PLATE STEEL	Package A	CLN/INSP	CLEANING AND INSPECTION		500.00	SR Technics Switzerland
673657					72-53-84		Package B	01	NICKEL PLATE SNAP DIAMETER		820.00	SR Technics Switzerland
673657					72-53-84		Package C	02	NICKEL PLATE PACKING SEAL LAND		820.00	SR Technics Switzerland
673659	50A182	EASA,FAA,CAAC,ANAC	5	28	72-34-20	PW4 BRG 1.5 BEARING SUPPORT ASSEMBLY ST	Package A	CLN/INSP	CLEANING AND INSPECTION		490.00	SR Technics Switzerland
673659					72-34-20		Package C	02	PLASMA SPRAY REAR SNAP DIAMETER		1875.00	SR Technics Switzerland
673659					72-34-20		Package D	03	PLASMA SPRAY No.1.5 BEARING JOURN		1965.00	SR Technics Switzerland
673659					72-34-20		Package E	04	REPLACE CLINCH NUTS		300.00	SR Technics Switzerland
673659					72-34-20		Package F	05	REPLACE HELICAL COIL INSERTS		155.00	SR Technics Switzerland
673659					72-34-20		Package SB00	PW4G-100-A72-10	INSPECTION OF THE SUPPORT FOR A THIN WALL CONDITION		1995.00	SR Technics Switzerland
673659					72-34-20		Package SB01	PWAENG 72-789	INSPECTION FOR DUPLICATE SERIAL NUMBERS ON BEARING SUPPORTS		70.00	SR Technics Switzerland
673659					72-34-20		Package SB02	PWAENG 72-678	INSPECTION OF TO IDENTIFY CERTAIN THAT MUST BE REMOVED FROM SERVICESUPPORTS		70.00	SR Technics Switzerland
673662	50B198	EASA,FAA,CAAC,ANAC	6	28	72-31-28	PW4 #1 BEARING SEAL SUPPORT ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		760.00	SR Technics Switzerland
673662	50B770	EASA,FAA,CAAC,ANAC			72-31-28		Package D	03	CLINCH NUT REPLACEMENT		3970.00	SR Technics Switzerland
673662					72-31-28		Package E	04	OUTER MATING DIAMETER PLASMA COAT	ALUMINIUM PART	2495.00	SR Technics Switzerland
673662					72-31-28		Package F	05	OUTER MATING DIAMETER PLASMA COAT	TITANIUM PART	2720.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
673666	51A478-01	EASA,FAA,CAAC,ANAC	5	28	72-54-83	PW4 NO.4 BEARING COVER ASSEMBLY TITANIU	Package A	CLN/INSP	CLEANING AND INSPECTION		290.00	SR Technics Switzerland
673666					72-54-83		Package SB00	PW4ENG 72-385	ADD JACKSCREW HOLES TO NO.4 BEARING COVER		470.00	SR Technics Switzerland
673681	50A478	EASA,FAA,CAAC,ANAC	4	28	72-41-86	PW4 NO.3 BARING SEAL RING HOLDER NICKEL	Package A	CLN/INSP	CLEANING AND INSPECTION		420.00	SR Technics Switzerland
673681					72-41-86		Package A	INSP-05	INSP/CHK-05 LEAK CHECK		420.00	SR Technics Switzerland
673681					72-41-86		Package B	01	NICKEL PLATE INSIDE SNAP DIA		2790.00	SR Technics Switzerland
673681					72-41-86		Package C	02	SEAL RING GROOVE REPAIR		1275.00	SR Technics Switzerland
673681					72-41-86		Package D	03	REPLACE RETAINING PIN		3055.00	SR Technics Switzerland
673681					72-41-86		Package E	04	NICKEL PLATE FRONT SNAP INNER DIA		2790.00	SR Technics Switzerland
673681					72-41-86		Package F	05	INSERT REPLACEMENT REPAIR		305.00	SR Technics Switzerland
673681					72-41-86		Package L	11	BLEND SURFACE DAMAGE	MPN 50A478	305.00	SR Technics Switzerland
673746	782475-1	EASA,FAA,CAAC,ANAC	3	21	80-12-06	PW4000 Adapter and Clamp	Package A	CLN/INSP	CLEANING & INSPECTION		275.00	SR Technics Switzerland
673760	PW4000 BASIS ENGINE	EASA,FAA,ANAC	3	28	72-00-00	REPLACEMENT OF HELICOIL ON ENGINE/MODULE	Package B		REPLACE INSERTS ENGINE		280.00	SR Technics Switzerland
673760					72-00-00		Package C		REPLACE INSERTS MODULE		280.00	SR Technics Switzerland
673760					72-00-00		Package D		REPLACE INSERTS TEST CELL		310.00	SR Technics Switzerland
673760					72-00-00		Package E		REPLACE INSERTS QTL		280.00	SR Technics Switzerland
1288	577251	EASA,FAA,CAAC,ANAC	2	21	75-41-01	PROBE-THERMOCOUPLE	Package B		OVERHAUL		945.00	SR Technics Switzerland
1288	HAD20836	EASA,FAA,CAAC,ANAC										
1777	51U615	EASA,FAA,CAAC,ANAC	15	21	71-21-16	FWD ENGINE MOUNT - BOLT - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		265.00	SR Technics Switzerland
1778	51U616	EASA,FAA,CAAC,ANAC	16	21	71-22-16	REAR ENGINE MOUNT - BOLT - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION	PNS5TS32 FOR SHOP VISIT ONLY	265.00	SR Technics Switzerland
2086	50G010	EASA,FAA,CAAC,ANAC	20	28	72-62-04	ANGLE GEARBOX - ANGLE GEARBOX BEARINGS	Package A	CLN/INSP	CLEANING AND INSPECTION		615.00	SR Technics Switzerland
2086	50G011	EASA,FAA,CAAC,ANAC										
2086	50G013	EASA,FAA,CAAC,ANAC										
2086	50G113	EASA,FAA,CAAC,ANAC										
2086	50G114	EASA,FAA,CAAC,ANAC										
2086	50G115	EASA,FAA,CAAC,ANAC										
2086	50G399	EASA,FAA,CAAC,ANAC										
2086	50G401	EASA,FAA,CAAC,ANAC										
2086	50G402	EASA,FAA,CAAC,ANAC										
2086	50G403	EASA,FAA,CAAC,ANAC										
2086	50G404	EASA,FAA,CAAC,ANAC										
2086	50G630	EASA,FAA,CAAC,ANAC										
2086	50G631	EASA,FAA,CAAC,ANAC										
2086	50G633	EASA,FAA,CAAC,ANAC										
2086	50G865	EASA,FAA,CAAC,ANAC										
2086	50G866	EASA,FAA,CAAC,ANAC										
2086	50G868	EASA,FAA,CAAC,ANAC										
2086	50G983	EASA,FAA,CAAC,ANAC										
2086	51G994	EASA,FAA,CAAC,ANAC										
2086	51G995	EASA,FAA,CAAC,ANAC										
2086	51G996	EASA,FAA,CAAC,ANAC										
2086	51G997	EASA,FAA,CAAC,ANAC										
2086	51G998	EASA,FAA,CAAC,ANAC										
2086	51G999	EASA,FAA,CAAC,ANAC										
2086	52G000	EASA,FAA,CAAC,ANAC										
2086	52G001	EASA,FAA,CAAC,ANAC										
2086	52G002	EASA,FAA,CAAC,ANAC										
2086	52G003	EASA,FAA,CAAC,ANAC										
2086	52G004	EASA,FAA,CAAC,ANAC										
2086	52G005	EASA,FAA,CAAC,ANAC										
2086	52G006	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
2086	52G007	EASA,FAA,CAAC,ANAC										
2086	71R081	EASA,FAA,CAAC,ANAC										
2086	71R082	EASA,FAA,CAAC,ANAC										
2140	23504-001	EASA,FAA,CAAC,ANAC	4	21	73-21-57	EEC THERMOCOUPLE PROBE (T13)	Package C	TEST	TEST		330.00	SR Technics Switzerland
2140	23744-000	EASA,FAA,CAAC,ANAC			73-21-57		Package C	TEST	PRE TEST		330.00	SR Technics Switzerland
2140	HAD20973	EASA,FAA,CAAC,ANAC			73-21-57		Package D		OVERHAUL		815.00	SR Technics Switzerland
2709	505728	EASA,FAA,CAAC,ANAC	34	28	72-35-53	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 6 HPC SYNCHRONIZING R	Package A	CLN/INSP	CLEANING AND INSPECTION	PN51H149 53H934 FOR SHOP VISIT ONLY	365.00	SR Technics Switzerland
2709	505730	EASA,FAA,CAAC,ANAC			72-35-53		Package B	01	REPLACE RING ASSEMBLY PIN AND LEVER ARM		1175.00	SR Technics Switzerland
2709	51H148	EASA,FAA,CAAC,ANAC			72-35-53		Package C	02	REPLACE NUT PLATES		670.00	SR Technics Switzerland
2709	51H149	EASA,FAA,CAAC,ANAC			72-35-53		Package F	05	WELD REPAIR OF VANE ARM PIN HOLES		2445.00	SR Technics Switzerland
2709	53H933	EASA,FAA,CAAC,ANAC			72-35-53		Package H	07	BLEND RING SEGMENT SURFACE DAMAGE		315.00	SR Technics Switzerland
2709	53H934	EASA,FAA,CAAC,ANAC			72-35-53		Package L	11	APPLY PWA 578 PAINT		970.00	SR Technics Switzerland
2709	54H801-01	EASA,FAA,CAAC,ANAC			72-35-53		Package M	12	RING SEGMENT SLOT WELD REPAIR		920.00	SR Technics Switzerland
2709	54H801-101	EASA,FAA,CAAC,ANAC			72-35-53		Package SB00	PW4ENG 72-432	SYNCHRONIZING RING - MODIFICATION OF PIN ATTACHMENT		1175.00	SR Technics Switzerland
2709	54H886	EASA,FAA,CAAC,ANAC			72-35-53		Package SB01	PW4ENG 72-474	SYNCHRONIZING RING - PAINT REMOVAL FROM ID		330.00	SR Technics Switzerland
2709	54H886-001	EASA,FAA,CAAC,ANAC			72-35-53		Package SB02	PW4ENG 72-527	SYNCHRONIZING RING STG 5 AND 6 - INCORPORATION OF LOCATING PIN		730.00	SR Technics Switzerland
2709	54H886-003	EASA,FAA,CAAC,ANAC			72-35-53		Package SB03	PW4ENG 72-837	SYNCHRONIZING RING STG 5 AND 6 REPL		1620.00	SR Technics Switzerland
2709	54H887	EASA,FAA,CAAC,ANAC										
2709	54H887-101	EASA,FAA,CAAC,ANAC										
2709	55H635-01	EASA,FAA,CAAC,ANAC										
2709	55H635-101	EASA,FAA,CAAC,ANAC										
2710	50H794	EASA,FAA,CAAC,ANAC	32	28	72-35-52	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 5 HPC SYNCHRONIZING R	Package A	CLN/INSP	CLEANING AND INSPECTION	PN54H780-01 50H794 54H795-01 54H902-01 5	365.00	SR Technics Switzerland
2710	50H795	EASA,FAA,CAAC,ANAC			72-35-52		Package B	01	REPLACE RING ASSEMBLY PIN AND LEVER ARM		1175.00	SR Technics Switzerland
2710	53H932	EASA,FAA,CAAC,ANAC			72-35-52		Package C	02	REPLACE NUT PLATES		670.00	SR Technics Switzerland
2710	54H780-01	EASA,FAA,CAAC,ANAC			72-35-52		Package F	05	WELD REPAIR OF VANE ARM PIN HOLES		2445.00	SR Technics Switzerland
2710	54H795-01	EASA,FAA,CAAC,ANAC			72-35-52		Package H	07	BLEND RING SEGMENT SURFACE DAMAGE		315.00	SR Technics Switzerland
2710	54H799-01	EASA,FAA,CAAC,ANAC			72-35-52		Package L	11	APPLY PWA 578 PAINT		970.00	SR Technics Switzerland
2710	54H884-001	EASA,FAA,CAAC,ANAC			72-35-52		Package SB00	PW4ENG 72-432	SYNCHRONIZING RING - MODIFICATION OF PIN ATTACHMENT		1175.00	SR Technics Switzerland
2710	54H885	EASA,FAA,CAAC,ANAC			72-35-52		Package SB01	PW4ENG 72-474	SYNCHRONIZING RING - PAINT REMOVAL FROM ID		330.00	SR Technics Switzerland
2710	54H902-01	EASA,FAA,CAAC,ANAC			72-35-52		Package SB02	PW4ENG 72-527	SYNCHRONIZING RING STG 5 AND 6 - INCORPORATION OF LOCATING PIN		730.00	SR Technics Switzerland
2710	55H626-01	EASA,FAA,CAAC,ANAC			72-35-52		Package SB03	PW4ENG 72-114	REPLACEMENT OR MODIFICATION FOR IMPROVED HPC ARM ASSEMBLY		1620.00	SR Technics Switzerland
2710	55H823-01	EASA,FAA,CAAC,ANAC										
2710	55H825-01	EASA,FAA,CAAC,ANAC										
2710	56H079-01	EASA,FAA,CAAC,ANAC										
2710	56H081-01	EASA,FAA,CAAC,ANAC										
2839	50D205	EASA,FAA,CAAC,ANAC	26	28	72-33-16	FAN CASE - BLEED VALVE CAM FOLLOWER DAMPER ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		200.00	SR Technics Switzerland
2839	50D613	EASA,FAA,CAAC,ANAC			72-33-16		Package B	01	REPLACE THE DAMPER ROLLER		300.00	SR Technics Switzerland
2839	52D338	EASA,FAA,CAAC,ANAC										
2839	52D341	EASA,FAA,CAAC,ANAC										
3202	286T3501-40	EASA,FAA,CAAC,ANAC	3	21	20-XX-XX	PW4000 ENGINE HARNESS	Package B		PRE-TESTING		565.00	SR Technics Switzerland
3202	286T3502-040	EASA,FAA,CAAC,ANAC			20-XX-XX		Package C		REPAIR LIGHT		1810.00	SR Technics Switzerland
3202	286T3502-044	EASA,FAA,CAAC,ANAC			20-XX-XX		Package D		REPAIR MEDIUM		2600.00	SR Technics Switzerland
3202	286T3502-40	EASA,FAA,CAAC,ANAC			20-XX-XX		Package E		REPAIR HEAVY		4230.00	SR Technics Switzerland
3202	286T3504-046	EASA,FAA,CAAC,ANAC			20-XX-XX		Package F		DISASSEMBLY		235.00	SR Technics Switzerland
3202	286T3504-056	EASA,FAA,CAAC,ANAC										
3202	286T3504-057	EASA,FAA,CAAC,ANAC										
3202	286T3504-059	EASA,FAA,CAAC,ANAC										
3202	286T3504-060	EASA,FAA,CAAC,ANAC										
3202	286T3504-42	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
3202	286T3506-003	EASA,FAA,CAAC,ANAC										
3202	286T3506-045	EASA,FAA,CAAC,ANAC										
3202	286T3506-047	EASA,FAA,CAAC,ANAC										
3202	286T3506-048	EASA,FAA,CAAC,ANAC										
3202	286T3506-050	EASA,FAA,CAAC,ANAC										
3202	286T3506-051	EASA,FAA,ANAC										
3202	286T3506-053	EASA,FAA,CAAC,ANAC										
3202	286T3506-056	EASA,FAA,CAAC,ANAC										
3202	286T3508-005	EASA,FAA,CAAC,ANAC										
3202	286T3508-041	EASA,FAA,CAAC,ANAC										
3202	286T3508-042	EASA,FAA,CAAC,ANAC										
3202	286T3508-044	EASA,FAA,CAAC,ANAC										
3202	286T3508-047	EASA,FAA,CAAC,ANAC										
3202	286T3508-050	EASA,FAA,CAAC,ANAC										
3202	286T3508-051	EASA,FAA,CAAC,ANAC										
3202	286T3508-053	EASA,FAA,CAAC,ANAC										
3202	286T3508-058	EASA,FAA,CAAC,ANAC										
3202	286T3508-41	EASA,FAA,CAAC,ANAC										
3202	286T3510-003	EASA,FAA,CAAC,ANAC										
3202	286T3510-041	EASA,FAA,CAAC,ANAC										
3202	286T3510-043	EASA,FAA,CAAC,ANAC										
3202	286T3510-044	EASA,FAA,CAAC,ANAC										
3202	286T3510-045	EASA,FAA,ANAC										
3202	286T3510-047	EASA,FAA,CAAC,ANAC										
3202	286T3510-41	EASA,FAA,CAAC,ANAC										
3202	286T3512-003	EASA,FAA,CAAC,ANAC										
3202	286T3512-040	EASA,FAA,CAAC,ANAC										
3202	286T3512-041	EASA,FAA,CAAC,ANAC										
3202	286T3512-043	EASA,FAA,CAAC,ANAC										
3202	286T3514-003	EASA,FAA,CAAC,ANAC										
3202	286T3514-041	EASA,FAA,CAAC,ANAC										
3202	286T3514-043	EASA,FAA,CAAC,ANAC										
3202	286T3514-40	EASA,FAA,CAAC,ANAC										
3202	286T3516-003	EASA,FAA,CAAC,ANAC										
3202	286T3516-041	EASA,FAA,CAAC,ANAC										
3202	286T3516-043	EASA,FAA,CAAC,ANAC										
3202	286T3516-40	EASA,FAA,CAAC,ANAC										
3202	286T3520-003	EASA,FAA,CAAC,ANAC										
3202	286T3520-041	EASA,FAA,CAAC,ANAC										
3202	286T3520-042	EASA,FAA,CAAC,ANAC										
3202	286T3520-044	EASA,FAA,CAAC,ANAC										
3202	286T3520-045	EASA,FAA,CAAC,ANAC										
3202	286T3520-047	EASA,FAA,CAAC,ANAC										
3202	286T3520-40	EASA,FAA,CAAC,ANAC										
3202	286T3522-003	EASA,FAA,CAAC,ANAC										
3202	286T3522-041	EASA,FAA,CAAC,ANAC										
3202	286T3522-043	EASA,FAA,CAAC,ANAC										
3202	286T3522-40	EASA,FAA,CAAC,ANAC										
3202	286T3538-042	EASA,FAA,CAAC,ANAC										
3202	286T3538-044	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
3202	286T3538-41	EASA,FAA,CAAC,ANAC										
3202	61B43502	EASA,FAA,CAAC,ANAC										
3202	61B43502-040	EASA,FAA,CAAC,ANAC										
3202	61B43502-044	EASA,FAA,CAAC,ANAC										
3202	61B43502-44	EASA,FAA,CAAC,ANAC										
3202	61B43504	EASA,FAA,CAAC,ANAC										
3202	61B43504-043	EASA,FAA,CAAC,ANAC										
3202	61B43504-046	EASA,FAA,CAAC,ANAC										
3202	61B43504-047	EASA,FAA,CAAC,ANAC										
3202	61B43504-050	EASA,FAA,CAAC,ANAC										
3202	61B43504-056	EASA,FAA,CAAC,ANAC										
3202	61B43506	EASA,FAA,CAAC,ANAC										
3202	61B43506-044	EASA,FAA,CAAC,ANAC										
3202	61B43506-049	EASA,FAA,CAAC,ANAC										
3202	61B43506-054	EASA,FAA,CAAC,ANAC										
3202	61B43506-055	EASA,FAA,CAAC,ANAC										
3202	61B43506-059	EASA,FAA,CAAC,ANAC										
3202	61B43508	EASA,FAA,CAAC,ANAC										
3202	61B43508-041	EASA,FAA,CAAC,ANAC										
3202	61B43508-042	EASA,FAA,CAAC,ANAC										
3202	61B43508-047	EASA,FAA,CAAC,ANAC										
3202	61B43508-051	EASA,FAA,CAAC,ANAC										
3202	61B43508-052	EASA,FAA,CAAC,ANAC										
3202	61B43510	EASA,FAA,CAAC,ANAC										
3202	61B43510-041	EASA,FAA,CAAC,ANAC										
3202	61B43510-042	EASA,FAA,CAAC,ANAC										
3202	61B43510-045	EASA,FAA,CAAC,ANAC										
3202	61B43510-046	EASA,FAA,CAAC,ANAC										
3202	61B43510-047	EASA,FAA,CAAC,ANAC										
3202	61B43512	EASA,FAA,CAAC,ANAC										
3202	61B43512-043	EASA,FAA,CAAC,ANAC										
3202	61B43514	EASA,FAA,CAAC,ANAC										
3202	61B43514-042	EASA,FAA,CAAC,ANAC										
3202	61B43514-043	EASA,FAA,CAAC,ANAC										
3202	61B43516	EASA,FAA,CAAC,ANAC										
3202	61B43516-042	EASA,FAA,CAAC,ANAC										
3202	61B43516-043	EASA,FAA,CAAC,ANAC										
3202	61B43520	EASA,FAA,CAAC,ANAC										
3202	61B43520-041	EASA,FAA,CAAC,ANAC										
3202	61B43520-042	EASA,FAA,CAAC,ANAC										
3202	61B43520-044	EASA,FAA,CAAC,ANAC										
3202	61B43520-047	EASA,FAA,CAAC,ANAC										
3202	61B43522	EASA,FAA,CAAC,ANAC										
3202	61B43522-042	EASA,FAA,CAAC,ANAC										
3202	61B43522-043	EASA,FAA,CAAC,ANAC										
3202	61B43538	EASA,FAA,CAAC,ANAC										
3202	61B43538-041	EASA,FAA,CAAC,ANAC										
3202	61B43538-0AA	EASA,FAA,CAAC,ANAC										
3606	51D415	EASA,FAA,CAAC,ANAC	9	21	73-21-56	PW4 EEC PROGRAMMING PLUG	Package A		FUNCTIONAL TEST		820.00	SR Technics Switzerland
3606	51D418	EASA,FAA,CAAC,ANAC			73-21-56		Package B	01	MOISTER REMOVAL		635.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
3606	51D429	EASA,FAA,CAAC,ANAC			73-21-56		Package C	02	CONNECTOR PIN REPAIR		635.00	SR Technics Switzerland
3606	51D434	EASA,FAA,CAAC,ANAC			73-21-56		Package D	03	REPLACEMENT OF DAMAGED		635.00	SR Technics Switzerland
3606	51D439	EASA,FAA,CAAC,ANAC			73-21-56		Package G		OVERHAUL		885.00	SR Technics Switzerland
3606	52D003	EASA,FAA,CAAC,ANAC			73-21-56		Package SB00	PW4ENG 72-755	RCC MODIFICATION (BOEING)		950.00	SR Technics Switzerland
3606	52D004	EASA,FAA,CAAC,ANAC			73-21-56		Package SB01	PW4ENG 72-756	RCC MODIFICATION (AIRBUS, SYMMETRIC)		950.00	SR Technics Switzerland
3606	52D005	EASA,FAA,CAAC,ANAC			73-21-56		Package SB02	PW4ENG 72-757	RCC MODIFICATION (MD-11)		950.00	SR Technics Switzerland
3606	52D009	EASA,FAA,CAAC,ANAC			73-21-56		Package SB03	PW4G-100-73-23	EEC PROGRAMMING PLUG - PROVIDE ADDITIONAL 20°C SHUNT CONFIGURATION		680.00	SR Technics Switzerland
3606	52D010	EASA,FAA,CAAC,ANAC										
3606	52D011	EASA,FAA,CAAC,ANAC										
3606	52D013	EASA,FAA,ANAC										
3606	52D014	EASA,FAA,CAAC,ANAC										
3606	52D032	EASA,FAA,ANAC										
3606	52D033	EASA,FAA,CAAC,ANAC										
3606	52D036	EASA,FAA,CAAC,ANAC										
3606	52D222	EASA,FAA,CAAC,ANAC										
3606	52D223	EASA,FAA,CAAC,ANAC										
3606	52D224	EASA,FAA,CAAC,ANAC										
3606	52D225	EASA,FAA,CAAC,ANAC										
3606	52D229	EASA,FAA,CAAC,ANAC										
3606	52D230	EASA,FAA,CAAC,ANAC										
3606	52D234	EASA,FAA,CAAC,ANAC										
3606	52D235	EASA,FAA,CAAC,ANAC										
3606	54D334	EASA,FAA,CAAC,ANAC										
3606	54D335	EASA,FAA,CAAC,ANAC										
3606	54D336	EASA,FAA,CAAC,ANAC										
3606	54D339	EASA,FAA,CAAC,ANAC										
3606	54D340	EASA,FAA,CAAC,ANAC										
3606	54D346	EASA,FAA,CAAC,ANAC										
3606	54D347	EASA,FAA,CAAC,ANAC										
3606	54D360	EASA,FAA,CAAC,ANAC										
3606	54D361	EASA,FAA,CAAC,ANAC										
9030	52H696-01	EASA,FAA,CAAC,ANAC	3	28	72-35-58	PW4 HPC SHROUD SEGMENT ASSEMBLY	Package A	CLN/INSP	CLEANING & INSPECTION		150.00	SR Technics Switzerland
9030	52H890-01	EASA,FAA,CAAC,ANAC			72-35-58		Package SB00	PW4G-100-72-121	REPLACE 11STG. HPC SHROUD SET		200.00	SR Technics Switzerland
9030	52H893-01	EASA,FAA,CAAC,ANAC										
9030	52H992-01	EASA,FAA,CAAC,ANAC										
9030	53H391-01	EASA,FAA,CAAC,ANAC										
9030	56H490-001	EASA,FAA,CAAC,ANAC										
9030	56H490-01	EASA,FAA,CAAC,ANAC										
9030	56H491-01	EASA,FAA,CAAC,ANAC										
9030	56H492-01	EASA,FAA,CAAC,ANAC										
9030	56H493-01	EASA,FAA,CAAC,ANAC										
9030	56H500-01	EASA,FAA,CAAC,ANAC										
9030	56H501-01	EASA,FAA,CAAC,ANAC										
9030	56H502-01	EASA,FAA,CAAC,ANAC										
9030	56H503-01	EASA,FAA,CAAC,ANAC										
9030	58H381-01	EASA,FAA,CAAC,ANAC										
9030	58H382-01	EASA,FAA,CAAC,ANAC										
9030	58H383-01	EASA,FAA,CAAC,ANAC										
9030	58H384-01	EASA,FAA,CAAC,ANAC										
9030	58H392-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
9030	58H394-01	EASA,FAA,CAAC,ANAC										
9030	59H578-01	EASA,FAA,CAAC,ANAC										
9030	59H580-01	EASA,FAA,CAAC,ANAC										
9030	59H588-01	EASA,FAA,CAAC,ANAC										
15167	221-0264-503	EASA,FAA,CAAC,ANAC	4	21	71-20-05	PW4 AFT ENGINE MOUNT PIN ITEM 1-300	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
18858	50P255-01	EASA,FAA,CAAC,ANAC	13	28	72-54-35	TURBINE EXHAUST CASE - NO. 4 BEARING SHIELD	Package A	CLN/INSP	CLEANING AND INSPECTION		160.00	SR Technics Switzerland
18858	50P347	EASA,FAA,CAAC,ANAC			72-54-35		Package B	02	DAMAGED FOIL MATERIAL SPOT WELD REPAIR		155.00	SR Technics Switzerland
18858	50P348-01	EASA,FAA,CAAC,ANAC										
18858	50P349-01	EASA,FAA,CAAC,ANAC										
18887	80876-20-5	EASA,FAA,CAAC,ANAC	4	21	71-20-05	AFT MOUNT MD-11 PIN & BOLTS	Package A	CLN/INSP	CLEANING AND INSPECTION		205.00	SR Technics Switzerland
18887	80876-20-6	EASA,FAA,CAAC,ANAC										
18888	221-0251-509	EASA,FAA,CAAC,ANAC	4	21	71-20-04	PW4 FWD MOUNT MD-11 BOLTS	Package A	CLN/INSP	CLEANING AND INSPECTION		205.00	SR Technics Switzerland
18888	221-0251-511	EASA,FAA,CAAC,ANAC										
18888	221-0251-515	EASA,FAA,CAAC,ANAC										
18888	221-0252-505	EASA,FAA,CAAC,ANAC										
18888	221-0252-507	EASA,FAA,CAAC,ANAC										
20803	50L171	EASA,FAA,CAAC,ANAC	3	28	72-00-52	PW4 TURBINE ROTOR-ASSEMBLY, 1ST STAGE	Package A	CLN/INSP	CLEANING & INSPECTION		495.00	SR Technics Switzerland
20803	50L471	EASA,FAA,CAAC,ANAC			72-00-52		Package B	INSP-02	INSPECTION/CHECK	PW 4168	695.00	SR Technics Switzerland
20803	50L671	EASA,FAA,CAAC,ANAC			72-00-52		Package C	INSP-03	INSPECTION/CHECK	PW 40XX, PW 41XX, PW 44XX	695.00	SR Technics Switzerland
20803	50L771	EASA,FAA,CAAC,ANAC										
20803	51L371	EASA,FAA,CAAC,ANAC										
20803	51L671	EASA,FAA,CAAC,ANAC										
20803	53L181	EASA,FAA,CAAC,ANAC										
20803	53L281	EASA,FAA,CAAC,ANAC										
20806	50L172	EASA,FAA,CAAC,ANAC	15	28	72-00-52	ENGINE GENERAL - COMMON PARTS - HIGH PRESSURE TURBINE - ASSE	Package A	CLN/INSP	CLEANING AND INSPECTION		1980.00	SR Technics Switzerland
20806	50L472	EASA,FAA,CAAC,ANAC			72-00-52		Package A	INSP-02	VISUAL INSPECTION	PW4168	1980.00	SR Technics Switzerland
20806	50L572	EASA,FAA,CAAC,ANAC			72-00-52		Package A	INSP-03	VISUAL INSPECTION	PW40XX,PW41XX,PW44XX	1980.00	SR Technics Switzerland
20806	50L972	EASA,FAA,CAAC,ANAC										
20806	51L372	EASA,FAA,CAAC,ANAC										
20806	51L472	EASA,FAA,CAAC,ANAC										
20806	51L572	EASA,FAA,CAAC,ANAC										
20806	51L592	EASA,FAA,CAAC,ANAC										
20806	54L682	EASA,FAA,CAAC,ANAC										
20874	70R019	EASA,FAA,CAAC,ANAC	22	28	72-09-50	ENGINE GENERAL - COMMON PARTS - ENGINE BEARINGS	Package A	CLN/INSP	CLEANING AND INSPECTION		270.00	SR Technics Switzerland
20874	70R020	EASA,FAA,CAAC,ANAC			72-09-50		Package 5B00	PW4G-100-72-115	REPL. OR MODIFICATION OF TO INCORPORATE A TIGHTER FIT AND AN ANTI-ROTATIONAL PIN		925.00	SR Technics Switzerland
20874	70R022	EASA,FAA,CAAC,ANAC			72-09-50		Package 5B01	PW4ENG 72-664	DEOILER IDLER BRG WITH ANTI-ROT FEATURES		805.00	SR Technics Switzerland
20874	70R023	EASA,FAA,CAAC,ANAC										
20874	70R024	EASA,FAA,CAAC,ANAC										
20874	70R032	EASA,FAA,CAAC,ANAC										
20874	70R033	EASA,FAA,CAAC,ANAC										
20874	70R034	EASA,FAA,CAAC,ANAC										
20874	70R218	EASA,FAA,CAAC,ANAC										
20874	70R219	EASA,FAA,CAAC,ANAC										
20874	70R222	EASA,FAA,CAAC,ANAC										
20874	70R223	EASA,FAA,CAAC,ANAC										
20874	70R225	EASA,FAA,CAAC,ANAC										
20874	70R268	EASA,FAA,CAAC,ANAC										
20874	70R269	EASA,FAA,CAAC,ANAC										
20874	70R270	EASA,FAA,CAAC,ANAC										
20874	70R271	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
20874	70R538	EASA,FAA,CAAC,ANAC										
20874	70R598	EASA,FAA,CAAC,ANAC										
20874	70R599	EASA,FAA,CAAC,ANAC										
20874	70R601	EASA,FAA,CAAC,ANAC										
20874	70R602	EASA,FAA,CAAC,ANAC										
20874	70R619	EASA,FAA,CAAC,ANAC										
20874	70R620	EASA,FAA,CAAC,ANAC										
20874	70R621	EASA,FAA,CAAC,ANAC										
20874	70R622	EASA,FAA,CAAC,ANAC										
20874	70R723	EASA,FAA,CAAC,ANAC										
20874	70R734	EASA,FAA,CAAC,ANAC										
20874	70R735	EASA,FAA,CAAC,ANAC										
20874	70R780	EASA,FAA,CAAC,ANAC										
20874	70R781	EASA,FAA,CAAC,ANAC										
20874	70R782	EASA,FAA,CAAC,ANAC										
20874	70R783	EASA,FAA,CAAC,ANAC										
20874	70R794	EASA,FAA,CAAC,ANAC										
20874	70R795	EASA,FAA,CAAC,ANAC										
20874	70R864	EASA,FAA,CAAC,ANAC										
20874	70R865	EASA,FAA,CAAC,ANAC										
20874	70R866	EASA,FAA,CAAC,ANAC										
20874	70R876	EASA,FAA,CAAC,ANAC										
20874	70R877	EASA,FAA,CAAC,ANAC										
20874	70R878	EASA,FAA,CAAC,ANAC										
20874	70R955	EASA,FAA,CAAC,ANAC										
20874	71R021	EASA,FAA,CAAC,ANAC										
20874	71R024	EASA,FAA,CAAC,ANAC										
20874	71R119	EASA,FAA,CAAC,ANAC										
21752	400970-11	EASA,FAA,CAAC,ANAC	9	21	29-10-01	HYDRAULIC HOSE	Package A	CLN/INSP	CLEANING AND INSPECTION		785.00	SR Technics Switzerland
21752	400970-13	EASA,FAA,CAAC,ANAC			29-10-01		Package A	CLN/INSP	PRE TEST		785.00	SR Technics Switzerland
21752	400970-15	EASA,FAA,CAAC,ANAC			29-10-01		Package G		OVERHAUL		1380.00	SR Technics Switzerland
21752	400970-3	EASA,FAA,CAAC,ANAC										
21752	400970-7	EASA,FAA,CAAC,ANAC										
21752	400970-9	EASA,FAA,CAAC,ANAC										
22803	505729	EASA,FAA,CAAC,ANAC	33	28	72-35-54	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 7 HPC SYNCHRONIZING R	Package A	CLN/INSP	CLEANING AND INSPECTION	PN54H782-01 54H797-01FOR SHOP VISIT ONL	485.00	SR Technics Switzerland
22803	51H151	EASA,FAA,CAAC,ANAC			72-35-54		Package B	01	REPLACE RING ASSEMBLY PIN AND LEVER ARM		1225.00	SR Technics Switzerland
22803	51H151-001	EASA,FAA,CAAC,ANAC			72-35-54		Package C	02	REPLACE NUT PLATES		1220.00	SR Technics Switzerland
22803	51H151-002	EASA,FAA,CAAC,ANAC			72-35-54		Package F	05	WELD REPAIR OF VANE ARM PIN HOLES		2530.00	SR Technics Switzerland
22803	51H151-003	EASA,FAA,CAAC,ANAC			72-35-54		Package H	07	BLEND RING SEGMENT SURFACE DAMAGE		330.00	SR Technics Switzerland
22803	51H152	EASA,FAA,CAAC,ANAC			72-35-54		Package L	11	APPLY PWA 578 PAINT		1005.00	SR Technics Switzerland
22803	51H152-003	EASA,FAA,CAAC,ANAC			72-35-54		Package SB00	PW4ENG 72-197	SYNCHRONIZING RING - RELOCATION OF RIGGING PIN HOLE		1865.00	SR Technics Switzerland
22803	52H095	EASA,FAA,CAAC,ANAC			72-35-54		Package SB01	PW4ENG 72-432	SYNCHRONIZING RING - MODIFICATION OF PIN ATTACHMENT		1225.00	SR Technics Switzerland
22803	53H936	EASA,FAA,CAAC,ANAC			72-35-54		Package SB02	PW4ENG 72-474	SYNCHRONIZING RING - PAINT REMOVAL FROM ID		340.00	SR Technics Switzerland
22803	54H782-01	EASA,FAA,CAAC,ANAC			72-35-54		Package SB03	PW4ENG 72-837	SYNCHRONIZING RING STG 5 AND 6 REPL		1620.00	SR Technics Switzerland
22803	54H797-01	EASA,FAA,CAAC,ANAC										
22803	54H802-01	EASA,FAA,CAAC,ANAC										
22803	54H802-101	EASA,FAA,CAAC,ANAC										
22803	54H888	EASA,FAA,CAAC,ANAC										
22803	54H888-001	EASA,FAA,CAAC,ANAC										
22803	54H890	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
22803	54H890-101	EASA,FAA,CAAC,ANAC										
23023	221-5098-501	EASA,FAA,CAAC,ANAC	4	21	72-09-71	PW4 EXTERNAL TUBES	Package A	CLN/INSP	CLEANING AND INSPECTION		230.00	SR Technics Switzerland
23023	332T4921-276	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		230.00	SR Technics Switzerland
23023	50U269-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY ANTIGALLING COMPOUND		80.00	SR Technics Switzerland
23023	50U401-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	THRUST WIRE INSTALLATION		270.00	SR Technics Switzerland
23023	50U591-01	EASA,FAA,CAAC,ANAC			72-09-71		Package D	04	BLEND REPAIR SURFACE DAMAGE		230.00	SR Technics Switzerland
23023	50U827-01	EASA,FAA,CAAC,ANAC			72-09-71		Package E	05	DENT REPAIR		1490.00	SR Technics Switzerland
23023	51U136-01	EASA,FAA,CAAC,ANAC			72-09-71		Package F	07	LINER,NUT,REDUCER,ELBOW,SLEEVE REPLACEMENT		810.00	SR Technics Switzerland
23023	51U440-01	EASA,FAA,CAAC,ANAC			72-09-71		Package G	10	HEAT SHIELD REPAIR OF BLEED DUCT		455.00	SR Technics Switzerland
23023	51U798-01	EASA,FAA,CAAC,ANAC			72-09-71		Package H	11	REPAIR OF DAMAGED AREA ON HEAT SHIELD TUBE CONNECTOR NUTS, COUPLING, FERRULE		280.00	SR Technics Switzerland
23023	51U889-01	EASA,FAA,ANAC			72-09-71		Package I	12	DAMAGED AREA HEATSHIELD STRAP GUIDE REPAIR		270.00	SR Technics Switzerland
23023	51U950-01	EASA,FAA,CAAC,ANAC			72-09-71		Package K	SPM	REPLACE DEFECTIVE STOPNUTS ACC. SPM		285.00	SR Technics Switzerland
23023	51U951-01	EASA,FAA,CAAC,ANAC			72-09-71		Package SB00	PW4G-100-A72-15	INSPECTION OF STARTING AIR ACTUATION TUBE (AA96)	SB PW4G-100-A72-158	275.00	SR Technics Switzerland
23023	52T548-01	EASA,FAA,CAAC,ANAC			72-09-71		Package SB01	PW4G-100-80-5	STARTER, CONNECT. ASSEMBLY MODI OR REPLACEMENT RR TUBE TO D PART 001		2075.00	SR Technics Switzerland
23023	55T446-01	EASA,FAA,CAAC,ANAC			72-09-71		Package W	022	REPAIR CONICAL SEAT		180.00	SR Technics Switzerland
23023	55T447-01	EASA,FAA,CAAC,ANAC										
23023	55T454-01	EASA,FAA,CAAC,ANAC										
23023	55T455-01	EASA,FAA,CAAC,ANAC										
23023	57T162	EASA,FAA,CAAC,ANAC										
23023	57T163	EASA,FAA,CAAC,ANAC										
23023	57T166	EASA,FAA,CAAC,ANAC										
23023	57T167	EASA,FAA,CAAC,ANAC										
23023	57T170	EASA,FAA,CAAC,ANAC										
23023	57T172	EASA,FAA,CAAC,ANAC										
23023	57T173	EASA,FAA,CAAC,ANAC										
23023	57T174	EASA,FAA,CAAC,ANAC										
23023	57T175	EASA,FAA,CAAC,ANAC										
23023	57T177	EASA,FAA,CAAC,ANAC										
23023	57T178	EASA,FAA,CAAC,ANAC										
23023	57T179	EASA,FAA,CAAC,ANAC										
23023	58T075-01	EASA,FAA,CAAC,ANAC										
23023	58T175-01	EASA,FAA,CAAC,ANAC										
23023	58T479-01	EASA,FAA,CAAC,ANAC										
23023	58T658-01	EASA,FAA,CAAC,ANAC										
23023	58T800-01	EASA,FAA,CAAC,ANAC										
23023	58T879-01	EASA,FAA,CAAC,ANAC										
23023	58T880-01	EASA,FAA,CAAC,ANAC										
23023	58T933-01	EASA,FAA,CAAC,ANAC										
23023	58T945-01	EASA,FAA,CAAC,ANAC										
23023	58T977-01	EASA,FAA,CAAC,ANAC										
23023	59T083-01	EASA,FAA,CAAC,ANAC										
23023	59T136	EASA,FAA,CAAC,ANAC										
23023	59T137	EASA,FAA,CAAC,ANAC										
23023	59T577-01	EASA,FAA,CAAC,ANAC										
23023	59T639-01	EASA,FAA,CAAC,ANAC										
23023	59T701	EASA,FAA,CAAC,ANAC										
23023	59T702	EASA,FAA,CAAC,ANAC										
23023	59T703	EASA,FAA,CAAC,ANAC										
23023	59T711-01	EASA,FAA,CAAC,ANAC										
23023	59T852-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
23023	59T853-01	EASA,FAA,CAAC,ANAC										
23023	AE706825-15	EASA,FAA,CAAC,ANAC										
27164	1602080-001	EASA,FAA,CAAC,ANAC	20	21	75-24-13	AIR-OIL HEAT EXCH VALVE/TCC VALVE - TURBINE CASE COOLING AIR V/	Package A	CLN/INSP	CLEANING AND INSPECTION		330.00	SR Technics Switzerland
27164	1604220-001	EASA,FAA,CAAC,ANAC										
27164	1605140-001	EASA,FAA,CAAC,ANAC										
27164	1605140-002	EASA,FAA,CAAC,ANAC										
27164	1606130-001	EASA,FAA,CAAC,ANAC										
27164	1606130-002	EASA,FAA,CAAC,ANAC										
27164	50U822	EASA,FAA,CAAC,ANAC										
27164	56T761	EASA,FAA,CAAC,ANAC										
27164	59T756	EASA,FAA,CAAC,ANAC										
62466	50S067-01	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 8 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
62466	58H343	EASA,FAA,CAAC,ANAC										
62466	58H601-01	EASA,FAA,CAAC,ANAC										
62477	50S066	EASA,FAA,CAAC,ANAC	4	28	72-35-23	PW4 STG. 15 HPC BLADE OUTER AIRSEAL	Package A	CLN/INSP	Cleaning and inspection		285.00	SR Technics Switzerland
62477	58H326	EASA,FAA,CAAC,ANAC										
62485	50S678-01	EASA,FAA,CAAC,ANAC	20	28	72-35-24	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 8 COMPRESSOR STATOR	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62485	50S678-02	EASA,FAA,CAAC,ANAC			72-35-24		Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62485	50S678-03	EASA,FAA,CAAC,ANAC			72-35-24		Package B	01	BLEND REPAIR SURFACE DAMAGE		155.00	SR Technics Switzerland
62485	50S678-04	EASA,FAA,CAAC,ANAC			72-35-24		Package B	01	BLEND REPAIR SURFACE DAMAGE		155.00	SR Technics Switzerland
62485	58H388-01	EASA,FAA,CAAC,ANAC			72-35-24		Package F	05	STATOR SEGMENT OUTER PLATFORM COATING REPAIR		305.00	SR Technics Switzerland
62485	58H388-02	EASA,FAA,CAAC,ANAC										
62485	58H388-03	EASA,FAA,CAAC,ANAC										
62485	58H388-04	EASA,FAA,CAAC,ANAC										
62486	50S279-01	EASA,FAA,CAAC,ANAC	20	28	72-35-25	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 9 COMPRESSOR STATOR	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62486	50S279-02	EASA,FAA,CAAC,ANAC			72-35-25		Package C	02	OUTER PLATFORM PLASMA COAT REPAIR		310.00	SR Technics Switzerland
62486	50S279-03	EASA,FAA,CAAC,ANAC			72-35-25		Package D	03	VANE SURFACE DAMAGE BLEND REPAIR		155.00	SR Technics Switzerland
62486	50S279-04	EASA,FAA,CAAC,ANAC			72-35-25		Package I	08	VANE SURFACE DAMAGE WELD REPAIR		1170.00	SR Technics Switzerland
62486	50S479-01	EASA,FAA,CAAC,ANAC										
62486	50S479-02	EASA,FAA,CAAC,ANAC										
62486	50S479-03	EASA,FAA,CAAC,ANAC										
62486	50S479-04	EASA,FAA,CAAC,ANAC										
62486	59H379-01	EASA,FAA,CAAC,ANAC										
62486	59H379-02	EASA,FAA,CAAC,ANAC										
62486	59H379-03	EASA,FAA,CAAC,ANAC										
62486	59H379-04	EASA,FAA,CAAC,ANAC										
62487	50S680-01	EASA,FAA,CAAC,ANAC	20	28	72-35-26	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 10 COMPRESSOR STATOF	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62487	50S680-02	EASA,FAA,CAAC,ANAC			72-35-26		Package C	2	OUTER PLATFORM PLASMA COAT REPAIR		305.00	SR Technics Switzerland
62487	50S680-03	EASA,FAA,CAAC,ANAC			72-35-26		Package H	7	VANE SURFACE DAMAGE BLEND REPAIR		155.00	SR Technics Switzerland
62487	59H380-01	EASA,FAA,CAAC,ANAC										
62487	59H380-02	EASA,FAA,CAAC,ANAC										
62487	59H380-03	EASA,FAA,CAAC,ANAC										
62488	50S271-01	EASA,FAA,CAAC,ANAC	20	28	72-35-27	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 11 COMPRESSOR STATOF	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62488	50S271-02	EASA,FAA,CAAC,ANAC			72-35-27		Package C	02	OUTER PLATFORM PLASMA COAT REPAIR		305.00	SR Technics Switzerland
62488	58H371-01	EASA,FAA,CAAC,ANAC			72-35-27		Package G	06	VANE SURFACE DAMAGE BLEND REPAIR		155.00	SR Technics Switzerland
62488	58H371-02	EASA,FAA,CAAC,ANAC										
62489	50S372-01	EASA,FAA,CAAC,ANAC	19	28	72-35-28	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 12 COMPRESSOR STATOF	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62489	50S372-02	EASA,FAA,CAAC,ANAC			72-35-28		Package B	01	VANE SURFACE DAMAGE BLEND REPAIR		160.00	SR Technics Switzerland
62489	50S372-03	EASA,FAA,CAAC,ANAC			72-35-28		Package C	02	OUTER PLATFORM PLASMA COAT REPAIR		315.00	SR Technics Switzerland
62489	58H372-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
62489	58H372-02	EASA,FAA,CAAC,ANAC										
62489	58H372-03	EASA,FAA,CAAC,ANAC										
62490	50S283-01	EASA,FAA,CAAC,ANAC	19	28	72-35-29	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 13 COMPRESSOR STATOF	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62490	50S283-02	EASA,FAA,CAAC,ANAC			72-35-29		Package B	01	VANE SURFACE DAMAGE BLEND REPAIR		160.00	SR Technics Switzerland
62490	58H373-01	EASA,FAA,CAAC,ANAC			72-35-29		Package C	02	OUTER PLATFORM PLASMA COAT REPAIR		315.00	SR Technics Switzerland
62490	58H373-02	EASA,FAA,CAAC,ANAC										
62491	50S174-01	EASA,FAA,CAAC,ANAC	20	28	72-35-30	HIGH PRESSURE COMPRESSOR (HPC) - STAGE 14 COMPRESSOR STATOF	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
62491	50S474-01	EASA,FAA,CAAC,ANAC			72-35-30		Package B	01	VANE SURFACE DAMAGE BLEND REPAIR		160.00	SR Technics Switzerland
62491	50S474-02	EASA,FAA,CAAC,ANAC			72-35-30		Package C	02	OUTER PLATFORM PLASMA COAT REPAIR		315.00	SR Technics Switzerland
62491	50S474-03	EASA,FAA,CAAC,ANAC										
62491	50S474-04	EASA,FAA,CAAC,ANAC										
62491	58H374-01	EASA,FAA,CAAC,ANAC										
62491	58H374-02	EASA,FAA,CAAC,ANAC										
62491	58H374-03	EASA,FAA,CAAC,ANAC										
62491	58H374-04	EASA,FAA,CAAC,ANAC										
62545	50S027	EASA,FAA,CAAC,ANAC	33	28	72-35-80	HIGH PRESSURE COMPRESSOR (HPC) - HEAT SHIELDS	Package A	CLN/INSP	CLEANING AND INSPECTION		515.00	SR Technics Switzerland
62545	50S028	EASA,FAA,CAAC,ANAC			72-35-80		Package B	01	ANTIGALLING COMPOUND REPLACEMENT REPAIR		1510.00	SR Technics Switzerland
62545	50S311-01	EASA,FAA,CAAC,ANAC			72-35-80		Package C	02	WASHER OR RIVET REPLACEMENT REPAIR		445.00	SR Technics Switzerland
62545	58H401	EASA,FAA,CAAC,ANAC			72-35-80		Package D	03	PLASMA COAT REPAIR		3845.00	SR Technics Switzerland
62545	58H402	EASA,FAA,CAAC,ANAC			72-35-80		Package SB00	PWMENG 72-783	MODIFY THE LOWER HALF OF THE HEATSHIELD TO INCORPORATE AN ANTI-ROTATION FEATURE (PART B)		1935.00	SR Technics Switzerland
62545	58H404	EASA,FAA,CAAC,ANAC										
62545	58H416-01	EASA,FAA,CAAC,ANAC										
62545	58H417-01	EASA,FAA,CAAC,ANAC										
62545	58H418	EASA,FAA,CAAC,ANAC										
62545	58H419	EASA,FAA,CAAC,ANAC										
62545	58H420	EASA,FAA,CAAC,ANAC										
62545	58H422-01	EASA,FAA,CAAC,ANAC										
62545	58H423	EASA,FAA,CAAC,ANAC										
62545	58H424	EASA,FAA,CAAC,ANAC										
73288	8241-01	EASA,FAA,CAAC,ANAC	10	21	26-10-62	PW4 FIRE AND OVERHEAT DETECTION SYSTEM	Package A		CLEANING, INSPECTION AND TEST		1325.00	SR Technics Switzerland
73288	8242	EASA,FAA,CAAC,ANAC			26-10-62		Package B		REPAIR UNSCHEDULED		1265.00	SR Technics Switzerland
73288	8243	EASA,FAA,CAAC,ANAC			26-10-62		Package C		WELD-REPAIR CLAMP REPLACEMENT		1400.00	SR Technics Switzerland
73288	8244	EASA,FAA,CAAC,ANAC										
73288	5332T100-15	EASA,FAA,CAAC,ANAC										
73288	5332T100-16	EASA,FAA,CAAC,ANAC										
73288	5332T100-17	EASA,FAA,CAAC,ANAC										
73288	5332T100-18	EASA,FAA,CAAC,ANAC										
129947	80168-1414	EASA,FAA,CAAC,ANAC	3	21	71-20-05	PW4 BARREL NUT, AFT MOUNT	Package A	CLN/INSP	CLEANING & INSPECTION		150.00	SR Technics Switzerland
129964	73182-624	EASA,FAA,CAAC,ANAC	25	28	72-53-44	LOW PRESSURE TURBINE (LPT) - TURBINE TIEROD NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		70.00	SR Technics Switzerland
129964	786376	EASA,FAA,CAAC,ANAC			72-53-44		Package B	01	RESTORE SILVER PLATE	PRICE PER UNIT	70.00	SR Technics Switzerland
129964	5T2115-12	EASA,FAA,CAAC,ANAC										
129964	5T2116-12	EASA,FAA,CAAC,ANAC										
129964	5T2117-12	EASA,FAA,CAAC,ANAC										
129964	5T2667-12	EASA,FAA,CAAC,ANAC										
130005	51A299	EASA,FAA,CAAC,ANAC	20	28	72-53-83	LOW PRESSURE TURBINE (LPT) - LOW PRESSURE TURBINE (LPT) - TIERO	Package A	CLN/INSP	CLEANING AND INSPECTION		90.00	SR Technics Switzerland
130005	51A306	EASA,FAA,CAAC,ANAC			72-53-83		Package B	01	RESTORE SILVER PLATE		95.00	SR Technics Switzerland
130005	51A307	EASA,FAA,CAAC,ANAC										
130005	51A535	EASA,FAA,CAAC,ANAC										
130005	51A536	EASA,FAA,CAAC,ANAC										
130005	51A569	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
130005	51A570	EASA,FAA,CAAC,ANAC										
130005	51A571	EASA,FAA,CAAC,ANAC										
130005	787448	EASA,FAA,CAAC,ANAC										
130005	787449	EASA,FAA,CAAC,ANAC										
130005	787454	EASA,FAA,CAAC,ANAC										
130005	787455	EASA,FAA,CAAC,ANAC										
130005	H54133-8	EASA,FAA,CAAC,ANAC										
132300	38771	EASA,FAA,CAAC,ANAC	22	21	79-10-14	CAP ASSY OIL TANK	Package B		REPLACE O-RING		410.00	SR Technics Switzerland
132300	791756	EASA,FAA,CAAC,ANAC										
132768	310T4020-14	EASA,FAA,CAAC,ANAC	20	21	71-21-16	AFT ENGINE MOUNT - ASSEMBLY - 94"	Package A	CLN/INSP	CLEAN AND INSPECTION		1385.00	SR Technics Switzerland
132768	310T4020-16	EASA,FAA,CAAC,ANAC			71-21-16		Package D	LIGHT	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P/ EXAMPLE: LINK ASSY REPLACEMENT (1EA)		1455.00	SR Technics Switzerland
132768	310T4020-2	EASA,FAA,CAAC,ANAC			71-21-16		Package E	MEDIUM	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P/ EXAMPLE: LINK ASSY REPLACEMENT (2EA)		2925.00	SR Technics Switzerland
132768	310T4020-24	EASA,FAA,CAAC,ANAC			71-21-16		Package F	HEAVY	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P/ EXAMPLE: HANGER ASSY REPLACEMENT		3315.00	SR Technics Switzerland
132768	310T4020-3	EASA,FAA,CAAC,ANAC			71-21-16		Package G	OVERHAUL	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PART REPAIRS		4095.00	SR Technics Switzerland
132768	310T4020-7	EASA,FAA,CAAC,ANAC			71-21-16		Package H		ASSEMBLY/DISASSEMBLY OF MOUNT LINK		3985.00	SR Technics Switzerland
132768	310U4020-2	EASA,FAA,CAAC,ANAC										
132768	310U4020-3	EASA,FAA,CAAC,ANAC										
132768	310U4020-5	EASA,FAA,CAAC,ANAC										
132768	310U4020-6	EASA,FAA,CAAC,ANAC										
132791	50P029	EASA,FAA,CAAC,ANAC	4	21	77-21-05	THERMOCOUPLE EEC	Package C	TEST	PRE TEST		380.00	SR Technics Switzerland
132791	50P109	EASA,FAA,CAAC,ANAC			77-21-05		Package C	TEST	TEST		380.00	SR Technics Switzerland
132791	5255	EASA,FAA,CAAC,ANAC			77-21-05		Package D	OVERHAUL		for PN: 5255; 5255J; HAD18540	815.00	SR Technics Switzerland
132791	5255G	EASA,FAA,CAAC,ANAC										
132791	5255J	EASA,FAA,CAAC,ANAC										
132791	HAD18540	EASA,FAA,CAAC,ANAC										
132792	50J344	EASA,FAA,CAAC,ANAC	3	28	73-21-57	THERMOCOUPLE EEC	Package B		BENCHTEST		380.00	SR Technics Switzerland
132792	HAD18952	EASA,FAA,CAAC,ANAC			73-21-57		Package C		OVERHAUL		760.00	SR Technics Switzerland
132802	50A508	EASA,FAA,CAAC,ANAC	30	28	72-33-80	FAN CASE - FAN EXIT (INNER) LINER SEGMENT ASSEMBLIES - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		560.00	SR Technics Switzerland
132802	50A508-001	EASA,FAA,CAAC,ANAC			72-33-80		Package AA	29	BONDED STIFFENER REPLACEMENT REPAIR		710.00	SR Technics Switzerland
132802	50A668	EASA,FAA,CAAC,ANAC			72-33-80		Package AB	32	ACOUSTIC LINER SIDE EDGE DISBOUND REPAIR		480.00	SR Technics Switzerland
132802	50G276	EASA,FAA,CAAC,ANAC			72-33-80		Package AN	SPM	MARK PART BY MARKER		135.00	SR Technics Switzerland
132802	50G276-001	EASA,FAA,CAAC,ANAC			72-33-80		Package B	01	GRAPHITE ID REAR PANEL MINOR REPAIR		735.00	SR Technics Switzerland
132802	50G277	EASA,FAA,CAAC,ANAC			72-33-80		Package C	02	REPLACE WASHERS		790.00	SR Technics Switzerland
132802	50G277-001	EASA,FAA,CAAC,ANAC			72-33-80		Package D	03	REPLACE SEAL		720.00	SR Technics Switzerland
132802	50G278	EASA,FAA,CAAC,ANAC			72-33-80		Package E	04	REPAIR DAMAGED SEAL ENDS		495.00	SR Technics Switzerland
132802	50G278-001	EASA,FAA,CAAC,ANAC			72-33-80		Package F	05	REPAIR DELAMINATION AT THE CORNERS		710.00	SR Technics Switzerland
132802	50G279	EASA,FAA,CAAC,ANAC			72-33-80		Package H	07	SURFACE DAMAGE PATCH REPAIR		755.00	SR Technics Switzerland
132802	50G279-001	EASA,FAA,CAAC,ANAC			72-33-80		Package N	13	CERAMIC FABRIC PATCH REPAIR		735.00	SR Technics Switzerland
132802	50G281	EASA,FAA,CAAC,ANAC			72-33-80		Package SB00	PW4ENG 72-490	CONVERSION OF A PW4460 OR PW4460 (-3) OR PW4462 (-3)		750.00	SR Technics Switzerland
132802	50G281-001	EASA,FAA,CAAC,ANAC			72-33-80		Package SB00	PW4ENG 72-504	CONVERSION OF A PW4052, PW4056, PW4060, TO A PW4052(-3), PW4056(-3), OR PW4060(-3)		750.00	SR Technics Switzerland
132802	50G440	EASA,FAA,CAAC,ANAC			72-33-80		Package SB00	PW4ENG 72-572	CONVERSION OF A PW4152, PW4156A, PW4158 ENGINE TO A PW4152(-3), PW4156A(-3), OR PW4158(-3) ENGINE		750.00	SR Technics Switzerland
132802	50G440-001	EASA,FAA,CAAC,ANAC			72-33-80		Package T	19	CUT SEAL REPAIR		230.00	SR Technics Switzerland
132802	51A380-01	EASA,FAA,CAAC,ANAC			72-33-80		Package W	22	NON ACOUSTIC LINER SEGMENT SEAL BONDING REPAIR		480.00	SR Technics Switzerland
132802	51A381-01	EASA,FAA,CAAC,ANAC										
132802	51A382-01	EASA,FAA,CAAC,ANAC										
132802	51A383-01	EASA,FAA,CAAC,ANAC										
132802	51A384-01	EASA,FAA,CAAC,ANAC										
132802	51A385-01	EASA,FAA,CAAC,ANAC										
132802	51A386-01	EASA,FAA,CAAC,ANAC										
132802	51A387-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
132802	51A642-01	EASA,FAA,CAAC,ANAC										
132802	51A643-01	EASA,FAA,CAAC,ANAC										
132802	51A644-01	EASA,FAA,CAAC,ANAC										
132802	51A645-01	EASA,FAA,CAAC,ANAC										
132802	51A646-01	EASA,FAA,CAAC,ANAC										
132802	51A647-01	EASA,FAA,CAAC,ANAC										
132802	51A648-01	EASA,FAA,CAAC,ANAC										
132802	51A649-01	EASA,FAA,CAAC,ANAC										
132802	51G272-01	EASA,FAA,CAAC,ANAC										
132802	51G273	EASA,FAA,CAAC,ANAC										
132802	51G273-001	EASA,FAA,CAAC,ANAC										
132802	52G116-01	EASA,FAA,CAAC,ANAC										
132802	52G117-01	EASA,FAA,CAAC,ANAC										
132802	52G118-01	EASA,FAA,CAAC,ANAC										
132802	52G119-01	EASA,FAA,CAAC,ANAC										
132802	52G120-01	EASA,FAA,CAAC,ANAC										
132802	52G121-01	EASA,FAA,CAAC,ANAC										
132802	52G122-01	EASA,FAA,CAAC,ANAC										
132809	50G663	EASA,FAA,CAAC,ANAC	28	28	72-33-82	FAN CASE - FAN EXIT INNER (BIFURCATION) FAIRING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		595.00	SR Technics Switzerland
132809	50G680	EASA,FAA,CAAC,ANAC			72-33-82		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	135.00	SR Technics Switzerland
132809	50G951	EASA,FAA,CAAC,ANAC			72-33-82		Package B	01	REPLACE WASHERS		1000.00	SR Technics Switzerland
132809	51G379-01	EASA,FAA,CAAC,ANAC			72-33-82		Package C	02	REPLACE SPLICE PLATE		445.00	SR Technics Switzerland
132809	51G380-01	EASA,FAA,CAAC,ANAC			72-33-82		Package D	03	REPLACE NUT PLATES		790.00	SR Technics Switzerland
132809	51G388-01	EASA,FAA,CAAC,ANAC			72-33-82		Package E	04	MINOR SURFACE DAMAGE REPAIR (EPOXY RESIN)		1010.00	SR Technics Switzerland
132809	51G389-01	EASA,FAA,CAAC,ANAC			72-33-82		Package F	05	PATCH REPAIR		1165.00	SR Technics Switzerland
132809	51G577	EASA,FAA,CAAC,ANAC			72-33-82		Package J	10	SURFACE DAMAGE REPAIR (POLYURETHANE COAT)		480.00	SR Technics Switzerland
132809	51G578	EASA,FAA,CAAC,ANAC										
132809	51G580-01	EASA,FAA,CAAC,ANAC										
132809	51G581-01	EASA,FAA,CAAC,ANAC										
132809	51G775-01	EASA,FAA,CAAC,ANAC										
132809	51G776-01	EASA,FAA,CAAC,ANAC										
132809	51G777-01	EASA,FAA,CAAC,ANAC										
132809	51G778-01	EASA,FAA,CAAC,ANAC										
132809	52G160-01	EASA,FAA,CAAC,ANAC										
132809	52G161-01	EASA,FAA,CAAC,ANAC										
132809	52G162	EASA,FAA,CAAC,ANAC										
132809	52G163	EASA,FAA,CAAC,ANAC										
132809	52G259	EASA,FAA,CAAC,ANAC										
132809	52G260	EASA,FAA,CAAC,ANAC										
132809	52G261-01	EASA,FAA,CAAC,ANAC										
132809	52G262-01	EASA,FAA,CAAC,ANAC										
133455	221-4027-505	EASA,FAA,CAAC,ANAC	11	21	78-10-03	PLUG EXHAUST	Package A	CLN/INSP	CLEANING AND INSPECTION		2080.00	SR Technics Switzerland
133455	221-4027-511	EASA,FAA,CAAC,ANAC			78-10-03		Package B	01	WELD REPAIR OF CRACKS IN THE PERFORATED OUTER SKIN		2350.00	SR Technics Switzerland
133455	221-4027-513	EASA,FAA,CAAC,ANAC			78-10-03		Package C	10	WELD CONE		2350.00	SR Technics Switzerland
133455	221-4036-501	EASA,FAA,CAAC,ANAC										
133455	221-4037-501	EASA,FAA,CAAC,ANAC										
133456	310T4020-10	EASA,FAA,CAAC,ANAC	19	21	71-21-16	FWD ENGINE MOUNT - ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING & INSPECTION		335.00	SR Technics Switzerland
133456	310T4020-17	EASA,FAA,CAAC,ANAC			71-21-16		Package D	LIGHT	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P# EXAMPLE: BEARING HOUSING REPLACEMENT		660.00	SR Technics Switzerland
133456	310T4020-19	EASA,FAA,CAAC,ANAC			71-21-16		Package E	MEDIUM	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P# EXAMPLE: LINK ASSY REPLACEMENT (1EA)		1625.00	SR Technics Switzerland
133456	310T4020-27	EASA,FAA,CAAC,ANAC			71-21-16		Package F	HEAVY	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P# EXAMPLE: FITTING ASSY REPLACEMENT		2840.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
133456	31074020-5	EASA,FAA,CAAC,ANAC			71-21-16		Package G	OVERHAUL	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PART REPAIRS		2930.00	SR Technics Switzerland
133456	31074020-8	EASA,FAA,CAAC,ANAC										
133457	314T3310-1	EASA,FAA,CAAC,ANAC	18	35	78-11-06	PRIMARY EXHAUST SLEEVE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		900.00	SR Technics Switzerland
133457	314T3310-10	EASA,FAA,CAAC,ANAC			78-11-06		Package B	1-1	RUB STRIP AND SEAL MEMBER REPLACEMENT		2900.00	SR Technics Switzerland
133457	314T3310-3	EASA,FAA,CAAC,ANAC			78-11-06		Package J	2-1 / 9	REPAIR OF HOLES OR PUNCTURES UP TO ONE INCH MAXIMUM LENGTH OF SOLID SKIN		1010.00	SR Technics Switzerland
133457	314T3310-5	EASA,FAA,CAAC,ANAC			78-11-06		Package K	2-1 / 10	REPAIR OF CRACKS UP TO SIX INCH LENGTH IN SOLID SKIN, NOT ADJACENT TO PANEL WELDS		1420.00	SR Technics Switzerland
133457	314T3310-6	EASA,FAA,CAAC,ANAC			78-11-06		Package O	2-1 / 14	REPAIR OF LONGITUDINAL CRACKS IN THE OUTER SLEEVE		1270.00	SR Technics Switzerland
133457	314T3310-7	EASA,FAA,CAAC,ANAC										
133457	314T3310-9	EASA,FAA,CAAC,ANAC										
133506	50U391	EASA,FAA,CAAC,ANAC	9	21	73-21-47	PROBE-ECC FUEL OIL TEMP	Package A		BENCH TEST		600.00	SR Technics Switzerland
133506	51T254	EASA,FAA,CAAC,ANAC			73-21-47		Package G		OVERHAUL		1645.00	SR Technics Switzerland
133506	53T903	EASA,FAA,CAAC,ANAC										
133506	HAC19822	EASA,FAA,CAAC,ANAC										
133506	HAD19247	EASA,FAA,CAAC,ANAC										
133506	HAD21021	EASA,FAA,CAAC,ANAC										
133506	HAD22501	EASA,FAA,CAAC,ANAC										
133511	1A6716	EASA,FAA,CAAC,ANAC	4	21	72-21-59	THERMOCOUPLE (DOT 3)	Package B		OVERHAUL		760.00	SR Technics Switzerland
133511	HAD18286	EASA,FAA,CAAC,ANAC										
133513	50A680	EASA,FAA,CAAC,ANAC	10	21	73-21-50	TRANSDUCER-ASSY OF MOTION 94"	Package SB00	PW4ENG 73-88	TRANSDUCER, N1 SPEED, IMPROVED INSTALLATION CONFIGURATION		355.00	SR Technics Switzerland
133513	50A775	EASA,FAA,CAAC,ANAC			73-21-50		Package SB01	PW4ENG 73-152	TRANSDUCER, N1 SPEED, REPAIR AND UPGRADE FACILITY EEC		110.00	SR Technics Switzerland
133513	51A022	EASA,FAA,CAAC,ANAC										
133519	22640-005	EASA,FAA,CAAC,ANAC	11	21	77-24-03	THERMOCOUPLE IMMERSION	Package B		BENCH TEST		645.00	SR Technics Switzerland
133519	51U552	EASA,FAA,CAAC,ANAC			77-24-03		Package E		MEDIUM		835.00	SR Technics Switzerland
133519	53T424	EASA,FAA,CAAC,ANAC			77-24-03		Package G		OVERHAUL		1670.00	SR Technics Switzerland
133519	HAC19460	EASA,FAA,CAAC,ANAC										
135898	51T379	EASA,FAA,CAAC,ANAC	25	21	72-41-89	DIFFUSER AND COMBUSTOR - FUEL SUPPLY TUBE ASSEMBLIES	Package A	CLN/INSP	PRESSURE TEST BY EACH OVERHAUL		295.00	SR Technics Switzerland
135898	51T383	EASA,FAA,CAAC,ANAC			72-41-89		Package A	CLN/INSP	CLEANING AND INSPECTION		295.00	SR Technics Switzerland
135898	51T387	EASA,FAA,CAAC,ANAC			72-41-89		Package B	01	REPLACE ADAPTER - FUEL SUPPLY TUBE ASSEMBLIES		590.00	SR Technics Switzerland
135898	51T389	EASA,FAA,CAAC,ANAC			72-41-89		Package C	02	REPLACE FERRULE - FUEL SUPPLY TUBE ASSEMBLIES		590.00	SR Technics Switzerland
135898	51T928	EASA,FAA,CAAC,ANAC										
135898	51T930	EASA,FAA,CAAC,ANAC										
135898	51T932	EASA,FAA,CAAC,ANAC										
135898	53T657-01	EASA,FAA,CAAC,ANAC										
135898	53T658-01	EASA,FAA,CAAC,ANAC										
135898	53T659-01	EASA,FAA,CAAC,ANAC										
135898	54T328-01	EASA,FAA,CAAC,ANAC										
135898	54T331-01	EASA,FAA,CAAC,ANAC										
135898	54T334-01	EASA,FAA,CAAC,ANAC										
135898	54T335-01	EASA,FAA,CAAC,ANAC										
135898	54T336-01	EASA,FAA,CAAC,ANAC										
135898	54T339-01	EASA,FAA,CAAC,ANAC										
135898	54T340-01	EASA,FAA,CAAC,ANAC										
135898	54T341-01	EASA,FAA,CAAC,ANAC										
135898	58T076-01	EASA,FAA,CAAC,ANAC										
135901	50A176	EASA,FAA,CAAC,ANAC	23	28	72-51-99	TURBINE NOZZLE - TURBINE NOZZLE MISCELLANEOUS PARTS - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		150.00	SR Technics Switzerland
135901	50A726-01	EASA,FAA,CAAC,ANAC,CAA UK										
135909	50J206	EASA,FAA,CAAC,ANAC	24	21	72-41-37	DIFFUSER AND COMBUSTOR - DIFFUSER & COMBUSTOR - TUBE SEALIN	Package A	CLN/INSP	CLEANING AND INSPECTION		335.00	SR Technics Switzerland
135909	50J393	EASA,FAA,CAAC,ANAC			72-41-37		Package B	01	NICKEL PLATE REPAIR INNER DIAMETER		2145.00	SR Technics Switzerland
135909	50J407	EASA,FAA,CAAC,ANAC										
135909	50J444	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
135909	51J036	EASA,FAA,CAAC,ANAC										
135909	51J038	EASA,FAA,CAAC,ANAC										
135909	51J040	EASA,FAA,CAAC,ANAC										
135909	51J113	EASA,FAA,CAAC,ANAC										
135914	52T189-01	EASA,FAA,CAAC,ANAC	26	28	72-41-93	DIFFUSER AND COMBUSTOR - GEARBOX HEAT SHIELD ASSEMBLIES	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
135914	52T190-01	EASA,FAA,CAAC,ANAC			72-41-93		Package B	01	REPAIR THE HEAT SHIELD WITH A PATCH		340.00	SR Technics Switzerland
135914	53T236-01	EASA,FAA,CAAC,ANAC			72-41-93		Package C	02	HEAT SHIELD PATCH REPAIR		340.00	SR Technics Switzerland
135914	54T310-01	EASA,FAA,CAAC,ANAC			72-41-93		Package D	03	NO. 3 BEARING OIL VENT TUBE HOLE CRACK WELD REPAIR		495.00	SR Technics Switzerland
135914	54T311-01	EASA,FAA,CAAC,ANAC			72-41-93		Package E	04	BOLT HOLE PATCH REPAIR		495.00	SR Technics Switzerland
135914	54T762-01	EASA,FAA,CAAC,ANAC										
135955	50A022	EASA,FAA,CAAC,ANAC	23	28	72-32-02	LPC/LPT COUPLING - NO. 1.5 ROLLER BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		750.00	SR Technics Switzerland
135955	50A092	EASA,FAA,CAAC,ANAC										
135955	50A093	EASA,FAA,CAAC,ANAC										
135955	50A696	EASA,FAA,CAAC,ANAC										
135955	51A653	EASA,FAA,CAAC,ANAC										
137318	50A083CL1	EASA,FAA,CAAC,ANAC	25	28	72-53-81	LOW PRESSURE TURBINE (LPT) - TURBINE SHAFT SPACER	Package A	CLN/INSP	CLEANING AND INSPECTION		155.00	SR Technics Switzerland
137318	50A083CL10	EASA,FAA,CAAC,ANAC			72-53-81		Package B	01	MACHINE SPACER TO CHANGE CLASS		535.00	SR Technics Switzerland
137318	50A083CL11	EASA,FAA,CAAC,ANAC										
137318	50A083CL12	EASA,FAA,CAAC,ANAC										
137318	50A083CL13	EASA,FAA,CAAC,ANAC										
137318	50A083CL14	EASA,FAA,CAAC,ANAC										
137318	50A083CL15	EASA,FAA,CAAC,ANAC										
137318	50A083CL16	EASA,FAA,CAAC,ANAC										
137318	50A083CL17	EASA,FAA,CAAC,ANAC										
137318	50A083CL18	EASA,FAA,CAAC,ANAC										
137318	50A083CL19	EASA,FAA,CAAC,ANAC										
137318	50A083CL2	EASA,FAA,CAAC,ANAC										
137318	50A083CL20	EASA,FAA,CAAC,ANAC										
137318	50A083CL21	EASA,FAA,CAAC,ANAC										
137318	50A083CL22	EASA,FAA,CAAC,ANAC										
137318	50A083CL23	EASA,FAA,CAAC,ANAC										
137318	50A083CL24	EASA,FAA,CAAC,ANAC										
137318	50A083CL25	EASA,FAA,CAAC,ANAC										
137318	50A083CL26	EASA,FAA,CAAC,ANAC										
137318	50A083CL27	EASA,FAA,CAAC,ANAC										
137318	50A083CL28	EASA,FAA,CAAC,ANAC										
137318	50A083CL29	EASA,FAA,CAAC,ANAC										
137318	50A083CL3	EASA,FAA,CAAC,ANAC										
137318	50A083CL30	EASA,FAA,CAAC,ANAC										
137318	50A083CL32	EASA,FAA,CAAC,ANAC										
137318	50A083CL4	EASA,FAA,CAAC,ANAC										
137318	50A083CL5	EASA,FAA,CAAC,ANAC										
137318	50A083CL6	EASA,FAA,CAAC,ANAC										
137318	50A083CL7	EASA,FAA,CAAC,ANAC										
137318	50A083CL8	EASA,FAA,CAAC,ANAC										
137318	50A083CL9	EASA,FAA,CAAC,ANAC										
137362	1A4953	EASA,FAA,CAAC,ANAC	25	28	72-31-13	LOW PRESSURE COMPRESSOR (LPC) - TIEROD NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		55.00	SR Technics Switzerland
137362	1A4954	EASA,FAA,CAAC,ANAC			72-31-13		Package B	01	RESTORE ANTIGALLING COMPOUND		115.00	SR Technics Switzerland
137362	1A4955	EASA,FAA,CAAC,ANAC										
137362	1A6670	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137362	508249	EASA,FAA,CAAC,ANAC										
137362	508256	EASA,FAA,CAAC,ANAC										
137362	508257	EASA,FAA,CAAC,ANAC										
137362	508258	EASA,FAA,CAAC,ANAC										
137362	81377-624	EASA,FAA,CAAC,ANAC										
137362	H51903-6	EASA,FAA,CAAC,ANAC										
137366	50A433	EASA,FAA,CAAC,ANAC	18	28	72-53-82	LOW PRESSURE TURBINE (LPT) - TURBINE (SHAFT) TIEROD	Package A	CLN/INSP	CLEANING AND INSPECTION		80.00	SR Technics Switzerland
137366	51A312	EASA,FAA,CAAC,ANAC										
137385	50H048	EASA,FAA,CAAC,ANAC	18	28	72-35-34	HIGH PRESSURE COMPRESSOR (HPC) - INTERMEDIATE CASE - COMPRES	Package A	CLN/INSP	CLEANING AND INSPECTION		100.00	SR Technics Switzerland
137385	50H049	EASA,FAA,CAAC,ANAC										
137385	50H051	EASA,FAA,CAAC,ANAC										
137385	50H052	EASA,FAA,CAAC,ANAC										
137385	51H319	EASA,FAA,CAAC,ANAC										
137385	51H320	EASA,FAA,CAAC,ANAC										
137385	56H381	EASA,FAA,CAAC,ANAC										
137385	56H385	EASA,FAA,CAAC,ANAC										
137386	50H053	EASA,FAA,CAAC,ANAC	23	28	72-35-35	HIGH PRESSURE COMPRESSOR (HPC) - COMPRESSOR TIEROD NUTS	Package A	CLN/INSP	CLEANING AND INSPECTION		80.00	SR Technics Switzerland
137386	51H517	EASA,FAA,CAAC,ANAC										
137386	53H118	EASA,FAA,CAAC,ANAC										
137386	53H119	EASA,FAA,CAAC,ANAC										
137386	92425-624	EASA,FAA,CAAC,ANAC										
137389	50H432	EASA,FAA,CAAC,ANAC	27	28	72-35-55	HIGH PRESSURE COMPRESSOR (HPC) - SYNCHRONIZING RING CLEVIS A	Package A	CLN/INSP	CLEANING AND INSPECTION		210.00	SR Technics Switzerland
137389	50H966	EASA,FAA,CAAC,ANAC			72-35-55		Package B	01	BLEND REPAIR		600.00	SR Technics Switzerland
137389	50H968	EASA,FAA,CAAC,ANAC			72-35-55		Package C	02	CLEVIS BOLT HOLE BUSHING REPAIR		1565.00	SR Technics Switzerland
137389	52H092	EASA,FAA,CAAC,ANAC			72-35-55		Package E	04	REPAIR CLEVIS ACTUATOR BOLT HOLE WITH BUSHING		1370.00	SR Technics Switzerland
137389	52H093	EASA,FAA,CAAC,ANAC			72-35-55		Package SB00	PW4ENG 72-534	ACTUATOR SUPPORT BRACKET UPPER MOUNT STUDS AND 5TH STG SYNCHRONIZING RING CLEVIS - REPLACEMENT OF		540.00	SR Technics Switzerland
137389	54H580-01	EASA,FAA,CAAC,ANAC			72-35-55		Package SB01	PW4ENG 72-197	HPC 5/6/7TH ST. VAR.VANE ACT.MODI.(SVS19)		570.00	SR Technics Switzerland
137389	54H582-01	EASA,FAA,CAAC,ANAC										
137389	54H616-01	EASA,FAA,CAAC,ANAC										
137389	54H733-01	EASA,FAA,CAAC,ANAC										
137389	54H734-01	EASA,FAA,CAAC,ANAC										
137389	54H735-01	EASA,FAA,CAAC,ANAC										
137389	55H372	EASA,FAA,CAAC,ANAC										
137389	55H685-01	EASA,FAA,CAAC,ANAC										
137389	55H687-01	EASA,FAA,CAAC,ANAC										
137389	58H231-01	EASA,FAA,CAAC,ANAC										
137392	50H180	EASA,FAA,CAAC,ANAC	28	28	72-35-56	HIGH PRESSURE COMPRESSOR (HPC) - SYNCHRONIZING RING PLATES	Package A	CLN/INSP	CLEANING AND INSPECTION		210.00	SR Technics Switzerland
137392	50H186	EASA,FAA,CAAC,ANAC			72-35-56		Package B	01	BLEND REPAIR		340.00	SR Technics Switzerland
137392	50H433	EASA,FAA,CAAC,ANAC			72-35-56		Package C	02	BOLT HOLE BUSHING REPAIR		940.00	SR Technics Switzerland
137392	50H441	EASA,FAA,CAAC,ANAC			72-35-56		Package SB00	PW4ENG 72-527	SYNCHRONIZING RING STG 5 AND 6 - INCORPORATION OF LOCATING PIN		415.00	SR Technics Switzerland
137392	54H266	EASA,FAA,CAAC,ANAC										
137392	54H588	EASA,FAA,CAAC,ANAC										
137392	54H590	EASA,FAA,CAAC,ANAC										
137392	54H592	EASA,FAA,CAAC,ANAC										
137392	55H602	EASA,FAA,CAAC,ANAC										
137392	55H603	EASA,FAA,CAAC,ANAC										
137410	50J252	EASA,FAA,CAAC,ANAC	28	21	72-41-32	DIFFUSER AND COMBUSTOR -TURBINE BLADE COOLING TUBES	Package A	CLN/INSP	CLEANING AND INSPECTION		155.00	SR Technics Switzerland
137410	51J034	EASA,FAA,CAAC,ANAC			72-41-32		Package B	01	NICKEL PLATE SEAL LANDS		935.00	SR Technics Switzerland
137411	50J347	EASA,FAA,CAAC,ANAC	28	28	72-41-38	DIFFUSER AND COMBUSTOR - NO. 3 BEARING FRT COOLING DUCT ROL	Package A	CLN/INSP	CLEANING AND INSPECTION		385.00	SR Technics Switzerland
137411	50J353	EASA,FAA,CAAC,ANAC			72-41-38		Package B	01	REPLACE SILVER PLATE	INCLUDING FPI	480.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137411	50I481	EASA,FAA,CAAC,ANAC										
137422	50N241	EASA,FAA,CAAC,ANAC	3	28	72-53-50	PW4 TURBINE CASE - STG 3 AIRSEALING RING	Package A	CLN/INSP	CLEANING AND INSPECTION		55.00	SR Technics Switzerland
137422	50N546	EASA,FAA,CAAC,ANAC			72-53-50		Package B	01	DAMAGE AREA PATCH REPAIR		110.00	SR Technics Switzerland
137423	50N121-01	EASA,FAA,CAAC,ANAC	24	28	72-53-51	LOW PRESSURE TURBINE (LPT) - TURBINE CASE (STAGE 4 VANE) HEAT	Package A	CLN/INSP	CLEANING AND INSPECTION		245.00	SR Technics Switzerland
137423	50N122-01	EASA,FAA,CAAC,ANAC			72-53-51		Package B	01	DAMAGE AREA PATCH REPAIR	PRICE PER UNIT	540.00	SR Technics Switzerland
137423	50N242	EASA,FAA,CAAC,ANAC										
137424	50N125-01	EASA,FAA,CAAC,ANAC	23	28	72-53-53	LOW PRESSURE TURBINE (LPT) - TURBINE CASE (STAGE 5 VANE) HEAT	Package A	CLN/INSP	CLEANING AND INSPECTION		250.00	SR Technics Switzerland
137424	50N126-01	EASA,FAA,CAAC,ANAC			72-53-53		Package B	01	DAMAGE AREA PATCH REPAIR	PRICE PER UNIT	540.00	SR Technics Switzerland
137424	50N244	EASA,FAA,CAAC,ANAC										
137425	50N245	EASA,FAA,CAAC,ANAC	4	28	72-53-54	PW4 TURBINE CASE - STG 5 AIRSEALING RING	Package A	CLN/INSP	CLEANING AND INSPECTION		250.00	SR Technics Switzerland
137425	50N564-01	EASA,FAA,CAAC,ANAC			72-53-54		Package B	01	DAMAGE AREA PATCH REPAIR		540.00	SR Technics Switzerland
137427	50P106	EASA,FAA,CAAC,ANAC	27	21	72-54-15	TURBINE EXHAUST CASE - NO. 4 BEARING PRESSURE AND SCAVENGE T	Package A	CLN/INSP	CLEANING AND INSPECTION		130.00	SR Technics Switzerland
137427	50P107	EASA,FAA,CAAC,ANAC			72-54-15		Package B	01	HEAT SHIELD PATCH REPAIR		370.00	SR Technics Switzerland
137427	50P136	EASA,FAA,CAAC,ANAC										
137427	50P137	EASA,FAA,CAAC,ANAC										
137427	50P238	EASA,FAA,CAAC,ANAC										
137427	50P239	EASA,FAA,CAAC,ANAC										
137427	50P246	EASA,FAA,CAAC,ANAC										
137427	50P247	EASA,FAA,ANAC										
137427	50P248	EASA,FAA,CAAC,ANAC										
137427	50P249-01	EASA,FAA,ANAC										
137427	50P250-01	EASA,FAA,ANAC										
137427	50P330	EASA,FAA,CAAC,ANAC										
137427	50P331	EASA,FAA,CAAC,ANAC										
137427	50P333-01	EASA,FAA,CAAC,ANAC										
137427	50P335	EASA,FAA,CAAC,ANAC										
137427	50P336	EASA,FAA,CAAC,ANAC										
137427	50P337-01	EASA,FAA,CAAC,ANAC										
137427	50P378	EASA,FAA,CAAC,ANAC										
137427	50P381	EASA,FAA,CAAC,ANAC										
137427	50P382-01	EASA,FAA,CAAC,ANAC										
137427	50P403	EASA,FAA,CAAC,ANAC										
137427	50P404	EASA,FAA,CAAC,ANAC										
137464	798612-2	EASA,ANAC	21	21	73-21-64	FUEL METRING UNIT - JFC131-2 - RESOLVER AND CONTACTS	Package F	5-2	REPAIR OF THE TRANSMITTER RESOLVER AND CONTACTS WHEN THE SPUR GEAR IS WORN IN TWO OPPOSITE QUADRU		300.00	SR Technics Switzerland
137464	798612-4	EASA,FAA,ANAC			73-21-64		Package SB00	JFC131-2-73-18	ADD EPOXY TO RESOLVER COVER SCREWS		615.00	SR Technics Switzerland
137464	798612-5	EASA,FAA,ANAC,CAA UK										
137548	51G942	EASA,FAA,CAAC,ANAC	2	21	72-34-38	PW4 NO.1.5 BEARING FACE SEAL ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		195.00	SR Technics Switzerland
137548	51G943	EASA,FAA,CAAC,ANAC										
137548	52G388	EASA,FAA,CAAC,ANAC										
137548	53G023-01	EASA,FAA,CAAC,ANAC										
137548	53G024-01	EASA,FAA,CAAC,ANAC										
137548	53G024-101	EASA,FAA,CAAC,ANAC										
137548	53G025	EASA,FAA,CAAC,ANAC										
137548	53G026	EASA,FAA,CAAC,ANAC										
137548	53G027	EASA,FAA,CAAC,ANAC										
137548	53G028-01	EASA,FAA,CAAC,ANAC										
137548	53G028-101	EASA,FAA,CAAC,ANAC										
137548	53G043-01	EASA,FAA,CAAC,ANAC										
137548	53G044-01	EASA,FAA,CAAC,ANAC										
137570	50A099	EASA,FAA,CAAC,ANAC	2	28	72-41-87	PW4 NO.3 BEARING (REAR) FACE SEAL ASSY	Package A	CLN/INSP	CLEANING & INSPECTION		285.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137570	50A472	EASA,FAA,CAAC,ANAC										
137570	50A707	EASA,FAA,CAAC,ANAC										
137570	50A707-001	EASA,FAA,CAAC,ANAC										
137570	50A757	EASA,FAA,CAAC,ANAC										
137570	50A757-001	EASA,FAA,CAAC,ANAC										
137570	51A082-001	EASA,FAA,CAAC,ANAC										
137570	51A085	EASA,FAA,CAAC,ANAC										
137570	51A273	EASA,FAA,CAAC,ANAC										
137570	51A369	EASA,FAA,CAAC,ANAC										
137570	51A369-001	EASA,FAA,CAAC,ANAC										
137570	51A370	EASA,FAA,CAAC,ANAC										
137570	51A370-001	EASA,FAA,CAAC,ANAC										
137570	51A559-001	EASA,FAA,CAAC,ANAC										
137570	51A560	EASA,FAA,CAAC,ANAC										
137570	51A561	EASA,FAA,CAAC,ANAC										
137570	51J324-01	EASA,FAA,CAAC,ANAC										
137570	51J332-01	EASA,FAA,CAAC,ANAC										
137570	51J334	EASA,FAA,CAAC,ANAC										
137571	50A126	EASA,FAA,CAAC,ANAC	4	28	72-41-82	PW4 BEARING ROLLER NO. 3 MAIN	Package A	CLN/INSP	Cleaning and inspection		800.00	SR Technics Switzerland
137571	50A127	EASA,FAA,CAAC,ANAC			72-41-82		Package SB00	PW4ENG 72-372	NO.3 BRG. EDDY CURRENT INSP / SPEC.UNITS		425.00	SR Technics Switzerland
137571	50A128	EASA,FAA,CAAC,ANAC										
137571	51A726	EASA,FAA,CAAC,ANAC										
137571	52A115	EASA,FAA,CAAC,ANAC										
137572	50A532	EASA,FAA,CAAC,ANAC	3	28	72-41-84	PW4 NO.3 BEARING REAR SEAL SEAT	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
137572	51A367	EASA,FAA,CAAC,ANAC										
137573	50A533	EASA,FAA,CAAC,ANAC	3	28	72-41-80	PW4 NO.3 BEARING FRONT SEAL SEAT	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
137573	51A368	EASA,FAA,CAAC,ANAC										
137582	50L276	EASA,FAA,CAAC,ANAC	12	28	72-52-31	PW4 STAGE 1 HPT DUCT SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		100.00	SR Technics Switzerland
137582	50L278	EASA,FAA,CAAC,ANAC			72-52-31		Package SB00	PW4NG 72-34	MODIFICATION OF THE CASTCASE ASSY AND 1ST STAGE HPT DUCT SUP REPLACEMENT OF 2ND AND 1ST STAGE HPT D		125.00	SR Technics Switzerland
137582	50L371	EASA,FAA,CAAC,ANAC										
137582	50L372	EASA,FAA,CAAC,ANAC										
137582	53L218	EASA,FAA,CAAC,ANAC										
137582	55L028	EASA,FAA,CAAC,ANAC										
137591	50N434-01	EASA,FAA,CAAC,ANAC	3	28	72-53-29	PW4 STAGE 3 LPT (OUTER) DUCT SEGMENT	Package A	CLN/INSP	CLEANING AND INSPECTION		355.00	SR Technics Switzerland
137591	50N450-01	EASA,FAA,ANAC			72-53-29		Package SB00	FAA-2020-25-09	REMOVE AND REPLACE 3RD STG LPT OTD		350.00	SR Technics Switzerland
137591	51N130	EASA,FAA,ANAC										
137591	51N134	EASA,FAA,ANAC										
137598	50N291-01	EASA,FAA,CAAC,ANAC	2	28	72-53-34	PW4 STG 5 LPT (OUTER) AIRSEALING RING	Package A	CLN/INSP	CLEANING & INSPECTION		50.00	SR Technics Switzerland
137598	50N527-01	EASA,FAA,CAAC,ANAC										
137599	50N292-01	EASA,FAA,CAAC,ANAC	3	28	72-53-35	PW4 STG 6 LPT (OUTER) AIRSEALING RING	Package A	CLN/INSP	CLEANING & INSPECTION		65.00	SR Technics Switzerland
137599	50N528-01	EASA,FAA,CAAC,ANAC										
137599	51N067-01	EASA,FAA,CAAC,ANAC										
137599	51N417-01	EASA,FAA,CAAC,ANAC										
137621	50T085	EASA,FAA,CAAC,ANAC	30	28	72-09-76	ENGINE GENERAL - COMMON PARTS - TURBINE CASE COOLING MANIF	Package A	CLN/INSP	CLEANING AND INSPECTION		380.00	SR Technics Switzerland
137621	50T086	EASA,FAA,CAAC,ANAC			72-09-76		Package B	01	WELD REPAIR		1420.00	SR Technics Switzerland
137621	50T087	EASA,FAA,CAAC,ANAC			72-09-76		Package C	01	COLD STRAIGHTENING REPAIR		550.00	SR Technics Switzerland
137621	50T088	EASA,FAA,CAAC,ANAC			72-09-76		Package D	02	REPLACE WORN TUBE REPAIR		1210.00	SR Technics Switzerland
137621	50T089	EASA,FAA,CAAC,ANAC			72-09-76		Package E	03	REPLACE WORN GUIDES REPAIR		955.00	SR Technics Switzerland
137621	50T090	EASA,FAA,CAAC,ANAC			72-09-76		Package F	04	REPLACE WORN TCC MANIFOLD (FRONT) BRACKET REPAIR		670.00	SR Technics Switzerland
137621	50T091	EASA,FAA,CAAC,ANAC			72-09-76		Package G	SPM	REPAIR OF DEFECT NUTS, GUIDES, BRACKETS AND RIVETS ACCORDING SPM		555.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137621	50T092	EASA,FAA,CAAC,ANAC										
137621	50T093	EASA,FAA,CAAC,ANAC										
137621	50T094	EASA,FAA,CAAC,ANAC										
137621	50T095	EASA,FAA,CAAC,ANAC										
137621	50T097	EASA,FAA,CAAC,ANAC										
137621	50T098	EASA,FAA,CAAC,ANAC										
137621	50T099	EASA,FAA,CAAC,ANAC										
137621	50T120	EASA,FAA,CAAC,ANAC										
137621	50U143-01	EASA,FAA,CAAC,ANAC										
137621	52T972-01	EASA,FAA,CAAC,ANAC										
137621	52T973-01	EASA,FAA,CAAC,ANAC										
137621	55T561	EASA,FAA,CAAC,ANAC										
137621	55T563	EASA,FAA,CAAC,ANAC										
137621	56T331	EASA,FAA,CAAC,ANAC										
137621	59T865-01	EASA,FAA,CAAC,ANAC										
137625	50T060	EASA,FAA,CAAC,ANAC	27	28	72-09-75	ENGINE GENERAL - COMMON PARTS - TURBINE CASE COOLING MANIF	Package A	CLN/INSP	CLEANING AND INSPECTION		380.00	SR Technics Switzerland
137625	50T061	EASA,FAA,CAAC,ANAC			72-09-75		Package B	01	WELD REPAIR TURBINE CASE COOLING MANIFOLD		1950.00	SR Technics Switzerland
137625	50T062	EASA,FAA,CAAC,ANAC			72-09-75		Package B	02	REPLACE THE BRACKET AND PIN		1950.00	SR Technics Switzerland
137625	50T063	EASA,FAA,CAAC,ANAC			72-09-75		Package B	03	NUTPLATE REPLACEMENT REPAIR		1950.00	SR Technics Switzerland
137625	50T064	EASA,FAA,CAAC,ANAC										
137625	50T065	EASA,FAA,CAAC,ANAC										
137625	50T066	EASA,FAA,CAAC,ANAC										
137625	51T277	EASA,FAA,CAAC,ANAC										
137625	51T321	EASA,FAA,CAAC,ANAC										
137625	52T889	EASA,FAA,CAAC,ANAC										
137625	52T890	EASA,FAA,CAAC,ANAC										
137625	52T891	EASA,FAA,CAAC,ANAC										
137625	52T892	EASA,FAA,CAAC,ANAC										
137625	52T893	EASA,FAA,CAAC,ANAC										
137625	52T894	EASA,FAA,CAAC,ANAC										
137625	52T895	EASA,FAA,CAAC,ANAC										
137625	52T896	EASA,FAA,CAAC,ANAC										
137625	52T897	EASA,FAA,CAAC,ANAC										
137625	53T745-01	EASA,FAA,CAAC,ANAC										
137625	53T746-01	EASA,FAA,CAAC,ANAC										
137625	53T747-01	EASA,FAA,CAAC,ANAC										
137625	53T748-01	EASA,FAA,CAAC,ANAC										
137625	53T749-01	EASA,FAA,CAAC,ANAC										
137625	57T547-01	EASA,FAA,CAAC,ANAC										
137625	57T571-01	EASA,FAA,CAAC,ANAC										
137625	59T036-01	EASA,FAA,CAAC,ANAC										
137634	50J059	EASA,FAA,CAAC,ANAC	8	21	72-41-09	PW4 NO. 3 BEARING (FRONT) FACE SEAL ASSEMBLY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		300.00	SR Technics Switzerland
137634	50J584	EASA,FAA,CAAC,ANAC										
137634	50J584-001	EASA,FAA,CAAC,ANAC										
137634	50J623	EASA,FAA,CAAC,ANAC										
137634	50J623-001	EASA,FAA,CAAC,ANAC										
137634	50J625-001	EASA,FAA,CAAC,ANAC										
137634	50J640	EASA,FAA,CAAC,ANAC										
137634	50J696	EASA,FAA,CAAC,ANAC										
137634	50J776	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137634	501776-001	EASA,FAA,CAAC,ANAC										
137634	501777	EASA,FAA,CAAC,ANAC										
137634	501777-001	EASA,FAA,CAAC,ANAC										
137634	501818-001	EASA,FAA,CAAC,ANAC										
137634	501819	EASA,FAA,CAAC,ANAC										
137634	501820	EASA,FAA,CAAC,ANAC										
137634	511323-01	EASA,FAA,CAAC,ANAC										
137634	511331-01	EASA,FAA,CAAC,ANAC										
137634	511333	EASA,FAA,CAAC,ANAC										
137651	310T3032-1	EASA,FAA,CAAC,ANAC	21	21	71-21-16	AFT ENGINE MOUNT - TANGENTIAL LINK - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1000.00	SR Technics Switzerland
137651	310T3032-2	EASA,FAA,CAAC,ANAC			71-21-16		Package B	6-1	BEARING REPLACEMENT		1410.00	SR Technics Switzerland
137651	310T3032-3	EASA,FAA,CAAC,ANAC			71-21-16		Package C	6-2	BEARING HOLE REPAIR		1700.00	SR Technics Switzerland
137651	310T3032-7	EASA,FAA,CAAC,ANAC										
137651	310T3032-9	EASA,FAA,CAAC,ANAC										
137710	70R639	EASA,FAA,CAAC,ANAC	22	28	72-61-69	MAIN GEARBOX - OIL TANK DEARATOR ASSEMBLY	Package B	01	ANODIZE TOUCH-UP		305.00	SR Technics Switzerland
137710	70R666	EASA,FAA,CAAC,ANAC			72-61-69		Package C	02	REPLACE HELICAL COIL INSERTS		370.00	SR Technics Switzerland
137710	70T520	EASA,FAA,CAAC,ANAC										
137745	50S055-001	EASA,FAA,CAAC,ANAC	4	28	72-35-63	PW4 HPC 5 SHROUD SET (6 SEGMENTS)	Package A	CLN/INSP	CLEANING AND INSPECTION		575.00	SR Technics Switzerland
137745	50S055-002	EASA,FAA,CAAC,ANAC			72-35-63		Package SB00	72-679	MODIFICATION OF TO INCORPORATE CERAMIC THERMAL BARRIER COATING AT THE 5TH STAGE		740.00	SR Technics Switzerland
137745	50S055-01	EASA,FAA,CAAC,ANAC			72-35-63		Package SB01	72-755	MODIFICATION OF TO INCORPORATE A RING CASE CONFIGURATION RE BOEING		540.00	SR Technics Switzerland
137745	52H031	EASA,FAA,CAAC,ANAC			72-35-63		Package SB02	72-756	MODIFICATION OF TO INCORPORATE A RING CASE CONFIGURATION RE AIRBUS		540.00	SR Technics Switzerland
137745	53H555-01	EASA,FAA,CAAC,ANAC			72-35-63		Package SB03	72-757	MODIFICATION OF TO INCORPORATE A RING CASE CONFIGURATION RE MD11		540.00	SR Technics Switzerland
137745	55H255-001	EASA,FAA,CAAC,ANAC										
137745	55H255-01	EASA,FAA,CAAC,ANAC										
137745	56H855-001	EASA,FAA,CAAC,ANAC										
137745	56H855-01	EASA,FAA,CAAC,ANAC										
137745	58H055	EASA,FAA,CAAC,ANAC										
137751	50L494	EASA,FAA,CAAC,ANAC	5	28	72-52-32	PW4000 STAGE 1 HPT DUCT SEGMENT	Package A	CLN/INSP	CLEANING AND INSPECTION		95.00	SR Technics Switzerland
137751	50L497	EASA,FAA,CAAC,ANAC			72-52-32		Package C	02	GRIND REPLACEMENT DUCT SEGMENTS		500.00	SR Technics Switzerland
137751	50L627	EASA,FAA,CAAC,ANAC										
137751	50L628	EASA,FAA,CAAC,ANAC										
137751	53L133	EASA,FAA,CAAC,ANAC										
137751	53L228	EASA,FAA,CAAC,ANAC										
137751	53L236	EASA,FAA,CAAC,ANAC										
137752	50R402	EASA,FAA,CAAC,ANAC	19	28	72-35-71	HIGH PRESSURE COMPRESSOR (HPC) - GEARBOX DRIVESHAFT HOUSING	Package A	CLN/INSP	CLEANING AND INSPECTION		95.00	SR Technics Switzerland
137752	70H249	EASA,FAA,CAAC,ANAC										
137756	50A045	EASA,FAA,CAAC,ANAC	22	28	72-34-23	INTERMEDIATE CASE - GEARSHAFT BALL BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		485.00	SR Technics Switzerland
137756	50A048	EASA,FAA,CAAC,ANAC										
137756	50G635	EASA,FAA,CAAC,ANAC										
137756	51G990	EASA,FAA,CAAC,ANAC										
137756	51G991	EASA,FAA,CAAC,ANAC										
137756	51G992	EASA,FAA,CAAC,ANAC										
137757	50D380	EASA,FAA,CAAC,ANAC	5	28	72-33-05	PW4 (94") FAN EXIT VANE AND CASE ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		160.00	SR Technics Switzerland
137757	50D390	EASA,FAA,CAAC,ANAC			72-33-05		Package C	02	AIRFOIL PATCH	ON MODULE LEVEL ONLY	380.00	SR Technics Switzerland
137757	50D580	EASA,FAA,CAAC,ANAC										
137757	50D590	EASA,FAA,CAAC,ANAC										
137757	50D610	EASA,FAA,CAAC,ANAC										
137757	50D680	EASA,FAA,CAAC,ANAC										
137757	50D690	EASA,FAA,CAAC,ANAC										
137757	50D910	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137757	51D280	EASA,FAA,CAAC,ANAC										
137757	51D290	EASA,FAA,CAAC,ANAC										
137757	51D380	EASA,FAA,CAAC,ANAC										
137757	51D390	EASA,FAA,CAAC,ANAC										
137757	51D910-001	EASA,FAA,CAAC,ANAC										
137757	52D690-001	EASA,FAA,CAAC,ANAC										
137757	52D780-001	EASA,FAA,CAAC,ANAC										
137757	52D790-001	EASA,FAA,CAAC,ANAC										
137757	54D280	EASA,FAA,CAAC,ANAC										
137757	54D290	EASA,FAA,CAAC,ANAC										
137757	54D380	EASA,FAA,CAAC,ANAC										
137757	54D390	EASA,FAA,CAAC,ANAC										
137757	54D910	EASA,FAA,CAAC,ANAC										
137757	55D780-001	EASA,FAA,CAAC,ANAC										
137757	55D790-001	EASA,FAA,CAAC,ANAC										
137766	50N232	EASA,FAA,CAAC,ANAC	4	28	72-53-30	PW4 STAGE 3 LPT OUTER DUCT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		400.00	SR Technics Switzerland
137766	50N309	EASA,FAA,CAAC,ANAC			72-53-30		Package E	04	DUCT SEGMENT REPLACEMENT		500.00	SR Technics Switzerland
137766	50N444	EASA,FAA,CAAC,ANAC										
137768	50B110	EASA,FAA,CAAC,ANAC	17	28	72-31-14	LOW PRESSURE COMPRESSOR (LPC) - NO. 1 BALL BEARING - 94" & 100'	Package A	CLN/INSP	CLEANING AND INSPECTION		475.00	SR Technics Switzerland
137768	50B233	EASA,FAA,CAAC,ANAC			72-31-14		Package SB00	PW4ENG 72-768	BRG NO.1 BALL-RECONDITIONING OF BEARING		480.00	SR Technics Switzerland
137768	50B234	EASA,FAA,CAAC,ANAC										
137768	50B235	EASA,FAA,CAAC,ANAC										
137768	50B239	EASA,FAA,CAAC,ANAC										
137768	50B797	EASA,FAA,CAAC,ANAC										
137768	50B798	EASA,FAA,CAAC,ANAC										
137768	51B156	EASA,FAA,CAAC,ANAC										
137772	51H270	EASA,FAA,CAAC,ANAC	3	28	72-35-41	PW4000 SHROUD 4 HPC INLET	Package A	CLN/INSP	CLEANING AND INSPECTION		175.00	SR Technics Switzerland
137772	51H470-001	EASA,FAA,CAAC,ANAC			72-35-41		Package SB00	72-650	WELD THE ALIGNMENT PINS TO INNER SHROUDS		80.00	SR Technics Switzerland
137772	54H870-01	EASA,FAA,CAAC,ANAC										
137772	54H970-01	EASA,FAA,CAAC,ANAC										
137772	58H470-01	EASA,FAA,CAAC,ANAC										
137772	58H570-01	EASA,FAA,CAAC,ANAC										
137785	50A095	EASA,FAA,CAAC,ANAC	22	28	72-34-14	INTERMEDIATE CASE - NO. 2 BALL BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		750.00	SR Technics Switzerland
137785	50A096	EASA,FAA,CAAC,ANAC										
137785	50A097	EASA,FAA,CAAC,ANAC										
137785	51A654	EASA,FAA,CAAC,ANAC										
137794	50D153	EASA,FAA,CAAC,ANAC	25	28	72-33-13	FAN CASE - BLEED VALVE LINKAGE BELL CRANK ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
137794	50D611	EASA,FAA,CAAC,ANAC			72-33-13		Package B	01	HOLE REPAIR		1275.00	SR Technics Switzerland
137794	51D593	EASA,FAA,CAAC,ANAC			72-33-13		Package C	02	REPLACE THE ANTIGALLANT		500.00	SR Technics Switzerland
137794	52D700	EASA,FAA,CAAC,ANAC			72-33-13		Package D	03	REPLACE THE BEARING		665.00	SR Technics Switzerland
137794	52G296	EASA,FAA,CAAC,ANAC			72-33-13		Package E	04	REPLACE SMALL BUSHING REPAIR		600.00	SR Technics Switzerland
137794	53D278-01	EASA,FAA,CAAC,ANAC			72-33-13		Package F	05	REPLACE LARGE BUSHING REPAIR		600.00	SR Technics Switzerland
137794	53D355	EASA,FAA,CAAC,ANAC			72-33-13		Package G	06	CONNECTING PIN HOLE REPAIR		1125.00	SR Technics Switzerland
137794	53D359-01	EASA,FAA,CAAC,ANAC			72-33-13		Package G	07	CONNECTING PIN HOLE REPAIR		1125.00	SR Technics Switzerland
137794	53D529	EASA,FAA,CAAC,ANAC			72-33-13		Package SB00	PW4ENG 72-672	MODIFICATION OF THE BELLCRANK ASSEMBLY, 2.5 BLEED		1180.00	SR Technics Switzerland
137794	53D532-01	EASA,FAA,CAAC,ANAC										
137795	50P020	EASA,FAA,CAAC,ANAC	23	21	72-54-82	TURBINE EXHAUST CASE - NO. 4 BEARING SEAL (REAR) SPACER	Package A	CLN/INSP	CLEANING AND INSPECTION		155.00	SR Technics Switzerland
137795	50P191	EASA,FAA,CAAC,ANAC										
137807	50G693	EASA,FAA,CAAC,ANAC	27	28	72-33-83	FAN CASE - FAN EXIT OUTER (BIFURCATION) FAIRING ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		560.00	SR Technics Switzerland
137807	50G695	EASA,FAA,CAAC,ANAC			72-33-83		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	135.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137807	51G531-01	EASA,FAA,CAAC,ANAC			72-33-83		Package B	01	MINOR SURFACE DAMAGE REPAIR		1690.00	SR Technics Switzerland
137807	51G575	EASA,FAA,CAAC,ANAC			72-33-83		Package C	02	PATCH REPAIR		1710.00	SR Technics Switzerland
137807	51G576	EASA,FAA,CAAC,ANAC			72-33-83		Package D	03	REPLACE WASHERS		1380.00	SR Technics Switzerland
137807	51G599-01	EASA,FAA,CAAC,ANAC			72-33-83		Package E	04	REPAIR DISBONDED TITANIUM SHIELD		650.00	SR Technics Switzerland
137807	51G636-01	EASA,FAA,CAAC,ANAC										
137807	51G636-03	EASA,FAA,CAAC,ANAC										
137807	52G168-01	EASA,FAA,CAAC,ANAC										
137807	52G169-01	EASA,FAA,CAAC,ANAC										
137814	50B199	EASA,FAA,CAAC,ANAC	24	28	72-31-17	LOW PRESSURE COMPRESSOR (LPC) - NO. 1 BEARING (CARBON) SEAL A	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
137814	50B247	EASA,FAA,CAAC,ANAC			72-31-17		Package C	02	REPLACE THE CLINCH NUTS		915.00	SR Technics Switzerland
137814	50B275	EASA,FAA,CAAC,ANAC			72-31-17		Package D	03	PLASMA SPRAY OD SNAP (TITANIUM PART)		1670.00	SR Technics Switzerland
137814	50B772	EASA,FAA,CAAC,ANAC			72-31-17		Package SB00	PWAENG-72-237	REPLACEMENT OR MODIFICATION OF, TO IMPROVE RESTITANCE TO OIL LEAKS		155.00	SR Technics Switzerland
137814	51B170	EASA,FAA,CAAC,ANAC										
137817	51H486	EASA,FAA,CAAC,ANAC	2	18	72-35-43	PW4000 STG. 6 HPC SHROUD SEGMENT ASSY	Package A	CLN/INSP	CLEANING & INSPECTION		175.00	SR Technics Switzerland
137817	51H586-001	EASA,FAA,CAAC,ANAC										
137817	51H586-01	EASA,FAA,CAAC,ANAC										
137817	54H286-01	EASA,FAA,CAAC,ANAC										
137817	54H786-01	EASA,FAA,CAAC,ANAC										
137817	58H376-01	EASA,FAA,CAAC,ANAC										
137817	58H476-01	EASA,FAA,CAAC,ANAC										
137821	50A432	EASA,FAA,CAAC,ANAC	29	28	72-32-84	LPC/LPT COUPLING - TURBINE SHAFT NUT	Package A	CLN/INSP	CLEANING AND INSPECTION		590.00	SR Technics Switzerland
137821	51A512	EASA,FAA,CAAC,ANAC			72-32-84		Package B	01	REPLACE ANTIGALLANT		600.00	SR Technics Switzerland
137821	52A118	EASA,FAA,CAAC,ANAC										
137822	50G405	EASA,FAA,CAAC,ANAC	17	28	72-34-22	INTERMEDIATE CASE - GEARSHAFT ROLLER BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		355.00	SR Technics Switzerland
137822	50G406	EASA,FAA,CAAC,ANAC										
137822	50G407	EASA,FAA,CAAC,ANAC										
137822	50G634	EASA,FAA,CAAC,ANAC										
137822	51G986	EASA,FAA,CAAC,ANAC										
137822	51G987	EASA,FAA,CAAC,ANAC										
137822	51G988	EASA,FAA,CAAC,ANAC										
137822	51G989	EASA,FAA,CAAC,ANAC										
137823	50P000	EASA,FAA,CAAC,ANAC	22	28	72-54-14	TURBINE EXHAUST CASE - NO. 4 ROLLER BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		745.00	SR Technics Switzerland
137823	50P001	EASA,FAA,CAAC,ANAC										
137823	50P005	EASA,FAA,CAAC,ANAC										
137823	50P084	EASA,FAA,CAAC,ANAC										
137823	50P395	EASA,FAA,CAAC,ANAC										
137824	50A617	EASA,FAA,CAAC,ANAC	20	28	72-34-80	INTERMEDIATE CASE - NO. 1 BEARING (OIL) PRESSURE MANIFOLD	Package A	CLN/INSP	CLEANING AND INSPECTION		515.00	SR Technics Switzerland
137824	50A662-01	EASA,FAA,CAAC,ANAC			72-34-80		Package B	01	FERRULE OUTER DIAMETER CHROMIUM PLATE REPAIR		1175.00	SR Technics Switzerland
137824	50A662-02	EASA,FAA,CAAC,ANAC			72-34-80		Package C	02	REPLACE THE FRONT SUPPORT PIN		760.00	SR Technics Switzerland
137824	50A732	EASA,FAA,CAAC,ANAC										
137835	50G533	EASA,FAA,CAAC,ANAC	4	28	72-34-01	PW4 FAIRING TO STRUT ON INTERMEDIATE CASE	Package A	CLN/INSP	CLEANING & INSPECTION		340.00	SR Technics Switzerland
137835	50G534	EASA,FAA,CAAC,ANAC			72-34-01		Package B	001	PATCH REPAIR	FLOUROELASTOMER	845.00	SR Technics Switzerland
137835	51G546-01	EASA,FAA,CAAC,ANAC			72-34-01		Package B	001	PATCH REPAIR	ORGANIC FIBRE	845.00	SR Technics Switzerland
137835	51G547-01	EASA,FAA,CAAC,ANAC			72-34-01		Package E	004	PATCH REPAIR	EPOXY	845.00	SR Technics Switzerland
137835	51G685-01	EASA,FAA,CAAC,ANAC			72-34-01		Package E	004	PATCH REPAIR	FLOUROELASTOMER	845.00	SR Technics Switzerland
137835	51G686-01	EASA,FAA,CAAC,ANAC										
137835	51G831-01	EASA,FAA,CAAC,ANAC										
137835	51G832-01	EASA,FAA,CAAC,ANAC										
137835	51G867-01	EASA,FAA,CAAC,ANAC										
137835	51G869-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137835	52G046-01	EASA,FAA,CAAC,ANAC										
137835	52G047-01	EASA,FAA,CAAC,ANAC										
137835	52G048-01	EASA,FAA,CAAC,ANAC										
137835	52G049-01	EASA,FAA,CAAC,ANAC										
137835	52G241	EASA,FAA,CAAC,ANAC										
137835	52G242	EASA,FAA,CAAC,ANAC										
137835	52G243	EASA,FAA,CAAC,ANAC										
137835	52G244	EASA,FAA,CAAC,ANAC										
137835	52G375	EASA,FAA,CAAC,ANAC										
137847	50G517	EASA,FAA,CAAC,ANAC	34	28	72-34-70	INTERMEDIATE CASE - FAN EXIT OUTER LINER	Package A	CLN/INSP	CLEANING AND INSPECTION		560.00	SR Technics Switzerland
137847	50G518	EASA,FAA,CAAC,ANAC			72-34-70		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	135.00	SR Technics Switzerland
137847	50G519	EASA,FAA,CAAC,ANAC			72-34-70		Package B	01	LINER SEGMENT PATCH REPAIR		845.00	SR Technics Switzerland
137847	50G520	EASA,FAA,CAAC,ANAC			72-34-70		Package C	02	LINER SEGMENT ASSEMBLY EPOXY REPAIR		1095.00	SR Technics Switzerland
137847	50G521	EASA,FAA,CAAC,ANAC			72-34-70		Package D	03	LINER SEGMENT ASSEMBLY EPOXY REPAIR		430.00	SR Technics Switzerland
137847	50G522	EASA,FAA,CAAC,ANAC			72-34-70		Package H	07	NON-ACOUSTIC OUTER DIAMETER LINER FLOW SURFACE FLUOROELASTOMER TOUCH-UP REPAIR		1400.00	SR Technics Switzerland
137847	50G523	EASA,FAA,CAAC,ANAC			72-34-70		Package K	10	WASHER REPLACEMENT REPAIR		570.00	SR Technics Switzerland
137847	50G524	EASA,FAA,CAAC,ANAC			72-34-70		Package L	11	FAN EXIT OUTER DIAMETER SEAL BONDING REPAIR		720.00	SR Technics Switzerland
137847	50G819	EASA,FAA,CAAC,ANAC			72-34-70		Package M	12	FAN EXIT (OUTER) LINER SEGMENT ASSEMBLIES SURFACE DAMAGE PATCH REPAIR		1040.00	SR Technics Switzerland
137847	50G820	EASA,FAA,CAAC,ANAC			72-34-70		Package O	14	FAN EXIT (OUTER) LINER SEGMENT ACOUSTIC LINER REPAIR		1310.00	SR Technics Switzerland
137847	50G821	EASA,FAA,CAAC,ANAC			72-34-70		Package P	15	LINER SEGMENT ASSEMBLY LOOSE OR DAMAGE SPACER REPLACEMENT REPAIR		760.00	SR Technics Switzerland
137847	50G822	EASA,FAA,CAAC,ANAC			72-34-70		Package Q	16	STRUT 1 OUTER LINER SEGMENT NUT PLATE REPLACEMENT REPAIR		505.00	SR Technics Switzerland
137847	50G823	EASA,FAA,CAAC,ANAC			72-34-70		Package SB00	PWVG-100-72-174	CASE ASSEMBLY, COMPRESSOR INTERMEDIATE - REPLACEMENT OF FAN BRACKET ASSEMBLIES WITH REDESIGNED ATT		620.00	SR Technics Switzerland
137847	50G824	EASA,FAA,CAAC,ANAC										
137847	50G825	EASA,FAA,CAAC,ANAC										
137847	51G782-01	EASA,FAA,CAAC,ANAC										
137847	51G783-01	EASA,FAA,CAAC,ANAC										
137847	51G784-01	EASA,FAA,CAAC,ANAC										
137847	51G785-01	EASA,FAA,CAAC,ANAC										
137847	51G786-01	EASA,FAA,CAAC,ANAC										
137847	51G787-01	EASA,FAA,CAAC,ANAC										
137847	51G788-01	EASA,FAA,CAAC,ANAC										
137847	51G789-01	EASA,FAA,CAAC,ANAC										
137847	51G790-01	EASA,FAA,CAAC,ANAC										
137847	51G791-01	EASA,FAA,CAAC,ANAC										
137847	51G792-01	EASA,FAA,CAAC,ANAC										
137847	51G793-01	EASA,FAA,CAAC,ANAC										
137847	51G794-01	EASA,FAA,CAAC,ANAC										
137847	51G795-01	EASA,FAA,CAAC,ANAC										
137847	51G796-01	EASA,FAA,CAAC,ANAC										
137847	51G894-01	EASA,FAA,CAAC,ANAC										
137847	51G895-01	EASA,FAA,CAAC,ANAC										
137847	51G896-01	EASA,FAA,CAAC,ANAC										
137847	51G897-01	EASA,FAA,CAAC,ANAC										
137847	51G898-01	EASA,FAA,CAAC,ANAC										
137847	51G899-01	EASA,FAA,CAAC,ANAC										
137847	51G900-01	EASA,FAA,CAAC,ANAC										
137847	51G901-01	EASA,FAA,CAAC,ANAC										
137847	51G902-01	EASA,FAA,CAAC,ANAC										
137847	51G903-01	EASA,FAA,CAAC,ANAC										
137847	51G904-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137847	51G905-01	EASA,FAA,CAAC,ANAC										
137847	51G906-01	EASA,FAA,CAAC,ANAC										
137847	51G907-01	EASA,FAA,CAAC,ANAC										
137847	51G908-01	EASA,FAA,CAAC,ANAC										
137847	51G909-01	EASA,FAA,CAAC,ANAC										
137847	51G910-01	EASA,FAA,CAAC,ANAC										
137847	51G911-01	EASA,FAA,CAAC,ANAC										
137847	51G912-01	EASA,FAA,CAAC,ANAC										
137847	51G913-01	EASA,FAA,CAAC,ANAC										
137847	51G914-01	EASA,FAA,CAAC,ANAC										
137847	51G915-01	EASA,FAA,CAAC,ANAC										
137847	52G182-01	EASA,FAA,CAAC,ANAC										
137847	52G183-01	EASA,FAA,CAAC,ANAC										
137847	52G184-01	EASA,FAA,CAAC,ANAC										
137847	52G185-01	EASA,FAA,CAAC,ANAC										
137847	52G186-01	EASA,FAA,CAAC,ANAC										
137847	52G187-01	EASA,FAA,CAAC,ANAC										
137847	52G188-01	EASA,FAA,CAAC,ANAC										
137847	52G189-01	EASA,FAA,CAAC,ANAC										
137847	52G199-01	EASA,FAA,CAAC,ANAC										
137847	52G200-01	EASA,FAA,CAAC,ANAC										
137847	52G201-01	EASA,FAA,CAAC,ANAC										
137847	52G202-01	EASA,FAA,CAAC,ANAC										
137847	52G203-01	EASA,FAA,CAAC,ANAC										
137847	52G204-01	EASA,FAA,CAAC,ANAC										
137847	52G205-01	EASA,FAA,CAAC,ANAC										
137847	52G358	EASA,FAA,CAAC,ANAC										
137847	52G358-001	EASA,FAA,CAAC,ANAC										
137847	52G359	EASA,FAA,CAAC,ANAC										
137847	52G359-001	EASA,FAA,CAAC,ANAC										
137847	52G360	EASA,FAA,CAAC,ANAC										
137847	52G360-001	EASA,FAA,CAAC,ANAC										
137847	52G361	EASA,FAA,CAAC,ANAC										
137847	52G361-001	EASA,FAA,CAAC,ANAC										
137847	52G362	EASA,FAA,CAAC,ANAC										
137847	52G362-001	EASA,FAA,CAAC,ANAC										
137847	52G363	EASA,FAA,CAAC,ANAC										
137847	52G363-001	EASA,FAA,CAAC,ANAC										
137847	52G364	EASA,FAA,CAAC,ANAC										
137847	52G364-001	EASA,FAA,CAAC,ANAC										
137847	52G425-01	EASA,FAA,CAAC,ANAC										
137847	52G426-01	EASA,FAA,CAAC,ANAC										
137847	52G427	EASA,FAA,CAAC,ANAC										
137847	52G428-01	EASA,FAA,CAAC,ANAC										
137847	52G429	EASA,FAA,CAAC,ANAC										
137847	52G430-01	EASA,FAA,CAAC,ANAC										
137847	52G431	EASA,FAA,CAAC,ANAC										
137847	52G432	EASA,FAA,CAAC,ANAC										
137847	52G433-01	EASA,FAA,CAAC,ANAC										
137847	52G434	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137847	52G440-01	EASA,FAA,CAAC,ANAC										
137847	52G536	EASA,FAA,CAAC,ANAC										
137847	52G537	EASA,FAA,CAAC,ANAC										
137847	52G538	EASA,FAA,CAAC,ANAC										
137847	52G539	EASA,FAA,CAAC,ANAC										
137847	52G540	EASA,FAA,CAAC,ANAC										
137847	52G541	EASA,FAA,CAAC,ANAC										
137847	52G542	EASA,FAA,CAAC,ANAC										
137853	310T3152-16	EASA,FAA,CAAC,ANAC	20	21	71-21-16	FWD ENGINE MOUNT - BOLT- 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		255.00	SR Technics Switzerland
137853	310T3152-17	EASA,FAA,CAAC,ANAC			71-21-16		Package B	10-1	CHROMIUM PLATE SHAFT OUTER DIAMETER		315.00	SR Technics Switzerland
137853	310T3152-18	EASA,FAA,CAAC,ANAC										
137853	310T3152-6	EASA,FAA,CAAC,ANAC										
137853	310T3152-7	EASA,FAA,CAAC,ANAC										
137853	310T3152-8	EASA,FAA,CAAC,ANAC										
137855	310T3150-1	EASA,FAA,CAAC,ANAC	3	21	71-21-16	PW4 ENGINE AFT MOUNT PIN-LINK PIVOT	Package A	CLN/INSP	CLEANING & INSPECTION		190.00	SR Technics Switzerland
137855	310T3150-2	EASA,FAA,CAAC,ANAC			71-21-16		Package J	9-1	PLATING PIN		660.00	SR Technics Switzerland
137855	310T3150-3	EASA,FAA,CAAC,ANAC			71-21-16		Package SB00	767-SL-54-016	AFT MOUNT, INSPECTION OF PIVOT-LINK PIN		120.00	SR Technics Switzerland
137855	310T3150-4	EASA,FAA,CAAC,ANAC										
137855	310T3150-5	EASA,FAA,CAAC,ANAC										
137896	50G911	EASA,FAA,CAAC,ANAC	3	28	72-62-15	PW4000 NOZZLE ASSY ANGLE GEARBOX	Package B	01	REPLACE PROTECTIVE COATING		175.00	SR Technics Switzerland
137896	51G090	EASA,FAA,CAAC,ANAC			72-62-15		Package SB00	PW4ENG 72-131	MODIFICATION OF AGB OIL NOZZLE ASSIES		715.00	SR Technics Switzerland
137896	71R050	EASA,FAA,CAAC,ANAC										
137902	50U402-01	EASA,FAA,CAAC,ANAC	24	21	72-09-73	ENGINE GENERAL - COMMON PARTS - BRACKETS - TCC MANIFOLD	Package A	CLN/INSP	CLEANING AND INSPECTION		700.00	SR Technics Switzerland
137902	50U403-001	EASA,FAA,CAAC,ANAC			72-09-73		Package B	01	REPLACE WORN GUIDE PINS		655.00	SR Technics Switzerland
137902	50U403-01	EASA,FAA,CAAC,ANAC			72-09-73		Package C	02	REPLACE WORN GUIDE PINS		415.00	SR Technics Switzerland
137902	51H443	EASA,FAA,CAAC,ANAC			72-09-73		Package D	03	REPLACE WORN GUIDE PINS (INCONEL 718)		680.00	SR Technics Switzerland
137902	51H445	EASA,FAA,CAAC,ANAC			72-09-73		Package E	04	BLEND REPAIR OIL COOLER BRACKET ASSEMBLY		300.00	SR Technics Switzerland
137902	51U762-01	EASA,FAA,CAAC,ANAC			72-09-73		Package F	05	REPLACE THE OIL COOLER BRACKET ASSEMBLY BEARING		845.00	SR Technics Switzerland
137902	51U955-01	EASA,FAA,CAAC,ANAC			72-09-73		Package G	06	LOOP CLAMP BRACKET ASSEMBLY WELD REPAIR		455.00	SR Technics Switzerland
137902	52T012-01	EASA,FAA,CAAC,ANAC			72-09-73		Package J	09	LOOP CLAMP BRACKET ASSEMBLY WELD BEAD CRACK REPAIR		665.00	SR Technics Switzerland
137902	52T127-001	EASA,FAA,CAAC,ANAC			72-09-73		Package L	11	OIL COOLER BRACKET ASSEMBLY BEARING REPLACEMENT REPAIR		1145.00	SR Technics Switzerland
137902	52T127-01	EASA,FAA,CAAC,ANAC			72-09-73		Package M	12	BIFURCATION ELECTRICAL CONDUIT LINK ASSEMBLY BEARING REPLACEMENT		555.00	SR Technics Switzerland
137902	52T543-01	EASA,FAA,CAAC,ANAC			72-09-73		Package O	14	ANTI SLIP STRIP ADHESIVE REPLACEMENT		685.00	SR Technics Switzerland
137902	52T631-01	EASA,FAA,CAAC,ANAC			72-09-73		Package Q	16	LAMINATE REPAIR		680.00	SR Technics Switzerland
137902	52T632-001	EASA,FAA,CAAC,ANAC			72-09-73		Package R	17	RUBBER CUSHION REPLACEMENT REPAIR		470.00	SR Technics Switzerland
137902	52T632-01	EASA,FAA,CAAC,ANAC			72-09-73		Package S	18	LOOP CLAMP BRACKET ASSEMBLY ELONGATED HOLE WELD REPAIR		590.00	SR Technics Switzerland
137902	52T782-01	EASA,FAA,CAAC,ANAC			72-09-73		Package SB00	PW4ENG 75-131	AIR - BRACKET ASSEMBLIES, TURBINE CASE COOLING /TCC) AIR TUBE SUPPORT - MODIFICATION OF TO INCORPORA		470.00	SR Technics Switzerland
137902	52T783-01	EASA,FAA,CAAC,ANAC			72-09-73		Package SB01	PW4ENG 79-76	OIL - TUBES, NO. 4 BEARING PRESSURE AND SCAVENGE - REROUTING FROM THE BEARING HOUSING TO THE INTERFA		465.00	SR Technics Switzerland
137902	52T914-001	EASA,FAA,CAAC,ANAC			72-09-73		Package SB02	PW4ENG 72-595	NUT PLATE, SELF-LOCKING-REPLACEMENT TO ELIMINATE GALLING AND SEIZING OF BOLTS		440.00	SR Technics Switzerland
137902	52T914-01	EASA,FAA,CAAC,ANAC			72-09-73		Package T	19	LOOP LAMP BRACKET ELONGATED HOLE WELD REPAIR		555.00	SR Technics Switzerland
137902	53H475	EASA,FAA,CAAC,ANAC			72-09-73		Package U	20	WELD BEAD CRACK WELD REPAIR		535.00	SR Technics Switzerland
137902	53T052-001	EASA,FAA,CAAC,ANAC			72-09-73		Package X	23	NUTPLATE AND LUG REPLACEMENT REPAIR		440.00	SR Technics Switzerland
137902	53T052-002	EASA,FAA,CAAC,ANAC										
137902	53T052-003	EASA,FAA,CAAC,ANAC										
137902	53T052-01	EASA,FAA,CAAC,ANAC										
137902	53T101-01	EASA,FAA,CAAC,ANAC										
137902	53T396-001	EASA,FAA,CAAC,ANAC										
137902	53T396-01	EASA,FAA,CAAC,ANAC										
137902	53T513-01	EASA,FAA,CAAC,ANAC										
137902	53T842-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
137902	537843-01	EASA,FAA,CAAC,ANAC										
137902	547414-01	EASA,FAA,CAAC,ANAC										
137902	547770-01	EASA,FAA,CAAC,ANAC										
137902	567604-01	EASA,FAA,CAAC,ANAC										
137902	567605-001	EASA,FAA,CAAC,ANAC										
137902	567605-01	EASA,FAA,CAAC,ANAC										
137902	567606-01	EASA,FAA,CAAC,ANAC										
137902	577970-01	EASA,FAA,CAAC,ANAC										
137902	577971-01	EASA,FAA,CAAC,ANAC										
137902	597140-01	EASA,FAA,CAAC,ANAC										
137902	597619-01	EASA,FAA,CAAC,ANAC										
137902	597620-01	EASA,FAA,CAAC,ANAC										
137902	597867-001	EASA,FAA,CAAC,ANAC										
137902	597867-01	EASA,FAA,CAAC,ANAC										
137902	597919-01	EASA,FAA,CAAC,ANAC										
137917	506664	EASA,FAA,CAAC,ANAC	24	28	72-33-18	FAN CASE - FAN EXIT LINER SEGMENT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		775.00	SR Technics Switzerland
137917	506666	EASA,FAA,CAAC,ANAC			72-33-18		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	135.00	SR Technics Switzerland
137917	506668	EASA,FAA,CAAC,ANAC			72-33-18		Package B	01	MINOR REPAIR - ID FRONT FLOWPATH LINER		600.00	SR Technics Switzerland
137917	506669	EASA,FAA,CAAC,ANAC			72-33-18		Package C	02	PATCH REPAIR - ID FRONT FLOWPATH LINER		875.00	SR Technics Switzerland
137917	516768-01	EASA,FAA,CAAC,ANAC			72-33-18		Package D	03	REPLACE NUT PLATES		410.00	SR Technics Switzerland
137917	516769-01	EASA,FAA,CAAC,ANAC			72-33-18		Package E	04	REPLACE SPLICE PLATE		655.00	SR Technics Switzerland
137917	516771-01	EASA,FAA,CAAC,ANAC			72-33-18		Package F	05	REPLACE WASHERS		410.00	SR Technics Switzerland
137917	516772-01	EASA,FAA,CAAC,ANAC										
137917	526190-01	EASA,FAA,CAAC,ANAC										
137917	526191-01	EASA,FAA,CAAC,ANAC										
137917	526192-01	EASA,FAA,CAAC,ANAC										
137917	526193-01	EASA,FAA,CAAC,ANAC										
137925	310U4031-1	EASA,FAA,CAAC,ANAC	11	21	71-21-16	PW4 AFTER ENGINE MOUNT HANGER ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		1110.00	SR Technics Switzerland
137925	310U4031-11	EASA,FAA,CAAC,ANAC			71-21-16		Package B	8-1	BUSHING REPLACEMENT		530.00	SR Technics Switzerland
137925	310U4031-13	EASA,FAA,CAAC,ANAC			71-21-16		Package C	8-1	APPLICATION OF PROTECTIVE COATING		2035.00	SR Technics Switzerland
137925	310U4031-15	EASA,FAA,CAAC,ANAC			71-21-16		Package C	8-2	SCRATCH AND GOUGE REPAIR		2035.00	SR Technics Switzerland
137925	310U4031-17	EASA,FAA,CAAC,ANAC			71-21-16		Package D	8-2	BUSHING HOLE REPAIR		1750.00	SR Technics Switzerland
137925	310U4031-19	EASA,FAA,CAAC,ANAC										
137925	310U4031-3	EASA,FAA,CAAC,ANAC										
137925	310U4031-5	EASA,FAA,CAAC,ANAC										
137925	310U4031-7	EASA,FAA,CAAC,ANAC										
137925	310U4031-9	EASA,FAA,CAAC,ANAC										
138121	70R229	EASA,FAA,CAAC,ANAC	23	28	72-61-48	MAIN GEARBOX - GEARBOX BEARING SEAL SEAT	Package B	01	LAP CARBON SEAL MATING FACE		280.00	SR Technics Switzerland
138121	70R738	EASA,FAA,CAAC,ANAC										
138122	221-4049-503	EASA,FAA,CAAC,ANAC	20	21	71-20-04	FWD ENGINE MOUNT - ASSEMBLY - 94"	Package D	LIGHT	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P# EXAMPLE: MOUNT SUPPORT REPLACEMENT		715.00	SR Technics Switzerland
138122	221-4049-507	EASA,FAA,CAAC,ANAC			71-20-04		Package E	MEDIUM	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P# EXAMPLE: LINK ASSY REPLACEMENT (2EA)		1720.00	SR Technics Switzerland
138122	221-4086-15	EASA,FAA,CAAC,ANAC			71-20-04		Package F	HEAVY	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE P# EXAMPLE: CROSSBEAM ASSY REPLACEMENT		2950.00	SR Technics Switzerland
138122	221-4086-17	EASA,FAA,CAAC,ANAC			71-20-04		Package G	OVERHAUL	DISASSEMBLY, CLEANING, INSPECTION, ASSEMBLY. EXCLUDED PIECE PART REPAIRS		3025.00	SR Technics Switzerland
138122	221-4086-19	EASA,FAA,CAAC,ANAC			71-20-04		Package SB00	PW4NAC 71-111	MODIFICATION OF MOUNT RETAINER ASSEMBLY	IN CONJUNCTION WITH PACKAGE HEAVY OR C	105.00	SR Technics Switzerland
138122	221-4086-25	EASA,FAA,CAAC,ANAC			71-20-04		Package SB01	PW4NAC 71-74	INSPECTION AND ELECTRO ETCHING	IN CONJUNCTION WITH PACKAGE HEAVY OR C	290.00	SR Technics Switzerland
138122	221-4086-507	EASA,FAA,CAAC,ANAC			71-20-04		Package SB02	PW4NAC 71-58	REPLACEMENT OF STOP BOLTS	IN CONJUNCTION WITH PACKAGE HEAVY OR C	105.00	SR Technics Switzerland
138122	221-4086-515	EASA,FAA,CAAC,ANAC			71-20-04		Package SB03	PW4NAC 71-77	REPLACEMENT OF MAIN BEAM AND BEARING	IN CONJUNCTION WITH PACKAGE HEAVY OR C	105.00	SR Technics Switzerland
138122	221-4086-517	EASA,FAA,CAAC,ANAC			71-20-04		Package SB04	PW4MD11 71-36	MODIFICATION OF RETAINER ASSEMBLY	IN CONJUNCTION WITH PACKAGE LIGHT, MED	110.00	SR Technics Switzerland
138122	221-4086-523	EASA,FAA,CAAC,ANAC			71-20-04		Package SB05	PW4NAC 71-163	REPLACE ATTACHMENT HARDWARE WITH SERIALIZED PARTS		105.00	SR Technics Switzerland
138141	50R280-01	EASA,FAA,CAAC,ANAC	22	28	72-61-74	MAIN GEARBOX - OIL TANK HEAT SHIELD ASSEMBLY	Package B	01	REPAIR DAMAGED AREA		440.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
138141	51R059-01	EASA,FAA,CAAC,ANAC										
138141	51R120-01	EASA,FAA,CAAC,ANAC										
138149	310T4031-1	EASA,FAA,CAAC,ANAC	22	21	71-21-16	AFT ENGINE MOUNT - HANGER ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		1245.00	SR Technics Switzerland
138149	310T4031-10	EASA,FAA,CAAC,ANAC			71-21-16		Package B	5-1	BUSHING REPLACEMENT		2010.00	SR Technics Switzerland
138149	310T4031-2	EASA,FAA,CAAC,ANAC			71-21-16		Package C	5-2	BUSHING HOLE REPAIR		2640.00	SR Technics Switzerland
138149	310T4031-5	EASA,FAA,CAAC,ANAC										
138236	50H084CL1	EASA,FAA,CAAC,ANAC	2	28	72-35-40	PW4 VSV-BEARING TO HPC FRONT CASE	Package B	01	REWORK OUTER DIAMETER FOR INSTALLATION		55.00	SR Technics Switzerland
138236	50H084CL2	EASA,FAA,CAAC,ANAC			72-35-40		Package C	23	REWORK OUTER DIAMETER FOR INSTALLATION		55.00	SR Technics Switzerland
138236	50H084CL3	EASA,FAA,CAAC,ANAC			72-35-40		Package D	44	REWORK OUTER DIAMETER FOR INSTALLATION		55.00	SR Technics Switzerland
138236	50H084CL4	EASA,FAA,CAAC,ANAC										
138236	50H084CL5	EASA,FAA,CAAC,ANAC										
138236	50H084CL6	EASA,FAA,CAAC,ANAC										
138236	50H084CL7	EASA,FAA,CAAC,ANAC										
138236	50H499CL1	EASA,FAA,CAAC,ANAC										
138236	50H499CL2	EASA,FAA,CAAC,ANAC										
138236	50H499CL3	EASA,FAA,CAAC,ANAC										
138236	50H499CL4	EASA,FAA,CAAC,ANAC										
138236	50H499CL5	EASA,FAA,CAAC,ANAC										
138236	50H499CL6	EASA,FAA,CAAC,ANAC										
138236	50H499CL7	EASA,FAA,CAAC,ANAC										
138236	50H500CL1	EASA,FAA,CAAC,ANAC										
138236	50H500CL2	EASA,FAA,CAAC,ANAC										
138236	50H500CL3	EASA,FAA,CAAC,ANAC										
138236	50H500CL4	EASA,FAA,CAAC,ANAC										
138236	50H500CL5	EASA,FAA,CAAC,ANAC										
138236	50H500CL6	EASA,FAA,CAAC,ANAC										
138236	50H500CL7	EASA,FAA,CAAC,ANAC										
138241	50B426	EASA,FAA,CAAC,ANAC	25	28	72-31-03	LOW PRESSURE COMPRESSOR (LPC) - STAGE 1.6 LPC BLADE - 94"	Package A	CLN/INSP	CLEANING 001 AND INSPECTION 001		60.00	SR Technics Switzerland
138241	51B026	EASA,FAA,CAAC,ANAC			72-31-03		Package E		WEIGH AND MATCH BLADES		60.00	SR Technics Switzerland
138241	53B516	EASA,FAA,CAAC,ANAC										
138241	53B516-001	EASA,FAA,CAAC,ANAC										
138241	55B116	EASA,FAA,CAAC,ANAC										
138241	55B116-001	EASA,FAA,CAAC,ANAC										
138259	50A620	EASA,FAA,CAAC,ANAC	14	28	72-33-84	FAN CASE - NO. 3 BEARING AIR COOLER ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		1050.00	SR Technics Switzerland
138259	50A695	EASA,FAA,CAAC,ANAC										
138259	51A008	EASA,FAA,CAAC,ANAC										
138259	51A613	EASA,FAA,CAAC,ANAC										
138580	312T4311-1	EASA,FAA,CAAC,ANAC	3	21	36-10-06	PNEUMATIC DUCTS B-767	Package A	CLN/INSP	CLEANING AND INSPECTION		595.00	SR Technics Switzerland
138580	312T4336-1	EASA,FAA,CAAC,ANAC			36-10-06		Package D	LIGHT	MINOR REPAIR		1125.00	SR Technics Switzerland
138580	332T4313-14	FAA,CAAC,ANAC										
138580	332T4320-3	EASA,FAA,CAAC,ANAC										
138580	332T4321-1	EASA,FAA,CAAC,ANAC										
138580	332T4322-1	EASA,FAA,CAAC,ANAC										
138580	332T4323-1	EASA,FAA,CAAC,ANAC										
138580	332T4324-1	EASA,FAA,CAAC,ANAC										
138580	332T4325-1	EASA,FAA,CAAC,ANAC										
138580	332T4326-1	EASA,FAA,CAAC,ANAC										
138580	332T4327-1	EASA,FAA,CAAC,ANAC										
138580	332T4327-5	EASA,FAA,CAAC,ANAC										
138580	332T4328-1	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
138580	332T4391-1	EASA,FAA,ANAC										
138629	50A374	EASA,FAA,CAAC,ANAC	29	21	72-54-09	TURBINE EXHAUST CASE - NO. 4 BEARING OIL SCAVENGE (INNER) TUBE	Package A	CLN/INSP	CLEANING AND INSPECTION		345.00	SR Technics Switzerland
138629	51A142-01	EASA,FAA,CAAC,ANAC										
138629	51A168-01	EASA,FAA,CAAC,ANAC										
138647	50I105	EASA,FAA,CAAC,ANAC	30	28	72-41-40	DIFFUSER AND COMBUSTOR - FUEL NOZZLE SUPPLY MANIFOLD ASSEM	Package A	CLN/INSP	CLEANING AND INSPECTION		360.00	SR Technics Switzerland
138647	50I105-001	EASA,FAA,CAAC,ANAC			72-41-40		Package B	01	INNER DIAMETER TUBE REPAIR		795.00	SR Technics Switzerland
138647	50I372	EASA,FAA,CAAC,ANAC			72-41-40		Package SB00	PW4ENG 73-167	NEW FUEL NOZZLE MANIFOLDS AND PACKINGS		470.00	SR Technics Switzerland
138647	50I372-001	EASA,FAA,CAAC,ANAC			72-41-40		Package SB00	PW4G-100-73-6	INCORPORATION OF NEW MANIFOLDS WITH SHORTER TUBE NUT THRUST WIRES AND MORE DURABLE PREFORM PAC		470.00	SR Technics Switzerland
138647	50I396-01	EASA,FAA,CAAC,ANAC			72-41-40		Package SB01	PW4G-100-A73-48	INSPECTION AND REPETITIVE	AD FAA 2019-06-07	330.00	SR Technics Switzerland
138647	50I398-01	EASA,FAA,CAAC,ANAC			72-41-40		Package W	22	REPAIR CONICAL SEAT	SPM 70-00-00	270.00	SR Technics Switzerland
138647	50I958-01	EASA,FAA,CAAC,ANAC										
138647	50I959-01	EASA,FAA,CAAC,ANAC										
138667	50D939-01	EASA,FAA,CAAC,ANAC	5	21	72-33-20	PW4 BELL CRANK BRACKET ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		315.00	SR Technics Switzerland
138667	51D778-001	EASA,FAA,CAAC,ANAC			72-33-20		Package B	01	REPLACE THE BEARINGS 94"		560.00	SR Technics Switzerland
138667	51D778-01	EASA,FAA,CAAC,ANAC			72-33-20		Package C	02	REPLACE THE BEARINGS 100"		325.00	SR Technics Switzerland
138667	52D697-01	EASA,FAA,CAAC,ANAC			72-33-20		Package D	03	REPLACE THE GUIDE PIN		275.00	SR Technics Switzerland
138667	53D255-01	EASA,FAA,CAAC,ANAC			72-33-20		Package SB00	PW4G-100-72-112	FC, SLOT LINER MODI 2.5 BLEED SYSTEM		350.00	SR Technics Switzerland
138667	53D357-01	EASA,FAA,CAAC,ANAC										
138667	53D899-01	EASA,FAA,CAAC,ANAC										
139219	50I309	EASA,FAA,CAAC,ANAC	23	28	72-41-01	DIFFUSER AND COMBUSTOR - CHANNEL ASSY OF DIFFUSER CASE	Package A	CLN/INSP	CLEANING AND INSPECTION		140.00	SR Technics Switzerland
139219	50I310	EASA,FAA,CAAC,ANAC			72-41-01		Package B	SPM-02	REPAIR OF GANG NUT ASSEMBLIES	SPM 70-00-00 P/N 585005 REP.02	660.00	SR Technics Switzerland
139219	50I311	EASA,FAA,CAAC,ANAC			72-41-01		Package B	SPM-11	REPLATING OF CASE FLANGE NUTS	SPM 70-00-00 P/N 585005 REP.11	660.00	SR Technics Switzerland
139219	50I320	EASA,FAA,CAAC,ANAC										
139219	50I321	EASA,FAA,CAAC,ANAC										
139226	50A191	EASA,FAA,CAAC,ANAC	19	28	72-54-83	TURBINE EXHAUST CASE - TURBINE EXHAUST CASE - NO. 4 BEARING C	Package A	CLN/INSP	CLEANING AND INSPECTION		605.00	SR Technics Switzerland
139226	50A191-001	EASA,FAA,CAAC,ANAC			72-54-83		Package SB00	PW4ENG 72-385	MODIFICATION OF, TO INCLUDE JACKSCREW HOLES		795.00	SR Technics Switzerland
139226	50A655-01	EASA,FAA,CAAC,ANAC										
139300	664508	EASA,FAA,CAAC,ANAC	3	28	72-61-65	PW4 PRESSURE RELIEF VALVE (FILTER ELEMENT)	Package A	TEST	PRESSURE TEST		435.00	SR Technics Switzerland
139300	740535	EASA,FAA,CAAC,ANAC										
139328	14510-113	EASA,FAA,CAAC,ANAC	25	21	72-09-00	ENGINE GENERAL - COMMON PARTS - VARIOUS ENGINE BRACKETS AN	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
139328	1A8431	EASA,FAA,CAAC,ANAC			72-09-00		Package B		INSERTS REPLACEMENT	ACC. SPM	160.00	SR Technics Switzerland
139328	221-4352-501	EASA,FAA,CAAC,ANAC,TCCA			72-09-00		Package B		NUTPLATES REPLACEMENT	ACC. SPM	160.00	SR Technics Switzerland
139328	221-4352-503	EASA,FAA,CAAC,ANAC,TCCA			72-09-00		Package B		SPRING TENSION CLIP REPLACEMENT	ACC. SPM	160.00	SR Technics Switzerland
139328	221-5357-501	EASA,FAA,CAAC,ANAC,TCCA			72-09-00		Package SB00	PW4G-100-72-60	INCORPORATION OF NEW SPRING TENSION CLIPS		215.00	SR Technics Switzerland
139328	312T2359-25	EASA,FAA,CAAC,ANAC			72-09-00		Package SB01	PW4ENG 72-595	REPLACEMENT TO ELIMINATE GALLING AND SEIZING OF BOLTS		120.00	SR Technics Switzerland
139328	332T4714-1	ANAC,TCCA			72-09-00		Package SB02	PW4ENG 72-609	MODIFICATION OF TO INCREASE CLEARANCE WITH THE PT4.95 SENSE TUBE		240.00	SR Technics Switzerland
139328	332T4714-7	ANAC,TCCA			72-09-00		Package SB03	PW4ENG 74-5	IGNITION EXCITER HEATSH. LOCATION IDENTIFICATION		135.00	SR Technics Switzerland
139328	332T4714-9	ANAC,TCCA			72-09-00		Package SB04	PW4ENG 73-118	INCORPORATION OF NEW TERMINAL LUG CONNECTORS		175.00	SR Technics Switzerland
139328	332T4911-58	EASA,FAA,CAAC,ANAC			72-09-00		Package SB05	PW4ENG 74-4	EXCITER FR.HEATSHIELD ASSY- MODIFICATION		135.00	SR Technics Switzerland
139328	332T4911-62	EASA,FAA,CAAC,ANAC										
139328	332T4911-77	EASA,FAA,CAAC,ANAC										
139328	332T4911-79	EASA,FAA,CAAC,ANAC										
139328	332T4921-219	EASA,FAA,ANAC										
139328	332T4921-241	EASA,FAA,CAAC,ANAC										
139328	332T4922-286	EASA,FAA,CAAC,ANAC										
139328	332T4922-369	EASA,FAA,CAAC,ANAC										
139328	332T4922-416	EASA,FAA,CAAC,ANAC										
139328	332T4922-632	EASA,FAA,CAAC,ANAC										
139328	332T4922-640	EASA,FAA,CAAC,ANAC										
139328	332T4922-96	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139328	33274925-10	EASA,FAA,CAAC,ANAC										
139328	33274925-24	EASA,FAA,ANAC										
139328	500729-01	EASA,FAA,CAAC,ANAC										
139328	500747-01	EASA,FAA,CAAC,ANAC										
139328	506959-01	EASA,FAA,CAAC,ANAC										
139328	501208	EASA,FAA,CAAC,ANAC										
139328	501601	EASA,FAA,CAAC,ANAC										
139328	501804-01	EASA,FAA,CAAC,ANAC										
139328	501831-01	EASA,FAA,CAAC,ANAC										
139328	501832-01	EASA,FAA,CAAC,ANAC										
139328	50N581-01	EASA,FAA,CAAC,ANAC										
139328	50P287-01	EASA,FAA,CAAC,ANAC										
139328	50P304-01	EASA,FAA,CAAC,ANAC										
139328	50P305-01	EASA,FAA,CAAC,ANAC										
139328	50P411-01	EASA,FAA,CAAC,ANAC										
139328	50P412-01	EASA,FAA,CAAC,ANAC										
139328	50P419-01	EASA,FAA,CAAC,ANAC										
139328	50R359-01	EASA,FAA,CAAC,ANAC										
139328	50T193	EASA,FAA,CAAC,ANAC										
139328	50T534	EASA,FAA,ANAC										
139328	50U005-001	EASA,FAA,CAAC,ANAC										
139328	50U005-01	EASA,FAA,CAAC,ANAC										
139328	50U037-01	EASA,FAA,CAAC,ANAC										
139328	50U053-01	EASA,FAA,CAAC,ANAC										
139328	50U054-01	EASA,FAA,CAAC,ANAC										
139328	50U056-01	EASA,FAA,CAAC,ANAC										
139328	50U057-01	EASA,FAA,CAAC,ANAC										
139328	50U058-01	EASA,FAA,CAAC,ANAC										
139328	50U062-01	EASA,FAA,CAAC,ANAC										
139328	50U063-01	EASA,FAA,CAAC,ANAC										
139328	50U064-01	EASA,FAA,CAAC,ANAC										
139328	50U144-01	EASA,FAA,CAAC,ANAC										
139328	50U359-01	EASA,FAA,CAAC,ANAC										
139328	50U360-01	EASA,FAA,CAAC,ANAC										
139328	50U390-01	EASA,FAA,CAAC,ANAC										
139328	50U397-01	EASA,FAA,CAAC,ANAC										
139328	50U417-01	EASA,FAA,CAAC,ANAC										
139328	50U419	EASA,FAA,CAAC,ANAC										
139328	50U458-01	EASA,FAA,CAAC,ANAC										
139328	50U493-01	EASA,FAA,CAAC,ANAC										
139328	50U593-01	EASA,FAA,CAAC,ANAC										
139328	50U725-01	EASA,FAA,CAAC,ANAC										
139328	50U731-01	EASA,FAA,CAAC,ANAC										
139328	50U734-01	EASA,FAA,CAAC,ANAC										
139328	50U757-01	EASA,FAA,CAAC,ANAC										
139328	50U761-01	EASA,FAA,ANAC,TCCA										
139328	50U764-01	EASA,FAA,CAAC,ANAC,TCCA										
139328	50U780-01	EASA,FAA,CAAC,ANAC										
139328	50U948-01	EASA,FAA,CAAC,ANAC										
139328	510671-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139328	51G427-01	EASA,FAA,CAAC,ANAC										
139328	51H396-01	EASA,FAA,CAAC,ANAC										
139328	51H397-01	EASA,FAA,CAAC,ANAC										
139328	51H398-01	EASA,FAA,CAAC,ANAC										
139328	51H484-01	EASA,FAA,CAAC,ANAC										
139328	51H596-01	EASA,FAA,CAAC,ANAC										
139328	51H872	EASA,FAA,CAAC,ANAC										
139328	51H995-01	EASA,FAA,CAAC,ANAC										
139328	51H995-03	EASA,FAA,CAAC,ANAC										
139328	51J142-01	EASA,FAA,CAAC,ANAC										
139328	51R131-01	EASA,FAA,CAAC,ANAC										
139328	51T247	EASA,FAA,CAAC,ANAC										
139328	51T306	EASA,FAA,CAAC,ANAC										
139328	51T758	EASA,FAA,CAAC,ANAC										
139328	51U070-01	EASA,FAA,CAAC,ANAC										
139328	51U089-01	EASA,FAA,CAAC,ANAC										
139328	51U092-01	EASA,FAA,CAAC,ANAC										
139328	51U115-01	EASA,FAA,CAAC,ANAC										
139328	51U580-01	EASA,FAA,CAAC,ANAC										
139328	51U602-01	EASA,FAA,CAAC,ANAC										
139328	51U676-01	EASA,FAA,CAAC,ANAC										
139328	51U700-01	EASA,FAA,CAAC,ANAC										
139328	51U737-01	EASA,FAA,CAAC,ANAC										
139328	51U790-01	EASA,FAA,CAAC,ANAC										
139328	51U923-01	EASA,FAA,CAAC,ANAC										
139328	51U941-01	EASA,FAA,CAAC,ANAC										
139328	51U952-01	EASA,FAA,CAAC,ANAC										
139328	51U984	EASA,FAA,ANAC										
139328	52G069-01	EASA,FAA,CAAC,ANAC										
139328	52T044-01	EASA,FAA,CAAC,ANAC										
139328	52T067	EASA,FAA,CAAC,ANAC										
139328	52T265	EASA,FAA,CAAC,ANAC										
139328	52T268	EASA,FAA,CAAC,ANAC										
139328	52T270	EASA,FAA,CAAC,ANAC										
139328	52T361	EASA,FAA,CAAC,ANAC										
139328	52T362	EASA,FAA,CAAC,ANAC										
139328	52T478	EASA,FAA,CAAC,ANAC										
139328	52T480-01	EASA,FAA,ANAC										
139328	52T614-01	EASA,FAA,CAAC,ANAC										
139328	52T686	EASA,FAA,CAAC,ANAC										
139328	52T698-01	EASA,FAA,CAAC,ANAC										
139328	52T704-01	EASA,FAA,CAAC,ANAC										
139328	52T720-01	EASA,FAA,CAAC,ANAC										
139328	52T728	EASA,FAA,CAAC,ANAC										
139328	52T771	EASA,FAA,CAAC,ANAC										
139328	52T877	EASA,FAA,CAAC,ANAC										
139328	52T878-01	EASA,FAA,CAAC,ANAC										
139328	52T900-01	EASA,FAA,CAAC,ANAC										
139328	52T909	EASA,FAA,ANAC										
139328	52T963	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139328	52U018-01	EASA,FAA,CAAC,ANAC										
139328	52U019-01	EASA,FAA,CAAC,ANAC										
139328	52U224-01	EASA,FAA,CAAC,ANAC										
139328	52U390-01	EASA,FAA,CAAC,ANAC										
139328	52U461-01	EASA,FAA,CAAC,ANAC										
139328	52U467-01	EASA,FAA,CAAC,ANAC										
139328	52U468-01	EASA,FAA,CAAC,ANAC										
139328	52U568-01	EASA,FAA,CAAC,ANAC										
139328	52U626-01	EASA,FAA,CAAC,ANAC										
139328	52U884-01	EASA,FAA,CAAC,ANAC										
139328	52U885-01	EASA,FAA,CAAC,ANAC										
139328	52U886-01	EASA,FAA,CAAC,ANAC										
139328	52U888-01	EASA,FAA,CAAC,ANAC										
139328	52U889-01	EASA,FAA,CAAC,ANAC										
139328	52U903-01	EASA,FAA,CAAC,ANAC										
139328	52U904-01	EASA,FAA,CAAC,ANAC										
139328	52U905-01	EASA,FAA,CAAC,ANAC										
139328	52U906-01	EASA,FAA,CAAC,ANAC										
139328	52U907-01	EASA,FAA,CAAC,ANAC										
139328	52U908-01	EASA,FAA,CAAC,ANAC										
139328	52U909-01	EASA,FAA,CAAC,ANAC										
139328	52U978-01	EASA,FAA,CAAC,ANAC										
139328	52U988-01	EASA,FAA,CAAC,ANAC										
139328	53T006	EASA,FAA,ANAC										
139328	53T066-01	EASA,FAA,CAAC,ANAC										
139328	53T102-01	EASA,FAA,CAAC,ANAC										
139328	53T123	EASA,FAA,CAAC,ANAC										
139328	53T261	EASA,FAA,CAAC,ANAC										
139328	53T263-01	EASA,FAA,CAAC,ANAC										
139328	53T264-01	EASA,FAA,CAAC,ANAC										
139328	53T283-01	EASA,FAA,CAAC,ANAC										
139328	53T332-01	EASA,FAA,CAAC,ANAC										
139328	53T400-01	EASA,FAA,CAAC,ANAC										
139328	53T420-01	EASA,FAA,CAAC,ANAC										
139328	53T421-01	EASA,FAA,CAAC,ANAC										
139328	53T498-01	EASA,FAA,CAAC,ANAC										
139328	53T506-01	EASA,FAA,CAAC,ANAC										
139328	53T514	EASA,FAA,CAAC,ANAC										
139328	53T521-01	EASA,FAA,CAAC,ANAC										
139328	53T532-01	EASA,FAA,CAAC,ANAC										
139328	53T534-01	EASA,FAA,CAAC,ANAC										
139328	53T626	EASA,FAA,CAAC,ANAC										
139328	53T626-01	EASA,FAA,CAAC,ANAC										
139328	53T639-01	EASA,FAA,CAAC,ANAC										
139328	53T672-01	EASA,FAA,CAAC,ANAC										
139328	53T689-01	EASA,FAA,ANAC										
139328	53T950-01	EASA,FAA,CAAC,ANAC										
139328	53T999	EASA,FAA,CAAC,ANAC										
139328	54H125-01	EASA,FAA,CAAC,ANAC										
139328	54H768-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139328	54H772-01	EASA,FAA,CAAC,ANAC										
139328	54T005-01	EASA,FAA,CAAC,ANAC										
139328	54T015-01	EASA,FAA,CAAC,ANAC										
139328	54T032	EASA,FAA,ANAC,TCCA										
139328	54T037-01	EASA,FAA,CAAC,ANAC										
139328	54T040-01	EASA,FAA,CAAC,ANAC										
139328	54T044-01	EASA,FAA,CAAC,ANAC										
139328	54T078-01	EASA,FAA,CAAC,ANAC										
139328	54T079-01	EASA,FAA,CAAC,ANAC										
139328	54T089-01	EASA,FAA,CAAC,ANAC										
139328	54T229-01	EASA,FAA,CAAC,ANAC										
139328	54T230-01	EASA,FAA,CAAC,ANAC										
139328	54T233	EASA,FAA,CAAC,ANAC										
139328	54T237-01	EASA,FAA,CAAC,ANAC										
139328	54T345-01	EASA,FAA,CAAC,ANAC										
139328	54T348-01	EASA,FAA,CAAC,ANAC										
139328	54T415-01	EASA,FAA,CAAC,ANAC										
139328	54T469-01	EASA,FAA,CAAC,ANAC										
139328	54T518-01	EASA,FAA,CAAC,ANAC										
139328	54T621-01	EASA,FAA,CAAC,ANAC										
139328	54T647-01	EASA,FAA,CAAC,ANAC										
139328	54T724-01	EASA,FAA,CAAC,ANAC										
139328	54T771-01	EASA,FAA,CAAC,ANAC										
139328	54T783-01	EASA,FAA,CAAC,ANAC										
139328	54T833-01	EASA,FAA,CAAC,ANAC										
139328	54T899-01	EASA,FAA,CAAC,ANAC										
139328	55H303-01	EASA,FAA,CAAC,ANAC										
139328	55T289-01	EASA,FAA,CAAC,ANAC										
139328	55T441-01	EASA,FAA,CAAC,ANAC										
139328	55T472-01	EASA,FAA,CAAC,ANAC										
139328	55T502-01	EASA,FAA,CAAC,ANAC										
139328	55T637-01	EASA,FAA,CAAC,ANAC										
139328	55T641-01	EASA,FAA,CAAC,ANAC										
139328	55T677-01	EASA,FAA,CAAC,ANAC										
139328	55T678-01	EASA,FAA,CAAC,ANAC										
139328	55T679-01	EASA,FAA,CAAC,ANAC										
139328	55T680-01	EASA,FAA,CAAC,ANAC										
139328	55T681-01	EASA,FAA,CAAC,ANAC										
139328	55T696-01	EASA,FAA,CAAC,ANAC										
139328	55T815-01	EASA,FAA,CAAC,ANAC										
139328	56T161	EASA,FAA,ANAC,TCCA										
139328	56T220-01	EASA,FAA,CAAC,ANAC										
139328	56T248-01	EASA,FAA,CAAC,ANAC										
139328	56T258	EASA,FAA,CAAC,ANAC										
139328	56T272-01	EASA,FAA,CAAC,ANAC										
139328	56T438-01	EASA,FAA,CAAC,ANAC										
139328	56T489-01	EASA,FAA,CAAC,ANAC										
139328	56T604-01	EASA,FAA,CAAC,ANAC										
139328	56T681-01	EASA,FAA,CAAC,ANAC										
139328	56T712-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139328	567776-01	EASA,FAA,CAAC,ANAC										
139328	567814-01	EASA,FAA,CAAC,ANAC										
139328	567831-01	EASA,FAA,CAAC,ANAC										
139328	567832-01	EASA,FAA,CAAC,ANAC										
139328	567835-01	EASA,FAA,CAAC,ANAC										
139328	567966-01	EASA,FAA,CAAC,ANAC										
139328	577003-01	EASA,FAA,CAAC,ANAC										
139328	577005-01	EASA,FAA,CAAC,ANAC										
139328	577026-01	EASA,FAA,CAAC,ANAC										
139328	577089-01	EASA,FAA,CAAC,ANAC										
139328	577231-01	EASA,FAA,CAAC,ANAC										
139328	577348-01	EASA,FAA,CAAC,ANAC										
139328	577360-01	EASA,FAA,CAAC,ANAC										
139328	577494-01	EASA,FAA,CAAC,ANAC										
139328	577503-01	EASA,FAA,CAAC,ANAC										
139328	577582-01	EASA,FAA,CAAC,ANAC										
139328	577583-01	EASA,FAA,CAAC,ANAC										
139328	577658-01	EASA,FAA,CAAC,ANAC										
139328	577663-01	EASA,FAA,CAAC,ANAC										
139328	577711-01	EASA,FAA,CAAC,ANAC										
139328	577760-01	EASA,FAA,CAAC,ANAC										
139328	577778-01	EASA,FAA,CAAC,ANAC										
139328	577783-01	EASA,FAA,CAAC,ANAC										
139328	577819-01	EASA,FAA,CAAC,ANAC										
139328	577836-01	EASA,FAA,CAAC,ANAC										
139328	577870-01	EASA,FAA,CAAC,ANAC										
139328	577883-01	EASA,FAA,CAAC,ANAC										
139328	577891-01	EASA,FAA,CAAC,ANAC										
139328	577945-01	EASA,FAA,CAAC,ANAC										
139328	577946-01	EASA,FAA,CAAC,ANAC										
139328	577947-01	EASA,FAA,CAAC,ANAC										
139328	577948-01	EASA,FAA,CAAC,ANAC										
139328	577949-01	EASA,FAA,CAAC,ANAC										
139328	581136-01	EASA,FAA,CAAC,ANAC										
139328	581165-01	EASA,FAA,CAAC,ANAC										
139328	581206-01	EASA,FAA,CAAC,ANAC										
139328	581231-01	EASA,FAA,CAAC,ANAC										
139328	581233	EASA,FAA,CAAC,ANAC										
139328	581257-01	EASA,FAA,CAAC,ANAC										
139328	581262-01	EASA,FAA,CAAC,ANAC										
139328	581264-01	EASA,FAA,CAAC,ANAC										
139328	581267-01	EASA,FAA,CAAC,ANAC										
139328	581304-01	EASA,FAA,CAAC,ANAC										
139328	581312-01	EASA,FAA,CAAC,ANAC										
139328	581315-01	EASA,FAA,CAAC,ANAC										
139328	581380	EASA,FAA,CAAC,ANAC										
139328	581529-01	EASA,FAA,CAAC,ANAC										
139328	581530-01	EASA,FAA,CAAC,ANAC										
139328	581531-01	EASA,FAA,CAAC,ANAC										
139328	581532-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139328	58T567-01	EASA,FAA,CAAC,ANAC										
139328	58T577-01	EASA,FAA,CAAC,ANAC										
139328	58T626-01	EASA,FAA,CAAC,ANAC										
139328	58T635-01	EASA,FAA,CAAC,ANAC										
139328	58T661-01	EASA,FAA,CAAC,ANAC										
139328	58T719-01	EASA,FAA,CAAC,ANAC										
139328	58T763-01	EASA,FAA,CAAC,ANAC										
139328	58T767-01	EASA,FAA,CAAC,ANAC										
139328	58T774-01	EASA,FAA,CAAC,ANAC										
139328	58T779-01	EASA,FAA,CAAC,ANAC										
139328	58T903-01	EASA,FAA,CAAC,ANAC										
139328	59T023-01	EASA,FAA,CAAC,ANAC										
139328	59T032-01	EASA,FAA,CAAC,ANAC										
139328	59T062-01	EASA,FAA,CAAC,ANAC										
139328	59T067-01	EASA,FAA,CAAC,ANAC										
139328	59T091	EASA,FAA,ANAC										
139328	59T109-01	EASA,FAA,CAAC,ANAC										
139328	59T124	EASA,FAA,CAAC,ANAC										
139328	59T128-01	EASA,FAA,CAAC,ANAC										
139328	59T139-01	EASA,FAA,CAAC,ANAC										
139328	59T153-01	EASA,FAA,CAAC,ANAC										
139328	59T171	EASA,FAA,CAAC,ANAC										
139328	59T172-01	EASA,FAA,CAAC,ANAC										
139328	59T191-01	EASA,FAA,CAAC,ANAC										
139328	59T192-01	EASA,FAA,CAAC,ANAC										
139328	59T199-01	EASA,FAA,CAAC,ANAC										
139328	59T230-01	EASA,FAA,CAAC,ANAC										
139328	59T242-01	EASA,FAA,CAAC,ANAC										
139328	59T368-01	EASA,FAA,ANAC										
139328	59T402-01	EASA,FAA,CAAC,ANAC										
139328	59T403-01	EASA,FAA,CAAC,ANAC										
139328	59T447-01	EASA,FAA,CAAC,ANAC										
139328	59T567-01	EASA,FAA,CAAC,ANAC										
139328	59T591-01	EASA,FAA,ANAC										
139328	59T604-01	EASA,FAA,CAAC,ANAC										
139328	59T672-01	EASA,FAA,ANAC										
139328	59T691-01	EASA,FAA,CAAC,ANAC										
139328	59T758-01	EASA,FAA,CAAC,ANAC										
139328	59T768-01	EASA,FAA,CAAC,ANAC										
139328	59T771-01	EASA,FAA,CAAC,ANAC										
139328	59T789-01	EASA,FAA,ANAC										
139328	59T801-01	EASA,FAA,CAAC,ANAC										
139328	59T802-01	EASA,FAA,CAAC,ANAC										
139328	59T803-01	EASA,FAA,CAAC,ANAC										
139328	59T818-01	EASA,FAA,CAAC,ANAC										
139328	59T823-01	EASA,FAA,CAAC,ANAC										
139328	59T871-01	EASA,FAA,CAAC,ANAC										
139328	59T872-01	EASA,FAA,CAAC,ANAC										
139328	59T873-01	EASA,FAA,ANAC										
139328	59T884	EASA,FAA,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139328	59T889-01	EASA,FAA,CAAC,ANAC										
139328	59T921-01	EASA,FAA,CAAC,ANAC										
139328	59T922-01	EASA,FAA,CAAC,ANAC										
139328	59T934-01	EASA,FAA,CAAC,ANAC										
139328	59T936-01	EASA,FAA,CAAC,ANAC										
139328	59T938-01	EASA,FAA,CAAC,ANAC										
139328	59T950-01	EASA,FAA,CAAC,ANAC										
139328	59T964-01	EASA,FAA,CAAC,ANAC										
139328	59T981-01	EASA,FAA,CAAC,ANAC										
139328	59T982-01	EASA,FAA,CAAC,ANAC										
139328	710767	EASA,FAA,CAAC,ANAC										
139328	TA12700019	EASA,FAA,CAAC,ANAC										
139590	50T955	EASA,FAA,CAAC,ANAC	3	21	72-09-71	PW4 FLEXIBLE EXTERNAL HOSES	Package A		PRESSURE TEST		420.00	SR Technics Switzerland
139590	50T963	EASA,FAA,CAAC,ANAC			72-09-71		Package A	CLN/INSP	CLEANING & INSPECTION		420.00	SR Technics Switzerland
139590	50U214	EASA,FAA,CAAC,ANAC			72-09-71		Package D	SPM	REPAIR CONICAL SEAT		425.00	SR Technics Switzerland
139590	51T288	EASA,FAA,CAAC,ANAC			72-09-71		Package SB00	PW4ENG 79-91	INSPECTION FOR VACUUM TESTING MARKING ON "B" NUT		220.00	SR Technics Switzerland
139590	51U247	EASA,FAA,CAAC,ANAC			72-09-71		Package SB01	PW4ENG 72-645	MODIFICATION OF METAL HOSE (AS12) TO ENSURE SAFETY WIRE PROVISIONS		275.00	SR Technics Switzerland
139590	51U960	EASA,FAA,CAAC,ANAC			72-09-71		Package SB02	PW4G-100-73-32	OFF-WING INSPECTION OF FM11 TUBE ASSY		220.00	SR Technics Switzerland
139590	52U244	EASA,FAA,CAAC,ANAC										
139590	53T290	EASA,FAA,CAAC,ANAC										
139590	53T553	EASA,FAA,CAAC,ANAC										
139590	53T977	EASA,FAA,CAAC,ANAC										
139590	53T994	EASA,FAA,CAAC,ANAC										
139590	58T557	EASA,FAA,ANAC										
139590	59T182	EASA,FAA,CAAC,ANAC										
139590	59T774	EASA,FAA,CAAC,ANAC										
139613	51T857	EASA,FAA,CAAC,ANAC	3	21	75-24-00	PW4TCC IDLER ARM LINKAGE WITH BEARING	Package B		REPLACE BEARING		95.00	SR Technics Switzerland
139613	51U728	EASA,FAA,CAAC,ANAC										
139613	51U729	EASA,FAA,CAAC,ANAC										
139613	53T593	EASA,FAA,CAAC,ANAC										
139613	56T430	EASA,FAA,CAAC,ANAC										
139620	51U671	EASA,FAA,CAAC,ANAC	22	21	71-21-10	FWD ENGINE MOUNT - BOLTS, NUTS, PLATES, WASHERS AND THRUST	Package A	CLN/INSP	CLEANING AND INSPECTION		90.00	SR Technics Switzerland
139620	54T700	EASA,FAA,CAAC,ANAC			71-21-10		Package C	02	LOCK NUT THREADS SILVER PLATE REPAIR		205.00	SR Technics Switzerland
139620	5T1614-11	EASA,FAA,CAAC,ANAC										
139620	5T1615-11	EASA,FAA,CAAC,ANAC										
139620	5T1616-11	EASA,FAA,CAAC,ANAC										
139620	5T1616-14	EASA,FAA,CAAC,ANAC										
139620	5T1617-11	EASA,FAA,CAAC,ANAC										
139620	5T1617-14	EASA,FAA,CAAC,ANAC										
139620	5T1618-11	EASA,FAA,CAAC,ANAC										
139674	51D901-01	EASA,FAA,CAAC,ANAC	21	28	72-33-80	FAN CASE - FAN EXIT (INNER) LINER SEGMENT ASSEMBLIES - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		560.00	SR Technics Switzerland
139674	51D902-01	EASA,FAA,CAAC,ANAC			72-33-80		Package AE	30	ACOUSTIC LINER SEGMENT SEAL, GASKET AND BLEED VALVE DUCT BONDING REPAIR		480.00	SR Technics Switzerland
139674	51D903-01	EASA,FAA,CAAC,ANAC			72-33-80		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	135.00	SR Technics Switzerland
139674	51D904-01	EASA,FAA,CAAC,ANAC			72-33-80		Package G	06	FAN EXIT (INNER) LINER SEGMENT ASSEMBLIES EPOXY REPAIR		570.00	SR Technics Switzerland
139674	51D905-01	EASA,FAA,CAAC,ANAC			72-33-80		Package J	09	REPLACE WASHERS		850.00	SR Technics Switzerland
139674	51D906-01	EASA,FAA,CAAC,ANAC			72-33-80		Package L	11	REPAIR DISCONNECTED INSULATION BLANKET		480.00	SR Technics Switzerland
139674	51D907-01	EASA,FAA,CAAC,ANAC			72-33-80		Package M	12	REPLACE COOLING AIR DUCT SEAL		1145.00	SR Technics Switzerland
139674	51D908-01	EASA,FAA,CAAC,ANAC			72-33-80		Package M	12	REPLACE INSULATION BLANKET		1145.00	SR Technics Switzerland
139674	51D909-01	EASA,FAA,CAAC,ANAC			72-33-80		Package M	12	REPLACE LINER WITH FLAME ARRESTOR		1145.00	SR Technics Switzerland
139674	53D416-01	EASA,FAA,CAAC,ANAC			72-33-80		Package M	12	REPLACE NUT PLATES		1145.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139674	530417-01	EASA,FAA,CAAC,ANAC			72-33-80		Package O	14	INSULATION BLANKET OUTER FABRIC PATCH REPAIR		480.00	SR Technics Switzerland
139674	530418-01	EASA,FAA,CAAC,ANAC			72-33-80		Package P	15	INSULATION BLANKET DAMAGED ALUMINUM FOIL REPAIR		615.00	SR Technics Switzerland
139674	530419-01	EASA,FAA,CAAC,ANAC			72-33-80		Package Q	16	REPAIR PUNCTURES OR CRACKS		480.00	SR Technics Switzerland
139674	530420-01	EASA,FAA,CAAC,ANAC			72-33-80		Package T	19	CUT SEAL REPAIR		230.00	SR Technics Switzerland
139674	530421-01	EASA,FAA,CAAC,ANAC										
139674	530422-01	EASA,FAA,CAAC,ANAC										
139674	530423-01	EASA,FAA,CAAC,ANAC										
139674	530463-01	EASA,FAA,CAAC,ANAC										
139674	530753-01	EASA,FAA,CAAC,ANAC										
139674	530755-01	EASA,FAA,CAAC,ANAC										
139674	530756-01	EASA,FAA,CAAC,ANAC										
139674	530757-01	EASA,FAA,CAAC,ANAC										
139674	530758-01	EASA,FAA,CAAC,ANAC										
139674	530759-01	EASA,FAA,CAAC,ANAC										
139674	530760-01	EASA,FAA,CAAC,ANAC										
139674	530761-01	EASA,FAA,CAAC,ANAC										
139674	530762-01	EASA,FAA,CAAC,ANAC										
139684	51G528-01	EASA,FAA,CAAC,ANAC	25	28	72-33-86	FAN CASE - FAN EXIT (BIFURCATION) FAIRING ASSEMBLY LEFT AND RIG	Package A	CLN/INSP	CLEANING AND INSPECTION		595.00	SR Technics Switzerland
139684	51G529-01	EASA,FAA,CAAC,ANAC			72-33-86		Package AN		MARKING OF PART IF P/N AND/OR S/N IS ILLEGIBLE	SPM TASK 70-11-00-800-001-001	135.00	SR Technics Switzerland
139684	51G593-01	EASA,FAA,CAAC,ANAC			72-33-86		Package B	01	REPLACE WASHERS		570.00	SR Technics Switzerland
139684	51G594-01	EASA,FAA,CAAC,ANAC			72-33-86		Package C	02	SURFACE DAMAGE REPAIR (POLYURETHANE COAT)		560.00	SR Technics Switzerland
139684	51G634-01	EASA,FAA,CAAC,ANAC			72-33-86		Package D	03	REPLACE FAN EXIT FAIRING PANEL SPACERS		500.00	SR Technics Switzerland
139684	51G635-01	EASA,FAA,CAAC,ANAC			72-33-86		Package E	04	NUT PLATE REPLACEMENT REPAIR		540.00	SR Technics Switzerland
139684	52G029-01	EASA,FAA,CAAC,ANAC			72-33-86		Package F	05	SMALL SURFACE DAMAGE REPAIR		850.00	SR Technics Switzerland
139684	52G030-01	EASA,FAA,CAAC,ANAC										
139684	52G164-01	EASA,FAA,CAAC,ANAC										
139684	52G165-01	EASA,FAA,CAAC,ANAC										
139684	52G166-01	EASA,FAA,CAAC,ANAC										
139684	52G167-01	EASA,FAA,CAAC,ANAC										
139684	52G423-01	EASA,FAA,CAAC,ANAC										
139684	52G424-01	EASA,FAA,CAAC,ANAC										
139690	54T662	EASA,FAA,CAAC,ANAC	20	21	71-21-10	FWD ENGINE MOUNT - BOLTS, NUTS, PLATES, WASHERS AND THRUST	Package A	CLN/INSP	CLEANING AND INSPECTION		105.00	SR Technics Switzerland
139690	54T663	EASA,FAA,CAAC,ANAC			71-21-10		Package B	01	PWA 474 ANTIGALLING COMPOUND REPLACEMENT REPAIR	FOR P/N 54T696, 54T697, 54T684 AND 54T674	95.00	SR Technics Switzerland
139690	54T674	EASA,FAA,CAAC,ANAC			71-21-10		Package C	01	PWA 474 ANTIGALLING COMPOUND REPLACEMENT REPAIR	FOR P/N 54T676, 54T680, 54T683 AND 58T758	145.00	SR Technics Switzerland
139690	54T676	EASA,FAA,CAAC,ANAC			71-21-10		Package D	01	PWA 474 ANTIGALLING COMPOUND REPLACEMENT REPAIR	FOR P/N 54T662, 54T663, 57T206 AND 59T692	175.00	SR Technics Switzerland
139690	54T680	EASA,FAA,CAAC,ANAC			71-21-10		Package E	01	PWA 474 ANTIGALLING COMPOUND REPLACEMENT REPAIR	ONLY REMOVE ANTIGALLANT COUNPOUND	75.00	SR Technics Switzerland
139690	54T683	EASA,FAA,CAAC,ANAC										
139690	54T684	EASA,FAA,CAAC,ANAC										
139690	54T696	EASA,FAA,CAAC,ANAC										
139690	54T697	EASA,FAA,CAAC,ANAC										
139690	57T206	EASA,FAA,CAAC,ANAC										
139690	59T692	EASA,FAA,CAAC,ANAC										
139715	50U039-01	EASA,FAA,CAAC,ANAC	22	28	72-09-72	ENGINE GENERAL - COMMON PARTS - EXTERNAL DUCTS	Package A	CLN/INSP	CLEANING AND INSPECTION		230.00	SR Technics Switzerland
139715	52U600-01	EASA,FAA,CAAC,ANAC			72-09-72		Package B	01	WELD REPAIR OF DAMAGED COOLING DUCT		1270.00	SR Technics Switzerland
139715	58T116-01	EASA,FAA,CAAC,ANAC			72-09-72		Package D	03	WELD REPAIR OF AIR STARTER VALVE DUCT ASSEMBLY KEY		1210.00	SR Technics Switzerland
139715	58T768-01	EASA,FAA,CAAC,ANAC			72-09-72		Package E	04	REPLACE AIR STARTER VALVE DUCT ASSEMBLY KEY		1305.00	SR Technics Switzerland
139715	58T770-01	EASA,FAA,CAAC,ANAC			72-09-72		Package F		REPLACE RIVETED PARTS		120.00	SR Technics Switzerland
139715	58T770-101	EASA,FAA,CAAC,ANAC										
139715	59T454-01	EASA,FAA,CAAC,ANAC										
139735	51D0910	EASA,FAA,CAAC,ANAC	2	28	72-33-15	PW4 (100") FAN EXIT BASE AND VANE ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		160.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139735	52D680	EASA,FAA,CAAC,ANAC			72-33-15		Package C	02	AIRFOIL PATCH		380.00	SR Technics Switzerland
139735	52D680-001	EASA,FAA,CAAC,ANAC										
139735	52D690	EASA,FAA,CAAC,ANAC										
139735	52D780	EASA,FAA,CAAC,ANAC										
139735	52D790	EASA,FAA,CAAC,ANAC										
139735	55D680	EASA,FAA,CAAC,ANAC										
139735	55D680-001	EASA,FAA,CAAC,ANAC										
139735	55D690	EASA,FAA,CAAC,ANAC										
139735	55D690-001	EASA,FAA,CAAC,ANAC										
139735	55D780	EASA,FAA,CAAC,ANAC										
139735	55D790	EASA,FAA,CAAC,ANAC										
139735	55D910	EASA,FAA,CAAC,ANAC										
139735	55D910-001	EASA,FAA,CAAC,ANAC										
139736	51J092	EASA,FAA,CAAC,ANAC	24	28	72-41-11	DIFFUSER AND COMBUSTOR - OUTER COMBUSTION CHAMBER ASSEM	Package B	60	PLASMA COATING REPLACEMENT		555.00	SR Technics Switzerland
139736	51J102	EASA,FAA,CAAC,ANAC										
139736	51J104	EASA,FAA,CAAC,ANAC										
139736	51J105	EASA,FAA,CAAC,ANAC										
139736	51J106	EASA,FAA,CAAC,ANAC										
139736	51J204	EASA,FAA,CAAC,ANAC										
139736	51J206	EASA,FAA,CAAC,ANAC										
139736	51J208	EASA,FAA,CAAC,ANAC										
139736	51J209	EASA,FAA,CAAC,ANAC										
139736	51J301	EASA,FAA,CAAC,ANAC										
139736	51J503	EASA,FAA,CAAC,ANAC										
139736	51J504	EASA,FAA,CAAC,ANAC										
139736	52J202	EASA,FAA,CAAC,ANAC										
139736	52J203	EASA,FAA,CAAC,ANAC										
139736	52J205	EASA,FAA,CAAC,ANAC										
139736	52J207	EASA,FAA,CAAC,ANAC										
139736	52J210	EASA,FAA,CAAC,ANAC										
139737	50K202	EASA,FAA,CAAC,ANAC	25	28	72-51-05	TURBINE NOZZLE - INNER COMBUSTION CHAMBER ASSEMBLY - LINER	Package B	34	PLASMA COATING REPLACEMENT		555.00	SR Technics Switzerland
139737	50K204	EASA,FAA,CAAC,ANAC										
139737	50K205	EASA,FAA,CAAC,ANAC										
139737	50K206	EASA,FAA,CAAC,ANAC										
139737	50K601	EASA,FAA,CAAC,ANAC										
139737	50K803	EASA,FAA,CAAC,ANAC										
139737	51K103	EASA,FAA,CAAC,ANAC										
139737	51K105	EASA,FAA,CAAC,ANAC										
139737	51K106	EASA,FAA,CAAC,ANAC										
139737	51K204	EASA,FAA,CAAC,ANAC										
139737	51K207	EASA,FAA,CAAC,ANAC										
139737	52K202	EASA,FAA,CAAC,ANAC										
139737	52K203	EASA,FAA,CAAC,ANAC										
139737	52K205	EASA,FAA,CAAC,ANAC										
139737	52K206	EASA,FAA,CAAC,ANAC										
139786	53H257-01	EASA,FAA,CAAC,ANAC	4	28	72-35-65	PW4 (100") STG 7 HPC SHROUD SET	Package A	CLN/INSP	CLEANING AND INSPECTION		140.00	SR Technics Switzerland
139786	56H457	EASA,FAA,CAAC,ANAC			72-35-65		Package SB00	PW4G-100-72-118	HPC BLADES/STATORS 6-9 STG - ZIOx BLADE		75.00	SR Technics Switzerland
139786	56H757-01	EASA,FAA,CAAC,ANAC										
139787	51H285	EASA,FAA,CAAC,ANAC	4	28	72-35-42	PW4000 STG. 5 HPC SHROUD SEGMENT ASSY	Package A	CLN/INSP	CLEANING AND INSPECTION		175.00	SR Technics Switzerland
139787	51H385-001	EASA,FAA,CAAC,ANAC			72-35-42		Package SB00	PW4ENG 72-650	HPC, INNER SHROUDS, TACK WELD OF PINS		80.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139787	53H485-01	EASA,FAA,CAAC,ANAC										
139787	53H585-01	EASA,FAA,CAAC,ANAC										
139787	58H375-01	EASA,FAA,CAAC,ANAC										
139787	58H475-01	EASA,FAA,CAAC,ANAC										
139862	52U420	EASA,FAA,CAAC,ANAC	24	21	71-21-12	FWD ENGINE MOUNT - BEARING RETAINER, BUSHING AND HOUSING - Package A	CLN/INSP		CLEANING AND INSPECTION		335.00	SR Technics Switzerland
139862	54T658	EASA,FAA,CAAC,ANAC			71-21-12		Package B	01	BEARING HOUSING BUSHING REPLACEMENT REPAIR		1330.00	SR Technics Switzerland
139862	54T659	EASA,FAA,CAAC,ANAC			71-21-12		Package C	02	SURFACE DAMAGE BLEND REPAIR		695.00	SR Technics Switzerland
139862	59T794	EASA,FAA,CAAC,ANAC										
140113	51U670	EASA,FAA,CAAC,ANAC	23	21	71-22-10	AFT ENGINE MOUNT - BOLTS, NUTS, PINS, PLATES, SPACERS AND WAS	Package A	CLN/INSP	CLEANING AND INSPECTION		150.00	SR Technics Switzerland
140113	52U364	EASA,FAA,CAAC,ANAC			71-22-10		Package B	01	ANTIGALLANT REPLACEMENT REPAIR		90.00	SR Technics Switzerland
140113	55T497	EASA,FAA,CAAC,ANAC			71-22-10		Package C	02	LOCK NUT THREADS SILVER PLATE REPAIR		225.00	SR Technics Switzerland
140113	55T498	EASA,FAA,CAAC,ANAC										
140113	55T499	EASA,FAA,CAAC,ANAC										
140113	55T525	EASA,FAA,CAAC,ANAC										
140113	55T526	EASA,FAA,CAAC,ANAC										
140113	55T527	EASA,FAA,CAAC,ANAC										
140113	55T603	EASA,FAA,CAAC,ANAC										
140113	55T605	EASA,FAA,CAAC,ANAC										
140113	56T039	EASA,FAA,CAAC,ANAC										
140113	57T713	EASA,FAA,CAAC,ANAC										
140744	50U204	EASA,FAA,CAAC,ANAC	3	21	72-09-71	PW4 HOSE NON-METALIC HYDRAULIC	Package A		PRESSURE TEST		420.00	SR Technics Switzerland
140744	51U179	EASA,FAA,CAAC,ANAC			72-09-71		Package A	CLN/INSP	CLEANING & INSPECTION		420.00	SR Technics Switzerland
140744	51U180	EASA,FAA,CAAC,ANAC			72-09-71		Package N	013	MINOR GAUGE, TEAR OR CUT OF FLEXIBLE TUBE FIRE SLEEVE REPAIR		280.00	SR Technics Switzerland
140744	51U721	EASA,FAA,CAAC,ANAC			72-09-71		Package W	022	REPAIR OUTER/INNER CONICAL SEAT	SPM 70-00-00	350.00	SR Technics Switzerland
140744	51U797	EASA,FAA,CAAC,ANAC										
140744	51U966	EASA,FAA,CAAC,ANAC										
140744	51U967	EASA,FAA,CAAC,ANAC										
140744	53T551	EASA,FAA,CAAC,ANAC										
140744	54T110-01	EASA,FAA,CAAC,ANAC										
140744	54T150-01	EASA,FAA,CAAC,ANAC										
140744	55T202	EASA,FAA,CAAC,ANAC										
140744	56T308	EASA,FAA,CAAC,ANAC										
140744	57T703	EASA,FAA,CAAC,ANAC										
140744	57T998-01	EASA,FAA,CAAC,ANAC										
140744	59T549	EASA,FAA,CAAC,ANAC										
144420	310T4023-1	EASA,FAA,CAAC,ANAC	19	21	71-21-16	FWD ENGINE MOUNT - THRUST LINK ASSY - 94"	Package A	CLN/INSP	CLEANING AND INSPECTION		240.00	SR Technics Switzerland
144420	310T4023-2	EASA,FAA,CAAC,ANAC			71-21-16		Package B	3-1	BEARING REPLACEMENT		570.00	SR Technics Switzerland
144420	310T4023-3	EASA,FAA,CAAC,ANAC			71-21-16		Package C	3-1	BUSHING REPLACEMENT		1135.00	SR Technics Switzerland
144420	310T4023-5	EASA,FAA,CAAC,ANAC			71-21-16		Package D	3-2	BUSHING HOLE REPAIR		2015.00	SR Technics Switzerland
144420	310T4023-6	EASA,FAA,CAAC,ANAC			71-21-16		Package E	3-2	BEARING HOLE REPAIR		760.00	SR Technics Switzerland
144420	310T4023-7	EASA,FAA,CAAC,ANAC			71-21-16		Package F	3-2	SCRATCH AND GOUGE REPAIR		520.00	SR Technics Switzerland
144420	310T4023-8	EASA,FAA,CAAC,ANAC										
144422	7101-129-1250/750-8	EASA,FAA,CAAC,ANAC	9	21	26-10-65	FIRE/OVERHEAT DETECTOR MODEL 801RDS	Package B	TEST	TEST		1400.00	SR Technics Switzerland
144422	7101-155	EASA,FAA,CAAC,ANAC			26-10-65		Package C	TEST	PRE TEST	CLEANING AND VISUAL INSPECTION	360.00	SR Technics Switzerland
144422	7101-155-1175-750-8	EASA,FAA,CAAC,ANAC										
144422	7101-155-1175/750-8	EASA,FAA,CAAC,ANAC										
144422	7101-22	EASA,FAA,ANAC										
144422	7101-23	EASA,FAA,CAAC,ANAC										
144422	7101-24	EASA,FAA,CAAC,ANAC										
144422	7101-51	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
144422	7101-53	EASA,FAA,ANAC										
144422	7101-53-1000-550-6	EASA,FAA,CAAC,ANAC										
144422	7101-53-1000/550-6	EASA,FAA,CAAC,ANAC										
144422	7101-54	EASA,FAA,CAAC,ANAC										
144422	7101-54-1175-750-4	EASA,FAA,CAAC,ANAC										
144422	7101-54-1175/750-4	EASA,FAA,CAAC,ANAC										
144729	50U455	EASA,FAA,CAAC,ANAC	22	21	71-22-11	AFT ENGINE MOUNT - LINK AND LINK ASSEMBLY - PRIMARY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
144729	50U479	EASA,FAA,CAAC,ANAC			71-22-11		Package A	INSP/CHECK-06	INSPECTION POSTREQUISITES - APPLY PWA 474 ANTIGALLING		225.00	SR Technics Switzerland
144729	51U690	EASA,FAA,CAAC,ANAC			71-22-11		Package B	01	REAR MOUNT LINK AND LINK ASSEMBLY BEARING DISASSEMBLY, MARKING, REPLACEMENT AND ASSEMBLY		325.00	SR Technics Switzerland
144729	52U290	EASA,FAA,CAAC,ANAC			71-22-11		Package E	04	PRIMARY AND SECONDARY LINK SURFACE DAMAGE BLEND REPAIR		445.00	SR Technics Switzerland
144729	52U291	EASA,FAA,CAAC,ANAC										
144729	52U392	EASA,FAA,CAAC,ANAC										
144729	52U393	EASA,FAA,CAAC,ANAC										
144729	52U545	EASA,FAA,CAAC,ANAC										
144729	52U546	EASA,FAA,CAAC,ANAC										
144729	57T144	EASA,FAA,CAAC,ANAC										
144729	57T158	EASA,FAA,CAAC,ANAC										
144808	50G199	EASA,FAA,CAAC,ANAC	15	28	72-33-91	FAN CASE - FAN EXIT FAIRING COVER PLATE ASSEMBLIES	Package A	CLN/INSP	CLEANING AND INSPECTION		225.00	SR Technics Switzerland
144808	50G244	EASA,FAA,CAAC,ANAC			72-33-91		Package B	01	BLEND REPAIR COATED COVER PLATES		270.00	SR Technics Switzerland
144808	51G282-01	EASA,FAA,CAAC,ANAC			72-33-91		Package B	01	BLEND REPAIR NOT COATED COVER PLATES		270.00	SR Technics Switzerland
144808	51G602-01	EASA,FAA,CAAC,ANAC			72-33-91		Package C	02	REPLACE NUT PLATE REPAIR		170.00	SR Technics Switzerland
144808	51G604-01	EASA,FAA,CAAC,ANAC										
144808	51G605-01	EASA,FAA,CAAC,ANAC										
144808	52G181-01	EASA,FAA,CAAC,ANAC										
144808	52G224-01	EASA,FAA,CAAC,ANAC										
144808	52G239-01	EASA,FAA,CAAC,ANAC										
144808	52G240-01	EASA,FAA,CAAC,ANAC										
144808	52G411-01	EASA,FAA,CAAC,ANAC										
602323	51U718	EASA,FAA,CAAC,ANAC	2	21	72-09-71	PW4 EXTERNAL FLEXIBLE HOSES ONLY	Package A	CLN/INSP	CLEANING & INSPECTION		165.00	SR Technics Switzerland
602323	51U739	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-CHECK-05	PRESSURE TEST		165.00	SR Technics Switzerland
602323	51U740	EASA,FAA,CAAC,ANAC			72-09-71		Package B		REPAIR INNER/OUTER CONICAL SEAT		240.00	SR Technics Switzerland
602323	51U742	EASA,FAA,CAAC,ANAC			72-09-71		Package SB00	PW4G-100-29-7	INSPECTION AND REPLACEMENT OF SUSPECT HYDRAULIC PRESSURE HOSES		165.00	SR Technics Switzerland
602323	51U780	EASA,FAA,CAAC,ANAC										
602323	51U781	EASA,FAA,CAAC,ANAC										
602323	51U920	EASA,FAA,CAAC,ANAC										
602323	51U954	EASA,FAA,CAAC,ANAC										
602323	51U970	EASA,FAA,CAAC,ANAC										
602323	51U971	EASA,FAA,CAAC,ANAC										
602323	51U972	EASA,FAA,CAAC,ANAC										
602323	51U973	EASA,FAA,CAAC,ANAC										
602323	51U974	EASA,FAA,CAAC,ANAC										
602323	51U976	EASA,FAA,CAAC,ANAC										
602323	51U977	EASA,FAA,CAAC,ANAC										
602323	54T957	EASA,FAA,CAAC,ANAC										
602323	56T302	EASA,FAA,CAAC,ANAC										
602323	56T308	EASA,FAA,CAAC,ANAC										
602323	56T314	EASA,FAA,CAAC,ANAC										
602323	56T315	EASA,FAA,CAAC,ANAC										
602323	56T316	EASA,FAA,CAAC,ANAC										
602323	58T205	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
602323	58T498	EASA,FAA,CAAC,ANAC										
602323	58T499	EASA,FAA,CAAC,ANAC										
602323	58T500	EASA,FAA,CAAC,ANAC										
602323	58T501	EASA,FAA,CAAC,ANAC										
602323	59T113	EASA,FAA,CAAC,ANAC										
602323	59T121	EASA,FAA,CAAC,ANAC										
602323	59T122	EASA,FAA,CAAC,ANAC										
602323	59T126	EASA,FAA,CAAC,ANAC										
610214	21W4068-509	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - INLET COWL WIRE HARNESS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	455.00	SR Technics Switzerland
610214	21W4068-511	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	3135.00	SR Technics Switzerland
610214	21W4068-513	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4390.00	SR Technics Switzerland
610214	21W4068-515	EASA,FAA,CAAC,ANAC			71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	5640.00	SR Technics Switzerland
610214	21W4068-523	EASA,FAA,CAAC,ANAC										
610214	21W4068-525	EASA,FAA,CAAC,ANAC										
610412	221-4950-691	EASA,FAA,CAAC,ANAC	3	21	71-00-15	PW4 DIVERSE HOSES (CMM 71-00-15)	Package A	CLN/INSP	CLEANING & INSPECTION		310.00	SR Technics Switzerland
610412	221D4020-501	EASA,FAA,CAAC,ANAC										
610412	AE2464072	EASA,FAA,CAAC,ANAC										
610412	AE2464072K0403	EASA,FAA,CAAC,ANAC										
610412	AE2464073K0390	EASA,FAA,CAAC,ANAC										
610412	AE705925-20	EASA,FAA,CAAC,ANAC										
610412	AE708179-1	EASA,FAA,CAAC,ANAC										
610412	AE708183-1	EASA,FAA,CAAC,ANAC										
610412	AE708186-1	EASA,FAA,CAAC,ANAC										
610412	AE708940-1	EASA,FAA,CAAC,ANAC										
610412	AE708941-1	EASA,FAA,CAAC,ANAC										
610412	S700H0313-43	EASA,FAA,CAAC,ANAC										
610412	S700H0313-45	EASA,FAA,CAAC,ANAC										
610412	S700H0391-245	EASA,FAA,CAAC,ANAC										
610742	21W4140-503	EASA,FAA,CAAC,ANAC	20	21	71-51-01	ELECTRICAL HARNESS - THRUST REVERSER PDU AND SLV-VALVE WIRE	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	525.00	SR Technics Switzerland
610742	21W4140-505	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2515.00	SR Technics Switzerland
610742	21W4140-507	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	4390.00	SR Technics Switzerland
610742	21W4140-509	EASA,FAA,CAAC,ANAC			71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	5395.00	SR Technics Switzerland
610742	21W4140-511	EASA,FAA,CAAC,ANAC			71-51-01		Package SB00	PW4NAC 71-136	THRUST REVERSER COMMAND CIRCUIT REWIRE	IN CONIUNCTION WITH PACKAGE MEDIUM O	1075.00	SR Technics Switzerland
610742	21W4140-513	EASA,FAA,CAAC,ANAC										
610742	21W4140-515	EASA,FAA,CAAC,ANAC										
610742	21W4140-517	EASA,FAA,CAAC,ANAC										
610765	21W4058-505	EASA,FAA,CAAC,ANAC	10	21	71-51-01	PW4 AI DIVERS EBU WIRE HARNESSES	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	365.00	SR Technics Switzerland
610765	21W4062-505	EASA,FAA,CAAC,ANAC			71-51-01		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	4900.00	SR Technics Switzerland
610765	21W4066-505	EASA,FAA,CAAC,ANAC			71-51-01		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	7690.00	SR Technics Switzerland
610765	21W4070-503	EASA,FAA,CAAC,ANAC			71-51-01		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	10485.00	SR Technics Switzerland
610765	21W4070-505	EASA,FAA,CAAC,ANAC										
610765	21W4070-507	EASA,FAA,CAAC,ANAC										
610765	21W4075-501	EASA,FAA,CAAC,ANAC										
610765	21W4075-503	EASA,FAA,CAAC,ANAC										
610765	21W4075-509	EASA,FAA,CAAC,ANAC										
610765	21W4078-509	EASA,FAA,CAAC,ANAC										
610765	21W4078-513	EASA,FAA,CAAC,ANAC										
610765	21W4080-513	EASA,FAA,CAAC,ANAC										
610765	21W4080-517	EASA,FAA,CAAC,ANAC										
610765	21W4082-509	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610765	21W4082-511	EASA,FAA,CAAC,ANAC										
610765	21W4082-517	EASA,FAA,CAAC,ANAC										
610765	21W4082-519	EASA,FAA,CAAC,ANAC										
610765	21W4122-511	EASA,FAA,CAAC,ANAC										
610765	21W4122-513	EASA,FAA,CAAC,ANAC										
610765	21W4124-507	EASA,FAA,CAAC,ANAC										
610765	21W4128-501	EASA,FAA,CAAC,ANAC										
610765	21W4129-501	EASA,FAA,CAAC,ANAC										
610765	21W4130-501	EASA,FAA,CAAC,ANAC										
610765	21W4131-501	EASA,FAA,CAAC,ANAC										
610765	21W4142-507	EASA,FAA,CAAC,ANAC										
610765	21W4144-503	EASA,FAA,CAAC,ANAC										
610765	21W4144-505	EASA,FAA,CAAC,ANAC										
610765	21W4146-505	EASA,FAA,CAAC,ANAC										
610765	21W4146-509	EASA,FAA,CAAC,ANAC										
610765	21W4146-511	EASA,FAA,CAAC,ANAC										
610765	21W4148-503	EASA,FAA,CAAC,ANAC										
610765	21W4152-503	EASA,FAA,CAAC,ANAC										
610765	21W4160-507	EASA,FAA,CAAC,ANAC										
610765	21W4160-509	EASA,FAA,CAAC,ANAC										
610765	21W4161-905	EASA,FAA,CAAC,ANAC										
610765	21W4161-507	EASA,FAA,CAAC,ANAC										
610765	21W4161-509	EASA,FAA,CAAC,ANAC										
610765	221-4828-523	EASA,FAA,CAAC,ANAC										
610765	221-4828-531	EASA,FAA,CAAC,ANAC										
610765	221-4828-533	EASA,FAA,CAAC,ANAC										
610765	221-4828-535	EASA,FAA,CAAC,ANAC										
610765	221-4891-503	EASA,FAA,CAAC,ANAC										
610853	221W5196-501	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - THRUST REVERSER RH HARNESS ASSEMBLY - M	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610853	221W5196-503	EASA,FAA,CAAC,ANAC			71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1370.00	SR Technics Switzerland
610853	221W5196-505	EASA,FAA,CAAC,ANAC			71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3315.00	SR Technics Switzerland
610853	221W5196-507	EASA,FAA,CAAC,ANAC			71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	4105.00	SR Technics Switzerland
610853	221W5196-509	EASA,FAA,CAAC,ANAC										
610856	221W5198-503	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - BELLMOUTH CATEGORY II HARNESS ASSEMBLY	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	465.00	SR Technics Switzerland
610856	221W5198-505	EASA,FAA,CAAC,ANAC			71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1325.00	SR Technics Switzerland
610856	221W5198-507	EASA,FAA,CAAC,ANAC			71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2890.00	SR Technics Switzerland
610856	221W5198-509	EASA,FAA,CAAC,ANAC			71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	3520.00	SR Technics Switzerland
610856	221W5198-511	EASA,FAA,CAAC,ANAC										
610866	221W5194-501	EASA,FAA,CAAC,ANAC	19	21	71-51-02	ELECTRICAL HARNESS - THRUST REVERSER LH HARNESS ASSEMBLY - M	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	555.00	SR Technics Switzerland
610866	221W5194-503	EASA,FAA,CAAC,ANAC			71-51-02		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1370.00	SR Technics Switzerland
610866	221W5194-505	EASA,FAA,CAAC,ANAC			71-51-02		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3315.00	SR Technics Switzerland
610866	221W5194-507	EASA,FAA,CAAC,ANAC			71-51-02		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	4105.00	SR Technics Switzerland
610866	221W5194-509	EASA,FAA,CAAC,ANAC										
610921	420651	EASA,FAA,CAAC,ANAC	21	21	73-21-18	WIRING HARNESS-ASSY WC 1 - 100"	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1245.00	SR Technics Switzerland
610921	420651-1	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2840.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610921	420651-2	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	8390.00	SR Technics Switzerland
610921	420651-3	EASA,FAA,CAAC,ANAC			73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	10990.00	SR Technics Switzerland
610921	420651-4	EASA,FAA,CAAC,ANAC			73-21-18		Package SB00	73-59	VIBRATION WIRE CHAFING ELIMINATION	IN CONJUNCTION WITH PACKAGE HEAVY	280.00	SR Technics Switzerland
610921	420651-5	EASA,FAA,CAAC,ANAC			73-21-18		Package SB01	PW4G-100-73-28	INSPECTION HARNESS FOR WIRE CHAFE AND LOOSE HARNESS CLAMPS	IN CONJUNCTION WITH PACKAGE LIGHT, MED	280.00	SR Technics Switzerland
610921	420651-51	EASA,FAA,CAAC,ANAC			73-21-18		Package SB02	73-39	REPLACEMENT OF ALUMEL AND CHROMEL CONTACTS	IN CONJUNCTION WITH PACKAGE HEAVY	280.00	SR Technics Switzerland
610921	421340	EASA,FAA,CAAC,ANAC			73-21-18		Package SB03	PW4G-100-73-39	INSTALLATION OF SPIRAL WRAP	UNISON SB 73-73	280.00	SR Technics Switzerland
610921	421340-1	EASA,FAA,CAAC,ANAC										
610921	421340-11	EASA,FAA,CAAC,ANAC										
610921	55T142	EASA,FAA,CAAC,ANAC										
610924	420654	EASA,FAA,CAAC,ANAC	21	21	73-21-18	WIRING HARNESS-ASSY WC 4 - 100"	Package C	TEST	PRE TEST	PN52U879 FOR SHOP VISIT ONLY	1730.00	SR Technics Switzerland
610924	420814	EASA,FAA,CAAC,ANAC			73-21-18		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	3710.00	SR Technics Switzerland
610924	420814-1	EASA,FAA,CAAC,ANAC			73-21-18		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	11140.00	SR Technics Switzerland
610924	421261	EASA,FAA,CAAC,ANAC			73-21-18		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	14290.00	SR Technics Switzerland
610924	421261-1	EASA,FAA,CAAC,ANAC			73-21-18		Package SB00	73-66	FIELD REPLACEMENT OF FUEL FILTER DELTA P CONNECTOR	IN CONJUNCTION WITH PACKAGE MEDIUM O	745.00	SR Technics Switzerland
610924	503860-1	EASA,FAA,CAAC,ANAC			73-21-18		Package SB01	73-39	REPLACEMENT OF ALUMEL AND CHROMEL CONTACTS	IN CONJUNCTION WITH PACKAGE HEAVY	280.00	SR Technics Switzerland
610924	52U879	EASA,FAA,CAAC,ANAC										
610924	55T146	EASA,FAA,CAAC,ANAC										
610968	420054	EASA,FAA,CAAC,ANAC	20	21	73-21-60	EEC WIRE HARNESS W1 (11 CONNECTIONS) - BOEING, AIRBUS OR MC	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1245.00	SR Technics Switzerland
610968	420054-1	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2840.00	SR Technics Switzerland
610968	420054-2	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	8655.00	SR Technics Switzerland
610968	420054-3	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	11450.00	SR Technics Switzerland
610968	420075	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-54	DEACTIVATION OF TRC AND TCA CIRCUITS (BOEING)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610968	420075-1	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-61	DEACTIVATION OF TRC AND TCA CIRCUITS (AIRBUS)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610968	420075-2	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-55	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL (IN CONJUNCTION WITH PACKAGE MEDIUM O	745.00	SR Technics Switzerland
610968	420075-3	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-62	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL (IN CONJUNCTION WITH PACKAGE MEDIUM O	745.00	SR Technics Switzerland
610968	420085	EASA,FAA,CAAC,ANAC			73-21-60		Package SB02	72-0755	RCC MODIFICATION (BOEING)	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610968	420085-5	EASA,FAA,CAAC,ANAC			73-21-60		Package SB02	72-0756	RCC MODIFICATION (AIRBUS)	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610968	420086-3	EASA,FAA,CAAC,ANAC										
610968	420087-5	EASA,FAA,CAAC,ANAC										
610968	420096-1	EASA,FAA,CAAC,ANAC										
610968	420096-2	EASA,FAA,CAAC,ANAC										
610968	420096-3	EASA,FAA,CAAC,ANAC										
610968	45774	EASA,FAA,CAAC,ANAC										
610968	45775	EASA,FAA,CAAC,ANAC										
610968	45791	EASA,FAA,CAAC,ANAC										
610968	45792	EASA,FAA,CAAC,ANAC										
610968	45851	EASA,FAA,CAAC,ANAC										
610968	45852	EASA,FAA,CAAC,ANAC										
610968	45860	EASA,FAA,CAAC,ANAC										
610968	45933	EASA,FAA,CAAC,ANAC										
610968	45982	EASA,FAA,CAAC,ANAC										
610968	45983	EASA,FAA,CAAC,ANAC										
610968	45983-3	EASA,FAA,ANAC										
610968	45984	EASA,FAA,CAAC,ANAC										
610968	45985	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610968	46224	EASA,FAA,CAAC,ANAC										
610968	46452	EASA,FAA,CAAC,ANAC										
610968	46452-3	EASA,FAA,CAAC,ANAC										
610968	46453	EASA,FAA,CAAC,ANAC										
610968	46460	EASA,FAA,CAAC,ANAC										
610968	46460-3	EASA,FAA,CAAC,ANAC										
610968	46460-5	EASA,FAA,CAAC,ANAC										
610968	46461-3	EASA,FAA,CAAC,ANAC										
610968	46463-3	EASA,FAA,CAAC,ANAC										
610968	46474	EASA,FAA,CAAC,ANAC										
610968	501495-1	EASA,FAA,CAAC,ANAC										
610968	501735-1	EASA,FAA,CAAC,ANAC										
610968	527832	EASA,FAA,CAAC,ANAC										
610968	527847	EASA,FAA,CAAC,ANAC										
610968	537078	EASA,FAA,CAAC,ANAC										
610968	537132	EASA,FAA,CAAC,ANAC										
610968	537133	EASA,FAA,CAAC,ANAC										
610968	537807	EASA,FAA,CAAC,ANAC										
610974	420103	EASA,FAA,CAAC,ANAC	19	21	73-21-53	EEC WIRE HARNESS W5 - AIRBUS	Package C	TEST	PRE TEST	PN45508 FOR SHOP VISIT ONLY	1045.00	SR Technics Switzerland
610974	420446	EASA,FAA,CAAC,ANAC			73-21-53		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2725.00	SR Technics Switzerland
610974	420751	EASA,FAA,CAAC,ANAC			73-21-53		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	7500.00	SR Technics Switzerland
610974	45858	EASA,FAA,CAAC,ANAC			73-21-53		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	9780.00	SR Technics Switzerland
610974	46097	EASA,FAA,CAAC,ANAC			73-21-53		Package SB00	73-28	REMOVAL OF TRC/ BVCA SWITCH BRANCHES	IN CONJUNCTION WITH PACKAGE MEDIUM O	1695.00	SR Technics Switzerland
610974	46097-1	EASA,FAA,CAAC,ANAC			73-21-53		Package SB01	73-32	CHAFE PROTECTION IN THE FMU BACKSHELL	IN CONJUNCTION WITH PACKAGE HEAVY	505.00	SR Technics Switzerland
610974	46384	EASA,FAA,CAAC,ANAC										
610974	46459	EASA,FAA,CAAC,ANAC										
610974	46459-1	EASA,FAA,CAAC,ANAC										
610974	537275	EASA,FAA,CAAC,ANAC										
610974	567058	EASA,FAA,CAAC,ANAC										
610978	420080	EASA,FAA,CAAC,ANAC	20	21	73-21-60	EEC WIRE HARNESS W5 (10 CONNECTIONS) - BOEING, AIRBUS OR MC	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1045.00	SR Technics Switzerland
610978	420094	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2725.00	SR Technics Switzerland
610978	420094-1	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	7500.00	SR Technics Switzerland
610978	420467	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	9780.00	SR Technics Switzerland
610978	420613	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-31	REMOVAL OF TRC/TBVCA SWITCH BRANCHES (BOEING)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1695.00	SR Technics Switzerland
610978	420752	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-32	CHAFE PROTECTION IN THE FMU BACKSHELL	IN CONJUNCTION WITH PACKAGE HEAVY	505.00	SR Technics Switzerland
610978	420790	EASA,FAA,CAAC,ANAC										
610978	46233	EASA,FAA,CAAC,ANAC										
610978	46478	EASA,FAA,CAAC,ANAC										
610978	537879	EASA,FAA,CAAC,ANAC										
610978	537879-002	EASA,FAA,CAAC,ANAC										
610978	567000	EASA,FAA,CAAC,ANAC										
610979	45778	EASA,FAA,CAAC,ANAC	19	21	73-21-53	EEC WIRE HARNESS W2 (9 CONNECTIONS) - AIRBUS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1045.00	SR Technics Switzerland
610979	45794	EASA,FAA,CAAC,ANAC			73-21-53		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2725.00	SR Technics Switzerland
610979	45854	EASA,FAA,CAAC,ANAC			73-21-53		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	7500.00	SR Technics Switzerland
610979	45988	EASA,FAA,CAAC,ANAC			73-21-53		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	9815.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610979	45989	EASA,FAA,CAAC,ANAC			73-21-53		Package SB00	73-62	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL (IN CONJUNCTION WITH PACKAGE MEDIUM O		750.00	SR Technics Switzerland
610979	46455	EASA,FAA,CAAC,ANAC			73-21-53		Package SB01	73-61	DEACTIVATION OF TRC AND TCA CIRCUITS	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610979	527833	EASA,FAA,CAAC,ANAC			73-21-53		Package SB02	72-0756	RCC MODIFICATION (AIRBUS)	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610979	527859	EASA,FAA,CAAC,ANAC										
610979	531084	EASA,FAA,CAAC,ANAC										
610979	537138	EASA,FAA,CAAC,ANAC										
610979	537139	EASA,FAA,CAAC,ANAC										
610981	420086	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W1 (12 CONNECTIONS) - BOEING	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1330.00	SR Technics Switzerland
610981	420086-2	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	3095.00	SR Technics Switzerland
610981	420437	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	9405.00	SR Technics Switzerland
610981	420437-3	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	12505.00	SR Technics Switzerland
610981	421660	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-54	DEACTIVATION OF TRC AND TCA CIRCUITS	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610981	46243	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-55	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL (IN CONJUNCTION WITH PACKAGE MEDIUM O		745.00	SR Technics Switzerland
610981	46243-2	EASA,FAA,CAAC,ANAC			73-21-60		Package SB02	72-0755	RCC MODIFICATION	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610981	46243-3	EASA,FAA,CAAC,ANAC										
610981	46461	EASA,FAA,CAAC,ANAC										
610981	537816	EASA,FAA,CAAC,ANAC										
610981	577796	EASA,FAA,CAAC,ANAC										
610982	420060	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W2 (8 CONNECTIONS) - BOEING, AIRBUS OR MC DI	Package C	TEST	PRE TEST	PN46902 FOR SHOP VISIT ONLY	945.00	SR Technics Switzerland
610982	420076	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2435.00	SR Technics Switzerland
610982	420076-1	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	6695.00	SR Technics Switzerland
610982	420076-2	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	8760.00	SR Technics Switzerland
610982	420076-3	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-54	DEACTIVATION OF TRC AND TCA CIRCUITS (BOEING)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610982	420098	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-61	DEACTIVATION OF TRC AND TCA CIRCUITS (AIRBUS)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610982	420098-1	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-55	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL (IN CONJUNCTION WITH PACKAGE MEDIUM O		745.00	SR Technics Switzerland
610982	420098-2	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-62	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL (IN CONJUNCTION WITH PACKAGE MEDIUM O		745.00	SR Technics Switzerland
610982	420098-3	EASA,FAA,CAAC,ANAC			73-21-60		Package SB02	72-0755	RCC MODIFICATION (BOEING)	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610982	45779	EASA,FAA,CAAC,ANAC			73-21-60		Package SB02	72-0756	RCC MODIFICATION (AIRBUS)	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610982	45793	EASA,FAA,CAAC,ANAC										
610982	45853	EASA,FAA,CAAC,ANAC										
610982	45853-3	EASA,FAA,ANAC										
610982	45862	EASA,FAA,CAAC,ANAC										
610982	45986	EASA,FAA,CAAC,ANAC										
610982	45987	EASA,FAA,CAAC,ANAC										
610982	46150	EASA,FAA,CAAC,ANAC										
610982	46454	EASA,FAA,CAAC,ANAC										
610982	46454-3	EASA,FAA,CAAC,ANAC										
610982	46475	EASA,FAA,CAAC,ANAC										
610982	46962	EASA,FAA,CAAC,ANAC										
610982	501500-1	EASA,FAA,CAAC,ANAC										
610982	501740-1	EASA,FAA,CAAC,ANAC										
610982	537876	EASA,FAA,CAAC,ANAC										
610984	420088	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W2 (11 CONNECTIONS) - BOEING	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1245.00	SR Technics Switzerland
610984	420088-2	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2840.00	SR Technics Switzerland
610984	420088-3	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	8655.00	SR Technics Switzerland
610984	46244	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	11475.00	SR Technics Switzerland
610984	46244-2	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	40	DEACTIVATION OF TRC AND TCA CIRCUITS	IN CONJUNCTION WITH PACKAGE MEDIUM O	1225.00	SR Technics Switzerland
610984	46244-3	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	41	INSTALLATION OF JUMPER WIRES FOR ELECTRONIC ENGINE CONTROL (IN CONJUNCTION WITH PACKAGE MEDIUM O		745.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610984	46463	EASA,FAA,CAAC,ANAC			73-21-60		Package SB02	42	RCC MODIFICATION	IN CONJUNCTION WITH PACKAGE HEAVY	745.00	SR Technics Switzerland
610984	537818	EASA,FAA,CAAC,ANAC										
610987	420090	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W3 (7 CONNECTIONS) - BOEING OR AIRBUS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	850.00	SR Technics Switzerland
610987	420100	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2295.00	SR Technics Switzerland
610987	420630	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5985.00	SR Technics Switzerland
610987	45722	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	7665.00	SR Technics Switzerland
610987	45855	EASA,FAA,CAAC,ANAC										
610987	46092	EASA,FAA,CAAC,ANAC										
610987	46382	EASA,FAA,CAAC,ANAC										
610987	46456	EASA,FAA,CAAC,ANAC										
610987	537811	EASA,FAA,CAAC,ANAC										
610987	587818	EASA,FAA,CAAC,ANAC										
610988	420079	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W4 (6 CONNECTIONS) - BOEING, AIRBUS OR MC D	Package C	TEST	PRE TEST	PN420079 420442 FOR SHOP VISIT ONLY	745.00	SR Technics Switzerland
610988	420091	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2035.00	SR Technics Switzerland
610988	420442	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5250.00	SR Technics Switzerland
610988	420746	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	6860.00	SR Technics Switzerland
610988	420749	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-28	REMOVAL OF TRC/BVCA SWITCH BRANCHES (MD11)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1695.00	SR Technics Switzerland
610988	420788	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-31	REMOVAL OF TRC/BVCA SWITCH BRANCHES (BOEING)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1695.00	SR Technics Switzerland
610988	45920	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-32	CHAFE PROTECTION IN THE FMU BACKSHELL	IN CONJUNCTION WITH PACKAGE HEAVY	505.00	SR Technics Switzerland
610988	46153	EASA,FAA,CAAC,ANAC										
610988	46155	EASA,FAA,CAAC,ANAC										
610988	46457	EASA,FAA,CAAC,ANAC										
610988	46465	EASA,FAA,CAAC,ANAC										
610988	537878	EASA,FAA,CAAC,ANAC										
610988	537878-001	EASA,FAA,CAAC,ANAC										
610989	420078	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W4 (7 CONNECTIONS) - BOEING, AIRBUS OR MC D	Package C	TEST	PRE TEST	PN420441 FOR SHOP VISIT ONLY	850.00	SR Technics Switzerland
610989	420092	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2295.00	SR Technics Switzerland
610989	420092-1	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5985.00	SR Technics Switzerland
610989	420101	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	7665.00	SR Technics Switzerland
610989	420102	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-28	REMOVAL OF TRC/BVCA SWITCH BRANCHES (MD11)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1695.00	SR Technics Switzerland
610989	420439	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-31	REMOVAL OF TRC/BVCA SWITCH BRANCHES (BOEING)	IN CONJUNCTION WITH PACKAGE MEDIUM O	1695.00	SR Technics Switzerland
610989	420441	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-32	CHAFE PROTECTION IN THE FMU BACKSHELL	IN CONJUNCTION WITH PACKAGE HEAVY	505.00	SR Technics Switzerland
610989	420443	EASA,FAA,CAAC,ANAC										
610989	420612	EASA,FAA,CAAC,ANAC										
610989	420745	EASA,FAA,CAAC,ANAC										
610989	420748	EASA,FAA,CAAC,ANAC										
610989	420789	EASA,FAA,CAAC,ANAC										
610989	45531	EASA,FAA,CAAC,ANAC										
610989	45797	EASA,FAA,CAAC,ANAC										
610989	45857	EASA,FAA,CAAC,ANAC										
610989	45915	EASA,FAA,CAAC,ANAC										
610989	45918	EASA,FAA,CAAC,ANAC										
610989	45924	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
610989	45924-1	EASA,FAA,CAAC,ANAC										
610989	45992	EASA,FAA,CAAC,ANAC										
610989	45993	EASA,FAA,CAAC,ANAC										
610989	46458	EASA,FAA,CAAC,ANAC										
610989	46466	EASA,FAA,CAAC,ANAC										
610989	46466-1	EASA,FAA,CAAC,ANAC										
610989	46477	EASA,FAA,CAAC,ANAC										
610989	46477-1	EASA,FAA,CAAC,ANAC										
610989	517861	EASA,FAA,CAAC,ANAC										
610989	527860	EASA,FAA,CAAC,ANAC										
610989	537085	EASA,FAA,CAAC,ANAC										
610989	537143	EASA,FAA,CAAC,ANAC										
610989	537243	EASA,FAA,CAAC,ANAC										
610989	537247	EASA,FAA,CAAC,ANAC										
610989	537821	EASA,FAA,CAAC,ANAC										
610992	420081	EASA,FAA,CAAC,ANAC	21	21	73-21-60	EEC WIRE HARNESS W6 - BOEING, AIRBUS OR MC DONNELL DOUGLAS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	360.00	SR Technics Switzerland
610992	421101	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1480.00	SR Technics Switzerland
610992	421273	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	3070.00	SR Technics Switzerland
610992	46188	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	3765.00	SR Technics Switzerland
610992	52U141	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-15	WG WIRING HARNESS REPLACEMENT		280.00	SR Technics Switzerland
610992	537403	EASA,FAA,CAAC,ANAC										
611008	46094	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W3 (6 CONNECTIONS) - BOEING	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	425.00	SR Technics Switzerland
611008	46152	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	1860.00	SR Technics Switzerland
611008	46231	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5095.00	SR Technics Switzerland
611008	46383	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	6610.00	SR Technics Switzerland
611008	46464	EASA,FAA,CAAC,ANAC										
611008	537272	EASA,FAA,CAAC,ANAC										
611008	537439	EASA,FAA,CAAC,ANAC										
611008	537701	EASA,FAA,CAAC,ANAC										
611008	537819	EASA,FAA,CAAC,ANAC										
611009	420440	EASA,FAA,CAAC,ANAC	19	21	73-21-60	EEC WIRE HARNESS W5 (9 CONNECTIONS) - BOEING	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	1045.00	SR Technics Switzerland
611009	420750	EASA,FAA,CAAC,ANAC			73-21-60		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2725.00	SR Technics Switzerland
611009	45866	EASA,FAA,CAAC,ANAC			73-21-60		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	7500.00	SR Technics Switzerland
611009	46100	EASA,FAA,CAAC,ANAC			73-21-60		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	9815.00	SR Technics Switzerland
611009	46335	EASA,FAA,CAAC,ANAC			73-21-60		Package SB00	73-31	REMOVAL OF TRC/BVCA SWITCH BRANCHES	IN CONJUNCTION WITH PACKAGE MEDIUM O	1695.00	SR Technics Switzerland
611009	46385	EASA,FAA,CAAC,ANAC			73-21-60		Package SB01	73-32	CHAFE PROTECTION IN THE FMU BACKSHELL	IN CONJUNCTION WITH PACKAGE HEAVY	505.00	SR Technics Switzerland
611009	46467	EASA,FAA,CAAC,ANAC										
611009	46467-1	EASA,FAA,CAAC,ANAC										
611009	597357	EASA,FAA,CAAC,ANAC										
611010	420083	EASA,FAA,CAAC,ANAC	19	21	73-21-61	EEC WIRE HARNESS W11 - MC DONNELL DOUGLAS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	425.00	SR Technics Switzerland
611010	420135	EASA,FAA,CAAC,ANAC			73-21-61		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	2140.00	SR Technics Switzerland
611010	420578	EASA,FAA,CAAC,ANAC			73-21-61		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	5900.00	SR Technics Switzerland
611010	46479	EASA,FAA,CAAC,ANAC			73-21-61		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	7655.00	SR Technics Switzerland
611010	46964	EASA,FAA,CAAC,ANAC										
611010	46965	EASA,FAA,CAAC,ANAC										
611010	537880	EASA,FAA,CAAC,ANAC										
611190	26257-000	EASA,FAA,CAAC,ANAC	20	21	77-21-04	EGT (T4.9) THERMOCOUPLE BOX AND CABLE	Package C		PRE-TEST	TESTING AND FAULT ISOLATION	440.00	SR Technics Switzerland
611190	50P090	EASA,FAA,CAAC,ANAC			77-21-04		Package D	LIGHT	REPAIR AND FINAL TEST	NO CONNECTIONS ARE AFFECTED	905.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
611190	50P228	EASA,FAA,CAAC,ANAC			77-21-04		Package E	MEDIUM	REPAIR AND FINAL TEST	LESS THAN OR EQUAL TO 50% OF THE CONNE	2035.00	SR Technics Switzerland
611190	50P281	EASA,FAA,CAAC,ANAC			77-21-04		Package F	HEAVY	REPAIR AND FINAL TEST	MORE THAN 50% OF CONNECTIONS ARE AFFE	2765.00	SR Technics Switzerland
611190	50P487	EASA,FAA,CAAC,ANAC			77-21-04		Package I		ASSEMBLY AND DISASSEMBLY		330.00	SR Technics Switzerland
611190	HAD18919	EASA,FAA,CAAC,ANAC			77-21-04		Package SB00	SB1-77-21-04	EGT HARNESS AND JUNCTION BOX - REPLACEMENT NUTS, RETAINING	IN CONJUNCTION WITH PACKAGE MEDIUM O	1010.00	SR Technics Switzerland
611190	HAD19490	EASA,FAA,CAAC,ANAC										
611190	HAD20458	EASA,FAA,CAAC,ANAC										
611190	HAD20459	EASA,FAA,CAAC,ANAC										
611190	HAD20460	EASA,FAA,CAAC,ANAC										
612638	108280-171	EASA,FAA,CAAC,ANAC	19	21	71-00-15	PNEUMATIC DUCTS, TUBES AND HOSES	Package A	CLN/INSP	CLEANING AND INSPECTION		310.00	SR Technics Switzerland
612638	14527-503	EASA,FAA,CAAC,ANAC			71-00-15		Package D	01	BLEND REPAIR		1745.00	SR Technics Switzerland
612638	14527-517	EASA,FAA,ANAC			71-00-15		Package D	02	BALL MANDREL REPAIR OF SMOOTH DENTS		1745.00	SR Technics Switzerland
612638	221-0841-509	EASA,FAA,CAAC,ANAC			71-00-15		Package D	03	DOUBLER REPAIR AND SECTION REPLACEMENT		1745.00	SR Technics Switzerland
612638	221-0841-511	EASA,FAA,CAAC,ANAC			71-00-15		Package I	05	INSULATION BLANKET PATCH REPAIR		1745.00	SR Technics Switzerland
612638	221-0842-505	EASA,FAA,CAAC,ANAC			71-00-15		Package I	06	WELD REPAIR OF TURBINE CASE COOLING DUCT LUG		1745.00	SR Technics Switzerland
612638	221-0842-507	EASA,FAA,CAAC,ANAC			71-00-15		Package I	07	WELD REPAIR OF TURBINE CASE COOLING DUCT FLANGE		1745.00	SR Technics Switzerland
612638	221-0843-503	EASA,FAA,CAAC,ANAC			71-00-15		Package I	08	DUCT AND MANIFOLD ASSEMBLY SUPPORT BRACKET BUSHING REPAIR		1745.00	SR Technics Switzerland
612638	221-0845-515	EASA,FAA,CAAC,ANAC			71-00-15		Package SB00	PW4NAC 71-131	REPLACEMENT OF WIRE HARNESS SUPPORT BRACKETS ON THE OIL TANK		570.00	SR Technics Switzerland
612638	221-0845-517	EASA,FAA,CAAC,ANAC			71-00-15		Package SB01	PW4NAC 71-168	MODIFICATION OF THE PYLON DRAIN TUBE		810.00	SR Technics Switzerland
612638	221-0846-505	EASA,FAA,CAAC,ANAC			71-00-15		Package SB02	PW4NAC 36-14	MODIFICATION OF THE TURBINE CASE COOLING DUCT		1275.00	SR Technics Switzerland
612638	221-0849-505	EASA,FAA,CAAC,ANAC			71-00-15		Package SB03	PW4NAC 71-139	REPLACEMENT OF THE ENGINE CORE BRACKET AND DUCT ASSEMBLY		315.00	SR Technics Switzerland
612638	221-0849-507	EASA,FAA,CAAC,ANAC			71-00-15		Package SB04	IA 80-069705	MD-11 MODIFICATION OF STARTER DUCT BRACKET		360.00	SR Technics Switzerland
612638	221-0873-505	EASA,FAA,CAAC,ANAC			71-00-15		Package SB05	PW4NAC 36-5	REPLACEMENT OF 8TH STAGE RIGHT HAND DUCT ELBOW		315.00	SR Technics Switzerland
612638	221-0873-507	EASA,FAA,CAAC,ANAC										
612638	221-1523-501	EASA,FAA,CAAC,ANAC										
612638	221-4301-511	EASA,FAA,CAAC,ANAC										
612638	221-4303-505	EASA,FAA,CAAC,ANAC										
612638	221-4304-503	EASA,FAA,ANAC										
612638	221-4304-505	EASA,FAA,CAAC,ANAC										
612638	221-4305-503	EASA,FAA,CAAC,ANAC										
612638	221-4306-503	EASA,FAA,CAAC,ANAC										
612638	221-4307-503	EASA,FAA,CAAC,ANAC										
612638	221-4308-507	EASA,FAA,CAAC,ANAC										
612638	221-4308-509	EASA,FAA,CAAC,ANAC										
612638	221-4309-1	EASA,FAA,CAAC,ANAC										
612638	221-4310-501	EASA,FAA,CAAC,ANAC										
612638	221-4314-509	EASA,FAA,CAAC,ANAC										
612638	221-4314-511	EASA,FAA,CAAC,ANAC										
612638	221-4314-513	EASA,FAA,CAAC,ANAC										
612638	221-4334-505	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
612638	221-4335-501	EASA,FAA,CAAC,ANAC										
612638	221-4335-503	EASA,FAA,CAAC,ANAC										
612638	221-4457-505	EASA,FAA,CAAC,ANAC										
612638	221-4463-517	EASA,FAA,CAAC,ANAC										
612638	221-4616-503	EASA,FAA,CAAC,ANAC										
612638	221-4751-505	EASA,FAA,CAAC,ANAC										
612638	221-4950-633	EASA,FAA,CAAC,ANAC										
612638	221-4950-705	EASA,FAA,CAAC,ANAC										
612638	221-4950-781	EASA,FAA,CAAC,ANAC										
612638	221-4950-869	EASA,FAA,CAAC,ANAC										
612638	221-4950-907	EASA,FAA,CAAC,ANAC										
612638	221-4950-917	EASA,FAA,CAAC,ANAC										
612638	221-4950-941	EASA,FAA,CAAC,ANAC										
612638	221-5094-501	EASA,FAA,CAAC,ANAC										
612638	221-5302-503	EASA,FAA,CAAC,ANAC										
612638	221-5303-505	EASA,FAA,CAAC,ANAC										
612638	221-5304-503	EASA,FAA,CAAC,ANAC										
612638	221-5306-501	EASA,FAA,CAAC,ANAC										
612638	221-5401-537	EASA,FAA,CAAC,ANAC										
612638	221-5721-527	EASA,FAA,CAAC,ANAC										
612638	221-5761-523	EASA,FAA,CAAC,ANAC										
612638	221-5766-509	EASA,FAA,CAAC,ANAC										
612638	221D5027-521	EASA,FAA,CAAC,ANAC										
612638	78024	EASA,FAA,CAAC,ANAC										
612638	AE707033-2	EASA,FAA,CAAC,ANAC										
624121	730464A	EASA,FAA,CAAC,ANAC	4	21	24-19-06	PW4 100" QUICK ATTACH-DETACH ADAPTER	Package A	CLN/INSP	CLEANING & INSPECTION		680.00	SR Technics Switzerland
624121	749865	EASA,FAA,CAAC,ANAC										
624121	753693	EASA,FAA,CAAC,ANAC										
624132	14611-14	EASA,FAA,CAAC,ANAC	3	21	36-11-30	STARTER DUCT ASSEMBLY FOR BOEING	Package A	CLN/INSP	CLEANING & INSPECTION		485.00	SR Technics Switzerland
624132	5332N303-14	EASA,FAA,CAAC,ANAC										
624175	332T4521-2	EASA,FAA,CAAC,ANAC	3	21	71-04-28	HEAT SHIELD ASSEMBLY FOR BOEING	Package A	CLN/INSP	CLEANING & INSPECTION		100.00	SR Technics Switzerland
624175	332T4521-48	EASA,FAA,CAAC,ANAC			71-04-28		Package B	1-1	THERMAL SHIELD ASSEMBLY		1290.00	SR Technics Switzerland
624175	332T4521-53	EASA,FAA,CAAC,ANAC										
624175	332T4521-54	EASA,FAA,CAAC,ANAC										
626263	51U093	EASA,FAA,CAAC,ANAC	19	28	72-61-99	MAIN GEARBOX - MAIN GEARBOX MISCELLANEOUS PARTS	Package A	CLN/INSP	CLEANING AND INSPECTION		955.00	SR Technics Switzerland
626263	59T303-01	EASA,FAA,CAAC,ANAC			72-61-99		Package B	01	PROTECTIVE COAT REPLACEMENT REPAIR		2010.00	SR Technics Switzerland
626263	70R749	EASA,FAA,CAAC,ANAC										
626263	70R768	EASA,FAA,CAAC,ANAC										
626263	70R779-01	EASA,FAA,CAAC,ANAC										
629647	71A304-001	EASA,FAA,CAAC,ANAC	4	21	78-11-11	PW4 (100") SADDLE OF NOZZLE ASSY	Package B	R.ESEE.000899	CHANNEL WEAR WELD REPAIR		3145.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
629647	76A013-1	EASA,FAA,CAAC,ANAC										
629647	76A013-3	EASA,FAA,CAAC,ANAC										
631334	420662	EASA,FAA,CAAC,ANAC	10	21	73-31-24	FIRE DETECTION AND THRUST REVERSER HARNESS	Package C	TEST	PRE TEST	TESTING AND FAULT ISOLATION	335.00	SR Technics Switzerland
636094	50A220	EASA,FAA,CAAC,ANAC	20	28	72-34-36	INTERMEDIATE CASE - NO. 1.5 AND 2 BEARING SEAL SUPPORT ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		240.00	SR Technics Switzerland
636094	51G096	EASA,FAA,CAAC,ANAC										
636094	51G176	EASA,FAA,CAAC,ANAC										
636094	52G379	EASA,FAA,CAAC,ANAC										
636895	50P140-01	EASA,FAA,CAAC,ANAC	16	28	72-54-35	TURBINE EXHAUST CASE - NO. 4 BEARING SHIELD - HEATSHIELD (INSULATED)	Package A	CLN/INSP	CLEANING AND INSPECTION		220.00	SR Technics Switzerland
636895	50P141	EASA,FAA,CAAC,ANAC			72-54-35		Package C	02	DAMAGED FOIL MATERIAL SPOT WELD REPAIR		530.00	SR Technics Switzerland
636895	50P264	EASA,FAA,CAAC,ANAC										
648706	336-022-402-0	EASA,FAA,CAAC,ANAC	2	21	72-53-10	CFM56 STAGE 1 LOW PRESSURE TURBINE NOZZLE	Package A	CLN/INSP	CLEANING & INSPECTION		35.00	SR Technics Switzerland
648706	336-022-503-0	EASA,FAA,CAAC,ANAC										
648706	340-256-401-0	EASA,FAA,CAAC,ANAC										
648706	340-256-501-0	EASA,FAA,CAAC,ANAC										
648903	332T4340-21	EASA,FAA,CAAC,ANAC	15	21	72-09-71	GENERAL PROCEDURES - HOSES AND TUBE ASSEMBLIES	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
648903	332T4710-90	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		165.00	SR Technics Switzerland
648903	332T4710-92	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY THE ANTIGALLING COMPOUND		75.00	SR Technics Switzerland
648903	4033716	EASA,FAA,ANAC			72-09-71		Package V	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	155.00	SR Technics Switzerland
648903	50T261	EASA,FAA,CAAC,ANAC										
648903	50T957	EASA,FAA,CAAC,ANAC										
648903	50T960	EASA,FAA,CAAC,ANAC										
648903	50T961	EASA,FAA,CAAC,ANAC										
648903	50T964	EASA,FAA,CAAC,ANAC										
648903	51R155-01	EASA,FAA,CAAC,ANAC										
648903	51T274	EASA,FAA,CAAC,ANAC										
648903	51T287	EASA,FAA,ANAC										
648903	51T368	EASA,FAA,CAAC,ANAC										
648903	51T475	EASA,FAA,CAAC,ANAC										
648903	51T478	EASA,FAA,CAAC,ANAC										
648903	51U179	EASA,FAA,CAAC,ANAC										
648903	52T770	EASA,FAA,CAAC,ANAC										
648903	52T898-01	EASA,FAA,CAAC,ANAC										
648903	53T098	EASA,FAA,CAAC,ANAC										
648903	53T099	EASA,FAA,CAAC,ANAC										
648903	53T148-01	EASA,FAA,CAAC,ANAC										
648903	53T185-01	EASA,FAA,CAAC,ANAC										
648903	53T207-01	EASA,FAA,CAAC,ANAC										
648903	53T233-01	EASA,FAA,CAAC,ANAC										
648903	53T259-01	EASA,FAA,CAAC,ANAC										
648903	53T981	EASA,FAA,CAAC,ANAC										
648903	53T982	EASA,FAA,CAAC,ANAC										
648903	53T996	EASA,FAA,CAAC,ANAC										
648903	54T022-01	EASA,FAA,CAAC,ANAC										
648903	54T108-01	EASA,FAA,CAAC,ANAC										
648903	54T244-01	EASA,FAA,CAAC,ANAC										
648903	54T427-01	EASA,FAA,CAAC,ANAC										
648903	54T928	EASA,FAA,CAAC,ANAC										
648903	54T980-01	EASA,FAA,CAAC,ANAC										
648903	55T390	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648903	55T392	EASA,FAA,CAAC,ANAC										
648903	56T069	EASA,FAA,CAAC,ANAC										
648903	59T531	EASA,FAA,CAAC,ANAC										
648903	59T757	EASA,FAA,CAAC,ANAC										
648904	50T279	EASA,FAA,CAAC,ANAC	15	21	72-09-71	GENERAL PROCEDURES - HOSES AND TUBE ASSEMBLIES	Package A	CLN/INSP	CLEANING AND INSPECTION		210.00	SR Technics Switzerland
648904	50T429	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		210.00	SR Technics Switzerland
648904	50T467	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY THE ANTIGALLING COMPOUND		80.00	SR Technics Switzerland
648904	51T076	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		290.00	SR Technics Switzerland
648904	51T079	EASA,FAA,CAAC,ANAC			72-09-71		Package S802	PW4ENG 72-773	HOSE CP11 AND CR13 HOSE AND TUBE ASSEMBLIES LP01 AND LP03 INSPECTION FOR DAMAGE		145.00	SR Technics Switzerland
648904	51T080	EASA,FAA,CAAC,ANAC			72-09-71		Package V	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	350.00	SR Technics Switzerland
648904	51T286	EASA,FAA,CAAC,ANAC			72-09-71		Package X	SPM	RIVET REMOVAL PROCEDURE	SPM 70-43-00	290.00	SR Technics Switzerland
648904	51T358	EASA,FAA,CAAC,ANAC										
648904	51T532	EASA,FAA,CAAC,ANAC										
648904	51U192	EASA,FAA,CAAC,ANAC										
648904	51U985-01	EASA,FAA,ANAC										
648904	52T336	EASA,FAA,CAAC,ANAC										
648904	52T503	EASA,FAA,CAAC,ANAC										
648904	52T637-01	EASA,FAA,CAAC,ANAC										
648904	52T641-01	EASA,FAA,CAAC,ANAC										
648904	52T674-01	EASA,FAA,CAAC,ANAC										
648904	52T694-01	EASA,FAA,CAAC,ANAC										
648904	52T695-01	EASA,FAA,CAAC,ANAC										
648904	52T696-01	EASA,FAA,CAAC,ANAC										
648904	52T999	EASA,FAA,CAAC,ANAC										
648904	52U012	EASA,FAA,CAAC,ANAC										
648904	53T104-01	EASA,FAA,CAAC,ANAC										
648904	53T231-01	EASA,FAA,CAAC,ANAC										
648904	53T278-01	EASA,FAA,CAAC,ANAC										
648904	53T281-01	EASA,FAA,CAAC,ANAC										
648904	53T501-01	EASA,FAA,CAAC,ANAC										
648904	53T847	EASA,FAA,CAAC,ANAC										
648904	53T935-01	EASA,FAA,CAAC,ANAC										
648904	53T974-01	EASA,FAA,CAAC,ANAC										
648904	54T021-01	EASA,FAA,CAAC,ANAC										
648904	54T052-01	EASA,FAA,CAAC,ANAC										
648904	54T097-01	EASA,FAA,CAAC,ANAC										
648904	54T107-01	EASA,FAA,CAAC,ANAC										
648904	54T109-01	EASA,FAA,CAAC,ANAC										
648904	54T113-01	EASA,FAA,CAAC,ANAC										
648904	54T121-01	EASA,FAA,CAAC,ANAC										
648904	54T144-01	EASA,FAA,CAAC,ANAC										
648904	54T146-01	EASA,FAA,CAAC,ANAC										
648904	54T206	EASA,FAA,CAAC,ANAC										
648904	54T216-01	EASA,FAA,CAAC,ANAC										
648904	54T217-01	EASA,FAA,CAAC,ANAC										
648904	54T243-01	EASA,FAA,CAAC,ANAC										
648904	54T250-01	EASA,FAA,CAAC,ANAC										
648904	54T575-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648904	557258-01	EASA,FAA,CAAC,ANAC										
648904	557295-01	EASA,FAA,CAAC,ANAC										
648904	557745-01	EASA,FAA,CAAC,ANAC										
648904	557817-01	EASA,FAA,CAAC,ANAC										
648904	567218-01	EASA,FAA,CAAC,ANAC										
648904	577244	EASA,FAA,CAAC,ANAC										
648904	577245	EASA,FAA,CAAC,ANAC										
648904	577297	EASA,FAA,CAAC,ANAC										
648904	577449	EASA,FAA,CAAC,ANAC										
648904	577471	EASA,FAA,CAAC,ANAC										
648904	577639-01	EASA,FAA,CAAC,ANAC										
648904	597175	EASA,FAA,CAAC,ANAC										
648904	597185	EASA,FAA,CAAC,ANAC										
648904	597401-01	EASA,FAA,CAAC,ANAC										
648904	597709	EASA,FAA,ANAC										
648904	597719-01	EASA,FAA,CAAC,ANAC										
648904	597813-01	EASA,FAA,CAAC,ANAC										
648905	507854	EASA,FAA,CAAC,ANAC	17	21	72-09-71	GENERAL PROCEDURES - HOSES AND TUBE ASSEMBLIES	Package A	CLN/INSP	CLEANING AND INSPECTION		420.00	SR Technics Switzerland
648905	507860	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		420.00	SR Technics Switzerland
648905	507860-001	EASA,FAA,CAAC,ANAC			72-09-71		Package AN	48	OIL TUBE COATING REPAIR		685.00	SR Technics Switzerland
648905	50U400-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY THE ANTIGALLING COMPOUND		80.00	SR Technics Switzerland
648905	50U592-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		285.00	SR Technics Switzerland
648905	50U639	EASA,FAA,CAAC,ANAC			72-09-71		Package E	04	BLEND REPAIR OF SURFACE DAMAGE		125.00	SR Technics Switzerland
648905	50U773-01	EASA,FAA,CAAC,ANAC			72-09-71		Package F	05	DENT REPAIR		1700.00	SR Technics Switzerland
648905	50U828-01	EASA,FAA,CAAC,ANAC			72-09-71		Package L	11	BLEND REPAIR SURFACE DAMAGE TUBE CONNECTOR NUTS COUPLINGS AND FERRULE DETAILS		155.00	SR Technics Switzerland
648905	51T490	EASA,FAA,CAAC,ANAC			72-09-71		Package S800	PW4ENG 79-87	REPLACEMENT OR MODIFICATION OF TO IMPROVE CLEARANCE		1100.00	SR Technics Switzerland
648905	51T498	EASA,FAA,CAAC,ANAC			72-09-71		Package S801	PW4G-100-79-42	INSPECTION FOR SUSPECT ELBOWS		730.00	SR Technics Switzerland
648905	51T526	EASA,FAA,CAAC,ANAC			72-09-71		Package V	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	135.00	SR Technics Switzerland
648905	51T880	EASA,FAA,CAAC,ANAC			72-09-71		Package X	SPM	RIVET REMOVAL PROCEDURE	SPM 70-43-00	285.00	SR Technics Switzerland
648905	51U540-01	EASA,FAA,CAAC,ANAC			72-09-71		Package Y	EO 524706	BSI BRG 4 LUBRICATION AND SCAVANGE	SRT COMPANY EDITION	80.00	SR Technics Switzerland
648905	51U702	EASA,FAA,CAAC,ANAC										
648905	51U704	EASA,FAA,CAAC,ANAC										
648905	52T472	EASA,FAA,CAAC,ANAC										
648905	52T526	EASA,FAA,CAAC,ANAC										
648905	52T622-01	EASA,FAA,CAAC,ANAC										
648905	52T707	EASA,FAA,CAAC,ANAC										
648905	52T934-01	EASA,FAA,CAAC,ANAC										
648905	52U045-01	EASA,FAA,CAAC,ANAC										
648905	53T002-01	EASA,FAA,CAAC,ANAC										
648905	53T146-01	EASA,FAA,CAAC,ANAC										
648905	53T166	EASA,FAA,CAAC,ANAC										
648905	53T167	EASA,FAA,CAAC,ANAC										
648905	53T256-01	EASA,FAA,CAAC,ANAC										
648905	53T343	EASA,FAA,CAAC,ANAC										
648905	53T429-01	EASA,FAA,CAAC,ANAC										
648905	53T445-01	EASA,FAA,CAAC,ANAC										
648905	53T559-01	EASA,FAA,CAAC,ANAC										
648905	53T803-01	EASA,FAA,CAAC,ANAC										
648905	53T871-01	EASA,FAA,CAAC,ANAC										
648905	53T915-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648905	53T920-01	EASA,FAA,CAAC,ANAC										
648905	53T921-01	EASA,FAA,CAAC,ANAC										
648905	53T922-01	EASA,FAA,CAAC,ANAC										
648905	53T965-01	EASA,FAA,CAAC,ANAC										
648905	54T068-01	EASA,FAA,CAAC,ANAC										
648905	54T070-01	EASA,FAA,CAAC,ANAC										
648905	54T086-01	EASA,FAA,ANAC										
648905	54T094-01	EASA,FAA,CAAC,ANAC										
648905	54T111-01	EASA,FAA,CAAC,ANAC										
648905	54T183-01	EASA,FAA,CAAC,ANAC										
648905	54T185-01	EASA,FAA,CAAC,ANAC										
648905	54T202	EASA,FAA,CAAC,ANAC										
648905	54T436-01	EASA,FAA,CAAC,ANAC										
648905	54T447	EASA,FAA,CAAC,ANAC										
648905	54T576-01	EASA,FAA,CAAC,ANAC										
648905	54T927	EASA,FAA,CAAC,ANAC										
648905	54T989-01	EASA,FAA,CAAC,ANAC										
648905	55T805-01	EASA,FAA,CAAC,ANAC										
648905	56T634	EASA,FAA,CAAC,ANAC										
648905	57T470	EASA,FAA,CAAC,ANAC										
648905	57T671-01	EASA,FAA,CAAC,ANAC										
648905	57T773-01	EASA,FAA,CAAC,ANAC										
648905	58T172	EASA,FAA,CAAC,ANAC										
648905	58T173	EASA,FAA,CAAC,ANAC										
648905	58T211-01	EASA,FAA,CAAC,ANAC										
648905	58T270-01	EASA,FAA,CAAC,ANAC										
648905	58T300-01	EASA,FAA,CAAC,ANAC										
648905	58T589	EASA,FAA,CAAC,ANAC										
648905	58T946-01	EASA,FAA,CAAC,ANAC										
648905	59T068-01	EASA,FAA,CAAC,ANAC										
648905	59T069-01	EASA,FAA,CAAC,ANAC										
648905	59T070-01	EASA,FAA,CAAC,ANAC										
648905	59T079-01	EASA,FAA,CAAC										
648905	59T081-01	EASA,FAA,CAAC,ANAC										
648905	59T089-01	EASA,FAA,CAAC,ANAC										
648905	59T101-01	EASA,FAA,CAAC,ANAC										
648905	59T159-01	EASA,FAA,CAAC,ANAC										
648905	59T173-01	EASA,FAA,CAAC,ANAC										
648905	59T180	EASA,FAA,CAAC,ANAC										
648905	59T238-01	EASA,FAA,CAAC,ANAC										
648905	59T261	EASA,FAA,CAAC,ANAC										
648905	59T640-01	EASA,FAA,CAAC,ANAC										
648905	59T641-01	EASA,FAA,CAAC,ANAC										
648905	59T669-01	EASA,FAA,CAAC,ANAC										
648905	59T670-01	EASA,FAA,CAAC,ANAC										
648905	59T712-01	EASA,FAA,CAAC,ANAC										
648905	59T812-01	EASA,FAA,CAAC,ANAC										
648906	221-5097-501	EASA,FAA,CAAC,ANAC	15	21	72-09-71	GENERAL PROCEDURES - HOSES AND TUBE ASSEMBLIES	Package A	CLN/INSP	CLEANING AND INSPECTION		525.00	SR Technics Switzerland
648906	50U010-01	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		525.00	SR Technics Switzerland
648906	50U202	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY THE ANTIGALLING COMPOUND		80.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648906	50U215	EASA,FAA;ANAC			72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		290.00	SR Technics Switzerland
648906	51R153-01	EASA,FAA;CAAC;ANAC			72-09-71		Package E	04	BLEND REPAIR OF SURFACE DAMAGE		145.00	SR Technics Switzerland
648906	51U703	EASA,FAA;CAAC;ANAC			72-09-71		Package F	05	DENT REPAIR		1085.00	SR Technics Switzerland
648906	51U818	EASA,FAA;CAAC;ANAC			72-09-71		Package H	07	REPLACE THE COUPLING FERRULE LINER NUT REDUCER ELBOW OR SLEEVE		905.00	SR Technics Switzerland
648906	51U978	EASA,FAA;CAAC;ANAC			72-09-71		Package L	11	BLEND REPAIR SURFACE DAMAGE TUBE CONNECTOR NUTS COUPLINGS AND FERRULE DETAILS		280.00	SR Technics Switzerland
648906	52T373	EASA,FAA;CAAC;ANAC			72-09-71		Package N	13	MINOR GOUGE, TEAR, CUT OF FLEXIBLE TUBE FIRE SLEEVE REPAIR		280.00	SR Technics Switzerland
648906	52T582	EASA,FAA;CAAC;ANAC			72-09-71		Package S	18	FLANGE COAT REPLACEMENT		820.00	SR Technics Switzerland
648906	52T676-01	EASA,FAA;CAAC;ANAC			72-09-71		Package U	20	MAIN BEARING STRAINER ELEMENT HOUSING ASSEMBLY FLANGE COATING REPLACEMENT REPAIR		280.00	SR Technics Switzerland
648906	52T780-01	EASA,FAA;CAAC;ANAC			72-09-71		Package V	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	350.00	SR Technics Switzerland
648906	52U054-01	EASA,FAA;CAAC;ANAC			72-09-71		Package X	SPM	RIVET REMOVAL PROCEDURE	SPM 70-43-00	290.00	SR Technics Switzerland
648906	52U243	EASA,FAA;CAAC;ANAC			72-09-71		Package Y	EO 524706	BSI BRG 4 LUBRICATION AND SCAVANGE	SRT COMPANY EDITION	80.00	SR Technics Switzerland
648906	52U910-01	EASA,FAA;CAAC;ANAC			72-09-71		Package Z	SPM	INSERTS REMOVAL PROCEDURE		90.00	SR Technics Switzerland
648906	52U911-01	EASA,FAA;CAAC;ANAC										
648906	52U912-01	EASA,FAA;CAAC;ANAC										
648906	52U913-01	EASA,FAA;CAAC;ANAC										
648906	52U965-01	EASA,FAA;ANAC										
648906	53T168	EASA,FAA;CAAC;ANAC										
648906	53T192-01	EASA,FAA;CAAC;ANAC										
648906	53T218-01	EASA,FAA;CAAC;ANAC										
648906	53T511-01	EASA,FAA;CAAC;ANAC										
648906	53T566-01	EASA,FAA;CAAC;ANAC										
648906	53T594-01	EASA,FAA;CAAC;ANAC										
648906	53T934-01	EASA,FAA;CAAC;ANAC										
648906	53U018-01	EASA,FAA;ANAC										
648906	54T177-01	EASA,FAA;CAAC;ANAC										
648906	54T521-01	EASA,FAA;CAAC;ANAC										
648906	55T287-01	EASA,FAA;CAAC;ANAC										
648906	55T545-01	EASA,FAA;CAAC;ANAC										
648906	55T675-01	EASA,FAA;CAAC;ANAC										
648906	55T798-01	EASA,FAA;CAAC;ANAC										
648906	55T821-01	EASA,FAA;CAAC;ANAC										
648906	55T944	EASA,FAA;CAAC;ANAC										
648906	56T093-01	EASA,FAA;CAAC;ANAC										
648906	56T140	EASA,FAA;CAAC;ANAC										
648906	56T453-01	EASA,FAA;CAAC;ANAC										
648906	56T743-01	EASA,FAA;CAAC;ANAC										
648906	56T745-01	EASA,FAA;CAAC;ANAC										
648906	56T746-01	EASA,FAA;CAAC;ANAC										
648906	56T812-01	EASA,FAA;CAAC;ANAC										
648906	57T467	EASA,FAA;CAAC;ANAC										
648906	57T527-01	EASA,FAA;CAAC;ANAC										
648906	57T595-01	EASA,FAA;CAAC;ANAC										
648906	57T697-01	EASA,FAA;CAAC;ANAC										
648906	57T910-01	EASA,FAA;CAAC;ANAC										
648906	57T951-01	EASA,FAA;CAAC;ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648906	571952-01	EASA,FAA,CAAC,ANAC										
648906	571996	EASA,FAA,CAAC,ANAC										
648906	581286-01	EASA,FAA,CAAC,ANAC										
648906	581707-01	EASA,FAA,CAAC,ANAC										
648906	581881-01	EASA,FAA,CAAC,ANAC										
648906	581882-01	EASA,FAA,CAAC,ANAC										
648906	581924-01	EASA,FAA,CAAC,ANAC										
648906	581947-01	EASA,FAA,CAAC,ANAC										
648906	591071-01	EASA,FAA,CAAC,ANAC										
648906	591072-01	EASA,FAA,CAAC,ANAC										
648906	591073-01	EASA,FAA,CAAC,ANAC										
648906	591074-01	EASA,FAA,CAAC,ANAC										
648906	591075-01	EASA,FAA,CAAC,ANAC										
648906	591084-01	EASA,FAA,CAAC,ANAC										
648906	591093-01	EASA,FAA,ANAC										
648906	591161-01	EASA,FAA,CAAC,ANAC										
648906	591347	EASA,FAA,CAAC,ANAC										
648906	591483	EASA,FAA,CAAC,ANAC										
648906	591532	EASA,FAA,CAAC,ANAC										
648906	591543	EASA,FAA,ANAC										
648906	591575-01	EASA,FAA,CAAC,ANAC										
648906	591623	EASA,FAA,CAAC,ANAC										
648906	591851-01	EASA,FAA,CAAC,ANAC										
648906	591887-01	EASA,FAA,CAAC,ANAC										
648906	591897-01	EASA,FAA,CAAC,ANAC										
648907	50U147-01	EASA,FAA,CAAC,ANAC	20	21	72-09-71	GENERAL PROCEDURES - HOSES AND TUBE ASSEMBLIES	Package A	CLN/INSP	CLEANING AND INSPECTION		260.00	SR Technics Switzerland
648907	50U201	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		260.00	SR Technics Switzerland
648907	50U229-01	EASA,FAA,CAAC,ANAC			72-09-71		Package AN	48	OIL TUBE COATING REPAIR		685.00	SR Technics Switzerland
648907	50U384-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	01	APPLY THE ANTIGALLING COMPOUND		80.00	SR Technics Switzerland
648907	50U395-01	EASA,FAA,CAAC,ANAC			72-09-71		Package C	02	TUBE NUT THRUST WIRE INSTALLATION		285.00	SR Technics Switzerland
648907	50U399-01	EASA,FAA,CAAC,ANAC			72-09-71		Package SB02	PW4ENG 72-773	HOSE CP11 AND CR13 HOSE AND TUBE ASSEMBLIES LP01 AND LP03 INSPECTION FOR DAMAGE		145.00	SR Technics Switzerland
648907	50U637-01	EASA,FAA,CAAC,ANAC			72-09-71		Package SB03	PW4ENG 73-205	HOSE AND TUBE ASSEMBLY FUEL PUMP INLET FM11 INSPECTION FOR NONCONFORMING HOSE AND TUBE ASSEMBLY		140.00	SR Technics Switzerland
648907	50U653-01	EASA,FAA,CAAC,ANAC			72-09-71		Package V	SPM	REPAIR OF THE TUBE CONICAL SEAT	SPM 70-00-00 REP-22	135.00	SR Technics Switzerland
648907	50U795-01	EASA,FAA,CAAC,ANAC			72-09-71		Package X	SPM	RIVET REMOVAL PROCEDURE	SPM 70-43-00	285.00	SR Technics Switzerland
648907	50U820-01	EASA,FAA,CAAC,ANAC			72-09-71		Package Y	EO 524706	BSI BRG 4 LUBRICATION AND SCAVANGE	SRT COMPANY EDITION	80.00	SR Technics Switzerland
648907	51T075	EASA,FAA,CAAC,ANAC										
648907	51T359	EASA,FAA,CAAC,ANAC										
648907	51T457	EASA,FAA,CAAC,ANAC										
648907	51T524	EASA,FAA,CAAC,ANAC										
648907	51T888	EASA,FAA,CAAC,ANAC										
648907	51T901	EASA,FAA,CAAC,ANAC										
648907	51U645-01	EASA,FAA,CAAC,ANAC										
648907	51U707	EASA,FAA,CAAC,ANAC										
648907	51U708	EASA,FAA,CAAC,ANAC										
648907	51U710	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648907	51U713-01	EASA,FAA,CAAC,ANAC										
648907	51U775	EASA,FAA,CAAC,ANAC										
648907	51U922-01	EASA,FAA,CAAC,ANAC										
648907	51U968	EASA,FAA,CAAC,ANAC										
648907	51U969	EASA,FAA,CAAC,ANAC										
648907	51U979	EASA,FAA,CAAC,ANAC										
648907	52T294	EASA,FAA,CAAC,ANAC										
648907	52T468	EASA,FAA,CAAC,ANAC										
648907	52T562	EASA,FAA,CAAC,ANAC										
648907	52T636-01	EASA,FAA,CAAC,ANAC										
648907	52T677-01	EASA,FAA,CAAC,ANAC										
648907	52T837-01	EASA,FAA,CAAC,ANAC										
648907	52T899-01	EASA,FAA,CAAC,ANAC										
648907	52T976-01	EASA,FAA,CAAC,ANAC										
648907	52U011	EASA,FAA,CAAC,ANAC										
648907	52U298-01	EASA,FAA,CAAC,ANAC										
648907	52U358-01	EASA,FAA,CAAC,ANAC										
648907	52U375-01	EASA,FAA,CAAC,ANAC										
648907	52U391-01	EASA,FAA,CAAC,ANAC										
648907	52U963-01	EASA,FAA,CAAC,ANAC										
648907	52U964-01	EASA,FAA,ANAC										
648907	53T001-01	EASA,FAA,CAAC,ANAC										
648907	53T003-01	EASA,FAA,CAAC,ANAC										
648907	53T010	EASA,FAA,CAAC,ANAC										
648907	53T011	EASA,FAA,CAAC,ANAC										
648907	53T113-01	EASA,FAA,CAAC,ANAC										
648907	53T195-01	EASA,FAA,CAAC,ANAC										
648907	53T197-01	EASA,FAA,CAAC,ANAC										
648907	53T253-01	EASA,FAA,CAAC,ANAC										
648907	53T254-01	EASA,FAA,CAAC,ANAC										
648907	53T258-01	EASA,FAA,CAAC,ANAC										
648907	53T260-01	EASA,FAA,CAAC,ANAC										
648907	53T288-01	EASA,FAA,CAAC,ANAC										
648907	53T321-01	EASA,FAA,CAAC,ANAC										
648907	53T358-01	EASA,FAA,CAAC,ANAC										
648907	53T369-01	EASA,FAA,CAAC,ANAC										
648907	53T407-01	EASA,FAA,CAAC,ANAC										
648907	53T475-01	EASA,FAA,CAAC,ANAC										
648907	53T486-01	EASA,FAA,CAAC,ANAC										
648907	53T584-01	EASA,FAA,CAAC,ANAC										
648907	53T622-01	EASA,FAA,CAAC,ANAC										
648907	53T688-01	EASA,FAA,CAAC,ANAC										
648907	53T690-01	EASA,FAA,CAAC,ANAC										
648907	53T692-01	EASA,FAA,CAAC,ANAC										
648907	53T695-01	EASA,FAA,CAAC,ANAC										
648907	53T799-01	EASA,FAA,CAAC,ANAC										
648907	53T872-01	EASA,FAA,CAAC,ANAC										
648907	53T904-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648907	53T916-01	EASA,FAA,CAAC,ANAC										
648907	54T011-01	EASA,FAA,CAAC,ANAC										
648907	54T043-01	EASA,FAA,CAAC,ANAC										
648907	54T069-01	EASA,FAA,CAAC,ANAC										
648907	54T080-01	EASA,FAA,CAAC,ANAC										
648907	54T088-01	EASA,FAA,CAAC,ANAC										
648907	54T091-01	EASA,FAA,CAAC,ANAC										
648907	54T095-01	EASA,FAA,CAAC,ANAC										
648907	54T098-01	EASA,FAA,CAAC,ANAC										
648907	54T099-01	EASA,FAA,CAAC,ANAC										
648907	54T101-01	EASA,FAA,CAAC,ANAC										
648907	54T102-01	EASA,FAA,CAAC,ANAC										
648907	54T103-01	EASA,FAA,CAAC,ANAC										
648907	54T104-01	EASA,FAA,CAAC,ANAC										
648907	54T105-01	EASA,FAA,CAAC,ANAC										
648907	54T106-01	EASA,FAA,CAAC,ANAC										
648907	54T112-01	EASA,FAA,CAAC,ANAC										
648907	54T117-01	EASA,FAA,CAAC,ANAC										
648907	54T119-01	EASA,FAA,CAAC,ANAC										
648907	54T129-01	EASA,FAA,CAAC,ANAC										
648907	54T145-01	EASA,FAA,CAAC,ANAC										
648907	54T182-01	EASA,FAA,CAAC,ANAC										
648907	54T258-01	EASA,FAA,CAAC,ANAC										
648907	54T265-01	EASA,FAA,CAAC,ANAC										
648907	54T382-01	EASA,FAA,CAAC,ANAC										
648907	54T438-01	EASA,FAA,CAAC,ANAC										
648907	54T470-01	EASA,FAA,CAAC,ANAC										
648907	54T471-01	EASA,FAA,CAAC,ANAC										
648907	54T472-01	EASA,FAA,CAAC,ANAC										
648907	54T474-01	EASA,FAA,CAAC,ANAC										
648907	54T500-01	EASA,FAA,CAAC,ANAC										
648907	54T550-01	EASA,FAA,CAAC,ANAC										
648907	54T573-01	EASA,FAA,CAAC,ANAC										
648907	54T574-01	EASA,FAA,CAAC,ANAC										
648907	54T581-01	EASA,FAA,CAAC,ANAC										
648907	54T582-01	EASA,FAA,CAAC,ANAC										
648907	54T584-01	EASA,FAA,CAAC,ANAC										
648907	54T585-01	EASA,FAA,CAAC,ANAC										
648907	55T232-01	EASA,FAA,CAAC,ANAC										
648907	55T246-01	EASA,FAA,CAAC,ANAC										
648907	55T247-01	EASA,FAA,CAAC,ANAC										
648907	55T248-01	EASA,FAA,CAAC,ANAC										
648907	55T249-01	EASA,FAA,CAAC,ANAC										
648907	55T254-01	EASA,FAA,CAAC,ANAC										
648907	55T255-01	EASA,FAA,CAAC,ANAC										
648907	55T259-01	EASA,FAA,CAAC,ANAC										
648907	55T261-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648907	55T265-01	EASA,FAA,CAAC,ANAC										
648907	55T315-01	EASA,FAA,CAAC,ANAC										
648907	55T331-01	EASA,FAA,CAAC,ANAC										
648907	55T333-01	EASA,FAA,CAAC,ANAC										
648907	55T489-01	EASA,FAA,CAAC,ANAC										
648907	55T647-01	EASA,FAA,CAAC,ANAC										
648907	55T673-01	EASA,FAA,CAAC,ANAC										
648907	55T695-01	EASA,FAA,CAAC,ANAC										
648907	55T802-01	EASA,FAA,CAAC,ANAC										
648907	55T820-01	EASA,FAA,CAAC,ANAC										
648907	55T921-01	EASA,FAA,CAAC,ANAC										
648907	56T040-01	EASA,FAA,CAAC,ANAC										
648907	56T215-01	EASA,FAA,CAAC,ANAC										
648907	56T216-01	EASA,FAA,CAAC,ANAC										
648907	56T217-01	EASA,FAA,CAAC,ANAC										
648907	56T241-01	EASA,FAA,CAAC,ANAC										
648907	56T744-01	EASA,FAA,CAAC,ANAC										
648907	57T002-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648907	571035-01	EASA,FAA,CAAC,ANAC										
648907	577469	EASA,FAA,CAAC,ANAC										
648907	571672-01	EASA,FAA,CAAC,ANAC										
648907	571684-01	EASA,FAA,CAAC,ANAC										
648907	571759-01	EASA,FAA,CAAC,ANAC										
648907	571769-01	EASA,FAA,CAAC,ANAC										
648907	571771-01	EASA,FAA,CAAC,ANAC										
648907	571772-01	EASA,FAA,CAAC,ANAC										
648907	571774-01	EASA,FAA,CAAC,ANAC										
648907	571775-01	EASA,FAA,CAAC,ANAC										
648907	571875-01	EASA,FAA,CAAC,ANAC										
648907	571892-01	EASA,FAA,CAAC,ANAC										
648907	571893-01	EASA,FAA,CAAC,ANAC										
648907	571982-01	EASA,FAA,CAAC,ANAC										
648907	571995	EASA,FAA,CAAC,ANAC										
648907	581062-01	EASA,FAA,CAAC,ANAC										
648907	581069-01	EASA,FAA,CAAC,ANAC										
648907	581207-01	EASA,FAA,CAAC,ANAC										
648907	581208-01	EASA,FAA,CAAC,ANAC										
648907	581209-01	EASA,FAA,CAAC,ANAC										
648907	581210-01	EASA,FAA,CAAC,ANAC										
648907	581288-01	EASA,FAA,CAAC,ANAC										
648907	581289-01	EASA,FAA,CAAC,ANAC										
648907	581298-01	EASA,FAA,CAAC,ANAC										
648907	581318-01	EASA,FAA,CAAC,ANAC										
648907	581379-01	EASA,FAA,CAAC,ANAC										
648907	581542-01	EASA,FAA,CAAC,ANAC										
648907	581657-01	EASA,FAA,CAAC,ANAC										
648907	581682-01	EASA,FAA,CAAC,ANAC										
648907	581706-01	EASA,FAA,CAAC,ANAC										
648907	581776-01	EASA,FAA,CAAC,ANAC										
648907	581797-01	EASA,FAA,CAAC,ANAC										
648907	581904-01	EASA,FAA,CAAC,ANAC										
648907	591085-01	EASA,FAA,CAAC,ANAC										
648907	591087-01	EASA,FAA,CAAC,ANAC										
648907	591088-01	EASA,FAA,CAAC,ANAC										
648907	591142-01	EASA,FAA,CAAC,ANAC										
648907	591143-01	EASA,FAA,CAAC,ANAC										
648907	591144-01	EASA,FAA,CAAC,ANAC										
648907	591145-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648907	59T148-01	EASA,FAA,CAAC,ANAC										
648907	59T149-01	EASA,FAA,CAAC,ANAC										
648907	59T150-01	EASA,FAA,CAAC,ANAC										
648907	59T178	EASA,FAA,CAAC,ANAC										
648907	59T244-01	EASA,FAA,CAAC,ANAC										
648907	59T400-01	EASA,FAA,CAAC,ANAC										
648907	59T484	EASA,FAA,CAAC,ANAC										
648907	59T713-01	EASA,FAA,CAAC,ANAC										
648907	59T721-01	EASA,FAA,CAAC,ANAC										
648907	59T806-01	EASA,FAA,CAAC,ANAC										
648907	59T868-01	EASA,FAA,CAAC,ANAC										
648907	59T869-01	EASA,FAA,CAAC,ANAC										
648907	59T874-01	EASA,FAA,CAAC,ANAC										
648907	59T896	EASA,FAA,CAAC,ANAC										
648907	59T913-01	EASA,FAA,CAAC,ANAC										
648907	59T933-01	EASA,FAA,CAAC,ANAC										
648907	59T983-01	EASA,FAA,CAAC,ANAC										
648907	59T985-01	EASA,FAA,CAAC,ANAC										
648907	59T986-01	EASA,FAA,CAAC,ANAC										
648908	51U148	EASA,FAA,CAAC,ANAC	5	21	72-09-71	PW4 HEAT SHIELD FOR TUBES AND DUCTS	Package A	CLN/INSP	CLEANING AND INSPECTION		285.00	SR Technics Switzerland
648908	51U149	EASA,FAA,CAAC,ANAC			72-09-71		Package B	10	HEAT SHIELD REPAIR		455.00	SR Technics Switzerland
648908	51U150	EASA,FAA,CAAC,ANAC			72-09-71		Package C	12	HEATSHIELD STRAP GUIDE REPAIR		270.00	SR Technics Switzerland
648908	51U891	EASA,FAA,CAAC,ANAC										
648908	51U892	EASA,FAA,CAAC,ANAC										
648908	52D294	EASA,FAA,CAAC,ANAC										
648908	52D295	EASA,FAA,CAAC,ANAC										
648908	53D685	EASA,FAA,CAAC,ANAC										
648908	53D686	EASA,FAA,CAAC,ANAC										
648908	53D687	EASA,FAA,CAAC,ANAC										
648908	53D688	EASA,FAA,CAAC,ANAC										
648908	53D689	EASA,FAA,CAAC,ANAC										
648908	53D691	EASA,FAA,CAAC,ANAC										
648908	53D695	EASA,FAA,CAAC,ANAC										
648908	53D696	EASA,FAA,CAAC,ANAC										
648908	57T181	EASA,FAA,CAAC,ANAC										
648908	57T182	EASA,FAA,CAAC,ANAC										
648908	57T184	EASA,FAA,CAAC,ANAC										
648908	57T185	EASA,FAA,CAAC,ANAC										
648908	57T186	EASA,FAA,CAAC,ANAC										
648908	57T187	EASA,FAA,CAAC,ANAC										
648908	57T188	EASA,FAA,CAAC,ANAC										
648908	57T189	EASA,FAA,CAAC,ANAC										
648908	57T194	EASA,FAA,CAAC,ANAC										
648908	57T195	EASA,FAA,CAAC,ANAC										
648908	57T198	EASA,FAA,CAAC,ANAC										
648908	57T199	EASA,FAA,CAAC,ANAC										
648908	57T429	EASA,FAA,CAAC,ANAC										
648908	57T430	EASA,FAA,CAAC,ANAC										
648908	57T708	EASA,FAA,CAAC,ANAC										
648908	57T709	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
648908	58T617	EASA,FAA,CAAC,ANAC										
648908	58T618	EASA,FAA,CAAC,ANAC										
648908	58T619	EASA,FAA,CAAC,ANAC										
648908	58T620	EASA,FAA,CAAC,ANAC										
648908	58T621	EASA,FAA,CAAC,ANAC										
648908	58T622	EASA,FAA,CAAC,ANAC										
648908	58T785	EASA,FAA,CAAC,ANAC										
649902	51A042	EASA,FAA,CAAC,ANAC	14	28	72-32-81	LPC/LPT COUPLING - PLUG TURBINE SHAFT	Package A	CLN/INSP	CLEANING AND INSPECTION		330.00	SR Technics Switzerland
649902	51A547	EASA,FAA,CAAC,ANAC										
650120	55T439	EASA,FAA,CAAC,ANAC	15	21	75-26-13	NACELLE CORE COMPARTMENT COOLING SYSTEM - COOLING DUCT SE	Package A	CLN/INSP	CLEANING AND INSPECTION		435.00	SR Technics Switzerland
650120	55T440	EASA,FAA,CAAC,ANAC										
650120	58T383	EASA,FAA,CAAC,ANAC										
650120	77989	EASA,FAA,ANAC										
650120	77989-1	EASA,FAA,CAAC,ANAC										
651079	50A367-01	EASA,FAA,CAAC,ANAC	2	21	72-54-00	PW4 NO.4 BRG HEATSHIELD BEARING ASSY	Package A	CLN	CLEANING & INSPECTION		70.00	SR Technics Switzerland
651115	50P361-01	EASA,FAA,CAAC,ANAC	3	28	72-54-21	PW4 NOZZLE, NO.4 BRG FRONT ASSY OF MODULE 54	Package A	CLN/INSP	CLEANING & INSPECTION		400.00	SR Technics Switzerland
651115	50P366-01	EASA,FAA,CAAC,ANAC										
652109	50R044	EASA,FAA,CAAC,ANAC	2	18	72-61-80	PW4 DRIVESHAFT, GEARBOX	Package A	CLN/INSP	CLEANING & INSPECTION		1315.00	SR Technics Switzerland
652109	50R450	EASA,FAA,CAAC,ANAC										
652128	50L159	EASA,FAA,CAAC,ANAC	6	28	72-52-13	PW4 STAGE 1 HPT BLADE (HUB RIM)	Package A	CLN/INSP	CLEANING & INSPECTION		50.00	SR Technics Switzerland
652128	KT50L159	EASA,FAA,ANAC										
652132	50L128	EASA,FAA,CAAC,ANAC	2	28	72-52-09	PW4 DAMPER, STAGE 1 HPT BLADE	Package A	CLN/INSP	CLEANING & INSPECTION		35.00	SR Technics Switzerland
652132	50L654	EASA,FAA,CAAC,ANAC										
652149	50L133CL1_	EASA,FAA,CAAC,ANAC	6	21	72-52-14	PW4 COVER, STAGE 1 HPT BLADE (HUB RIM)	Package A	CLN/INSP	CLEANING & INSPECTION		45.00	SR Technics Switzerland
652149	50L133CL2_	EASA,FAA,CAAC,ANAC										
652149	50L133CL3_	EASA,FAA,CAAC,ANAC										
652173	50N297	EASA,FAA,CAAC,ANAC	2	28	72-53-XX	PW4 PLUG, INSTRUMENTATION (BORESCOPE) B	Package A	CLN/INSP	CLEANING & INSPECTION		45.00	SR Technics Switzerland
652173	50N580	EASA,FAA,CAAC,ANAC										
652196	50A335	EASA,FAA,CAAC,ANAC	2	28	72-54-81	PW4 SEAL, NO.4 BEARING (CARBON)	Package A	CLN/INSP	CLEANING & INSPECTION		75.00	SR Technics Switzerland
652196	50A728	EASA,FAA,CAAC,ANAC										
652197	50P032	EASA,FAA,CAAC,ANAC	3	21	72-54-20	NO. 4 BEARING DAMPER SUPPLY TUBE	Package A	CLN/INSP	CLEANING & INSPECTION		205.00	SR Technics Switzerland
652197	50P358-01	EASA,FAA,CAAC,ANAC										
652197	50P365-01	EASA,FAA,CAAC,ANAC										
652198	50A197	EASA,FAA,CAAC,ANAC	3	28	72-51-04	PW4 DEFLECTOR, HPT COOLING DUCT	Package A	CLN/INSP	CLEANING & INSPECTION		260.00	SR Technics Switzerland
652198	50A710	EASA,FAA,CAAC,ANAC										
652199	50K069	EASA,FAA,CAAC,ANAC	4	28	72-51-10	COMBUSTION CHAMBER GUIDE PLATE	Package A	CLN/INSP	CLEANING & INSPECTION		35.00	SR Technics Switzerland
652199	50K258-01	EASA,FAA,ANAC										
652199	51K210-01	EASA,FAA,CAAC,ANAC										
652512	50J329	EASA,FAA,CAAC,ANAC	11	28	72-41-35	DIFFUSER AND COMBUSTOR - NO. 3 BEARING (OIL) NOZZLE ASSEMBLY	Package A	CLN/INSP	CLEANING AND INSPECTION		350.00	SR Technics Switzerland
652512	50J541	EASA,FAA,CAAC,ANAC										
652512	50J588	EASA,FAA,CAAC,ANAC										
652512	51J321	EASA,FAA,CAAC,ANAC										
654928	1A7891	EASA,FAA,CAAC,ANAC	4	28	72-35-76	PW4 HPC CLEVISSES	Package A	CLN/INSP	CLEANING AND INSPECTION		165.00	SR Technics Switzerland
654928	50H602	EASA,FAA,CAAC,ANAC										
654928	54H933	EASA,FAA,CAAC,ANAC										
655303	50A688	EASA,FAA,CAAC,ANAC	5	28	72-34-38	PW4 CONNECTOR TO MAIN BEARING	Package A	CLN/INSP	CLEANING & INSPECTION		1020.00	SR Technics Switzerland
655303	51G971	EASA,FAA,CAAC,ANAC										
655315	50A028	EASA,FAA,CAAC,ANAC	4	28	72-34-13	PW4 RING, SPACER	Package A	CLN/INSP	CLEANING AND INSPECTION		275.00	SR Technics Switzerland
655315	50A028CL1	EASA,FAA,CAAC,ANAC			72-34-13		Package B	SPM	BLEND NICKS AND SCRATCHES ACC. SPM		145.00	SR Technics Switzerland
655315	50A028CL10	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
655315	50A028CL11	EASA,FAA,CAAC,ANAC										
655315	50A028CL12	EASA,FAA,CAAC,ANAC										
655315	50A028CL13	EASA,FAA,CAAC,ANAC										
655315	50A028CL14	EASA,FAA,CAAC,ANAC										
655315	50A028CL15	EASA,FAA,CAAC,ANAC										
655315	50A028CL16	EASA,FAA,CAAC,ANAC										
655315	50A028CL17	EASA,FAA,CAAC,ANAC										
655315	50A028CL18	EASA,FAA,CAAC,ANAC										
655315	50A028CL19	EASA,FAA,CAAC,ANAC										
655315	50A028CL20	EASA,FAA,CAAC,ANAC										
655315	50A028CL21	EASA,FAA,CAAC,ANAC										
655315	50A028CL22	EASA,FAA,CAAC,ANAC										
655315	50A028CL23	EASA,FAA,CAAC,ANAC										
655315	50A028CL24	EASA,FAA,CAAC,ANAC										
655315	50A028CL25	EASA,FAA,CAAC,ANAC										
655315	50A028CL26	EASA,FAA,CAAC,ANAC										
655315	50A028CL27	EASA,FAA,CAAC,ANAC										
655315	50A028CL28	EASA,FAA,CAAC,ANAC										
655315	50A028CL5	EASA,FAA,CAAC,ANAC										
655315	50A028CL6	EASA,FAA,CAAC,ANAC										
655315	50A028CL7	EASA,FAA,CAAC,ANAC										
655315	50A028CL8	EASA,FAA,CAAC,ANAC										
655315	50A028CL9	EASA,FAA,CAAC,ANAC										
655319	50A290	EASA,FAA,CAAC,ANAC	6	21	72-34-43	SCAVENGE TUBE ASSY OF MAIN BEARING	Package A	CLN/INSP	CLEANING AND INSPECTION		1170.00	SR Technics Switzerland
655319	51A363-01	EASA,FAA,CAAC,ANAC										
655320	51G085	EASA,FAA,CAAC,ANAC	9	21	72-34-31	OIL PRESSURE TUBE OF GEARBOX	Package A	CLN/INSP	CLEANING AND INSPECTION		595.00	SR Technics Switzerland
655320	51G449	EASA,FAA,CAAC,ANAC										
655333	50S025-01	EASA,FAA,CAAC,ANAC	4	28	72-35-81	PW4 RETAINER AND COVER, HEAT SHIELD HPC	Package A	CLN/INSP	CLEANING AND INSPECTION		360.00	SR Technics Switzerland
655333	50S026-01	EASA,FAA,CAAC,ANAC										
655333	58H403	EASA,FAA,CAAC,ANAC										
655333	58H425	EASA,FAA,CAAC,ANAC										
655333	58H426	EASA,FAA,CAAC,ANAC										
655333	58H567	EASA,FAA,CAAC,ANAC										
655630	50D320	EASA,FAA,CAAC,ANAC	6	28	72-33-14	PW4 STG 2.5 VLV CAM FOLLOWER	Package A	CLN/INSP	CLEANING AND INSPECTION		130.00	SR Technics Switzerland
655630	51D805	EASA,FAA,CAAC,ANAC										
655630	52D344	EASA,FAA,CAAC,ANAC										
655630	53D157	EASA,FAA,CAAC,ANAC										
656721	14616-15	EASA,FAA,CAAC,ANAC	3	21	36-11-01	STARTER DUCT ASSEMBLY FOR BOEING	Package A	CLN/INSP	CLEANING & INSPECTION		485.00	SR Technics Switzerland
656721	5332N303-15	EASA,FAA,CAAC,ANAC										
663222	55A221-003	EASA,FAA,CAAC,ANAC	11	28	72-31-82	LOW PRESSURE COMPRESSOR (LPC) - STAGE 1 LPC BLADE SINGLE	Package A	CLN/INSP	CLEANING AND INSPECTION	PN57A721-001 FOR SHOP VISIT ONLY	165.00	SR Technics Switzerland
663222	55A221-004	EASA,FAA,CAAC,ANAC			72-31-82		Package B	INSP/CHK-05	MOMENT WEIGH BLADE ASSEMBLY		110.00	SR Technics Switzerland
663222	57A721-001	EASA,FAA,CAAC,ANAC			72-31-82		Package S800	PW4G-100-199	LUBRICATION OF THE 1ST STAGE LPC BLADE ASSEMBLY (FAN BLADE) ROOT		110.00	SR Technics Switzerland
663222	57A821-001	EASA,FAA,CAAC,ANAC										
663222	58A121	EASA,FAA,CAAC,ANAC										
663441	30377-300	EASA,FAA,ANAC	12	28	72-00-00	ENGINE GENERAL - COMMON PARTS - MISCELLANEOUS CLAMPS GENE	Package A	CLN/INSP	CLEANING AND INSPECTION		205.00	SR Technics Switzerland
663441	30377-500	EASA,FAA,ANAC			72-00-00		Package B		REPLACE DEFECT INSERTS		155.00	SR Technics Switzerland
663441	30377-600	EASA,FAA,ANAC			72-00-00		Package C		REPLACE DEFECT NUTPLATES		155.00	SR Technics Switzerland
663441	30398-200	EASA,FAA,ANAC										
663441	30398-400	EASA,FAA,ANAC										
663441	30550-400	EASA,FAA,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
663441	30659-200	EASA,FAA,ANAC										
663441	30659-400	EASA,FAA,ANAC										
663441	30679-450	EASA,FAA,ANAC										
663441	30679-500	EASA,FAA,ANAC										
663441	30679-600	EASA,FAA,ANAC										
663441	30759-200	EASA,FAA,ANAC										
663441	30766-400	EASA,FAA,ANAC										
663441	31046-150	EASA,FAA,ANAC										
663441	31073-150	EASA,FAA,ANAC										
663441	34H40-600	EASA,FAA,ANAC										
663441	50U366	EASA,FAA,ANAC										
663441	50U367	EASA,FAA,ANAC										
663441	50U368	EASA,FAA,ANAC										
663441	50U370	EASA,FAA,ANAC										
663441	50U372	EASA,FAA,ANAC										
663441	50U373	EASA,FAA,ANAC										
663441	50U374	EASA,FAA,ANAC										
663441	51U749	EASA,FAA,ANAC										
663441	51U888	EASA,FAA,ANAC										
663441	56T561	EASA,FAA,ANAC										
663441	57T938	EASA,FAA,CAAC,ANAC										
663441	58T054	EASA,FAA,ANAC										
663441	58T886	EASA,FAA,ANAC										
663441	59T331	EASA,FAA,ANAC										
663441	728879-2	EASA,FAA,ANAC										
663961	50H236	EASA,FAA,CAAC,ANAC	4	28	7X-XX-XX	PW4000 INSPECTION OF VARIOUS PARTS ACC.	Package A	CLN/INSP	CLEANING & INSPECTION		115.00	SR Technics Switzerland
663961	50J284	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package B		REPLACE DEFECTIVE RIVETS / PARTS		55.00	SR Technics Switzerland
663961	50U654	EASA,FAA,CAAC,ANAC										
663961	51G642-01	EASA,FAA,CAAC,ANAC										
663961	52U020	EASA,FAA,CAAC,ANAC										
663961	52U023-01	EASA,FAA,CAAC,ANAC										
663961	52U024-01	EASA,FAA,CAAC,ANAC										
663961	52U026-01	EASA,FAA,CAAC,ANAC										
663961	54T798-01	EASA,FAA,CAAC,ANAC										
663961	56T816-01	EASA,FAA,CAAC,ANAC										
663961	672732	EASA,FAA,CAAC,ANAC										
664060	50R175	EASA,FAA,CAAC,ANAC	2	28	72-61-66	PW4 PACKING TRANSFER TUBES	Package A	CLN/INSP	CLEANING & INSPECTION		205.00	SR Technics Switzerland
664060	50R176	EASA,FAA,CAAC,ANAC										
664060	70R116	EASA,FAA,CAAC,ANAC										
664060	70R118	EASA,FAA,CAAC,ANAC										
664060	70R657	EASA,FAA,CAAC,ANAC										
664060	70R945-01	EASA,FAA,CAAC,ANAC										
664060	70T028	EASA,FAA,CAAC,ANAC										
664337	50A294	EASA,FAA,CAAC,ANAC	4	28	7X-XX-XX	PW4000 INSPECTION OF VARIOUS PARTS ACC.	Package A	CLN/INSP	CLEANING & INSPECTION		275.00	SR Technics Switzerland
664337	50A314	EASA,FAA,ANAC			7X-XX-XX		Package B		REPLACE NUTPLATES (SPM)		230.00	SR Technics Switzerland
664337	50A737	EASA,FAA,ANAC										
664337	50D144	EASA,FAA,CAAC,ANAC										
664337	50D294	EASA,FAA,CAAC,ANAC										
664337	50D304	EASA,FAA,CAAC,ANAC										
664337	50D307	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
664337	50D314	EASA,FAA,CAAC,ANAC										
664337	50D626-01	EASA,FAA,CAAC,ANAC										
664337	50D779	EASA,FAA,CAAC,ANAC										
664337	50D797	EASA,FAA,CAAC,ANAC										
664337	50D838-01	EASA,FAA,CAAC,ANAC										
664337	50D849	EASA,FAA,CAAC,ANAC										
664337	50D872-01	EASA,FAA,CAAC,ANAC										
664337	50D893	EASA,FAA,CAAC,ANAC										
664337	50D928-01	EASA,FAA,CAAC,ANAC										
664337	50D958-01	EASA,FAA,CAAC,ANAC										
664337	50G104	EASA,FAA,CAAC,ANAC										
664337	50G653	EASA,FAA,CAAC,ANAC										
664337	50G858CL10	EASA,FAA,CAAC,ANAC										
664337	50G858CL6	EASA,FAA,CAAC,ANAC										
664337	50G859	EASA,FAA,CAAC,ANAC										
664337	50G895	EASA,FAA,CAAC,ANAC										
664337	50G896	EASA,FAA,CAAC,ANAC										
664337	50G923	EASA,FAA,CAAC,ANAC										
664337	50G937	EASA,FAA,CAAC,ANAC										
664337	50G960-01	EASA,FAA,CAAC,ANAC										
664337	50U042-01	EASA,FAA,CAAC,ANAC										
664337	50U732-01	EASA,FAA,CAAC,ANAC										
664337	50U763-01	EASA,FAA,CAAC,ANAC										
664337	51D967-01	EASA,FAA,CAAC,ANAC										
664337	51D968-01	EASA,FAA,CAAC,ANAC										
664337	51G093	EASA,FAA,CAAC,ANAC										
664337	51G290-01	EASA,FAA,CAAC,ANAC										
664337	51G325-01	EASA,FAA,CAAC,ANAC										
664337	51G977	EASA,FAA,CAAC,ANAC										
664337	51U687-01	EASA,FAA,CAAC,ANAC										
664337	52D373-01	EASA,FAA,CAAC,ANAC										
664337	52D374-01	EASA,FAA,CAAC,ANAC										
664337	52D572-01	EASA,FAA,CAAC,ANAC										
664337	52D584-01	EASA,FAA,CAAC,ANAC										
664337	52G196	EASA,FAA,CAAC,ANAC										
664337	52G220-01	EASA,FAA,ANAC										
664337	52T796	EASA,FAA,CAAC,ANAC										
664337	52T882-01	EASA,FAA,CAAC,ANAC										
664337	53D254	EASA,FAA,CAAC,ANAC										
664337	53D530	EASA,FAA,CAAC,ANAC										
664337	53D876-01	EASA,FAA,CAAC,ANAC										
664337	53T356-01	EASA,FAA,CAAC,ANAC										
664337	53T518-01	EASA,FAA,CAAC,ANAC										
664337	53T520-01	EASA,FAA,CAAC,ANAC										
664337	53T523	EASA,FAA,CAAC,ANAC										
664337	53T525-01	EASA,FAA,CAAC,ANAC										
664337	53T527-01	EASA,FAA,CAAC,ANAC										
664337	53T528-01	EASA,FAA,CAAC,ANAC										
664337	53T531-01	EASA,FAA,CAAC,ANAC										
664337	53T537-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
664337	537538-01	EASA,FAA;ANAC										
664337	537698-01	EASA,FAA;CAAC;ANAC										
664337	537699-01	EASA,FAA;CAAC;ANAC										
664337	537751-01	EASA,FAA;CAAC;ANAC										
664337	547781-01	EASA,FAA;CAAC;ANAC										
664337	547866-01	EASA,FAA;CAAC;ANAC										
664337	547887-01	EASA,FAA;CAAC;ANAC										
664337	557346	EASA,FAA;CAAC;ANAC										
664337	557837-01	EASA,FAA;CAAC;ANAC										
664337	557838-01	EASA,FAA;CAAC;ANAC										
664337	557840-01	EASA,FAA;CAAC;ANAC										
664337	567663-01	EASA,FAA;CAAC;ANAC										
664337	577318-01	EASA,FAA;CAAC;ANAC										
664337	577320-01	EASA,FAA;CAAC;ANAC;CAA UK										
664337	577473-01	EASA,FAA;CAAC;ANAC										
664337	577889-01	EASA,FAA;CAAC;ANAC										
664337	577950-01	EASA,FAA;CAAC;ANAC										
664337	577975-01	EASA,FAA;CAAC;ANAC										
664337	587258-01	EASA,FAA;CAAC;ANAC										
664337	587516-01	EASA,FAA;CAAC;ANAC										
664337	587517-01	EASA,FAA;CAAC;ANAC										
664337	587520-01	EASA,FAA;CAAC;ANAC										
664337	587521-01	EASA,FAA;CAAC;ANAC										
664337	587612-01	EASA,FAA;CAAC;ANAC										
664337	587674-01	EASA,FAA;CAAC;ANAC										
664337	597046-01	EASA,FAA;CAAC;ANAC										
664337	597111-01	EASA,FAA;CAAC;ANAC										
664337	597459-01	EASA,FAA;CAAC;ANAC										
664337	614995	EASA,FAA;CAAC;ANAC										
664374	221-4134-7	EASA,FAA;CAAC;ANAC	4	21	72-09-73	PW4 VARIOUS BRACKETS GENERAL	Package A	CLN/INSP	Cleaning and inspection		285.00	SR Technics Switzerland
664374	221-4134-8	EASA,FAA;CAAC;ANAC			72-09-73		Package B	SPM	REPLACE INSERTS (SPM)		145.00	SR Technics Switzerland
664374	22807	EASA,FAA;CAAC;ANAC			72-09-73		Package C	SPM	REPLACE NUTPLATES (SPM)		155.00	SR Technics Switzerland
664374	51U760	EASA,FAA;ANAC			72-09-73		Package D	SPM	REPLACE SPRING TENSION CLIP (SPM)		135.00	SR Technics Switzerland
664374	537399	EASA,FAA;CAAC;ANAC										
664374	597080-01	EASA,FAA;CAAC;ANAC										
664520	506958	EASA,FAA;CAAC;ANAC	3	28	7X-XX-XX	PW4 VARIOUS GEARBOX BRACKETS GENERAL SP	Package A	CLN/INSP	CLEANING & INSPECTION		360.00	SR Technics Switzerland
664520	50R384-01	EASA,FAA;CAAC;ANAC			7X-XX-XX		Package B		REPLACE INSERTS (SPM)		135.00	SR Technics Switzerland
664520	50U225-01	EASA,FAA;CAAC;ANAC			7X-XX-XX		Package C		REPLACE NUTPLATES (SPM)		155.00	SR Technics Switzerland
664520	50U643-01	EASA,FAA;CAAC;ANAC			7X-XX-XX		Package D		REPLACE SPRING TENSION CLIP		145.00	SR Technics Switzerland
664520	51R079-01	EASA,FAA;CAAC;ANAC										
664520	51R080	EASA,FAA;CAAC;ANAC										
664520	51U177-01	EASA,FAA;CAAC;ANAC										
664520	51U628-01	EASA,FAA;CAAC;ANAC										
664520	51U631-01	FAA;ANAC										
664520	51U802-01	EASA,FAA;CAAC;ANAC										
664520	52G263	EASA,FAA;CAAC;ANAC										
664520	52T079	EASA,FAA;CAAC;ANAC										
664520	52T456-01	EASA,FAA;CAAC;ANAC										
664520	52T703	EASA,FAA;CAAC;ANAC										
664520	52U653-01	EASA,FAA;CAAC;ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
664520	52U868-01	EASA,FAA,CAAC,ANAC										
664520	53T488-01	EASA,FAA,CAAC,ANAC										
664520	53T612-01	EASA,FAA,CAAC,ANAC										
664520	53T866-01	EASA,FAA,CAAC,ANAC										
664520	53T906-01	EASA,FAA,CAAC,ANAC										
664520	53T907-01	EASA,FAA,CAAC,ANAC										
664520	53T908-01	EASA,FAA,CAAC,ANAC										
664520	53U013-01	EASA,FAA,CAAC,ANAC										
664520	54T152-01	EASA,FAA,CAAC,ANAC										
664520	55T235-01	EASA,FAA,CAAC,ANAC										
664520	55T792-01	EASA,FAA,CAAC,ANAC										
664520	58T237	EASA,FAA,CAAC,ANAC										
664520	58T255-01	EASA,FAA,CAAC,ANAC										
664520	58T555-01	EASA,FAA,CAAC,ANAC										
664520	58T693	EASA,FAA,CAAC,ANAC										
664520	58T902-01	EASA,FAA,CAAC,ANAC										
664520	59T198-01	EASA,FAA,CAAC,ANAC										
664520	59T241-01	EASA,FAA,CAAC,ANAC										
664520	59T482-01	EASA,FAA,CAAC,ANAC										
664520	59T504-01	EASA,FAA,CAAC,ANAC										
664520	59T777-01	EASA,FAA,CAAC,ANAC										
664520	59T779-01	EASA,FAA,CAAC,ANAC										
664520	59T840-01	EASA,FAA,CAAC,ANAC										
664520	59T941	EASA,FAA,CAAC,ANAC										
664520	59T942-01	EASA,FAA,CAAC,ANAC										
664520	59T951-01	EASA,FAA,CAAC,ANAC										
664520	70R153	EASA,FAA,CAAC,ANAC										
664520	70R523	EASA,FAA,CAAC,ANAC										
664520	70R631	EASA,FAA,CAAC,ANAC										
664521	59T209-01	EASA,FAA,CAAC,ANAC	4	28	72-09-73	PW4 VARIOUS GEARBOX BRACKETS GENERAL AT	Package A	CLN/INSP	Cleaning and inspection		360.00	SR Technics Switzerland
664521	59T861-01	EASA,FAA,CAAC,ANAC			72-09-73		Package B	SPM	REPLACE INSERTS (SPM)		135.00	SR Technics Switzerland
664521	59T930-01	EASA,FAA,CAAC,ANAC			72-09-73		Package C	SPM	REPLACE NUTPLATES (SPM)		155.00	SR Technics Switzerland
664521	59T945-01	EASA,FAA,CAAC,ANAC			72-09-73		Package D	SPM	REPLACE SPRING TENSION CLIP (SPM)		145.00	SR Technics Switzerland
664521	59T975-01	EASA,FAA,CAAC,ANAC										
665210	58R000-001	EASA,FAA,CAAC,ANAC	4	28	72-61-00	GEARBOX ASSY MAIN MODULE	Package A	ASSEMBLY	ASSEMBLY AIRBUS		3205.00	SR Technics Switzerland
665210	58R000-002	EASA,FAA,CAAC,ANAC			72-61-00		Package A	ASSEMBLY	ASSEMBLY BOEING		3205.00	SR Technics Switzerland
665210	58R000-003	EASA,FAA,CAAC,ANAC			72-61-00		Package A	ASSEMBLY	ASSEMBLY MD11		3205.00	SR Technics Switzerland
665210	58R000-004	EASA,FAA,CAAC,ANAC										
665210	58R000-005	EASA,FAA,CAAC,ANAC										
665210	58R000-006	EASA,FAA,CAAC,ANAC										
665210	58R000-007	EASA,FAA,CAAC,ANAC										
665210	58R000-008	EASA,FAA,CAAC,ANAC										
665210	58R000-009	EASA,FAA,CAAC,ANAC										
665210	58R000-01	EASA,FAA,CAAC,ANAC										
665210	58R000-010	EASA,FAA,CAAC,ANAC										
665210	58R000-02	EASA,FAA,CAAC,ANAC										
665210	58R000-03	EASA,FAA,CAAC,ANAC										
665210	58R000-04	EASA,FAA,CAAC,ANAC										
665210	58R000-05	EASA,FAA,CAAC,ANAC										
665210	58R000-07	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
665210	58R000-08	EASA,FAA,CAAC,ANAC										
665210	58R000-09	EASA,FAA,CAAC,ANAC										
665210	58R000-205	EASA,FAA,CAAC,ANAC										
665212	50G000-002	EASA,FAA,CAAC,ANAC	4	28	72-62-00	GEARBOX ASSEMBLY-ANGLE	Package A	ASSEMBLY	ASSEMBLY AIRBUS		2325.00	SR Technics Switzerland
665212	51G000	EASA,FAA,CAAC,ANAC			72-62-00		Package A	ASSEMBLY	ASSEMBLY BOEING		2325.00	SR Technics Switzerland
665212	51G000-01	EASA,FAA,CAAC,ANAC			72-62-00		Package A	ASSEMBLY	ASSEMBLY MD11		2325.00	SR Technics Switzerland
665464	4042813	EASA,FAA,CAAC,ANAC	4	21	71-22-10	PW4 ENGINE REAR MOUNT PARTS 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		250.00	SR Technics Switzerland
665464	4042814	EASA,FAA,CAAC,ANAC			71-22-10		Package B	01	ANTIGALLANT RELACEMENT REPAIR		90.00	SR Technics Switzerland
665464	4042815	EASA,FAA,CAAC,ANAC			71-22-10		Package C	02	APPLICATION OF SILVER PLATE ONLY		425.00	SR Technics Switzerland
665464	51U688	EASA,FAA,CAAC,ANAC			71-22-10		Package C	02	SILVER PLATE REPAIR; SILVER PLATE		425.00	SR Technics Switzerland
665464	51U689	EASA,FAA,CAAC,ANAC										
665464	51U692	EASA,FAA,CAAC,ANAC										
665464	51U758	EASA,FAA,CAAC,ANAC										
665464	52U629	EASA,FAA,CAAC,ANAC										
665464	54T736	EASA,FAA,CAAC,ANAC										
665464	55T538	EASA,FAA,CAAC,ANAC										
665464	55T540	EASA,FAA,CAAC,ANAC										
665464	55T541	EASA,FAA,CAAC,ANAC										
665464	55T542	EASA,FAA,CAAC,ANAC										
665464	55T601	EASA,FAA,CAAC,ANAC										
665464	57T145	EASA,FAA,CAAC,ANAC										
665464	57T146	EASA,FAA,CAAC,ANAC										
665464	58T246	EASA,FAA,CAAC,ANAC										
665464	58T247	EASA,FAA,CAAC,ANAC										
665464	59T696	EASA,FAA,CAAC,ANAC										
665464	AS3066-11	EASA,FAA,CAAC,ANAC										
665464	AS3069-11	EASA,FAA,CAAC,ANAC										
665464	ST1614-24	EASA,FAA,CAAC,ANAC										
665464	ST1615-24	EASA,FAA,CAAC,ANAC										
665464	ST1616-24	EASA,FAA,CAAC,ANAC										
665464	ST1617-24	EASA,FAA,CAAC,ANAC										
665511	52G414-01	EASA,FAA,CAAC,ANAC	3	28	72-33-00	PW4000 FAIRING ASSY	Package A	CLN	CLEANING & INSPECTION		125.00	SR Technics Switzerland
665511	52G455-01	EASA,FAA,CAAC,ANAC										
667758	51D378-01	EASA,FAA,CAAC,ANAC	4	28	72-34-01	FAN EXIT CASE BRACKET ASSEMBLY	Package A	CLN/INSP	Cleaning and inspection		315.00	SR Technics Switzerland
667758	51D379-01	EASA,FAA,CAAC,ANAC			72-34-01		Package B	SPM	REPLACE NUT PLATES ACCORDING SPM		425.00	SR Technics Switzerland
667758	51G917-01	EASA,FAA,CAAC,ANAC										
667758	51G918-01	EASA,FAA,CAAC,ANAC										
667758	51G919-01	EASA,FAA,CAAC,ANAC										
667758	51G920-01	EASA,FAA,CAAC,ANAC										
667758	51G921-01	EASA,FAA,CAAC,ANAC										
667758	51G922-01	EASA,FAA,CAAC,ANAC										
667758	51G924-01	EASA,FAA,CAAC,ANAC										
667758	51G925-01	EASA,FAA,CAAC,ANAC										
667758	51G926-01	EASA,FAA,CAAC,ANAC										
667758	51G927-01	EASA,FAA,CAAC,ANAC										
667758	51G928-01	EASA,FAA,CAAC,ANAC										
667758	52G519-01	EASA,FAA,CAAC,ANAC										
667758	52G520-01	EASA,FAA,CAAC,ANAC										
667758	52G522-01	EASA,FAA,CAAC,ANAC										
667758	52G523-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
66758	52G524-01	EASA,FAA,CAAC,ANAC										
66758	52G525-01	EASA,FAA,CAAC,ANAC										
66758	52G531-01	EASA,FAA,CAAC,ANAC										
66758	52G532-01	EASA,FAA,CAAC,ANAC										
66758	52G533-01	EASA,FAA,CAAC,ANAC										
66758	52G534-01	EASA,FAA,CAAC,ANAC										
66758	52G535-01	EASA,FAA,CAAC,ANAC										
66758	52G550-01	EASA,FAA,ANAC										
668484	51T197	EASA,FAA,CAAC,ANAC	3	28	7X-XX-XX	PW4000 INSPECTION OF PARTS IN MODUL INSP	Package A	CLN/INSP	CLEANING & INSPECTION		90.00	SR Technics Switzerland
668484	53T754	EASA,FAA,CAAC,ANAC										
672446	52R100-10	EASA,FAA,CAAC,ANAC	4	28	72-61-00	PW4 100" GEARBOX ASSEMBLY	Package A	CLN/INSP	CLEANING & INSPECTION		340.00	SR Technics Switzerland
672446	52R100-11	EASA,FAA,CAAC,ANAC										
672446	52R100-114	EASA,FAA,CAAC,ANAC										
672446	52R100-116	EASA,FAA,CAAC,ANAC										
672446	52R100-117	EASA,FAA,CAAC,ANAC										
672446	52R100-12	EASA,FAA,CAAC,ANAC										
672446	52R100-13	EASA,FAA,CAAC,ANAC										
672446	52R100-14	EASA,FAA,CAAC,ANAC										
672446	52R100-15	EASA,FAA,CAAC,ANAC										
672446	52R100-16	EASA,FAA,CAAC,ANAC										
672446	52R100-17	EASA,FAA,CAAC,ANAC										
672446	52R100-18	EASA,FAA,CAAC,ANAC										
672446	52R100-20	EASA,FAA,CAAC,ANAC										
672446	52R100-21	EASA,FAA,CAAC,ANAC										
672446	52R100-214	EASA,FAA,CAAC,ANAC										
672446	52R100-216	EASA,FAA,CAAC,ANAC										
672446	52R100-217	EASA,FAA,CAAC,ANAC										
672592	50H033	EASA,FAA,CAAC,ANAC	2	21	72-35-00	PW4000 INSPECTION OF VARIOUS MODULE 35 PARTS	Package A	CLN/INSP	CLEANING & INSPECTION		95.00	SR Technics Switzerland
672592	50H649	EASA,FAA,CAAC,ANAC			72-35-00		Package SB00	PWMENG 72-565	HPC 14/15 STAGE BLADES MODIFICATION		120.00	SR Technics Switzerland
672592	50H653	EASA,FAA,CAAC,ANAC			72-35-00		Package SB01	PW4G-100-72-8	HPC 14/15 STAGE BLADES MODIFICATION		120.00	SR Technics Switzerland
672592	50H654	EASA,FAA,CAAC,ANAC										
672592	50H665	EASA,FAA,CAAC,ANAC										
672592	50H736	EASA,FAA,CAAC,ANAC										
672592	50H738	EASA,FAA,CAAC,ANAC										
672592	50H935	EASA,FAA,CAAC,ANAC										
672592	50S153	EASA,FAA,CAAC,ANAC										
672592	50S158	EASA,FAA,CAAC,ANAC										
672592	50S159	EASA,FAA,CAAC,ANAC										
672592	50S160	EASA,FAA,CAAC,ANAC										
672592	50S733	EASA,FAA,CAAC,ANAC										
672592	52H324	EASA,FAA,CAAC,ANAC										
672592	52H325	EASA,FAA,CAAC,ANAC										
672592	52H326	EASA,FAA,CAAC,ANAC										
672592	52H327	EASA,FAA,CAAC,ANAC										
672592	52H328	EASA,FAA,CAAC,ANAC										
672592	52H329	EASA,FAA,CAAC,ANAC										
672592	52H330	EASA,FAA,CAAC,ANAC										
672592	53H047	EASA,FAA,CAAC,ANAC										
672592	53H048	EASA,FAA,CAAC,ANAC										
672592	53H052	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672592	54H054	EASA,FAA,CAAC,ANAC										
672592	54H323	EASA,FAA,CAAC,ANAC										
672592	54H324	EASA,FAA,CAAC,ANAC										
672592	54H325	EASA,FAA,CAAC,ANAC										
672592	54H326	EASA,FAA,CAAC,ANAC										
672592	54H327	EASA,FAA,CAAC,ANAC										
672592	54H328	EASA,FAA,CAAC,ANAC										
672592	54H329	EASA,FAA,CAAC,ANAC										
672592	54H334	EASA,FAA,CAAC,ANAC										
672592	54H335	EASA,FAA,CAAC,ANAC										
672592	54H335-001	EASA,FAA,CAAC,ANAC										
672592	55H587	EASA,FAA,CAAC,ANAC										
672592	55H588	EASA,FAA,CAAC,ANAC										
672592	56H304	EASA,FAA,CAAC,ANAC										
672592	56H308	EASA,FAA,CAAC,ANAC										
672592	56H316	EASA,FAA,CAAC,ANAC										
672592	56H317	EASA,FAA,CAAC,ANAC										
672592	56H318	EASA,FAA,CAAC,ANAC										
672592	56H319	EASA,FAA,CAAC,ANAC										
672592	56H324	EASA,FAA,CAAC,ANAC										
672592	56H325	EASA,FAA,CAAC,ANAC										
672592	56H326	EASA,FAA,CAAC,ANAC										
672810	50A457	EASA,FAA,CAAC,ANAC	4	Z1	72-09-71	PW4000 TUBES	Package A	CLN/INSP	CLEANING & INSPECTION		210.00	SR Technics Switzerland
672810	50A778-01	EASA,FAA,CAAC,ANAC			72-09-71		Package A	INSP-05	PRESSURE TEST		210.00	SR Technics Switzerland
672810	50A779-01	EASA,FAA,CAAC,ANAC			72-09-71		Package B	001	APPLY ANTI-SIZE COMPOUND		80.00	SR Technics Switzerland
672810	50T300	EASA,FAA,CAAC,ANAC			72-09-71		Package C	002	TUBE NUT THRUST WIRE INSTALLATION		285.00	SR Technics Switzerland
672810	50T306	EASA,FAA,CAAC,ANAC			72-09-71		Package D		REPAIR INNER CONICAL SEAT	SPM 70-00-00 / REP-22	350.00	SR Technics Switzerland
672810	50T360	EASA,FAA,CAAC,ANAC			72-09-71		Package D		REPAIR OUTER CONICAL SEAT	SPM 70-00-00 / REP-22	350.00	SR Technics Switzerland
672810	51A294-01	EASA,FAA,CAAC,ANAC			72-09-71		Package F		REPLACE RIVETED STOP NUT	SPM 70-43-00	235.00	SR Technics Switzerland
672810	51G817-01	EASA,FAA,CAAC,ANAC			72-09-71		Package H	048	OIL TUBE, COATING REPAIR		685.00	SR Technics Switzerland
672810	51G860-01	EASA,FAA,CAAC,ANAC										
672810	52A214-01	EASA,FAA,CAAC,ANAC										
672810	52G125-01	EASA,FAA,CAAC,ANAC										
672810	52G237-01	EASA,FAA,CAAC,ANAC										
672810	52G273-01	EASA,FAA,CAAC,ANAC										
672810	52T691-01	EASA,FAA,CAAC,ANAC										
672810	53T105-01	EASA,FAA,CAAC,ANAC										
672810	53T656-01	EASA,FAA,CAAC,ANAC										
672810	53T683-01	EASA,FAA,CAAC,ANAC										
672810	53T988-01	EASA,FAA,CAAC,ANAC										
672810	53T989-01	EASA,FAA,CAAC,ANAC										
672810	54T128-01	EASA,FAA,CAAC,ANAC										
672810	55T260-01	EASA,FAA,CAAC,ANAC										
672810	55T435-01	EASA,FAA,CAAC,ANAC										
672810	56T242-01	EASA,FAA,CAAC,ANAC										
672810	56T925-01	EASA,FAA,CAAC,ANAC										
672810	58T297-01	EASA,FAA,CAAC,ANAC										
672821	50D311	EASA,FAA,CAAC,ANAC	5	Z1	7X-XX-XX	PW4000 VARIOUS BRACKETS GENERAL	Package A	CLN/INS	CLEANING & INSPECTION		105.00	SR Technics Switzerland
672821	50D775	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package B		REPLACE INSERTS	ACC. SPM	160.00	SR Technics Switzerland
672821	50D776	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package B		REPLACE NUTPLATES	ACC. SPM	160.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672821	50D873-01	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package B		REPLACE SPRING TENSION CLIP	ACC. SPM	160.00	SR Technics Switzerland
672821	50D876-01	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package SB00	PW4G-100-72-60	MODIFICATION OF BRACKET ASSEMBY BY REPLACING OF SPRING TENSION CLIPS		215.00	SR Technics Switzerland
672821	50D894-01	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package SB01	PW4ENG 72-595	SELF-LOCKING NUT PLATES REPLACEMENT	72-00-00	120.00	SR Technics Switzerland
672821	50D919-01	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package SB02	PW4ENG 75-112	INTRODUCTION OF NEW OR REDESIGNED BRACKET ASSEMBLY	75-00-00	175.00	SR Technics Switzerland
672821	50D920-01	EASA,FAA,CAAC,ANAC			7X-XX-XX		Package SB03	PW4ENG 72-306	MODIFICATION OF EEC/SCU ATTACHMENT OF PROGRAMMING PLUG LI 72-33-00		120.00	SR Technics Switzerland
672821	50D921-01	EASA,FAA,CAAC,ANAC										
672821	50D924-01	EASA,FAA,CAAC,ANAC										
672821	50D929-01	EASA,FAA,CAAC,ANAC										
672821	50D936-01	EASA,FAA,CAAC,ANAC										
672821	50D960-01	EASA,FAA,CAAC,ANAC										
672821	50D963-01	EASA,FAA,CAAC,ANAC										
672821	50D972-02	EASA,FAA,CAAC,ANAC										
672821	50D981-01	EASA,FAA,CAAC,ANAC										
672821	50D982-01	EASA,FAA,CAAC,ANAC										
672821	50G148	EASA,FAA,CAAC,ANAC										
672821	50G652	EASA,FAA,CAAC,ANAC										
672821	50G661	EASA,FAA,CAAC,ANAC										
672821	50G910	EASA,FAA,CAAC,ANAC										
672821	50G932	EASA,FAA,CAAC,ANAC										
672821	50U020-01	EASA,FAA,CAAC,ANAC										
672821	50U024-01	EASA,FAA,CAAC,ANAC										
672821	50U041-01	EASA,FAA,CAAC,ANAC,CAA UK										
672821	50U762-01	EASA,FAA,CAAC,ANAC										
672821	51D353-01	EASA,FAA,CAAC,ANAC										
672821	51D381-01	EASA,FAA,CAAC,ANAC										
672821	51D382-01	EASA,FAA,CAAC,ANAC										
672821	51D988-01	EASA,FAA,CAAC,ANAC										
672821	51G146	EASA,FAA,CAAC,ANAC										
672821	51G170	EASA,FAA,CAAC,ANAC										
672821	51G420-01	EASA,FAA,CAAC,ANAC										
672821	51G422-01	EASA,FAA,CAAC,ANAC										
672821	51G423-01	EASA,FAA,CAAC,ANAC										
672821	51G424-01	EASA,FAA,CAAC,ANAC										
672821	51G425-01	EASA,FAA,CAAC,ANAC										
672821	51G426-01	EASA,FAA,CAAC,ANAC										
672821	51G428-01	EASA,FAA,CAAC,ANAC										
672821	51G429-01	EASA,FAA,CAAC,ANAC										
672821	51G430-01	EASA,FAA,CAAC,ANAC										
672821	51G431-01	EASA,FAA,CAAC,ANAC										
672821	51G432-01	EASA,FAA,CAAC,ANAC										
672821	51G433-01	EASA,FAA,CAAC,ANAC										
672821	51G434-01	EASA,FAA,CAAC,ANAC										
672821	51G435-01	EASA,FAA,CAAC,ANAC										
672821	51G436-01	EASA,FAA,CAAC,ANAC										
672821	51G438-01	EASA,FAA,CAAC,ANAC										
672821	51G440-01	EASA,FAA,ANAC										
672821	51G442-01	EASA,FAA,ANAC										
672821	51G446-01	EASA,FAA,CAAC,ANAC										
672821	51G482	EASA,FAA,CAAC,ANAC										
672821	51G484	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672821	51G486-01	EASA,FAA,CAAC,ANAC										
672821	51G641-01	EASA,FAA,CAAC,ANAC										
672821	51G758-01	EASA,FAA,CAAC,ANAC										
672821	51G976-01	EASA,FAA,CAAC,ANAC										
672821	51U195-01	EASA,FAA,CAAC,ANAC										
672821	51U649-01	EASA,FAA,ANAC										
672821	51U932-01	EASA,FAA,ANAC										
672821	52D417-01	EASA,FAA,CAAC,ANAC										
672821	52G062-01	EASA,FAA,CAAC,ANAC										
672821	52G155-01	EASA,FAA,CAAC,ANAC										
672821	52G521-01	EASA,FAA,CAAC,ANAC										
672821	52T657	EASA,FAA,CAAC,ANAC										
672821	53D825-01	EASA,FAA,CAAC,ANAC										
672821	53D877-01	EASA,FAA,CAAC,ANAC										
672821	53G052	EASA,FAA,CAAC,ANAC										
672821	53G055	EASA,FAA,CAAC,ANAC										
672821	53T037-01	EASA,FAA,CAAC,ANAC										
672821	53T530-01	EASA,FAA,CAAC,ANAC										
672821	53T536-01	EASA,FAA,CAAC,ANAC										
672821	53T769-01	EASA,FAA,CAAC,ANAC										
672821	53T888-01	EASA,FAA,CAAC,ANAC										
672821	53T896-01	EASA,FAA,CAAC,ANAC										
672821	53T937-01	EASA,FAA,CAAC,ANAC										
672821	53T938-01	EASA,FAA,CAAC,ANAC										
672821	53T951-01	EASA,FAA,CAAC,ANAC										
672821	53T952-01	EASA,FAA,CAAC,ANAC										
672821	53T953-01	EASA,FAA,CAAC,ANAC										
672821	53T958-01	EASA,FAA,CAAC,ANAC										
672821	54D087-01	EASA,FAA,CAAC,ANAC										
672821	54T001-01	EASA,FAA,CAAC,ANAC										
672821	54T016-01	EASA,FAA,CAAC,ANAC										
672821	54T033-01	EASA,FAA,CAAC,ANAC										
672821	54T045-01	EASA,FAA,CAAC,ANAC										
672821	54T065-01	EASA,FAA,CAAC,ANAC										
672821	54T066-01	EASA,FAA,CAAC,ANAC										
672821	54T255-01	EASA,FAA,CAAC,ANAC										
672821	54T263-01	EASA,FAA,CAAC,ANAC										
672821	54T452-01	EASA,FAA,CAAC,ANAC										
672821	54T625-01	EASA,FAA,CAAC,ANAC										
672821	54T780-01	EASA,FAA,CAAC,ANAC										
672821	56T564-01	EASA,FAA,CAAC,ANAC										
672821	56T628-01	EASA,FAA,CAAC,ANAC										
672821	56T752-01	EASA,FAA,CAAC,ANAC										
672821	56T753-01	EASA,FAA,CAAC,ANAC										
672821	57T012-01	EASA,FAA,CAAC,ANAC										
672821	57T807-01	EASA,FAA,CAAC,ANAC										
672821	58T066-01	EASA,FAA,CAAC,ANAC										
672821	58T067-01	EASA,FAA,CAAC,ANAC										
672821	58T363-01	EASA,FAA,CAAC,ANAC										
672821	58T400-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672821	587401-01	EASA,FAA,CAAC,ANAC										
672821	587402-01	EASA,FAA,CAAC,ANAC										
672821	587403-01	EASA,FAA,CAAC,ANAC										
672821	587404-01	EASA,FAA,CAAC,ANAC										
672821	587406-01	EASA,FAA,ANAC										
672821	587407-01	EASA,FAA,CAAC,ANAC										
672821	587408-01	EASA,FAA,CAAC,ANAC										
672821	587409-01	EASA,FAA,CAAC,ANAC										
672821	587410-01	EASA,FAA,CAAC,ANAC										
672821	587411-01	EASA,FAA,CAAC,ANAC										
672821	587412-01	EASA,FAA,CAAC,ANAC										
672821	587414-01	EASA,FAA,CAAC,ANAC										
672821	587415-01	EASA,FAA,CAAC,ANAC										
672821	587416-01	EASA,FAA,CAAC,ANAC										
672821	587417-01	EASA,FAA,CAAC,ANAC										
672821	587418-01	EASA,FAA,CAAC,ANAC										
672821	587419-01	EASA,FAA,CAAC,ANAC										
672821	587515-01	EASA,FAA,CAAC,ANAC										
672821	587518-01	EASA,FAA,CAAC,ANAC										
672821	587519-01	EASA,FAA,CAAC,ANAC										
672821	587606-01	EASA,FAA,CAAC,ANAC										
672821	587607-01	EASA,FAA,CAAC,ANAC										
672821	587628-01	EASA,FAA,CAAC,ANAC										
672821	587673-01	EASA,FAA,CAAC,ANAC										
672821	587750-01	EASA,FAA,CAAC,ANAC										
672821	587753-01	EASA,FAA,CAAC,ANAC										
672821	597045-01	EASA,FAA,CAAC,ANAC										
672821	597201-01	EASA,FAA,CAAC,ANAC										
672821	597460-01	EASA,FAA,CAAC,ANAC										
672821	597782-01	EASA,FAA,CAAC,ANAC										
672821	597890-01	EASA,FAA,CAAC,ANAC										
672825	33274921-213	EASA,FAA,CAAC,ANAC	3	21		PW4000 VARIOUS BRACKETS GENERAL	Package A	CLN/INSP	CLEANING & INSPECTION		105.00	SR Technics Switzerland
672825	50P102	EASA,FAA,CAAC,ANAC					Package B		REPLACE INSERTS	ACC. SPM	160.00	SR Technics Switzerland
672825	50P103	EASA,FAA,CAAC,ANAC					Package B		REPLACE NUTPLATES	ACC. SPM	160.00	SR Technics Switzerland
672825	50P213-01	EASA,FAA,CAAC,ANAC					Package B		REPLACE SPRING TENSION CLIP	ACC. SPM	160.00	SR Technics Switzerland
672825	50P215-01	EASA,FAA,CAAC,ANAC					Package SB00	PW4G-100-72-60	MODIFICATION OF BRACKET ASSEMBY BY REPLACING OF SPRING TENSION CLIPS		215.00	SR Technics Switzerland
672825	50P217-01	EASA,FAA,CAAC,ANAC					Package SB01	PW4ENG 72-595	SELF-LOCKING NUT PLATES REPLACEMENT	72-00-00	120.00	SR Technics Switzerland
672825	50P223-01	EASA,FAA,CAAC,ANAC					Package SB02	PW4ENG 72-609	MODIFICATION OF TO INCREASE CLEARANCE WITH THE PT4.95 SENSE TUBE		240.00	SR Technics Switzerland
672825	50P458-01	EASA,FAA,CAAC,ANAC										
672825	50P459-01	EASA,FAA,CAAC,ANAC										
672825	50U011-01	EASA,FAA,CAAC,ANAC										
672825	50U050-01	EASA,FAA,CAAC,ANAC										
672825	50U052-01	EASA,FAA,CAAC,ANAC										
672825	50U148-01	EASA,FAA,CAAC,ANAC										
672825	50U167-01	EASA,FAA,CAAC,ANAC										
672825	50U224-01	EASA,FAA,CAAC,ANAC										
672825	50U376-01	EASA,FAA,CAAC,ANAC										
672825	50U405-01	EASA,FAA,CAAC,ANAC										
672825	50U421	EASA,FAA,CAAC,ANAC										
672825	50U596	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672825	50U726-01	EASA,FAA,CAAC,ANAC										
672825	50U758-01	EASA,FAA,CAAC,ANAC										
672825	50U767-01	EASA,FAA,CAAC,ANAC										
672825	50U774-01	EASA,FAA,CAAC,ANAC										
672825	51H441	EASA,FAA,CAAC,ANAC										
672825	51H447	EASA,FAA,CAAC,ANAC										
672825	51H527-01	EASA,FAA,CAAC,ANAC										
672825	51H623	EASA,FAA,ANAC										
672825	51R067-01	EASA,FAA,CAAC,ANAC										
672825	51R087-01	EASA,FAA,CAAC,ANAC										
672825	51U085-01	EASA,FAA,CAAC,ANAC										
672825	51U086-01	EASA,FAA,CAAC,ANAC										
672825	51U491-01	EASA,FAA,CAAC,ANAC										
672825	51U627-01	EASA,FAA,CAAC,ANAC										
672825	51U632-01	EASA,FAA,CAAC,ANAC										
672825	51U634-01	EASA,FAA,CAAC,ANAC										
672825	51U635-01	EASA,FAA,CAAC,ANAC										
672825	51U701-01	EASA,FAA,CAAC,ANAC										
672825	51U800-01	EASA,FAA,CAAC,ANAC										
672825	51U801-01	EASA,FAA,CAAC,ANAC										
672825	51U854-01	EASA,FAA,CAAC,ANAC										
672825	51U949-01	EASA,FAA,ANAC										
672825	51U953-01	EASA,FAA,CAAC,ANAC										
672825	52T134	EASA,FAA,CAAC,ANAC										
672825	52T663	EASA,FAA,CAAC,ANAC										
672825	52T876-01	EASA,FAA,CAAC,ANAC										
672825	52U572-01	EASA,FAA,CAAC,ANAC										
672825	52U659	EASA,FAA,ANAC,TCCA										
672825	52U661-01	EASA,FAA,CAAC,ANAC										
672825	52U663-01	EASA,FAA,CAAC,ANAC										
672825	52U665-01	EASA,FAA,CAAC,ANAC										
672825	53T068-01	EASA,FAA,CAAC,ANAC										
672825	53T397	EASA,FAA,CAAC,ANAC										
672825	53T505-01	EASA,FAA,CAAC,ANAC										
672825	53T539-01	EASA,FAA,CAAC,ANAC										
672825	53T647	EASA,FAA,CAAC,ANAC										
672825	54H220-01	EASA,FAA,CAAC,ANAC										
672825	54H681-01	EASA,FAA,CAAC,ANAC										
672825	54H682-01	EASA,FAA,CAAC,ANAC										
672825	54H934-01	EASA,FAA,CAAC,ANAC										
672825	54H972-01	EASA,FAA,CAAC,ANAC										
672825	54T251-01	EASA,FAA,CAAC,ANAC										
672825	54T272-01	EASA,FAA,CAAC,ANAC										
672825	54T273-01	EASA,FAA,CAAC,ANAC										
672825	54T322-01	EASA,FAA,CAAC,ANAC										
672825	54T384-01	EASA,FAA,CAAC,ANAC										
672825	54T450-01	EASA,FAA,CAAC,ANAC										
672825	54T496-01	EASA,FAA,CAAC,ANAC										
672825	54T732-01	EASA,FAA,CAAC,ANAC										
672825	54T993-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672825	54T995-01	EASA,FAA,CAAC,ANAC										
672825	55H417-01	EASA,FAA,CAAC,ANAC										
672825	55T234-01	EASA,FAA,CAAC,ANAC										
672825	55T300-01	EASA,FAA,CAAC,ANAC										
672825	55T337-01	EASA,FAA,CAAC,ANAC										
672825	55T354-01	EASA,FAA,CAAC,ANAC										
672825	55T427-01	EASA,FAA,CAAC,ANAC										
672825	55T553-01	EASA,FAA,CAAC,ANAC										
672825	55T640-01	EASA,FAA,CAAC,ANAC										
672825	55T706-01	EASA,FAA,CAAC,ANAC										
672825	55T772-01	EASA,FAA,CAAC,ANAC										
672825	55T793-01	EASA,FAA,CAAC,ANAC										
672825	56T212-01	EASA,FAA,CAAC,ANAC										
672825	56T219-01	EASA,FAA,CAAC,ANAC										
672825	56T463-01	EASA,FAA,CAAC,ANAC										
672825	56T673-01	EASA,FAA,CAAC,ANAC										
672825	56T774-01	EASA,FAA,CAAC,ANAC										
672825	56T778-01	EASA,FAA,CAAC,ANAC										
672825	56T829-01	EASA,FAA,CAAC,ANAC										
672825	56T830-01	EASA,FAA,CAAC,ANAC										
672825	56T921-01	EASA,FAA,CAAC,ANAC										
672825	56T947-01	EASA,FAA,CAAC,ANAC										
672825	56T952-01	EASA,FAA,CAAC,ANAC										
672825	57T004-01	EASA,FAA,CAAC,ANAC										
672825	57T217-01	EASA,FAA,CAAC,ANAC										
672825	57T218-01	EASA,FAA,CAAC,ANAC										
672825	57T220-01	EASA,FAA,CAAC,ANAC										
672825	57T226-01	EASA,FAA,CAAC,ANAC										
672825	57T311-01	EASA,FAA,CAAC,ANAC										
672825	57T413-01	EASA,FAA,CAAC,ANAC										
672825	57T458-01	EASA,FAA,CAAC,ANAC										
672825	57T487-01	EASA,FAA,CAAC,ANAC										
672825	57T504-01	EASA,FAA,CAAC,ANAC										
672825	57T695-01	EASA,FAA,CAAC,ANAC										
672825	57T706-01	EASA,FAA,CAAC,ANAC										
672825	57T724-01	EASA,FAA,CAAC,ANAC										
672825	57T729-01	EASA,FAA,CAAC,ANAC										
672825	57T732-01	EASA,FAA,CAAC,ANAC										
672825	57T761-01	EASA,FAA,CAAC,ANAC										
672825	57T764-01	EASA,FAA,CAAC,ANAC										
672825	57T770-01	EASA,FAA,CAAC,ANAC										
672825	57T777-01	EASA,FAA,CAAC,ANAC										
672825	57T876-01	EASA,FAA,CAAC,ANAC										
672825	57T980-01	EASA,FAA,CAAC,ANAC										
672825	57T983-01	EASA,FAA,CAAC,ANAC										
672825	58H196	EASA,FAA,CAAC,ANAC										
672825	58H440-01	EASA,FAA,CAAC,ANAC										
672825	58H546-01	EASA,FAA,CAAC,ANAC										
672825	58H547-01	EASA,FAA,ANAC										
672825	58H548-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672825	58H549-01	EASA,FAA,CAAC,ANAC										
672825	58T053-01	EASA,FAA,CAAC,ANAC										
672825	58T090-01	EASA,FAA,CAAC,ANAC										
672825	58T204-01	EASA,FAA,CAAC,ANAC										
672825	58T266-01	EASA,FAA,CAAC,ANAC										
672825	58T310-01	EASA,FAA,CAAC,ANAC										
672825	58T321-01	EASA,FAA,CAAC,ANAC										
672825	58T322-01	EASA,FAA,CAAC,ANAC										
672825	58T332-01	EASA,FAA,CAAC,ANAC										
672825	58T340-01	EASA,FAA,CAAC,ANAC										
672825	58T364-01	EASA,FAA,CAAC,ANAC										
672825	58T365-01	EASA,FAA,CAAC,ANAC										
672825	58T900-01	EASA,FAA,CAAC,ANAC										
672825	58T910-01	EASA,FAA,CAAC,ANAC										
672825	58T922-01	EASA,FAA,CAAC,ANAC										
672825	58T955-01	EASA,FAA,CAAC,ANAC										
672825	58T989-01	EASA,FAA,CAAC,ANAC										
672825	59T012-01	EASA,FAA,CAAC,ANAC										
672825	59T044-01	EASA,FAA,CAAC,ANAC										
672825	59T096-01	EASA,FAA,CAAC,ANAC										
672825	59T151-01	EASA,FAA,CAAC,ANAC										
672825	59T154-01	EASA,FAA,CAAC,ANAC										
672825	59T193-01	EASA,FAA,CAAC,ANAC										
672825	59T204-01	EASA,FAA,CAAC,ANAC										
672825	59T207-01	EASA,FAA,CAAC,ANAC										
672825	59T270-01	EASA,FAA,CAAC,ANAC										
672825	59T432-01	EASA,FAA,CAAC,ANAC										
672825	59T468-01	EASA,FAA,CAAC,ANAC										
672825	59T472-01	EASA,FAA,CAAC,ANAC										
672825	59T486-01	EASA,FAA,CAAC,ANAC										
672825	59T552-01	EASA,FAA,CAAC,ANAC										
672825	59T553-01	EASA,FAA,CAAC,ANAC										
672825	59T579-01	EASA,FAA,CAAC,ANAC										
672825	59T615-01	EASA,FAA,CAAC,ANAC										
672825	59T676-01	EASA,FAA,CAAC,ANAC										
672825	59T723-01	EASA,FAA,CAAC,ANAC										
672825	59T765-01	EASA,FAA,CAAC,ANAC										
672825	59T766-01	EASA,FAA,CAAC,ANAC										
672825	59T797-01	EASA,FAA,CAAC,ANAC										
672825	59T799-01	EASA,FAA,CAAC,ANAC										
672825	59T841-01	EASA,FAA,CAAC,ANAC										
672825	59T855-01	EASA,FAA,CAAC,ANAC										
672825	59T860-01	EASA,FAA,CAAC,ANAC										
672825	59T994	EASA,FAA,CAAC,ANAC										
672825	70R516	EASA,FAA,CAAC,ANAC										
672831	51D768-01	EASA,FAA,CAAC,ANAC	6	21	72-09-73	PW4 ENGINE BRACKET	Package A	CLN/INSP	CLEANING AND INSPECTION		315.00	SR Technics Switzerland
672831	51D772-01	EASA,FAA,CAAC,ANAC			72-09-73		Package O	14	ANTI SLIP STRIP ADHESIVE REPLACEMENT		685.00	SR Technics Switzerland
672831	52D375-01	EASA,FAA,CAAC,ANAC										
672831	52D376-01	EASA,FAA,CAAC,ANAC										
672831	52D377-01	EASA,FAA,CAAC,ANAC										

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672831	52D378-01	EASA,FAA,CAAC,ANAC										
673782	50R403	EASA,FAA,TCCA	3	28	72-35-72	PW4 GEARBOX DRIVESHAFT HOUSING SUPPORT	Package A	CLN/INSP	CLEANING & INSPECTION		225.00	SR Technics Switzerland
673857	70R112	EASA,FAA,CAAC,ANAC	2	28	72-61-63	PW4000 RELIEF VALVE PLUG AND SPRING	Package A	CLN/INSP	CLEANING & INSPECTION		155.00	SR Technics Switzerland
673857	70R115	EASA,FAA,CAAC,ANAC										
672294	33_34_MOD_INSP_100		5	28	72-XX-XX	FAN AND INTERMEDIATE CASE ASSY 100*	Package AA	057	REPLACE INNER FAN EXIT CASE MONTING FLANGE SCREW THREAD INSERTS	72-34-01	715.00	SR Technics Switzerland
672294					72-XX-XX		Package AB	058	REPAIR OR REPLACE BOSS H	72-34-01	6,145.00	SR Technics Switzerland
672294					72-XX-XX		Package AC	059	REPLACE 2.5 BLEED VALVE DUCT FLANGE SCREW THREAD INSERTS	72-34-01	715.00	SR Technics Switzerland
672294					72-XX-XX		Package AC	060	REPLACE NO. 1 BEARING SUPPORT FLANGE SCREW THREAD INSERTS	72-34-01	715.00	SR Technics Switzerland
672294					72-XX-XX		Package AC	061	REPLACE SCREW THREAD INSERTS AT STRUT LOCATION NO. 2 AND 3	72-34-01	715.00	SR Technics Switzerland
672294					72-XX-XX		Package AD	061	BLEND REPAIR SURFACE DAMAGE	72-33-04	630.00	SR Technics Switzerland
672294					72-XX-XX		Package AE	R.ESEE.000913-E	REPAIR FEGV LEADING EDGE	72-00-33	505.00	SR Technics Switzerland
672294					72-XX-XX		Package AF	062	REPAIR PROTECTIVE LAYER	72-34-01	2,665.00	SR Technics Switzerland
672294					72-XX-XX		Package AG	-	REPLACE PROTECTIVE SHIELD ACC. SPM	-	455.00	SR Technics Switzerland
672294					72-XX-XX		Package AG	-	REPLACE RIVETS ACC. SPM	-	455.00	SR Technics Switzerland
672294					72-XX-XX		Package AH	064	REPLACE STRUT SEALANT	72-34-01	2,665.00	SR Technics Switzerland
672294					72-XX-XX		Package AI	065	REPLACE TIMING PIN	72-34-01	1,155.00	SR Technics Switzerland
672294					72-XX-XX		Package AJ	066	REPAIR SEALANT AROUND BAFFLES	72-34-01	865.00	SR Technics Switzerland
672294					72-XX-XX		Package AK	067	BAFFEL REPLACEMENT	72-34-01	1,565.00	SR Technics Switzerland
672294					72-XX-XX		Package AK	068	REPLACE FRONT FAN EXIT CASE BRACKET ASSEMBLIES	72-34-01	1,565.00	SR Technics Switzerland
672294					72-XX-XX		Package AK	070	REPLACE CENTER FAN EXIT CASE BRACKET ASSEMBLIES	72-34-01	1,565.00	SR Technics Switzerland
672294					72-XX-XX		Package AK	071	REPLACE REAR FAN EXIT CASE BRACKET ASSEMBLIES	72-34-01	1,565.00	SR Technics Switzerland
672294					72-XX-XX		Package AK	112	REPLACE FAN EXIT CASE MID-FLANGE BRACKETS	72-34-01	1,565.00	SR Technics Switzerland
672294					72-XX-XX		Package AL	074	REPLACE NUT PLATES INNER LINER SEGMENT CONNECTION	72-34-01	1,380.00	SR Technics Switzerland
672294					72-XX-XX		Package AM	083	FAN EXIT CASE SURFACE DAMAGE BLEND REPAIR	72-34-01	570.00	SR Technics Switzerland
672294					72-XX-XX		Package AN	107	REPLACE HELICAL COIL INSERTS IN BOSSES	72-34-01	925.00	SR Technics Switzerland
672294					72-XX-XX		Package AN	116	HELICAL INSERT REPLACEMENT	72-34-01	350.00	SR Technics Switzerland
672294					72-XX-XX		Package AO	033	REPLACE LPC STATOR NUT PLATES	72-33-04	925.00	SR Technics Switzerland
672294					72-XX-XX		Package AP	031	SCREEN REPLACEMENT	72-33-04	860.00	SR Technics Switzerland
672294					72-XX-XX		Package AQ	-	ADD ENGINE SERIAL NUMBER ACC. SPM	-	160.00	SR Technics Switzerland
672294					72-XX-XX		Package B	001	TOUCH UP ANODIZE	72-33-08	480.00	SR Technics Switzerland
672294					72-XX-XX		Package C	002	AIRFOIL PATCH	72-33-05	380.00	SR Technics Switzerland
672294					72-XX-XX		Package D	003	BEARING PADS SINGLE REPLACEMENT BEFORE INSTALLATION	72-33-08	1,580.00	SR Technics Switzerland
672294					72-XX-XX		Package E	006	INSTALL HELICAL TWININSERTS	72-33-08	510.00	SR Technics Switzerland
672294					72-XX-XX		Package E	006	REPLACE HELICAL INSERTS	72-33-08	510.00	SR Technics Switzerland
672294					72-XX-XX		Package F	009	REPAIR DAMAGED INSULATION BLANKETS	72-33-08	565.00	SR Technics Switzerland
672294					72-XX-XX		Package G	013	REPLACE LINER REPAIR	72-33-08	1,230.00	SR Technics Switzerland
672294					72-XX-XX		Package H	014	TOUCH UP ANODIZE REPAIR	72-33-04	330.00	SR Technics Switzerland
672294					72-XX-XX		Package I	014	(ALUMINIUM LINER) FAN CASE LINER	72-33-01	1,845.00	SR Technics Switzerland
672294					72-XX-XX		Package J	014	(WIRE MESH LINER) FAN CASE LINER	72-33-01	1,650.00	SR Technics Switzerland
672294					72-XX-XX		Package K	015	REPAIR FOR WEAR AND HOLES IN RUBSTRIP	72-33-01	3,055.00	SR Technics Switzerland
672294					72-XX-XX		Package L	019	BLEND SURFACE DAMAGE	72-33-01	635.00	SR Technics Switzerland
672294					72-XX-XX		Package M	020	BLEND SURFACE DAMAGE	72-34-01	1,240.00	SR Technics Switzerland
672294					72-XX-XX		Package N	023	ACUSTIC LINER BLEND REPAIR	72-33-01	2,645.00	SR Technics Switzerland
672294					72-XX-XX		Package N	023	LINER PROTECTIVE COATING REPLACEMENT	72-33-01	2,645.00	SR Technics Switzerland
672294					72-XX-XX		Package N	023	REPLACE FOURTH STATOR MOUNTING FLANGE HELICAL COIL INSERTS	72-34-01	2,645.00	SR Technics Switzerland
672294					72-XX-XX		Package O	024	REPLACE HELICAL COIL INSERTS AT 2, 4 AND 8 O'CLOCK POSITION	72-34-01	945.00	SR Technics Switzerland
672294					72-XX-XX		Package P	030	REPLACE PIN RIVET AND COLLAR	72-33-04	1,120.00	SR Technics Switzerland
672294					72-XX-XX		Package Q	034	FAIRING REPLACEMENT	72-34-01	8,155.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Ite m	TA T	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672294					72-XX-XX		Package R	034	REPLACE LPC SPLITTER FAIRING NUT	72-33-04	330.00	SR Technics Switzerland
672294					72-XX-XX		Package S	34-1	LINER JOINT DISBOND REPAIR	72-33-01	1,465.00	SR Technics Switzerland
672294					72-XX-XX		Package S	34-2	LINER-INSERT DISBOND REPAIR	72-33-01	1,465.00	SR Technics Switzerland
672294					72-XX-XX		Package S	34-3	LINER-JOINT FILLER REPAIR	72-33-01	1,465.00	SR Technics Switzerland
672294					72-XX-XX		Package T	035	REPLACE FRONT ANGLE GANG	72-33-04	540.00	SR Technics Switzerland
672294					72-XX-XX		Package U	041	APPLY ANODIZE TOUCH-UP SOLUTION	72-34-01	715.00	SR Technics Switzerland
672294					72-XX-XX		Package U	063	APPLY ANODIZE TOUCH-UP SOLUTION	72-34-01	715.00	SR Technics Switzerland
672294					72-XX-XX		Package V	042	REPAIR OF DAMAGED FOIL ON THE FIRE ABLATIVE BLANKETS	72-33-04	2,195.00	SR Technics Switzerland
672294					72-XX-XX		Package W	044	BLEND SURFACE DAMAGE ON THE FAN EXIT CASE FLANGE ASSEMBLY	72-34-01	1,370.00	SR Technics Switzerland
672294					72-XX-XX		Package X	047	REPLACE FIRE SHIELD SEGMENT	72-33-04	780.00	SR Technics Switzerland
672294					72-XX-XX		Package Y	055	SEALANT REPAIR	72-34-01	4,250.00	SR Technics Switzerland
672294					72-XX-XX		Package Z	056	HELICAL E-FLANGE SCREW THREAD INSERTS	72-34-01	715.00	SR Technics Switzerland
138178	PW4000 MOD-41-1		3	28	72-41-XX	PW4 OUTER COMBUSTION CASE (PARTS) 94"	Package A	CLN/INSP	CLEANING & INSPECTION		1,040.00	SR Technics Switzerland
661210	PW4000 MOD-41/2		3	28	72-41-XX	PW4 OUTER COMBUSTION CASE (PARTS) 100" - MOD-41/2	Package A	CLN/INSP	CLEANING & INSPECTION		1,040.00	SR Technics Switzerland
672466					72-XX-XX	LOW PRESSURE TURBINE (LPT)	Package AN	039	TOUCH-UP P/N 52A402-101 AND 52A577-01	72-53-80	2,390.00	SR Technics Switzerland
672466					72-XX-XX		Package B	001	FEATHERSEAL REPLACEMENT	72-00-53	2,190.00	SR Technics Switzerland
672466					72-XX-XX		Package C	002	FEATHERSEAL REPLACEMENT	72-00-53	2,190.00	SR Technics Switzerland
672466					72-XX-XX		Package D	003	3STG LEADING EDGE BLEND REPAIR	72-00-53	1,730.00	SR Technics Switzerland
672466					72-XX-XX		Package P	015	LOCAL TOUCH-UP COATING	72-53-80	2,330.00	SR Technics Switzerland
672311	33_34_MOD_INSP_94		6	21	72-XX-XX	FAN AND INTERMEDIATE CASE ASSY 94"	Package AA	015	INSTALL INSERTS IN ANGLE GEARBOX MOUNT PAD	72-34-01	910.00	SR Technics Switzerland
672311					72-XX-XX		Package AB	016	REPLACE NO.1 BRG. SUPPORT FLANGE HELICAL COIL INSERTS	72-34-01	2,450.00	SR Technics Switzerland
672311					72-XX-XX		Package AC	017	REPLACE REAR INNER FLANGE ANGE HELICAL COIL INSERTS	72-34-01	2,645.00	SR Technics Switzerland
672311					72-XX-XX		Package AD	018	REPLACE INNER FAN EXIT CASE MOUNTING FLANGE HELICAL COIL INSERTS	72-34-01	920.00	SR Technics Switzerland
672311					72-XX-XX		Package AE	019	REPAIR THREADED BOSS HOLES	72-34-01	910.00	SR Technics Switzerland
672311					72-XX-XX		Package AF	020	BLEND THE SURFACE DAMAGE	72-34-01	1,240.00	SR Technics Switzerland
672311					72-XX-XX		Package AG	021	REPLACE NUT PLATE ON FRONT FAN EXIT CASE BRACKET ASSEMBLY B	72-34-01	510.00	SR Technics Switzerland
672311					72-XX-XX		Package AH	022	REPLACE A FAIRING WITH NO RIVETS	72-34-01	1,245.00	SR Technics Switzerland
672311					72-XX-XX		Package AI	023	REPLACE 4TH STATOR MOUNTING FLANGE HELICAL COIL INSERTS	72-34-01	2,645.00	SR Technics Switzerland
672311					72-XX-XX		Package AJ	024	REPLACE HELICAL COIL NSERTS AT 2,4, AND 8 O'CLOCK POSITIONS	72-34-01	945.00	SR Technics Switzerland
672311					72-XX-XX		Package AK	026	REPLACE THE FRONT FAN EXIT CASE BRACKET ASSEMBLIES	72-34-01	445.00	SR Technics Switzerland
672311					72-XX-XX		Package AL	042	REPAIR DAMAGED FOIL ON FIRE ABLATIVE BLANKETS	72-33-04	2,195.00	SR Technics Switzerland
672311					72-XX-XX		Package AM	045	REPLACE LINER	72-33-04	910.00	SR Technics Switzerland
672311					72-XX-XX		Package AN	063	BLEED VALVE SCREEN INNER SURFACE BLEND REPAIR	72-33-04	505.00	SR Technics Switzerland
672311					72-XX-XX		Package AO	027	REPLACE THE REAR FAN EXIT CASE BRACKET ASSEMBLIES	72-34-01	855.00	SR Technics Switzerland
672311					72-XX-XX		Package AQ	029	REPLACE THE TRUST MOUNT BUSHINGS	72-34-01	2,345.00	SR Technics Switzerland
672311					72-XX-XX		Package AR	034	REPLACE A FAIRING WITH RIVETS	72-34-01	4,805.00	SR Technics Switzerland
672311					72-XX-XX		Package AS	035	REPAIR THE THREADED HOLES IN THE GROUND HANDLING PAD	72-34-01	1,795.00	SR Technics Switzerland
672311					72-XX-XX		Package AT	036	SEALANT REPAIR	72-34-01	2,645.00	SR Technics Switzerland
672311					72-XX-XX		Package AU	037	REPLACE THE BAFFLES	72-34-01	1,795.00	SR Technics Switzerland
672311					72-XX-XX		Package AV	039	REPLACE THE TIMING PIN	72-34-01	580.00	SR Technics Switzerland
672311					72-XX-XX		Package AW	041	APPLY ANODIZE TOUCH-UP SOLUTION	72-34-01	715.00	SR Technics Switzerland
672311					72-XX-XX		Package AX	044	BLEND SURFACE DAMAGE ON THE FAN EXIT CASE FLANGE ASSEMBLY	72-34-01	1,370.00	SR Technics Switzerland
672311					72-XX-XX		Package AY	045	REPLACE THE PROTECTIVE LAYER	72-34-01	2,450.00	SR Technics Switzerland
672311					72-XX-XX		Package AZ	03	REPLACE OR BOND A STRUT SEAL	72-00-34	2,450.00	SR Technics Switzerland
672311					72-XX-XX		Package B	001	REPLACE LPC STATOR NUT PLATES	72-33-04	350.00	SR Technics Switzerland
672311					72-XX-XX		Package BA	049	SURFACE DAMAGE BLEND REPAIR	72-34-01	1,610.00	SR Technics Switzerland
672311					72-XX-XX		Package BB	070	REPLACE THE CENTER FAN EXIT CASE BRACKET ASSEMBLIES	72-34-01	1,565.00	SR Technics Switzerland
672311					72-XX-XX		Package BC	074	REPLACE NUT PLATES	72-34-01	1,380.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
672311					72-XX-XX		Package BD	100	STOP DRILL FAN EXIT FAIRING	72-34-01	305.00	SR Technics Switzerland
672311					72-XX-XX		Package BE	101	FAN EXIT FAIRING COVER REPLACEMENT	72-34-01	1,050.00	SR Technics Switzerland
672311					72-XX-XX		Package BF	105	BLEND REPAIR FAIRING ASSEMBLY	72-34-01	1,095.00	SR Technics Switzerland
672311					72-XX-XX		Package BG	107	REPLACE HELICAL COIL INSERTS IN BOSSES	72-34-01	925.00	SR Technics Switzerland
672311					72-XX-XX		Package BH	109	REPLACE FRONT FAN EXIT BRACKETS	72-34-01	1,000.00	SR Technics Switzerland
672311					72-XX-XX		Package BI	110	REPLACE THE CENTER BRACKET ASSEMBLIES	72-34-01	1,795.00	SR Technics Switzerland
672311					72-XX-XX		Package BJ	122	REAR BRACKET REPLACEMENT REPAIR	72-34-01	1,795.00	SR Technics Switzerland
672311					72-XX-XX		Package BK	123	BLEND THRUST CLEVIS BRACKET	72-34-01	845.00	SR Technics Switzerland
672311					72-XX-XX		Package BL	R.ESEE.000913-E	REPAIR FEGV LEADING EDGE	72-00-33	505.00	SR Technics Switzerland
672311					72-XX-XX		Package BM	-	REPLACE MOD-34 INSERT 12 O'CLOCK ACC. SPM	-	160.00	SR Technics Switzerland
672311					72-XX-XX		Package BN	-	REPLACE NUT PLATES ACCORDING SPM	-	160.00	SR Technics Switzerland
672311					72-XX-XX		Package BO	-	ADD ENGINE SERIAL NUMBER ACC. SPM	-	160.00	SR Technics Switzerland
672311					72-XX-XX		Package BP	014	CORROSION REMOVAL FAN EXIT CASE	72-33-03	3,595.00	SR Technics Switzerland
672311					72-XX-XX		Package C	002	REPLACE LPC FAIRING NUT	72-33-04	330.00	SR Technics Switzerland
672311					72-XX-XX		Package D	003	REPLACE BLEED VALVE DUCT BRACKET	72-33-04	3,160.00	SR Technics Switzerland
672311					72-XX-XX		Package E	004	REPLACE DUCT BRACKET NUT	72-33-04	1,085.00	SR Technics Switzerland
672311					72-XX-XX		Package F	005	REPLACE DUCT BRACKET	72-33-04	3,160.00	SR Technics Switzerland
672311					72-XX-XX		Package G	006	REPLACE BLEED VALVE DUCT BRACKET	72-33-04	855.00	SR Technics Switzerland
672311					72-XX-XX		Package H	007	REPLACE DUCT BRACKET	72-33-04	3,160.00	SR Technics Switzerland
672311					72-XX-XX		Package I	008	REPLACE VALVE DUCT HELICOIL INSERTS	72-33-04	350.00	SR Technics Switzerland
672311					72-XX-XX		Package J	009	REPLACE EXIT CASE GANG NUT	72-33-04	685.00	SR Technics Switzerland
672311					72-XX-XX		Package K	010	REPLACE EXIT CASE NUT PLATES	72-33-04	685.00	SR Technics Switzerland
672311					72-XX-XX		Package L	011	REPLACE EXIT INNER CASE BRACKET ASSEMBLY	72-33-04	1,525.00	SR Technics Switzerland
672311					72-XX-XX		Package M	012	REPLACE BRACKET NUT PLATE	72-33-04	1,525.00	SR Technics Switzerland
672311					72-XX-XX		Package N	013	REPLACE INNER CASE RIVET	72-33-04	170.00	SR Technics Switzerland
672311					72-XX-XX		Package O	014	TOUCH UP ANODIZE FAN EXIT	72-33-04	330.00	SR Technics Switzerland
672311					72-XX-XX		Package P	002	AIRFOIL PATCH	72-33-05	380.00	SR Technics Switzerland
672311					72-XX-XX		Package Q	016	REPLACE RUBBER SEAL	72-33-04	1,005.00	SR Technics Switzerland
672311					72-XX-XX		Package R	001	REPLACE FAN CASE ASSEMBLY LOCATING PIN	72-33-01	370.00	SR Technics Switzerland
672311					72-XX-XX		Package S	002	BLEND SURFACE DAMAGE REPAIR	72-33-01	1,885.00	SR Technics Switzerland
672311					72-XX-XX		Package T	005	REPAIR DUCT SEGMENT HOLES	72-33-01	2,820.00	SR Technics Switzerland
672311					72-XX-XX		Package U	006	REPAIR DUCT SEGMENT CRACKS	72-33-01	2,820.00	SR Technics Switzerland
672311					72-XX-XX		Package V	007	REPAIR DUCT SEGMENT SURFACE DAMAGE	72-33-01	2,820.00	SR Technics Switzerland
672311					72-XX-XX		Package W	022	REPLACE BONDED PADS	72-33-04	1,620.00	SR Technics Switzerland
672311					72-XX-XX		Package X	001	PATCH REPAIR (FLOUROELASTOMER)	72-34-01	845.00	SR Technics Switzerland
672311					72-XX-XX		Package X	001	PATCH REPAIR (ORGANIC FIBRE)	72-34-01	845.00	SR Technics Switzerland
672311					72-XX-XX		Package Y	004	PATCH REPAIR (EPOXY)	72-34-01	845.00	SR Technics Switzerland
672311					72-XX-XX		Package Y	004	PATCH REPAIR (FLOUROELASTOMER)	72-34-01	845.00	SR Technics Switzerland
672311					72-XX-XX		Package Z	025	REPAIR THE ABLATIVE COATING	72-33-04	1,520.00	SR Technics Switzerland
138267	9-15 HPC BLADES		14	21	72-35-38	HIGH PRESSURE COMPRESSOR (HPC) - DRUM ROTOR AND BLADES (FRONT) ASSEMBLY	Package B	ASSEMBLY 02	GRIND STAGE 9 THROUGH 12 HPC BLADE PLATFORMS - 94"	PN9-15 HPC BLADES FOR SHOP VISIT ONLY	1,205.00	SR Technics Switzerland
138267					72-35-38		Package C	ASSEMBLY 03	GRIND STAGE 13 THROUGH 15 HPC BLADE PLATFORMS - 94"	PN9-15 HPC BLADES FOR SHOP VISIT ONLY	1,205.00	SR Technics Switzerland
138267					72-35-38		Package D	ASSEMBLY 03	GRIND AND MEASURE THE AXIAL COMPRESSOR ROTOR ASSEMBLY BLADE TIPS - 100"	PN9-15 HPC BLADES FOR SHOP VISIT ONLY	1,205.00	SR Technics Switzerland
139327	SHRD SET STG 5-7		23	21	72-35-40	HIGH PRESSURE COMPRESSOR (HPC) - FRONT CASE/OUTER AIRSEAL SET	Package A	CLN/INSP	CLEANING AND INSPECTION		1,140.00	SR Technics Switzerland
139327	SHROUD SET 5-7.STG				72-35-40		Package AI	34	REVISED THE STAGE 5, 6 AND 7 SHROUD SETS RUBSTRIPS		3,775.00	SR Technics Switzerland
139327					72-35-40		Package B		LEVEL INNER SHROUD (HONEYCOMB) FOR KNIFE EDGE CLEANENACE		1,950.00	SR Technics Switzerland
139327					72-35-40		Package V	21	REWORK SHROUD STG. 5-7 (FELTMETAL)		3,590.00	SR Technics Switzerland
139327					72-35-40		Package W	22	REWORK SHROUD STG. 5-7 (PLASMA COAT)		3,590.00	SR Technics Switzerland
139855	100" REAR COMPR ROTOR ASSY		29	21	72-35-01	HIGH PRESSURE COMPRESSOR (HPC) - REAR COMPRESSOR ROTOR ASSY - 100"	Package A	CLN/INSP	CLEANING AND INSPECTION		1,705.00	SR Technics Switzerland

Capabilities and Fixed Prices Catalogue 2024 for

PW4000

Prices for labor only / General Conditions of Business for Parts Repair (GCBPR) apply



valid until December 31, 2024

Quot. No.	MPN	Capability release label	Item	TA	ATA	Part Description	Package	Rep. No.	Repair Description	Remark	Price per ea (USD)	Repair Facility
139855					72-35-01		Package B	ASSEMBLY 16	HIGH SPEED GRINDING OF BLADE TIP		9,290.00	SR Technics Switzerland
139855					72-35-01		Package B	PW4G-100-72-118	MODI. OR REPL. BLADES TO ZIRCONIUM OXIDE COATED TIPS AND SHROUDS WIT H PWA 284-2 RUBSTRIPS	COMPRESSOR ROTOR BLADE TIP GRINDING ONLY	9,290.00	SR Technics Switzerland
139855					72-35-01		Package B	PW4G-100-72-219	MODIFCATION OF TO INCORPORATE THE ADVANTAGE 70TM PERFORMANCE	COMPRESSOR ROTOR BLADE TIP GRINDING ONLY	9,290.00	SR Technics Switzerland
139855					72-35-01		Package B	PW4G-100-72-220	CONVERSION OF PW4164 PW4168 OR PW4168A TO A PW4164-1D PW4168-1D PW4168A-1D OR PW4170 ENGINE	COMPRESSOR ROTOR BLADE TIP GRINDING ONLY	9,290.00	SR Technics Switzerland
139855					72-35-01		Package C	01	BLEND INSTALLED HPC BLADES		2,825.00	SR Technics Switzerland
139603	SCREW-NUT-SPACER-SET2		19	21	72-00-00	ENGINE GENERAL - COMMON PARTS - SCREWS, NUTS AND SPACERS REFURBISHMENT	Package A	CLN/INSP	CLEANING AND INSPECTION		580.00	SR Technics Switzerland
139603					72-00-00		Package B	LIGHT	REFURBISHMENT OF REMOVED SET OF PARTS	LESS THAN 4 OF FOLLOWING ENG. MODULS PARTIALLY/FULLY DISASSEMBLED (31,33 OR 34,41,51,52,53,54,61,62)	3,775.00	SR Technics Switzerland
139603					72-00-00		Package C	MEDIUM	REFURBISHMENT OF REMOVED SET OF PARTS	MODUL 33 AND 34 PARTIALLY/FULLY DISASSEMBLED OR NOT LIGHT CONDITION	15,040.00	SR Technics Switzerland
139603					72-00-00		Package D	HEAVY	REFURBISHMENT OF REMOVED SET OF PARTS	MODUL 35 PARTIALLY/FULLY DISASSEMBLED AND AT LEAST ONE ENGINE MAJOR FLANGE SPLITTED	31,320.00	SR Technics Switzerland